

## **General Disclaimer**

### **One or more of the Following Statements may affect this Document**

- This document has been reproduced from the best copy furnished by the organizational source. It is being released in the interest of making available as much information as possible.
- This document may contain data, which exceeds the sheet parameters. It was furnished in this condition by the organizational source and is the best copy available.
- This document may contain tone-on-tone or color graphs, charts and/or pictures, which have been reproduced in black and white.
- This document is paginated as submitted by the original source.
- Portions of this document are not fully legible due to the historical nature of some of the material. However, it is the best reproduction available from the original submission.



NASA  
NATIONAL AERONAUTICS AND  
SPACE ADMINISTRATION

ENVIRONMENTAL EFFECTS ON  
DEFECT GROWTH  
IN COMPOSITE MATERIALS

by  
T. R. Porter

Advanced Airplane Branch  
Boeing Military Airplane Company  
A Division of The Boeing Company  
Seattle, Washington

Prepared for  
NATIONAL AERONAUTICS AND SPACE ADMINISTRATION

NASA Lewis Research Center  
Contract NAS3-20405  
Gordon T. Smith, Project Engineer

FOREWORD

This report summarizes the work accomplished on NASA Contract NAS3-20405, "Environmental Effects on Defect Growth in Composite Materials."

The program was sponsored by the National Aeronautics and Space Administration, Lewis Research Center, Cleveland, Ohio. Mr. G. T. Smith, NASA Lewis Research Center, was Project Manager.

Performance of this contract was under the direction of the Advanced Airplane Branch of the Boeing Military Airplane Company. Dr. R. R. June, who heads Advanced Composites Development, was the program manager. Mr. T. R. Porter was the technical leader, Pete Smith coordinated specimen fabrication, J. R. Vosper provided testing support, and L. R. Hause was responsible for ultrasonic inspection support.

PRECEDING PAGE BLANK NOT FILMED

TABLE OF CONTENTS

	<u>Page</u>
INTRODUCTION . . . . .	1
SPECIMEN DESIGN AND MANUFACTURE. . . . .	3
WIDTH EFFECT TESTING . . . . .	11
MOISTURE CONDITIONING. . . . .	15
STATIC TESTING . . . . .	19
CYCLIC TESTING . . . . .	25
CONCLUSIONS. . . . .	31
REFERENCES . . . . .	99
 APPENDIX A      STATIC AND CYCLIC TEST DATA . . . . .	 101
APPENDIX B      WIDTH EFFECT TEST SPECIMEN, DAMAGE GROWTH DATA. . . . .	125
APPENDIX C      STATIC TEST DAMAGE GROWTH DATA. . . . .	159
APPENDIX D      CYCLIC TEST DAMAGE GROWTH DATA. . . . .	285
APPENDIX E      WEIGHT GAIN DATA. . . . .	383
APPENDIX F      PHOTOGRAPHS OF FAILED TEST SPECIMENS. . . . .	395

## FIGURES

No.		Page
1	Test Specimen Configuration. . . . .	39
2	Specimen Layup Sequence. . . . .	39
3	Specimen Cutting Procedure . . . . .	40
4	Stress Concentration Configurations. . . . .	41
5	Natural Defects. . . . .	42
6	Photomicrograph Showing Root of Ultrasonically Machined Flaw. . . . .	43
7	Impact Test Machine. . . . .	44
8	Ultrasonic Scan Records of Impact Damage . . . . .	45
9	Effect of Width on Static Strength of Laminate L1. . . . .	46
10	Effect of Width on Static Strength of Laminate L3. . . . .	46
11	Photograph of Static Compression Test Specimen L3-31-22 Showing Fracture Path. . . . .	47
12	Fracture Edge Detail of Specimen L3-31-22. . . . .	47
13	Weight Gain in Untabbed Static Test Laminates. . . . .	48
14	Weight Gain in Laminate L2 Untabbed Samples. . . . .	49
15	Weight Gain in Cyclic Test Laminates . . . . .	50
16	Weight Gain After One Week of Exposure . . . . .	51
17	Weight Gain After Four Weeks of Exposure . . . . .	52
18	Influence of Preload on Weight Gain After One Week of Exposure. . . . .	53
19	Influence of Preload on Weight Gain After Four Weeks of Exposure. . . . .	54
20	Influence of Preload on Weight Gain After Eight Weeks of Exposure. . . . .	55
21	Influence of Moisture Exposure on Laminate L1 Shear Strength . . . . .	56
22	Influence of Moisture Exposure on Laminate L2 Shear Strength . . . . .	56
23	Influence of Moisture Exposure on Laminate L3 Shear Strength . . . . .	57
24	Influence of Moisture Exposure on All Graphite Laminate L3 Shear Strength . . . . .	57
25	Influence of Cure Pressure on Laminate, L2 Shear Strength . . . . .	58

## FIGURES (Continued)

No.		Page
26	Static Test Load Sequences . . . . .	59
27	Front- and Back-Surface Temperatures for 60-second Heatup . . . . .	60
28	Through-the-Thickness Temperature Difference for Various Heating Rates . . . . .	60
29	Laminate L1 Static Test Data, FP Slit. . . . .	61
30	Laminate L1 Static Test Data, FP Hole. . . . .	61
31	Laminate L1 Static Test Data, HP Slit. . . . .	62
32	Laminate L1 Static Test Data, HP Hole. . . . .	62
33	Laminate L1 Static Test Data, Csk Hole . . . . .	63
34	Laminate L2 Static Test Data, FP Slit. . . . .	63
35	Laminate L2 Static Test Data, FP Hole. . . . .	64
36	Laminate L2 Static Test Data, HP Slit. . . . .	64
37	Laminate L2 Static Test Data, Low Cure Pressure. . . . .	65
38	Laminate L3 Static Test Data, FP Slit. . . . .	65
39	Laminate L3 Static Test Data, FP Hole. . . . .	66
40	Laminate L3 Static Test Data, HP Slit. . . . .	66
41	Laminate L3 Static Test Data, All Graphite Laminate . . . . .	67
42	Average Ratio of PL to NPL Specimen Fracture Strength. . . . .	67
43	Effect of Moisture on Laminate L1 Fracture, FP Slit. . . . .	68
44	Effect of Moisture on Laminate L1 Fracture, FP Hole. . . . .	68
45	Effect of Moisture on Laminate L1 Fracture, HP Slit. . . . .	69
46	Effect of Moisture on Laminate L1 Fracture, HP Hole. . . . .	69
47	Effect of Moisture on Laminate L2 Fracture, FP Slit. . . . .	70
48	Effect of Moisture on Laminate L2 Fracture, FP Hole. . . . .	70

## FIGURES (Continued)

No.		Page
49	Effect of Moisture on Laminate L2 Fracture, HP Slit . . . . .	71
50	Effect of Moisture on Laminate L3 Fracture, FP Slit . . . . .	71
51	Effect of Moisture on Laminate L3 Fracture, FP Hole . . . . .	72
52	Effect of Moisture on Laminate L3 Fracture, HP Slit HP Slit . . . . .	72
53	Comparison of Laminate L1 Fracture Data and Inherent Flaw Analysis . . . . .	73
54	Comparison of Laminate L2 Fracture Data and Inherent Flaw Analysis . . . . .	74
55	Comparison of Laminate L3 Fracture Data and Inherent Flaw Analysis . . . . .	75
56	Typical C-Scan Damage in Preloaded Test Specimens . . . . .	76
57	Typical Crack Opening Displacement Records for Preloaded Test Specimens. . . . .	77
58	Effect of Preload on C-Scan Damage in Unnotched Laminates . . . . .	78
59	Ultrasonic C-Scan Records for Unnotched Laminate L2 Specimen. . . . .	79
60	Effect of Autoclave Cure Pressure on C-Scan Record. . . . .	80
61	Effect of Autoclave Pressure and Preload on C-Scan Record . . . . .	80
62	Effect of Autoclave Pressure, Preload and Moisture on C-Scan Record . . . . .	81
63	Environmental Cyclic Test Loading Patterns. . . . .	82
64	Environmental Cyclic Test Setup . . . . .	83
65	Room Temperature Dry Tension-Tension Tests, 5/8 FP Slit . . . . .	84
66	Room Temperature Dry Tension-Tension Tests, 5/8 FP Hole . . . . .	84
67	Room Temperature Dry Tension-Compression Tests, 5/8 FP Slit . . . . .	85
68	Room Temperature Dry Tension-Compression Tests, 5/8 FP Hole . . . . .	85

# FIGURES (Continued)

No.		Page
69	Room Temperature Wet Tension-Tension Tests, 5/8 FP Slit . . . . .	86
70	Room Temperature Wet Tension-Tension Tests, 5/8 FP Hole . . . . .	86
71	Room Temperature Wet Tension-Compression Tests, 5/8 FP Slit . . . . .	87
72	Room Temperature Wet Tension-Compression Tests, 5/8 FP Hole . . . . .	87
73	Influence of Moisture on Residual Static Strength for Slit Specimens. . . . .	88
74	Influence of Moisture on Residual Static Strength for Hole Specimens. . . . .	88
75	Influence of Moisture on Tension-Compression Fatigue for Hole Specimens. . . . .	89
76	Influence of Moisture on Tension-Compression Fatigue for Hole Specimens. . . . .	89
77	Elevated Temperature Dry Tension-Tension Tests, 5/8 FP Slit. . . . .	90
78	Elevated Temperature Dry Tension-Tension Tests, 5/8 FP Hole. . . . .	90
79	Elevated Temperature Dry Tension-Compression Tests, 5/8 FP Slit . . . . .	91
80	Elevated Temperature Dry Tension-Compression Tests, 5/8 FP Hole . . . . .	91
81	Influence of Cycling Temperature on Residual Strength of Dry Slit Specimens. . . . .	92
82	Influence of Cycling Temperature on Residual Strength of Dry Hole Specimens. . . . .	92
83	Influence of Cycling Temperature on Fatigue Strength of Dry Slit Specimens. . . . .	93
84	Influence of Cycling Temperature on Fatigue Strength of Dry Hole Specimens. . . . .	93
85	Elevated Temperature Wet Tension-Tension Tests, 5/8 FP Slit . . . . .	94
86	Elevated Temperature Wet Tension-Tension Tests, 5/8 FP Hole . . . . .	94

## FIGURES (Concluded)

No.		Page
87	Elevated Temperature Wet Tension-Compression Tests, 5/8 FP Slit. . . . .	95
88	Elevated Temperature Wet Tension-Compression Tests, 5/8 FP Hole. . . . .	95
89	Influence of Moisture Content on Residual Strength of Slit Specimens Cycled at Elevated Temperature. . . . .	96
90	Influence of Moisture Content on Residual Strength of Hole Specimens Cycled at Elevated Temperature. . . . .	96
91	Influence of Moisture Content on Elevated Temperature Fatigue of Slit Specimens. . . . .	97
92	Influence of Moisture Content on Elevated Temperature Fatigue of Hole Specimens. . . . .	97



## TABLES

No.		Page
1	Structural Laminates Evaluated . . . . .	33
2	Summary of Test Laminate Construction. . . . .	33
3	Defect Type and Size Code. . . . .	34
4	Width Effect Test Matrix . . . . .	34
5	Static Fracture Test Matrix of Wet Room Temperature Specimens. . . . .	35
6	Static Fracture Test Matrix of Wet Thermal Spike Specimens. . . . .	35
7	Environmental Cyclic Test Matrix . . . . .	36
8	Influence of Preload on Static Strength. . . . .	37

PRECEDING PAGE BLANK NOT FILMED

## INTRODUCTION

The objective of this program was to derive data for evaluating the effects of moisture and temperature on the integrity of fiber composite components. In particular, the static and cyclic performance of three composite laminates containing flaws was investigated at room temperature and 422K (300°F) in wet and dry conditions. This program extends the results developed under Contract NAS3-19709 reported in NASA CR-135403 (ref. 1). The test results evaluate the following for each environmental condition:

- a. Effect of defect type and size on static fracture
- b. Influence of compression loadings on fatigue
- c. Description of the effects of static and cyclic loadings on damage accumulation
- d. The effect of preloading on damage growth, static strength, and cyclic load behavior
- e. The comparison of wet and dry data at room and 422K (300°F) temperatures

Static fracture data were obtained for three different composite systems that had been moisture soaked to near the maximum moisture-absorption potential. The fracture test data were obtained at room temperature and immediately after the application of an abrupt temperature transient that caused the specimen to attain 422K (300°F). Three different 20-ply layups were tested. Laminate L1 represents general-purpose structure, laminate L2 is typical of polar and hoop wound pressure vessels, and laminate L3 is representative of turbine engine fan blades or tubular strut support structure. Half the test specimens were preloaded to 90% of their ultimate static load prior to moisture conditioning. Intermittent nondestructive inspection, including visual and ultrasonic techniques, were used to detect defect growth.

Cyclic test data were obtained on laminate L1 specimens in wet and dry conditions at room temperature and at 422K (300°F). In these tests the specimens contained a central slit or hole. Both tension-tension ( $R = 0.05$ ) and tension-compression ( $R = -1.0$ ) loadings were used. The residual tensile strength was evaluated in test specimens that did not fail during cyclic loading.

## SPECIMEN DESIGN AND MANUFACTURE

The test specimen materials, designs, and fabrication procedures were selected to permit the generation of data for evaluation of flawed structural components. The components considered were a general-purpose laminate structure, a polar and hoop wound pressure vessel, and a turbine engine fan blade. These materials and layups are the same as previously studied (Ref. 1).

### Materials

The materials used for the program were Thornel T-300 graphite fiber, 901 S-glass fiber, and Fiberite 934 epoxy resin. Intermediate stiffness graphite/epoxy was selected as the basic material for the program because of its wide use, moderate cost, and established structural performance. The Thornel T-300 graphite fibers were selected because they can be supplied with a twist, making them suitable for general-purpose structure as well as filament winding pressure vessels. The Fiberite 934 resin system satisfied the requirements of a general-purpose epoxy and also has a wide range of applications in aerospace structures. In the turbine engine fan blade layup, 901 S-glass fiber plies were interspersed with the T-300 fiber plies to improve impact-damage resistance of the laminate. This S-glass and graphite hybrid was selected on the basis of prior work that demonstrated significantly improved impact-damage tolerance.

### Layups and Stacking Sequences

Three different layups were used in the fabrication of test specimens. These layups are presented in table 1. The first layup (L1) was a 20-ply balanced layup representative of a practical aerospace application. This layup is moderately directional and would be used to support biaxial loads that approximate having about a 2:1 ratio. The second layup (L2) is representative of spacecraft pressure vessels fabricated using both polar and hoop wraps. The third layup (L3) is representative of turbine engine fan blades or, possibly, tubular support struts. The S-glass fiber was included as 0° plies.

The stacking sequence selected for layup L1, based on symmetry and load transfer requirements, was  $((0/\pm 45/0/90)_S)_2$ .

The stacking sequence for layup L2 is representative of pressure vessels. There are two basic approaches to polar and hoop wrapping of aerospace pressure vessels. If the vessel wall is thin, the polar wraps can be applied before the hoop wraps. However, when the vessel wall is thick, there is slippage of the hoop wraps at the end of the cylinder. This is prevented when the polar and hoop wraps are interspersed by applying one revolution (two plies) of polar wrap followed by three plies of hoop wrap. The resulting stacking sequence is  $(0/0/0/+80/-80)$ . This stacking sequence for laminate L2 was modified slightly to produce a symmetrical laminate for testing  $((0/0/0/+80/-80)_2)_S$ .

The stacking sequence for layup L3 is representative of those considered for use in composite turbine engine fan blades. Two possible layup approaches are the dispersed-ply approach and the core-shell approach. The dispersed-ply approach was used because such layups are less subject to delamination from foreign object impact. The representative stacking sequence then becomes  $((0/+30/0^*/-30/0)_2)_S$ . The asterisks indicate the plies that are replaced with S-glass to increase fracture toughness of the laminate. Replacement of the middle ply results in an even distribution of the hybridizing material throughout the panel thickness.

### Test Specimen Configuration

The test specimen configuration is shown in figure 1. The 76-mm (3.0-in) width used for the majority of the tests was chosen to provide specimens large enough to preclude significant interaction between the stress concentration and stress-free specimen boundaries. The specimen was designed so that the stress concentration factor for the largest defect would be within 5% of the corresponding stress concentration factor for a plate of infinite width. The potential effect of the free edge on the fracture behavior was investigated experimentally by static testing specimens of various widths that contained the largest defects. The  $0^\circ$  laminate direction corresponds to the axial direction of the specimen. Woven fiberglass grip tabs were secondarily bonded to the specimen using a 394K (250°F) cure adhesive.

## Test Specimen Fabrication and Processing

Specimen layup and fabrication steps are illustrated in figures 2 and 3. Laminates were laid up and cured in 81-cm (32-in) wide panels having lengths up to 293 cm (120 in). The panel sizes fabricated are given in table 2. After curing fiberglass end tabs were bonded to the basic laminates and then the panels were sawed into specimen blanks. The panel fabrication steps were as follows:

- a. Remove material from freezer and allow it to come to room temperature before unwrapping.
- b. Unwrap material and cut tape to length. Use a template to cut angle plies to size.
- c. Lay up plies.
- d. Debulk after 4th, 8th, 12th, 16th, and 20th ply by holding the laminate under vacuum for 15 to 20 min.
- e. Cover laminate with perforated FEP, one ply of 1581 fiberglass bleeder for each four plies of laminate, a layer of nonperforated FEP, a metal caul sheet, two layers of 1581 fiberglass breather, and a vacuum bag.
- f. Cure laminate in an autoclave using the following cure cycle:
  1. Apply vacuum.
  2. Increase autoclave temperature so that laminate temperature increases at a rate of  $0.5^{\circ}$  to  $2.8^{\circ}\text{C}$  ( $1^{\circ}$  to  $5^{\circ}\text{F}$ ) per min.
  3. Hold 60 min at  $121^{\circ}\text{C} \pm 5.5^{\circ}\text{C}$  ( $250^{\circ}\text{F} \pm 20^{\circ}\text{F}$ ).
  4. Apply 689 kPa (100 psi) pressure 15 min after the laminate reaches temperature.

5. Increase laminate temperature to  $177^{\circ}\text{C} \pm 5.5^{\circ}\text{C}$  ( $350^{\circ}\text{F} \pm 10^{\circ}\text{F}$ ) at a rate of  $0.5^{\circ}$  to  $2.8^{\circ}\text{C}$  ( $1^{\circ}$  to  $5^{\circ}\text{F}$ ) per min.
6. Hold at temperature for 120 min  $\pm 5$  min, then cool under pressure.
- g. Cut laminate panels to length of test specimens.
- h. Lay up fiberglass-epoxy grips on the panel edges.
- i. Vacuum bag and cure in an autoclave at  $121^{\circ}\text{C}$  ( $250^{\circ}\text{F}$ ).
- j. Remove panels from autoclave and cut specimens from the panels.

### **Specimen Defect Geometry**

A number of defects can occur in composite laminates due to manufacturing, handling, or inservice damage. Defects that can be found in the basic laminates are—

- a. Excessive porosity or voids due to contamination of the prepreg materials, geometrical restrictions that prevent the escape of volatiles during cure, or low curing pressure
- b. Wrinkled or nonaligned fibers due to improper layup, thickness changes, etc.
- c. Resin-rich and resin-starved areas
- d. Impact-damaged surface areas that result in delaminations or broken fibers
- e. Scratched or gouged surfaces caused by mishandling during manufacture or inservice use

There are also a number of defects associated with the use of fasteners in composite structure. Some of these are—

- a. Delaminations near the exit side of drilled holes due to inadequate backing or excessive drill pressure
- b. Overly deep countersinks
- c. Local damage due to excessive fastener torque
- d. Resin-starved bearing surfaces that result from excessive drilling heat
- e. New holes located where mislocated holes have been filled

The potential effects of several of these defects were assessed by testing laminates containing defects simulated by stress concentrations. These defect types can be categorized as: (1) sharp defects that break or cut filaments, (2) blunt defects that cut or break filaments, (3) delaminations, and (4) poor resin properties. The defects that include cut or broken filaments were simulated by holes and sharp slits. Both full-penetration (FP) and half-penetration (HP) holes and slits were tested (fig. 4). The delaminations were produced by subjecting the specimens to impact damage.

In addition to these stress concentrations, potential natural defects typical of the particular laminate application were also tested (fig. 5).

For laminate L1, specimens were tested that had holes containing overly deep countersinks. Deep countersinks are often unavoidable due to the lack of thickness of laminate skins. This condition was simulated by countersinking holes so that the countersink extended through the laminate thickness and left a sharp edge at the exit side of the hole.

For filament-wound pressure vessels, great care must be taken to provide the correct pressure during cure. Hence, it is appropriate to investigate the



effects of low pressure on the fracture and fatigue strength of laminate L2. Three variations of curing pressure were used: 345 kPa (50 psi), 172 kPa (25 psi), and 86 kPa (12.5 psi). The normal curing pressure is 689 kPa (100 psi).

For laminate L3, tests were conducted on a 20-ply layup that contained no S-glass. These tests were conducted to allow an evaluation of the effectiveness of the S-glass in increasing the fracture toughness of the laminates.

The hole and slit sizes selected for test were 3.18 mm (0.125 in), 9.52 mm (0.375 in), and 15.87 mm (0.625 in). These sizes, coded as 1/8, 3/8, and 5/8 respectively encompass most practical fastener diameters. They are also at the threshold of detectable damage sizes for many common inspection procedures. The same sizes were used for the surface length of the half-penetration defects, because when partial penetration damage exists in structure, the most obvious and descriptive dimension is the length of the damage on the surface.

The type and size codes used to identify each of the defects are given in table 3.

All slits were perpendicular to the primary load carrying direction of each laminate. This means that they were perpendicular to the  $0^{\circ}$  fibers. The  $0^{\circ}$  fibers correspond to the hoop direction of a cylindrical filament-wound pressure vessel for laminate L2.

The slits were fabricated by ultrasonic machining. Ultrasonic machining is typically used to produce cuts of difficult configuration in nonconductive materials. Circular cutter tips were machined to a thickness of 1.52 (0.06 in) and a sharp radius. The ultrasonic vibrations of the cutter produce a lapping action in an abrasive slurry that carries away the excess material as the cutter penetrates the part. The slit radius in the composite laminate was typically about 0.127 mm (0.005 in) with a smooth surface.

Figure 6 shows a typical partial penetration flaw that has been sectioned to illustrate the root geometry.

The full-penetration circular holes were drilled, and the half-penetration circular holes were end-milled.

The impact damage defect was produced by impacting the specimens with a 0.91 kg (2 lb) weight dropped from a height of 0.38m (15 in). Figure 7 is a photograph of the impact stand used. The test specimen was supported on a circular support containing a 15.9-mm (0.625-in) diameter hole. This support condition, together with the 15.9-mm (0.625-in) diameter hemispherical impactor, produced delamination damage areas approximately 15.9 mm (0.625 in) in size. Examination of sectioned specimens damaged in this manner showed delamination damage throughout the laminate thickness. Ultrasonic C-Scan records of typical impact-damaged test specimens are shown in figure 8.

## WIDTH EFFECT TESTING

As shown in table 4, the static strength of laminate L1 and L3 specimens containing 5/8 FP slits and impact damage was evaluated for three specimen widths. Both static-tension and static-compression tests were performed. All tests were conducted in a room temperature air environment. The tests show a slight effect of specimen width for test specimens less than 76 mm (3.0 in) wide. The impact-damaged test specimens and the specimens with slits displayed similar compressive strengths. However, under tension loads the specimens containing slits had a much lower strength.

A 76-mm (3.0-inch) specimen width was selected as a baseline for the current testing and for previous tests (ref. 1) This selection was made from analytical studies. To confirm this selection, tests were performed on specimens containing the largest defects selected from specimens of approximately 50, 100, and 150 mm (2.0, 4.0, and 6.0 in) in width. Results of these tests, along with the 76-mm (3.0-in) specimen data was used to assess the width effect on the specimen strength and to check the validity of the specimen size selection.

In order to gain additional information, this test series was expanded to include static-compression testing of the specimens with slits as well as tension and compression tests of the specimens containing delaminations. The specimen delaminations were the result of a low-velocity impact.

The results of the width effect testing are shown in figures 9 and 10 and presented in appendix B. These data are normalized to load-per-unit width to allow a direct comparison of the various panel widths. Previous test data are also included in the figures where applicable. The trends found are similar for both the L1 and L3 laminates and similar conclusions are applicable to each.

At widths of 100 and 150 mm (4.0 and 6.0 in) there is no significant width effect shown by the data. At the 50-mm (2.0-in) width, there is a slight decrease in strength. The 76-mm (3.0 in) specimens are similar to the 100- and 150-mm (4.0- and 6.0-in) specimens. It is concluded that the selection of the 76-mm-wide test specimen size was sufficient for the largest defect size tested.

The test results permit several additional conclusions. The tension test data showed a large difference between the impact-damaged and the slit specimens. The impact-damaged specimens had tensile strengths comparable to the undamaged specimens, while the slit specimens had less than 50% of the damaged specimen strength.

The visible external damage was slight, with a 3.39J (30 in-lb) level of impact. A visual examination of the specimen after impact revealed only a slight front surface dent and no broken filaments. The dent depth was typically about 0.08 mm (0.003 in). Damage of this magnitude would probably be considered to be undetectable by visual inspection. It was concluded that impact damage that produces only delamination has little or no effect on the tensile strength for the layup patterns tested.

The compression strength of the impact-damaged specimens was approximately the same as the compression strength of the specimens containing slits with lengths equal to the delamination diameter. The magnitude of the compression fracture strength was similar to the tension fracture strength of the slit specimens. This implies that notches are equally severe in compression and tension and delaminations of the type tested are as critical as a machined notch in compression.

Examination of the failed compression panel supports a notch-sensitive fracture failure mechanism. The failure initiated at the notch edge as a local compressive failure and produced local delamination, buckling and fiber breakage which lead to a local loss of load carrying ability. In a manner analogous to tension fracture, the now-larger damage size results in even higher local stresses and unstable fractures that propagate across the specimen width.

Photographs of failed specimens shown in figures 11 and 12 illustrate this failure mode. As shown in figure 11, the specimen failure emanated from the notch and run to the specimen edge. The path of this failure is normal to the panel loading. The close-up detail of the failure shows the local buckling-shear failure of the laminate. This failed region lost the ability to support compressive loading.

The test specimens containing impact damage behaved similarly to the machined-defect specimens. The multilayer delamination supports a very small compressive load in the delaminated impact zone. In laminate L1 materials, the machined slit and impact-delaminated zone were of similar size and had a similar effect on compression fracture strengths. In laminate L3, the size of the delaminated zone was not as wide (fig. 8) as the slit length, and the test specimens had a greater compressive fracture strength. The smaller delaminated zone width is attributed to the orthotropic ply orientation  $((0/+30/0/-30/0)_2)_S$  for laminate L3.

## MOISTURE CONDITIONING

The specimens in this program were tested in two moisture conditions: dry and wet. The test conditions are given in tables 5 through 7. The dry condition resulted from normal storage in the laboratory from the time of cure until the test. The wet condition specimens were soaked in a water bath at 355K (180°F) for 8 weeks. These conditions represent the extremes of expected structural applications.

The length of the laboratory storage condition was typically 90 days. The laboratory temperature was continuously maintained at approximately 20°C. The laboratory relative humidity, though not controlled, was generally in the range of 40% - 50%.

The water-soak was selected to produce a condition near the maximum moisture-absorption level. The soak time and temperature were selected to minimize unrealistic effects from the conditioning treatment and to provide soak time within the scope of the program. Exposure temperatures for service conditions that can influence the rate of moisture absorption can range up to the maximum design requirements for the composite. However, it is not likely that water baths would exceed 100°C (212°F) for most composite applications and will likely be somewhat less.

In order to assess these parameters and to determine the required exposure conditions, a Boeing finite-difference computer analysis for moisture absorption was conducted on the test specimen configuration. From this study it was shown that in order to precondition the test specimens to maximum moisture content in a time that met schedule requirements, the moisture conditioning had to be performed at temperatures of 355K (180°F). This permitted completion of moisture conditioning in 8 weeks.

### Weight Gain Data

During the elevated-temperature soak, test specimens were taken from the water bath at weekly intervals, towel dried, and weighed to determine the amount of

moisture gain. Previous exposure testing of similar configuration specimens has shown, that the glass tabs absorb moisture at a higher rate than the graphite/epoxy, making the actual weight-gain values hard to interpret. To offset this problem, untabbed test laminate material from each of the laminate types was soaked and weighed along with the test samples. The weight of the untabbed laminate materials was used to monitor the conditioning treatment.

To minimize variances due to conditioning procedures, the specimens were conditioned together in one tank. Program schedules required two separate batches; the first included the static test specimens (XX-2X-XX numbers), and the second included cyclic specimens (XX-3X-XX). These materials were purchased and processed at separate times under different tasks in the program thus preventing simultaneous conditioning.

The weight-gain data found for the untabbed laminates conditioned with the static test specimens is shown in figure 13. As can be seen, the final moisture level is about 1.4% to 1.5% by weight in all laminates. Laminate L3, which contains four plies of glass fiber, has the greatest final moisture content.

Test panels of laminate L2 were cured at lower than the standard 689 kPa (100 psi) autoclave pressure. The effect of cure pressure on moisture absorption is shown in figure 14. The laminate cured at the lowest pressure experienced the greatest moisture absorption. This increase in moisture level can be attributed to a higher void content in the low pressure cure laminates. The higher void content in these laminates was confirmed by ultrasonic inspection of the specimens.

Moisture conditioning of the cyclic test specimens was also monitored using untabbed laminate material. Figure 15 presents results of the weight gain for laminate L1 and L3 untabbed samples. The data points are derived from these measurements. Lines, representing the results derived from the static test specimen samples, are shown for comparison. The results are similar. The greatest difference is in the terminal weight gain response for laminate L1.

The weight gain data in the test specimens having bonded glass grip tabs are compared with the untabbed coupon data in figures 16 and 17. As expected, there is a significant influence of the end tab on the weight gain data, making the weight gain measurements in the specimens greater than expected for only the graphite/epoxy. It was assumed, however, that these results can be used to compare the tabbed specimens with each other to show trends.

Half the static test specimens were preloaded prior to moisture conditioning. These tests were used to assess the effect of potential proof testing on subsequent moisture absorption and structural properties. The preload level selected was 90% of the estimated static fracture strength. Because a range of defect types and sizes, having various fracture strengths, was evaluated, a range of preload stress levels was applied to the test specimens. The percent weight gain specimens from each of the three laminates as a function of the preload level is shown in figures 18 through 20. The three figures are for 1-, 4- and 8-week conditioning periods.

The static test specimens were evaluated in groups of four, a PL and NPL specimen for both room temperature and 422K (300°F) tests. This gave two nonpreloaded and two preloaded test specimens for each laminate and defect geometry. For this reason the same number of nonpreloaded specimens were used to evaluate the average, maximum, and minimum lines in figures 18 through 20, as data points shown for the preloaded specimens. Also the preloaded test specimens are in pairs, one identified for subsequent room temperature testing, and one for 422K (300°F) testing.

As can be seen from the one week soak data in figure 18, the initial weight gain in these specimens is accelerated by the preload. However, after moisture conditioning for 4 and 8 weeks, the data for laminates L1 and L2 indicate there may be a decrease in moisture absorption with preload. The data also indicate there is a greater scatter in moisture absorption of the preloaded test specimens.



A review of the data from laminate L3 indicates that one specimen from each pair of nominally identical tests absorbed moisture at a higher rate. Because these specimens were cut from adjacent sections of the same panel, were preloaded at the same time to nominally the same load, and were placed together in the water tank, this difference is as yet unexplained. A review of the crack opening displacement (COD) records for these test specimens indicates there is a trend for the specimen experiencing the greatest weight gain to show a greater damage during loading.

### **Interlaminar Shear Data**

As a method of monitoring the effect of moisture levels on matrix properties, interlaminar shear test specimens were cut from moisture conditioned samples after 1, 2, 4 and 8 weeks of exposure. The results of these tests at room and 422K (300°F) are shown in figures 21 through 25. The test specimen was 6.3 mm (0.25 in) wide and had a 4:1 span-to-thickness ratio. Five replicates were run for each test condition, with the average values and the range shown in the figures.

A trend for decreasing interlaminar shear strength with soak time was observed for all laminates. The graphite/glass L3 laminate showed the greatest effect of soak time. All laminates had a significant reduction in interlaminar shear strength at 422K (300°F).

The interlaminar shear strength for the laminates cured with low autoclave pressures are compared in figure 25. The results shown are for specimens that have been conditioned for the full 8 weeks. Only the laminate materials cured at the lowest pressure of 86 kPa (12.5 psi) had reduced properties.

## STATIC TESTING

Static tensile fracture strength was evaluated for the three laminates at room temperature and 422K (300°F). All testing was conducted with moisture-conditioned test specimens. Tables 5 and 6 describe conditions for each test. The four load sequences used are presented in figure 26. The first sequence (a) shows the room temperature nonpreloaded static test performed after moisture conditioning. Tests without preloading are designated NPL. The second sequence (b) shows the room temperature preload-static test sequence. Preloaded specimens are designated PL. As shown, the preloading was performed prior to moisture conditioning. The corresponding 422K (300°F) test sequences are shown in figure 26 by (c) and (d).

### Test Procedures

All static tests were performed in a load controlled test machine using hydraulic specimen grips. The specimens were loaded at a rate of 1100 N/s (250 lb/s) for both preloading and fracture testing. This rate resulted in failure in about 1 min after the onset of loading. Unloading after preloading was rapid, with no hold time at the maximum load level.

The flawed test specimens were instrumented using a crack opening displacement (COD) gage across the defect. The COD gage was placed across the defect against bonded knife-edge supports; for specimens with larger holes, knife-edge supports were inserted in the hole. COD versus load was recorded for each test. These curves are included in appendix C.

### Temperature Control

The 422K (300°F) elevated temperature tests were static tested after the application of an abrupt temperature transient. The test specimen was heated by a radiant heater placed near one face of the test specimen. This heating procedure produced a temperature gradient during heatup. The temperature was allowed to stabilize during static testing. This type of heating was considered to be representative of many structural applications.

The specimen heating procedures were developed using temperature survey specimens. Temperature gradients were developed across the width and along the length using front-surface, back-surface, and embedded thermocouples. Also the tests evaluated the through-the-thickness temperature gradient variation with changes in the heatup rate. The measured front- and back-surface temperatures for a 60-sec heatup rate are shown in figure 27. The temperature difference between the front and back surface was about 17K (30°F). From these tests the through-the-thickness temperature difference during heating for a range of heatup times was determined as shown in figure 28. A heating time of 60 sec was selected for the static testing, resulting in a 17K (30°F) temperature difference through the specimen thickness.

Test specimen loading began 180 sec after the start of heatup, allowing temperature stabilization at the time of static test. Temperature survey results indicated the through-the-thickness temperature difference was less than 3K (5°F) at that time.

### Static Test Data

The static test data are presented in tabular form in appendix A.

Static test results are shown in figures 29 through 41. The circular symbols are for the room temperature tests, and the triangular symbols are for the elevated temperature tests. Lines are shown connecting the nonpreloaded test data at room and elevated test temperatures.

Unnotched specimens showed a significant reduction in strength due to the elevated temperature for all the laminates. However, the notched strengths for laminate L1 and L3 specimens did not show this trend. The fracture strengths of notched, hot, wet laminates were greater in some cases than the room temperature values.

The elevated temperature primarily affects the matrix properties, and not the fiber strengths. Interlaminar shear strength data show this large decrease in

matrix shear strength at the elevated temperature. A reduction in matrix properties would be expected to cause a significant reduction in shear transfer around the defects at 422K (300°F). Such an effect can relieve the notch stress concentration and reduce the loss of basic laminate strength.

The influence of preloading on the fracture strength after moisture conditioning is a concern when considering proof-loading techniques for composite structure. A goal of this study was to determine if the fracture strength of moisture-conditioned samples was degraded by the prior preload. The preload was applied at room temperature and prior to moisture exposure. This would be typical of a before-service proof test. The data shown in figures 29 through 41 were used to compute the ratios of the preloaded (PL) specimen to nonpreloaded (NPL) specimen fracture strengths. A similar computation was made for the dry room temperature static data from reference 1. These ratios are shown in table 8.

An examination of the static fracture data indicates that preloading does not exert a large influence on strength; most of the PL specimen data were within +10 % of the NPL test data. Part of the observed variations probably were due to scatter. However, there is some indication of a trend. This is shown in figure 42, where the average PL/NPL specimen strength ratio for each laminate and test condition is compared. Laminate L1 shows a 5% average increase in room temperature, dry fracture strength and a 7% average decrease in the hot, wet fracture strength, for a 12% change. The other laminates show average residual strengths that are within 4% of the initial fracture strengths for all environments.

The fact that, the PL/NPL ratio was greater than 1.0 for laminate L2 and less than 1.0 for laminate L3 may be significant, but the magnitude of the change in strength is very small and probably not critical to proof-loading applications.

The autoclave pressure during cure had only a small effect on the fracture strength of laminate L2, as shown in figure 37. This is in contrast to the interlaminar shear strength reduction presented in figure 25. This is consistent with the fracture strength primary controlled by fiber properties and the interlaminar strength primary controlled by matrix properties.

Figures 43 through 52 compare wet and dry test data. The wet room temperature tests typically exceed the dry room temperature strengths by 10% in the all-graphite L1 and L2 laminates. The graphite-glass L3 hybrid laminate displayed the reverse trend, with the dry laminate having the greater strength.

The influence of moisture conditioning on fracture strength was determined by comparing the dry room temperature tests reported in a previous program (ref. 1) with present data. These tests had identical layups, materials, and specimen configurations but a different material order. A comparison of these materials showed a 67% difference in fiber volumes for the present tests and 62% for the previous tests. This difference is also reflected by material thickness. Because the quantity of graphite fiber is controlled by Boeing specification and remains constant, the data were compared on a basis of total load rather than stress.

### Static Fracture Analysis

There have been a number of techniques proposed for the analysis of composite fracture. In these linear stress analysis methods the defect size is shown to control laminate strength. The current test data is analyzed using the inherent flaw analysis (ref. 2). In this analysis the typical fracture relations for slits and holes are modified by adding an inherent dimension  $a_0$ ; that is,

$$K_C = \sigma_C (\pi (a + a_0))^{1/2} \quad \text{for slits}$$

$$K_C = \sigma_C (\pi a_0)^{1/2} F\left(\frac{a_0}{R}\right) \quad \text{for holes}$$

$$K_C = \sigma_C (\pi a_0)^{1/2} \quad \text{for unnotched strength}$$

where  $F()$  is the standard Bowie function for cracks from a hole, and  $K_C$ ,  $\sigma_C$ ,  $a$ , and  $R$  are fracture toughness, fracture stress, half slit length, and hole radius, respectively.

Figures 53 through 55 compare the static test data for the FP slit specimens and the least square fit fracture lines. The figures also include the values of the fracture toughness and inherent flaw size that were computed.

### Damage Growth

The damage growth was monitored by the crack opening displacement instrumentation, periodic C-scan, and visual observation. These results for all the static testing are presented in appendix C.

Figure 56 shows typical C-scan damage experienced by the three laminate materials during static loading. As shown, there is a difference in the size of delamination damage experienced by the three laminates. Laminate L1 shows the lowest tendency to delaminate at the notch, while L2 shows extensive damage growth. This damage growth difference results from clustering of the plies and the low inplane shear strength in laminate L2 ( $0_3+80$ ). Laminates L1 ( $0/+45/0/90$ ) and L3 ( $0/+30/0/-30/0$ ) have dispersed ply orientations and higher inplane shear because of the fiber orientation.

The half-penetration defect test specimens show a damage indication above and below the notch after load. This damage indication is produced by a delamination at the specimen midplane due to the interlaminar shear. The through-penetration slit specimens show damage growth at the notch tips. This growth is again due to the shear stresses, but in this case it is inplane shear. Visual examination reveals splits near the notch tips for both defect types.

The crack opening displacement records for the three laminates and two defect types are compared in figure 57. These two types of damage growth behavior were typical of all machined defects tested.

Ultrasonic examinations of the preloaded unflawed test samples are shown in Figure 58. The scans for laminates L1 and L3 before and after preload did not show any change. The laminate L2 scan showed extensive internal damage. Careful examination of the scan indicates that the damage is in the ( $+80$ ) plies. An

examination of polished edges on these specimens indicates there is microcracking in the (+80) plies at the applied strain levels for this specimen configuration. C-scan records after moisture conditioning (fig. 59) indicates some fill-in of this damage by moisture. This then can be used to explain the accelerated moisture absorption shown in figure 18 for this specimen.

The C-scan records for specimens with cure cycles having low autoclave pressure are shown in figures 60 through 62. These records show a significant reduction in laminate quality at the lowest pressure and some reduction at the next to lowest. This indication of poor quality is probably due to voids or poor interlaminar bonding. It is interesting to note that moisture conditioning reduces the attenuation shown in the low-pressure cure laminates, indicating a fill-in of the poor interlaminar bond or voids.

## CYCLIC TESTING

The test matrix for the environmental cyclic tests is shown in table 7. The approach used is a parametric variation of environmental and testing parameters to evaluate their effect. The cyclic testing was limited to one laminate  $((0/+45/0/90)_S)_2$  and two defects (5/8 FP hole and 5/8 FP slit). The target life (cycles) defines the maximum applied number of load cycles before the cyclic loading was stopped and the specimen tested for residual strength.

### Test Procedures

All cyclic and static loading was conducted in a laboratory air environment. The wet tests were room air cyclic tests of specimens that had been moisture preconditioned in a water bath for 8 weeks. This was the same preconditioning used for the static wet specimens. The moisture content in the graphite/epoxy laminate after this exposure was approximately 1.5%. The preconditioned specimens were stored between tests in a wet environment at room temperature to maintain their moisture level.

Both tension-tension ( $R = 0.05$ ) and tension-compression ( $R = -1$ ) cyclic loading patterns were applied as shown in Figure 63. In the event that the target cyclic life was reached without a fatigue failure, the specimen was given an ultrasonic inspection and then static loaded to failure to establish residual strength. The effect of a preload cycle was determined from the preload tests.

Test loads were selected by evaluating previous results (ref. 1) for dry room temperature conditions. The number of load levels was minimized to allow a direct comparison of the life results from various test conditions. All tension-tension tests ( $R = 0.05$ ) were at 46.7 KN (10.5 kip). This load was the upper bound used for cyclic testing in order to prevent single cycle failures and is about 85% of the average dry room temperature static strength. Because of the similar response of the 5/8 FP hole and slit, the same loads were used for both defect types.



As noted, selected specimens were preloaded. As in the static tests, the preload was applied to the test specimens prior to moisture conditioning. This preload is a one-time load application with no hold time at maximum load. The level was 48.9 KN (11.0 kip) for both defect types, which was approximately 90% of the anticipated room temperature dry fracture strength.

Cyclic testing was performed in servohydraulic test machines at a maximum frequency of 5 Hz. Figure 64 is a photograph of the test setup. The cyclic frequency was reduced for the first few cycles and while reading the instrumentation.

Load was transmitted to the specimen through bolted friction grips. The compressive-loaded specimens were restrained from buckling through the use of two faceplates, one against each specimen surface. The faceplates had a 50.8 mm (2 in) diameter hole centered over the defect to allow local out-of-plane deformation and to allow inspection of the specimen damage. The inspection hole diameter was smaller than specimen width, allowing full length support at the specimen edge.

All the test specimens had crack opening displacement (COD) instrumentation to monitor changes during cyclic load. The COD gage output was recorded periodically during the cyclic test life. This information was used to monitor damage growth in the test specimens due to loading and environmental conditions.

### **Inspection Procedures**

Ultrasonic inspection of the test specimens was conducted before the specimens were installed in the test machine. The preloaded specimens were reinspected following the preload cycle. In addition to these pretest inspections, fatigue specimens were reinspected during the cyclic life of the specimen. For specimens that reached the targeted cyclic life without failure, an inspection was performed before the residual strength measurements were conducted. These ultrasonic scan records are included in appendix D.

To identify potential damage from the unloading portion of the preload cycle, pulse-echo ultrasonic inspection was conducted before preload, while at load, and after unloading. This was performed in the test machine using a hand-held transducer. It was found from these studies that there was only limited damage growth during preloading. This is consistent with the ultrasonic scan results and for results for 5/8 slits and holes in laminate L1. A comparison of the pulse echo inspection data taken during maximum load and after unloading indicated that this damage occurred on loading, with no detectable damage resulting from unloading.

The ultrasonic inspection during the cyclic test life was made by removing the specimen from test. The specimen removal procedure was adapted to allow better techniques to be used during inspection. The inspection times selected were after 10 cycles for the  $10^3$  cyclic life specimens and after 100 cycles for the  $10^6$  and  $10^7$  cyclic life specimens. These lives were selected to supplement the available data at 1,  $10^3$ ,  $10^5$ , and  $10^6$  cycles.

### Temperature Control

The tension-tension test specimens, were heated with a radiant heater on one face. This procedure is similar to that previously used for static testing. The temperature gradient through the thickness was found to be less than five 3 K ( $5^{\circ}\text{F}$ ) after about 2 min. at temperature. Heating from one side allowed easy specimen inspection and access for the COD gage.

The tension-compression testing required specimen stabilization plates that interfered with temperature control and heating. This problem was overcome by placing resistance heaters on the stabilizing plates in addition to the radiant heater. In this manner the specimen temperature is controlled to within five 3 K ( $5^{\circ}\text{F}$ ) of 422K ( $300^{\circ}\text{F}$ ). These procedures allowed access to the specimen for inspection and COD instrumentation. Access to the specimen face was through the 50.8 mm (2 in) diameter central holes in the stabilization plates.

## Test Results

Dry room temperature test results are presented in figures 65 through 68. The results are shown as maximum cyclic load versus applied load cycles. Specimens that did not fail during the cyclic test (circles with arrows) were residual static tested to failure. The residual static test results are shown as triangular points in the figures. Results from similar tests (ref. 1) are also included in the figures and identified with the number (1). The test data support the combinations of the results from these programs.

The results for the slits and the holes were similar for both the tension-tension and the tension-compression tests. Under tension-tension loading there was a high endurance limit, and the residual static strength increased with the application of cyclic loads. Under tension-compression loading the endurance load was about 60% of the static tension load for the long cyclic lives. The residual static tension strength data indicates an increase as found for tension-tension loading, although the limited data prevents firm conclusions.

Cyclic test results for room temperature wet tests are presented in figures 69 through 72. These data show a trend similar to the dry testing.

In both of these sets of data there does not seem to be an effect from the preloading on the cyclic lives.

The wet room temperature results are compared with the dry room temperature test data in figures 73 through 76. Figures 73 and 74 compare the residual strength data from the tension-tension tests, and figures 75 and 76 compare the cyclic life data from the tension-compression tests. The open symbols are for the dry tests, and the closed symbols are for the preconditioned (wet) specimens. The preloaded and nonpreloaded specimens are not differentiated in this presentation.

For both the hole and slit defects the residual strength of the wet test specimens generally exceeds the identical dry test specimens. There is an indication that the residual strength of the wet and dry specimens are the same after 10 million cycles.

The comparison of the cyclic test data for the tension-compression testing indicated a significant reduction (greater than an order of magnitude in life) for the wet specimen test data. This reduction is probably the result of reduced compressive properties and increased delamination in the wet specimens due to the reduced matrix strength.

Figures 77 through 80 present the dry 422K (300°F) test results. The presentation format is the same as for the other test conditions. The test loadings were maintained at the same levels as used for the previous series. As shown, the tension-tension tests again generally survived to the planned life, whereas the tension-compression specimens experienced fatigue failure.

These data are compared to the room temperature tests in figures 81 through 84. The elevated temperature tests are similar to the room temperature wet tests; i.e., higher residual strength and significantly shorter fatigue lives. However, it should be noted that residual strength tests were conducted at room temperature for both the room and 422K (300°F) cyclic tests. The difference in residual strength is due to the prior effect of temperature on damage growth during load cycling, while the early fatigue failures at 422K (300°F) for the tension-compression tests are due to the temperature effects on both strength and damage growth.

Figures 85 through 88 present the wet 422K (300°F) test results. The tension-tension test loadings were maintained the same as for the previous testing. However, for the tension-compression testing the cyclic load had to be reduced to prevent static compressive load failures.

These data are compared to the 422K (300°F) wet specimens in figures 89 through 92. It is interesting to note that the curve for the residual strength of the wet test specimens intersects the curve for the dry specimen residual strength at the long lives. One explanation could be drying of the test samples during cycling loading. This would be reasonable because of the potential acceleration in the diffusion rates from the cyclic loading. Also this would be expected in the 422K (300°F) tests where the diffusion rates would be high due to the temperature.

## CONCLUSIONS

Three composite 20-ply laminates representative of general structure, pressure vessels, and turbine engine fan blades were studied to develop data on the moisture and temperature effects on defect tolerance. The test results presented apply to the specific laminates and test conditions evaluated. However, the trends define general behavior for a wide range of composite materials and help to define expected structural behavior. Some of the conclusions that were made from the test data, and which are discussed in more detail in the report, are as follows:

- a. Defects in the composite laminates that cut filaments significantly reduced the strength.
- b. The failure in the test specimens with cut filaments initiated at the stress concentration and propagated across the specimen width. The failure mode and failure stress were similar for both tension and compression loading.
- c. The fracture strength was a direct function of defect size. Only when specimen width was less than about four times the defect size were the edge effects significant.
- d. When specimens had impact damage delaminations with no broken filaments there was no reduction in tension strength but there was a reduction in compression strength. The compression strength was reduced to the same value as for a machined defect of the same size as the delamination size.
- e. There was little difference between the performance of laminates with circular holes or sharp slits in the sizes tested.
- f. Half-penetration defects were less severe than full-penetration defects of the same surface length.

- g. Absorbed moisture had a small effect on the static fracture strength at room temperature. In graphite laminates the wet specimens had a greater strength, whereas the hybrid laminates had a reduced strength when wet.
- h. Preloading had a small effect on moisture absorption and residual static strength. The preload accelerated initial moisture gain but not the end result. In laminate L1 the preloading increased the dry room temperature residual strength and reduced the elevated temperature wet value. The other conditions and laminates showed little change.
- i. Graphite fiber composite materials were relatively insensitive to tension-tension fatigue, even when at 422K (300°F) and wet. However, the application of compression loadings ( $R = -1.0$ ) yielded fatigue failures at significantly lower loads than in tension.
- j. Moisture and temperature, independently and in combination, had a significant effect on tension-compression fatigue behavior.

**Table 1. Structural Laminates Evaluated**

Designation	Material	Layup	Application
L1	Thornel 300/fiberite 934 (T300/934)	$[(0/\pm 45/0/90)]_2$	General structure
L2	T300/934	$[(0_3/\pm 80)_2]_S$	Pressure vessels
L3	T300/934 with 901-S	$[(0/+30/0^\circ/-30/0)_2]_S$	Turbine engine fan blades or support struts

\*Plies that are replaced with S-glass

**Table 2. Summary of Test Laminate Construction**



Specimen number	Test type	Laminate number	Stacking sequence	Panel size m (inXin)
L1-21-XX	Static	L1	$[(0/\pm 45/0/90)_S]_2$	0.81 X 3.06 (32X120)
L2-2X-XX	Static	L2	$[(0_3/\pm 80)_2]_S$	0.81 X 2.92 (32X115) 1▶
L3-21-XX	Static	L3	$[(0/+30/0^\circ/-30/0)_2]_S$ 2▶	0.81 X 1.90 (32X75)
L3-22-XX	Static	L3 all graphite	$[(0/+30/0/-30/0)_2]_S$	0.81 X .76 (32X30)
L1-31-XX	Cyclic	L1	$[(0/\pm 45/0/90)_S]_2$	0.81 X 1.52 (32X60) 3▶


1▶ Test panel was cut after layup into one 0.81 X 1.96 (32X77) panel and three smaller panels prior to cure for the low pressure cure cycles

2▶ \* denotes S-glass ply

3▶ Two panels were required

**Table 3. Defect Type and Size Code**

Defect type \ Approximate diameter or surface length mm (in)	3.18 (0.125)	9.52 (0.375)	15.9 (0.625)
Full-penetration hole	1/8 FP HOLE	3/8 FP HOLE	5/8 FP HOLE
Half-penetration hole 	1/8 HP HOLE	3/8 HP HOLE	5/8 HP HOLE
Full-penetration slit	1/8 FP SLIT	3/8 FP SLIT	5/8 FP SLIT
Half-penetration slit 	1/8 HP SLIT	3/8 HP SLIT	5/8 HP SLIT
100-degree full-depth countersink hole	1/8 CSK HOLE	3/8 CSK HOLE	5/8 CSK HOLE
Circular disbond defect between 15th and 16th plies	—	—	5/8 DISBOND
Low velocity impact damage 3.38 N-m (30 in-lb')	—	—	IMPACT

 HP defects are 1.5 mm (0.060 in) deep

**Table 4. Width Effect Test Matrix**

Specimen configuration		Laminate	L <sub>1</sub>						L <sub>3</sub>					
		Defect code	5/8 FP SLIT			IMPACT			5/8 FP SLIT			IMPACT		
		Specimen mm width (in)	50 (2)	100 (4)	150 (6)	50 (2)	100 (4)	150 (6)	50 (2)	100 (4)	150 (6)	50 (2)	100 (4)	150 (6)
Loading condition	Static tension		1	1	1	1	1	1	1	1	1	1	1	1
	static compression		1	1	1	1	1	1	1	1	1	1	1	1



Table 5. Static Fracture Test Matrix of Wet Room Temperature Specimens

Layup pattern and loading condition		Defect type and degree of penetration															
		S <sub>0</sub>	Circular holes						Sharp slits						Natural		
			1/8		3/8		5/8		1/8		3/8		5/8		S <sub>1</sub>	S <sub>2</sub>	S <sub>3</sub>
			—	FP	HP	FP	HP	FP	HP	FP	HP	FP	HP	FP	HP	—	—
L <sub>1</sub>	NPL	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1
	PL	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1
L <sub>2</sub>	NPL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1
	PL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1
L <sub>3</sub>	NPL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1
	PL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1

Static tests at room temperature after moisture conditioning

- L<sub>1</sub> — Laminate L<sub>1</sub> ((0/±45/0/90)<sub>2</sub>)<sub>S</sub>  
 L<sub>2</sub> — Laminate L<sub>2</sub> ((0<sub>3</sub>/±80)<sub>2</sub>)<sub>S</sub>  
 L<sub>3</sub> — Laminate L<sub>3</sub> ((0/+30/0°/-30/0)<sub>2</sub>)<sub>S</sub>  
 NPL — No preload  
 PL — Preload to 90 percent estimated strength prior to moisture conditioning  
 FP — Full penetration  
 HP — Half penetration  
 S<sub>0</sub> — Unflawed test specimen  
 S<sub>1</sub>, S<sub>2</sub>, S<sub>3</sub> — Natural defects (see Figure 5)

Table 6. Static Fracture Test Matrix of Wet Thermal Spike Specimens

Layup pattern and loading condition		Defect type and degree of penetration															
		S <sub>0</sub>	Circular holes						Sharp slits						Natural		
			1/8		3/8		5/8		1/8		3/8		5/8		S <sub>1</sub>	S <sub>2</sub>	S <sub>3</sub>
			—	FP	HP	FP	HP	FP	HP	FP	HP	FP	HP	FP	HP	—	—
L <sub>1</sub>	NPL	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1
	PL	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1
L <sub>2</sub>	NPL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1
	PL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1
L <sub>3</sub>	NPL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1
	PL	1	1	—	1	—	1	—	1	1	1	1	1	1	1	1	1

Static tests at 422K (300°F) after abrupt heating from room temperature all specimens moisture conditioned

- L<sub>1</sub> — Laminate L<sub>1</sub> ((0/±45/0/90)<sub>2</sub>)<sub>S</sub>  
 L<sub>2</sub> — Laminate L<sub>2</sub> ((0<sub>3</sub>/±80)<sub>2</sub>)<sub>S</sub>  
 L<sub>3</sub> — Laminate L<sub>3</sub> ((0/+30/0°/-30/0)<sub>2</sub>)<sub>S</sub>  
 NPL — No preload  
 PL — Preload to 90 percent estimated strength prior to moisture conditioning  
 FP — Full penetration  
 HP — Half penetration  
 S<sub>0</sub> — Unflawed test specimen  
 S<sub>1</sub>, S<sub>2</sub>, S<sub>3</sub> — Natural defects (see Figure 5)

Table 7. Environmental Cyclic Test Matrix

Laminate	Defect code	Load ratio, R (P <sub>min</sub> /P <sub>max</sub> )	Preload, % σ <sub>ult</sub>	Number of tests at designated test condition										
				Test conditions										
				Room temperature — dry	Room temperature wet			422K (300°F) dry			422K (300°F) wet			
				Target life (cycles)	Target life (cycles)			Target life (cycles)			Target life (cycles)			
				10 <sup>6</sup>	10 <sup>7</sup>	10 <sup>3</sup>	10 <sup>6</sup>	10 <sup>7</sup>	10 <sup>3</sup>	10 <sup>6</sup>	10 <sup>7</sup>	10 <sup>3</sup>	10 <sup>6</sup>	10 <sup>7</sup>
L <sub>1</sub>	5/8 FP HOLE	0.05	0 90	1	1	1	1	1	1	1	1	1	1	1
		-1.0	0 90	1	1	1	1	1	1	1	1	1	1	
	5/8 FP SLIT	0.05	0 90	1	1	1	1	1	1	1	1	1	1	1
		-1.0	0 90	1	1	1	1	1	1	1	1	1	1	1

Table 8. Influence of Preload on Static Strength

Defect code	Ratio of Preload (PL) to Non Preload (NPL) static strength											
	Laminate L <sub>1</sub>			Laminate L <sub>2</sub>			Laminate L <sub>3</sub> hybrid			Laminate L <sub>3</sub> all graphite		
	Room		422K	Room		422K	Room		422K	Room		422K
	Dry	Wet	Wet	Dry	Wet	Wet	Dry	Wet	Wet	Dry	Wet	Wet
FP SLIT	1/8	1.11	1.02	0.92	1.01	1.24	1.02	0.99	1.06	0.89	0.94	
	3/8	1.01	1.08	0.89	0.97	1.05	0.99	1.00	0.98	0.81		
	5/8	1.04	1.08	0.89	0.92	0.94	1.08	0.97	0.98	0.98	0.91	0.89
FP HOLE	1/8	1.10	1.00	0.96	1.00	1.04	1.05	0.98	1.00	1.03		
	3/8	1.12	0.99	0.79	1.08	0.93	1.01	1.04	1.01	0.81		
	5/8	1.08	1.06	0.83	1.19	0.90	1.07	—	0.92	1.00	0.97	0.91
HP SLIT	1/8	1.12	1.00	0.82	1.19	1.03	0.99	0.95	0.97	0.93		
	3/8	1.17	0.90	0.97	0.92	0.93	1.00	0.93	1.12	0.93		
	5/8	1.05	1.19	0.90	—	0.99	1.07	—	0.75	1.23	1.05	0.88
HP HOLE	1/8	0.95	0.92	0.87								
	3/8	—	0.90	0.93								
	5/8	0.96	0.92	1.07								
CSK HOLE	1/8	1.03	0.90	1.02								
	3/8	—	1.11	1.05								
	5/8	1.09	1.00	0.87								
NONE	—	0.99	0.91	0.99	0.98	1.04	0.95	0.96	0.95	0.95		

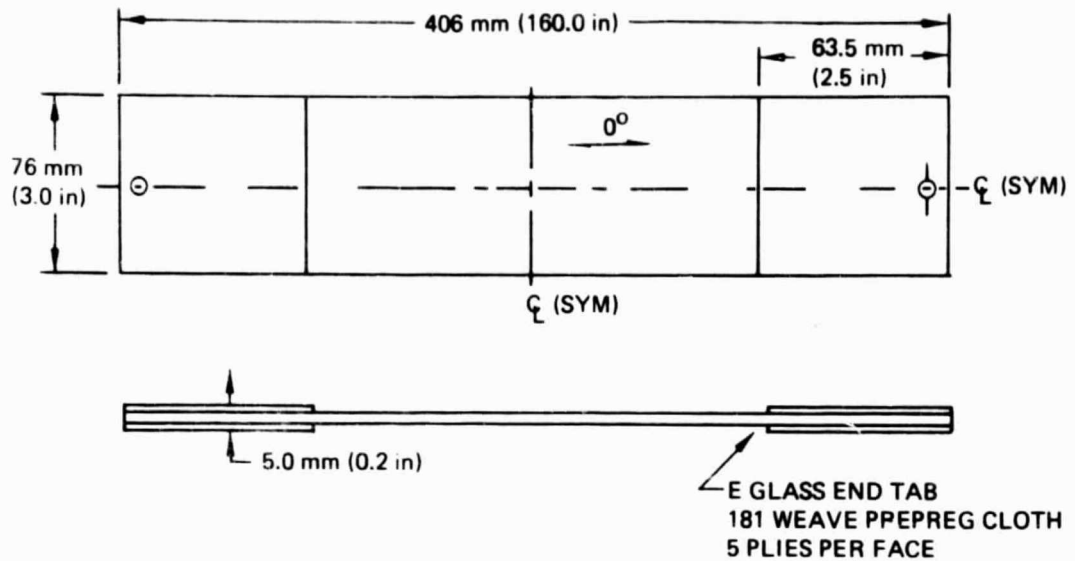


Figure 1. Test Specimen Configuration

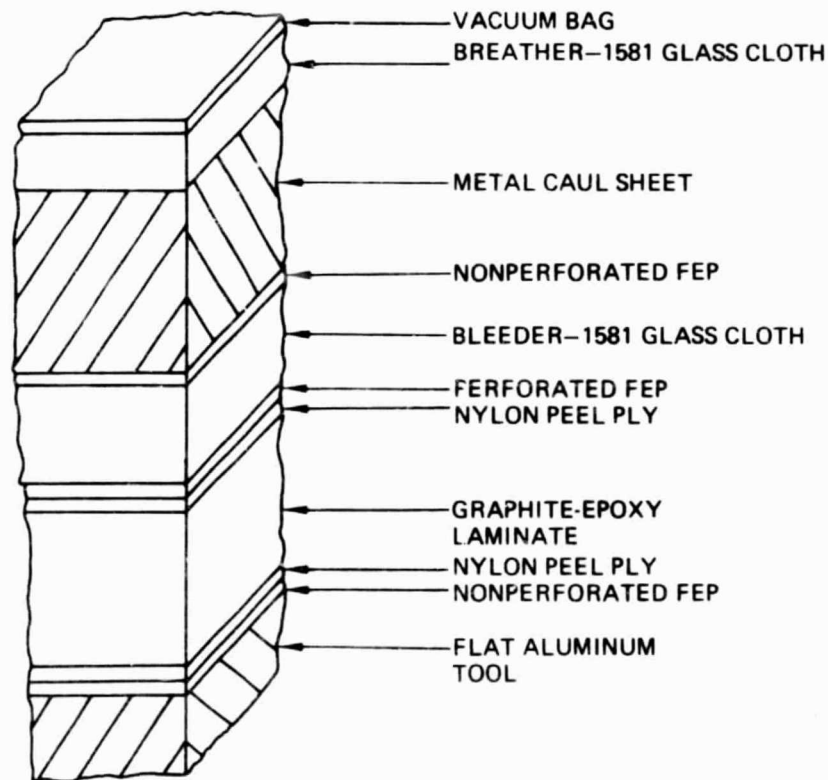


Figure 2. Specimen Laminate Layup Sequence




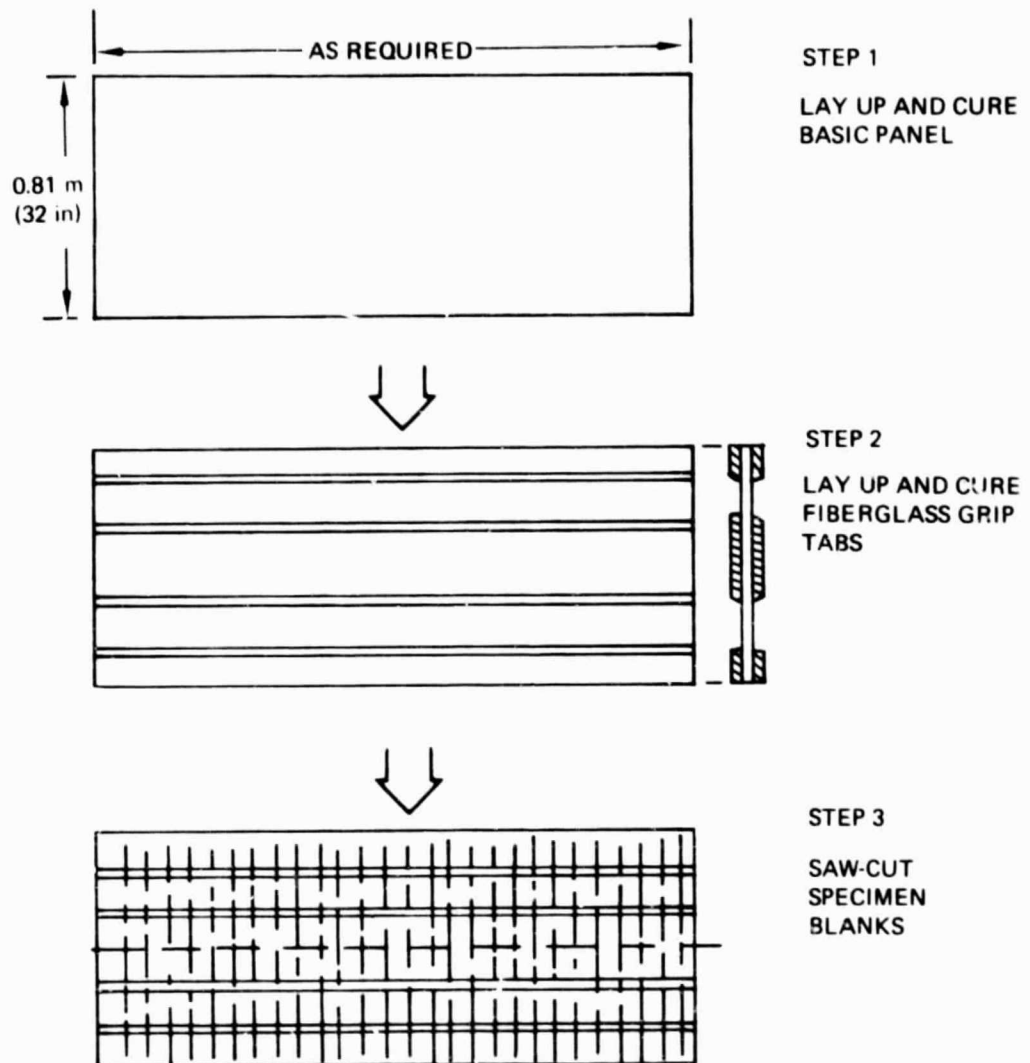




Figure 3. Specimen Cutting Procedure

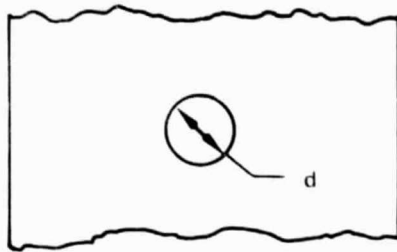


a) FULL-PENETRATION HOLE (FP)

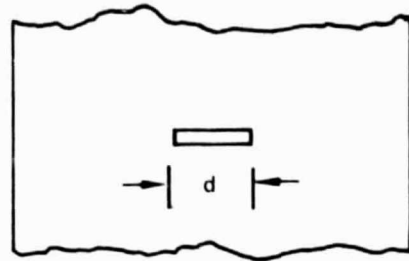

c) FULL-PENETRATION SLIT (FP)

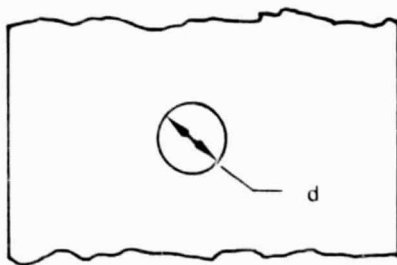

b) HALF-PENETRATION HOLE (HP)

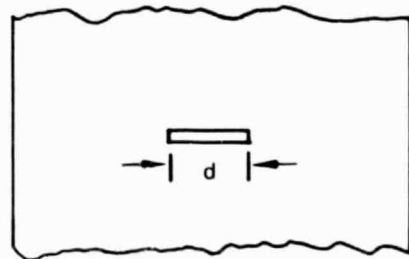

d) HALF-PENETRATION SLIT (HP)

*Figure 4. Stress Concentration Configurations*





LAMINATE	DEFECT
L <sub>1</sub>	 <p>100°</p> <p>DEEP COUNTERSINK</p>
L <sub>2</sub>	 <p>VOIDS</p>
L <sub>3</sub>	 <p>NO HYBRID FIBERS</p>


Figure 5. Natural Defects



*Figure 6. Photomicrograph Showing Root of Ultrasonically Machined Flaw*

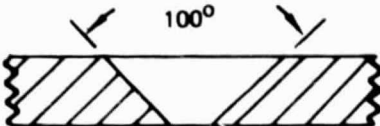
ORIGINAL PAGE IS  
OF POOR QUALITY

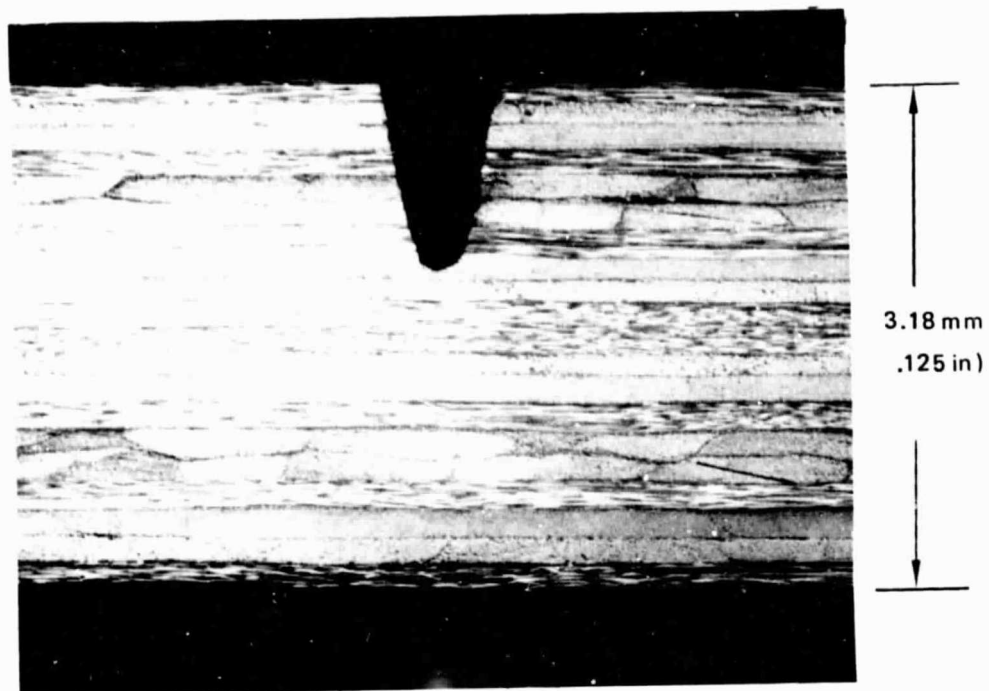

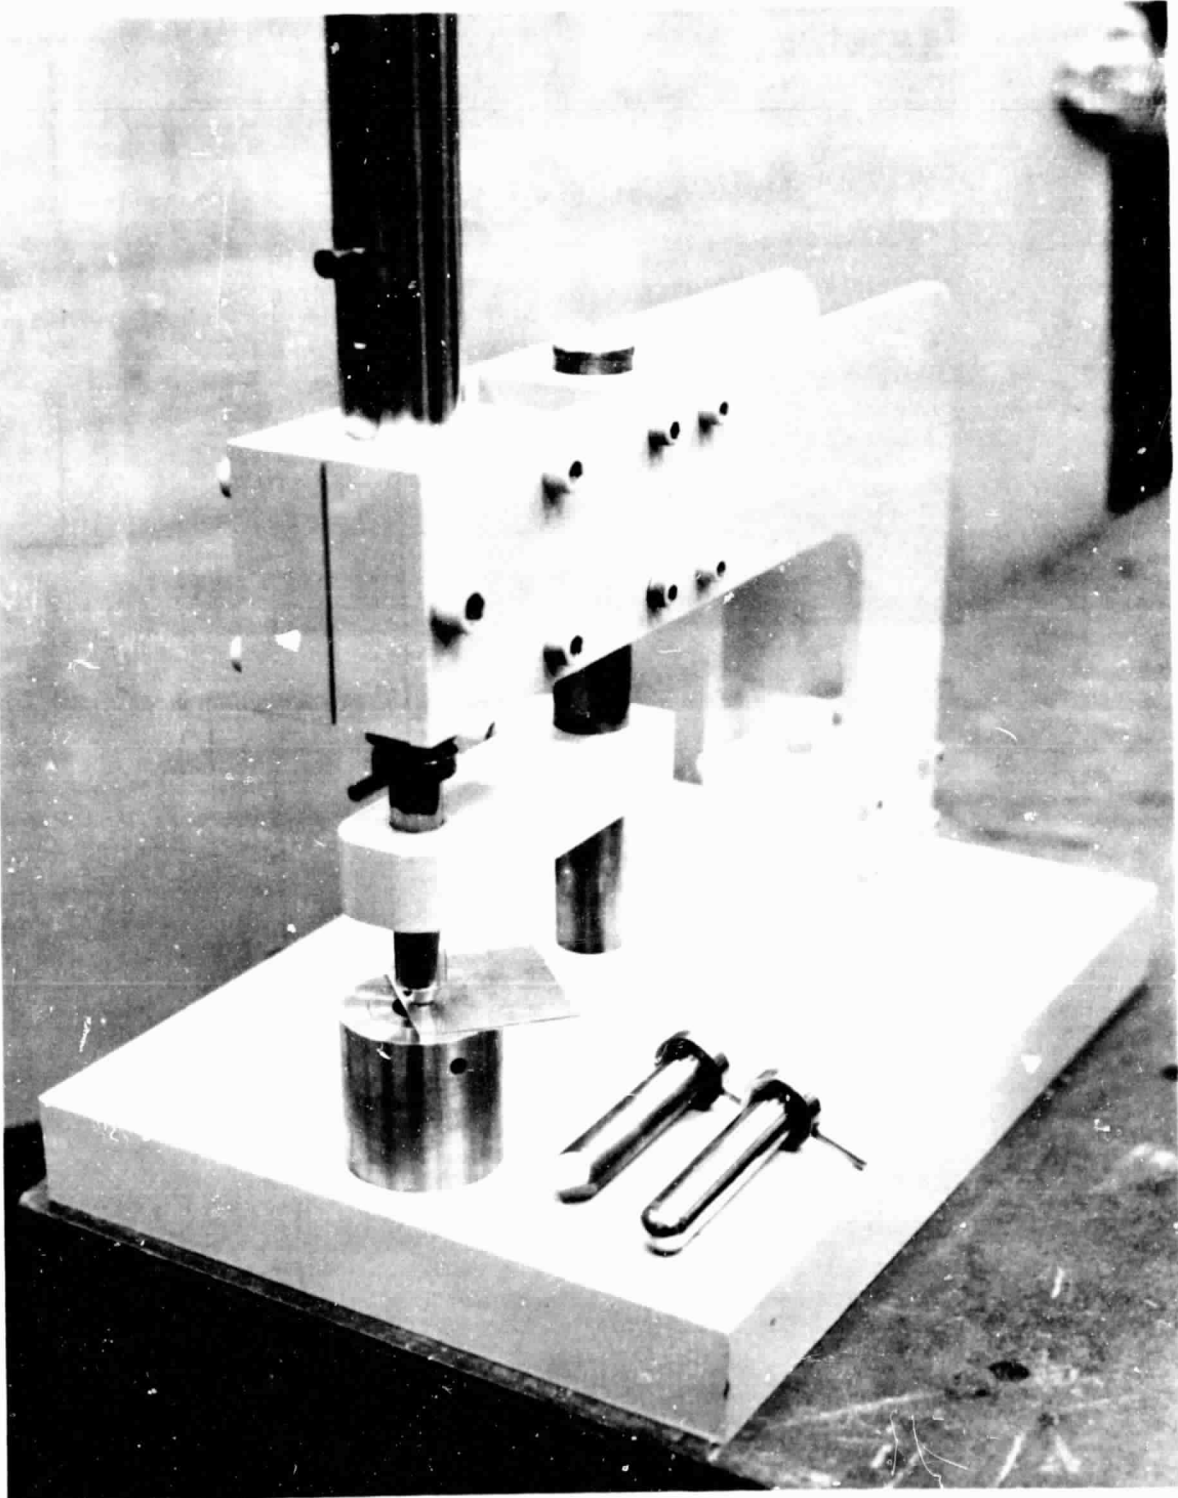


*Figure 7. Impact Test Machine*

ORIGINAL PAGE IS  
OF POOR QUALITY

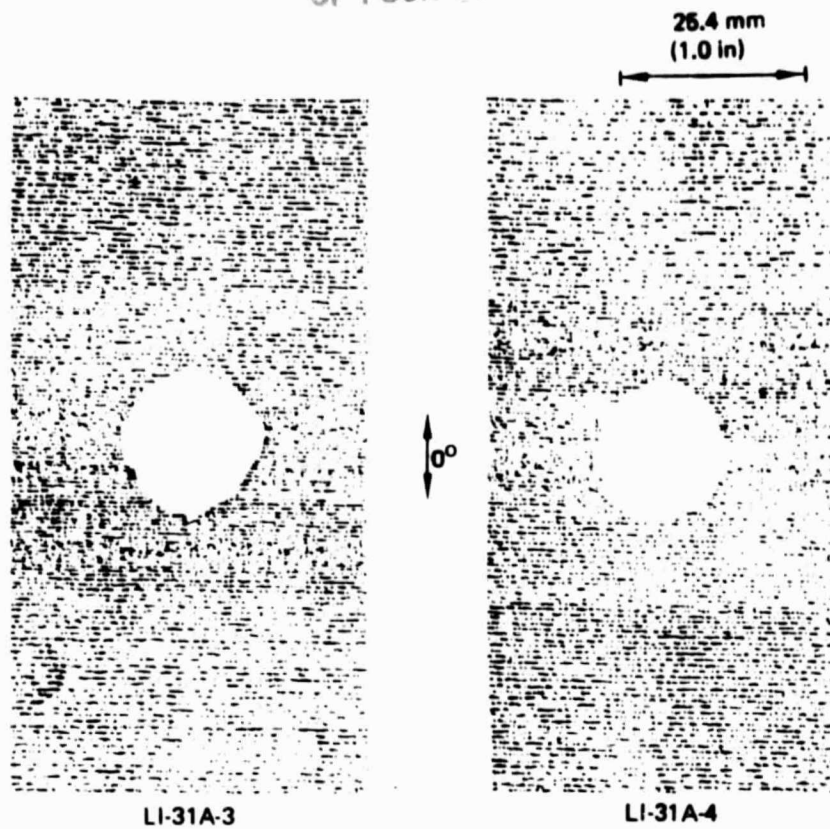

LAMINATE LI SPECIMENS  $[(0/\pm 45/0/90)_S]_2$

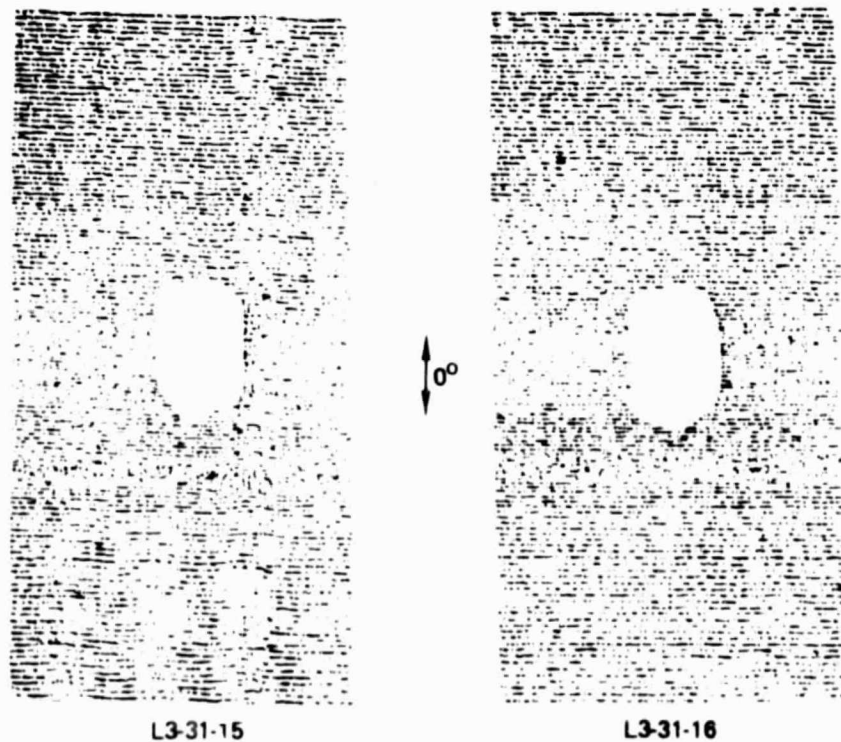

LAMINATE L3 SPECIMENS  $[(0/+30/0^\circ/-30/0)_S]_2$

Figure 8. Ultrasonic Scan Records for Impact Damage

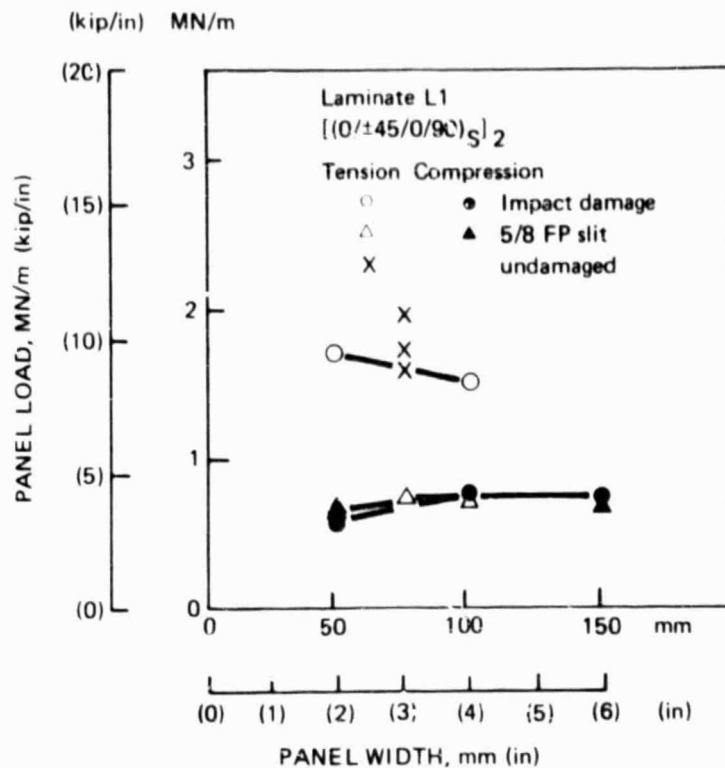


Figure 9. Effect of Width on Static Strength of Laminate L1

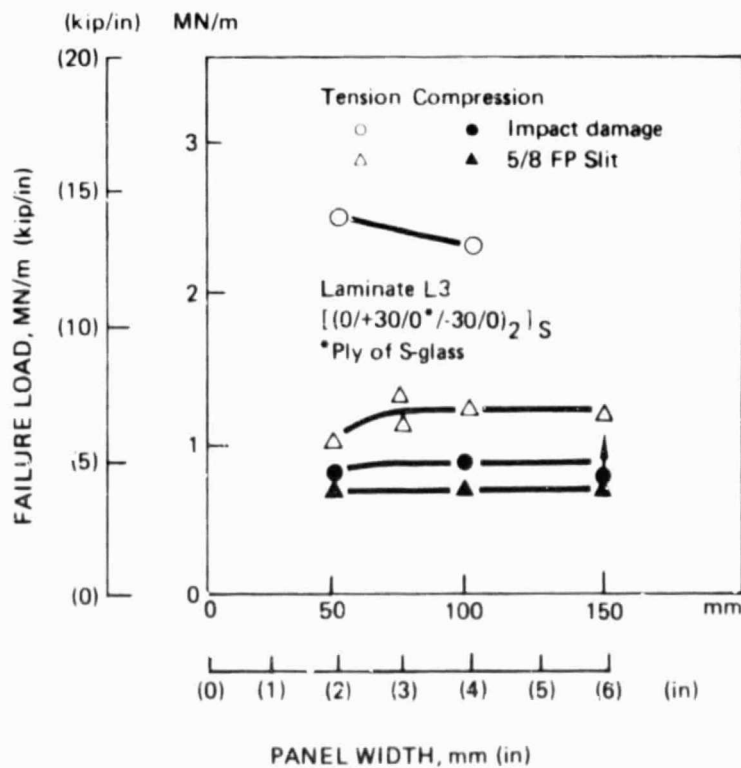


Figure 10. Effect of Width on Static Strength of Laminate L3

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH



*Figure 11. Photograph of Compression Fracture Specimen*



*Figure 12. Edge Detail of Compression Fracture*

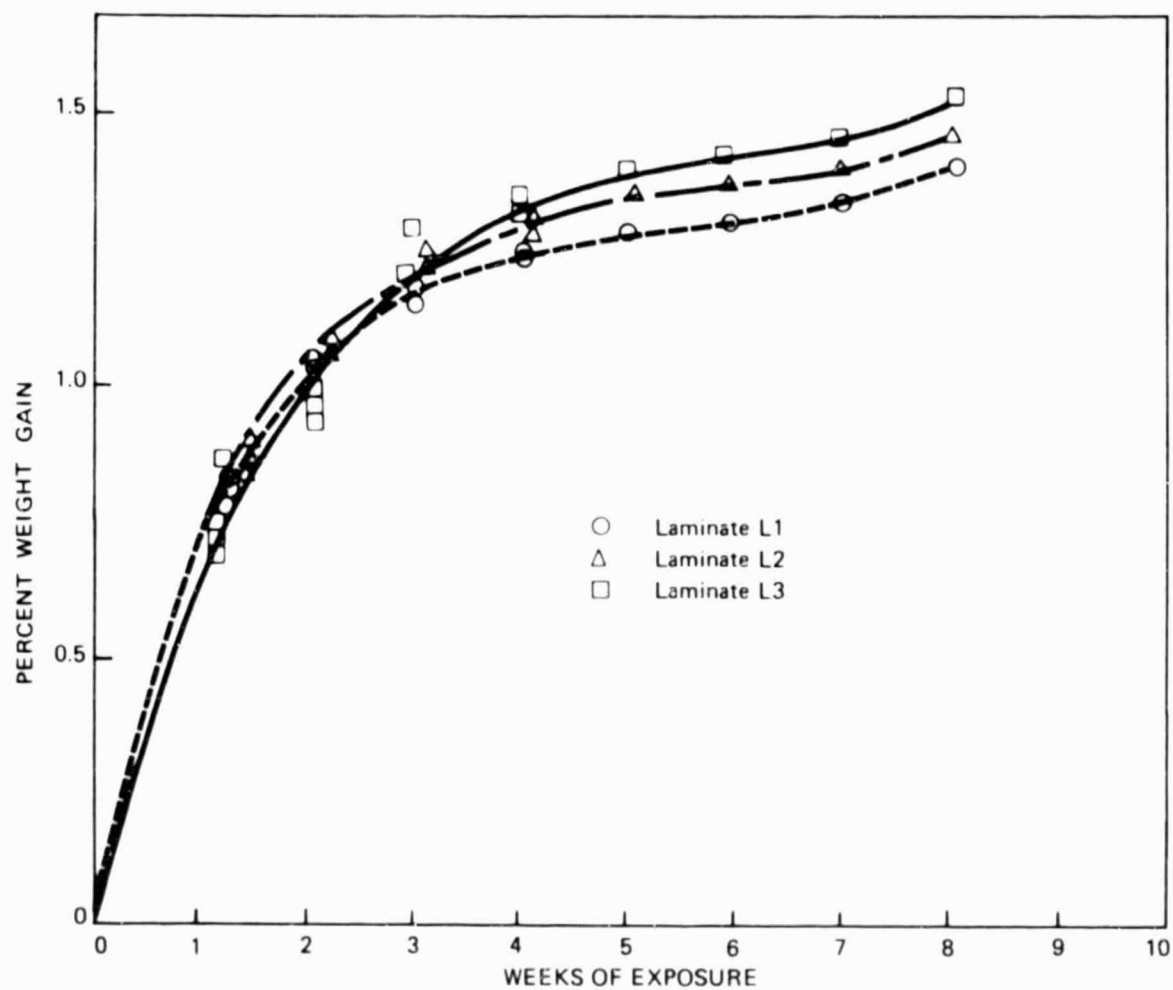


Figure 13. Weight Gain in Untabbed Static Test Laminates

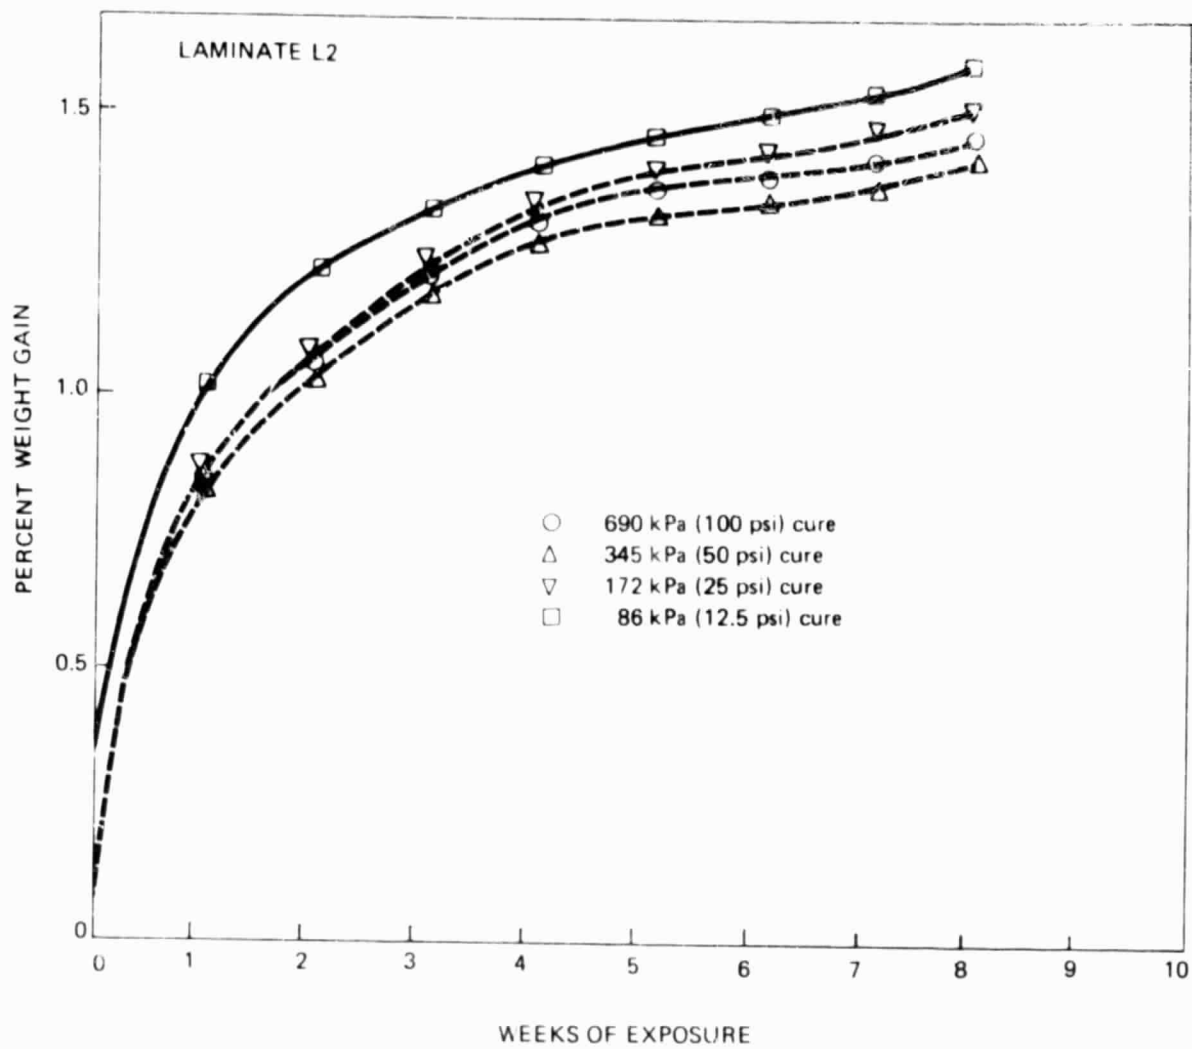


Figure 14. Weight Gain in Laminate L2 Untabbed Samples

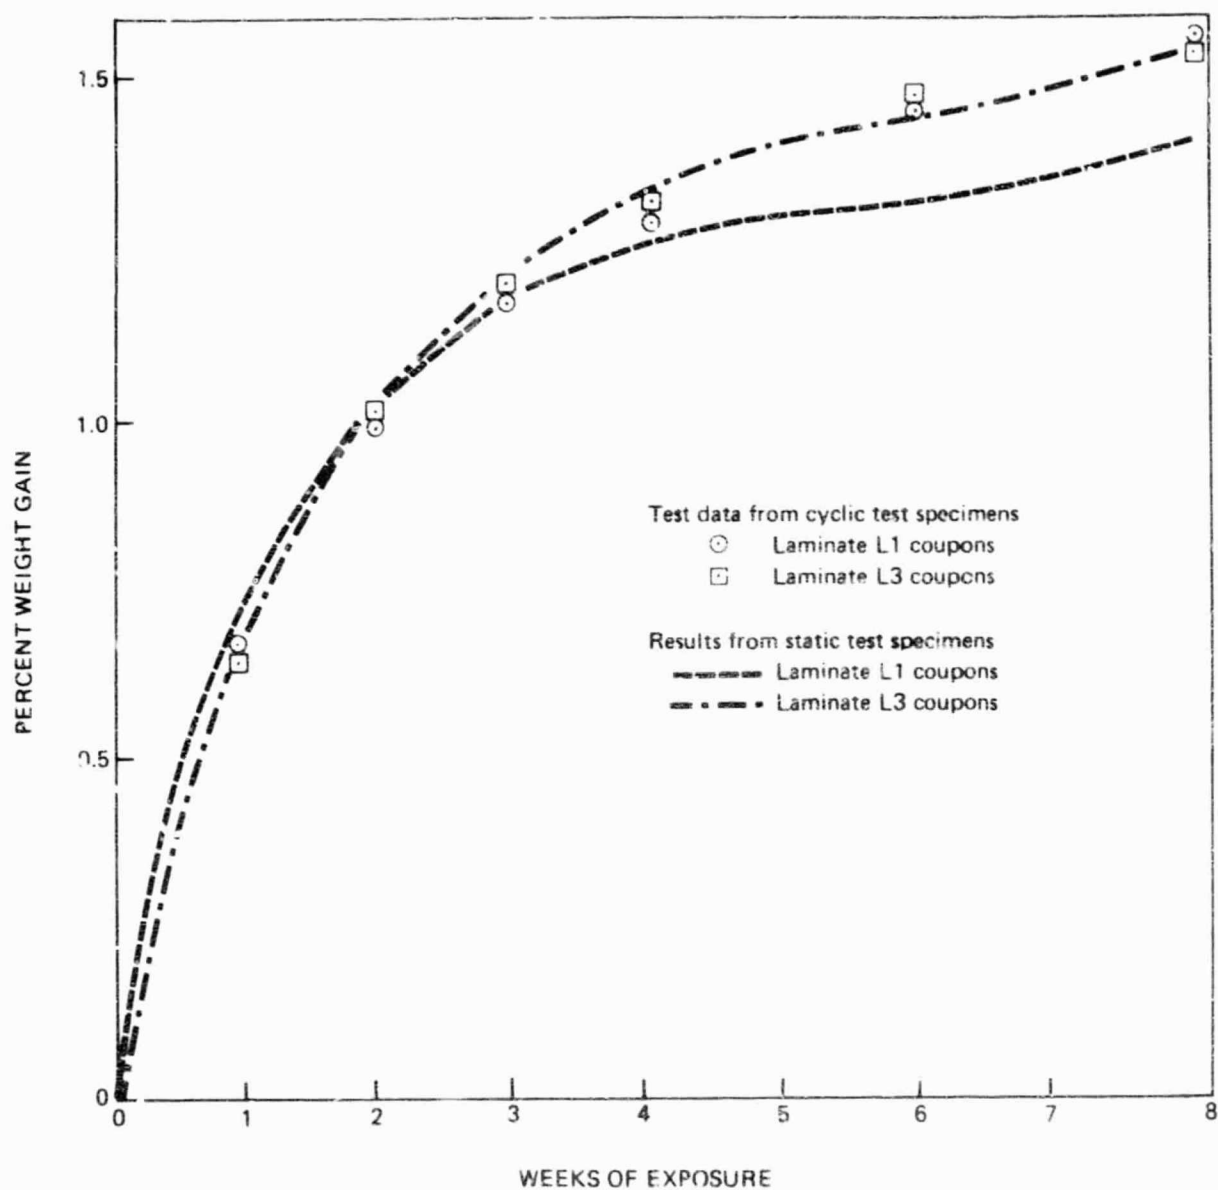


Figure 15. Weight Gain in Cyclic Test Laminates

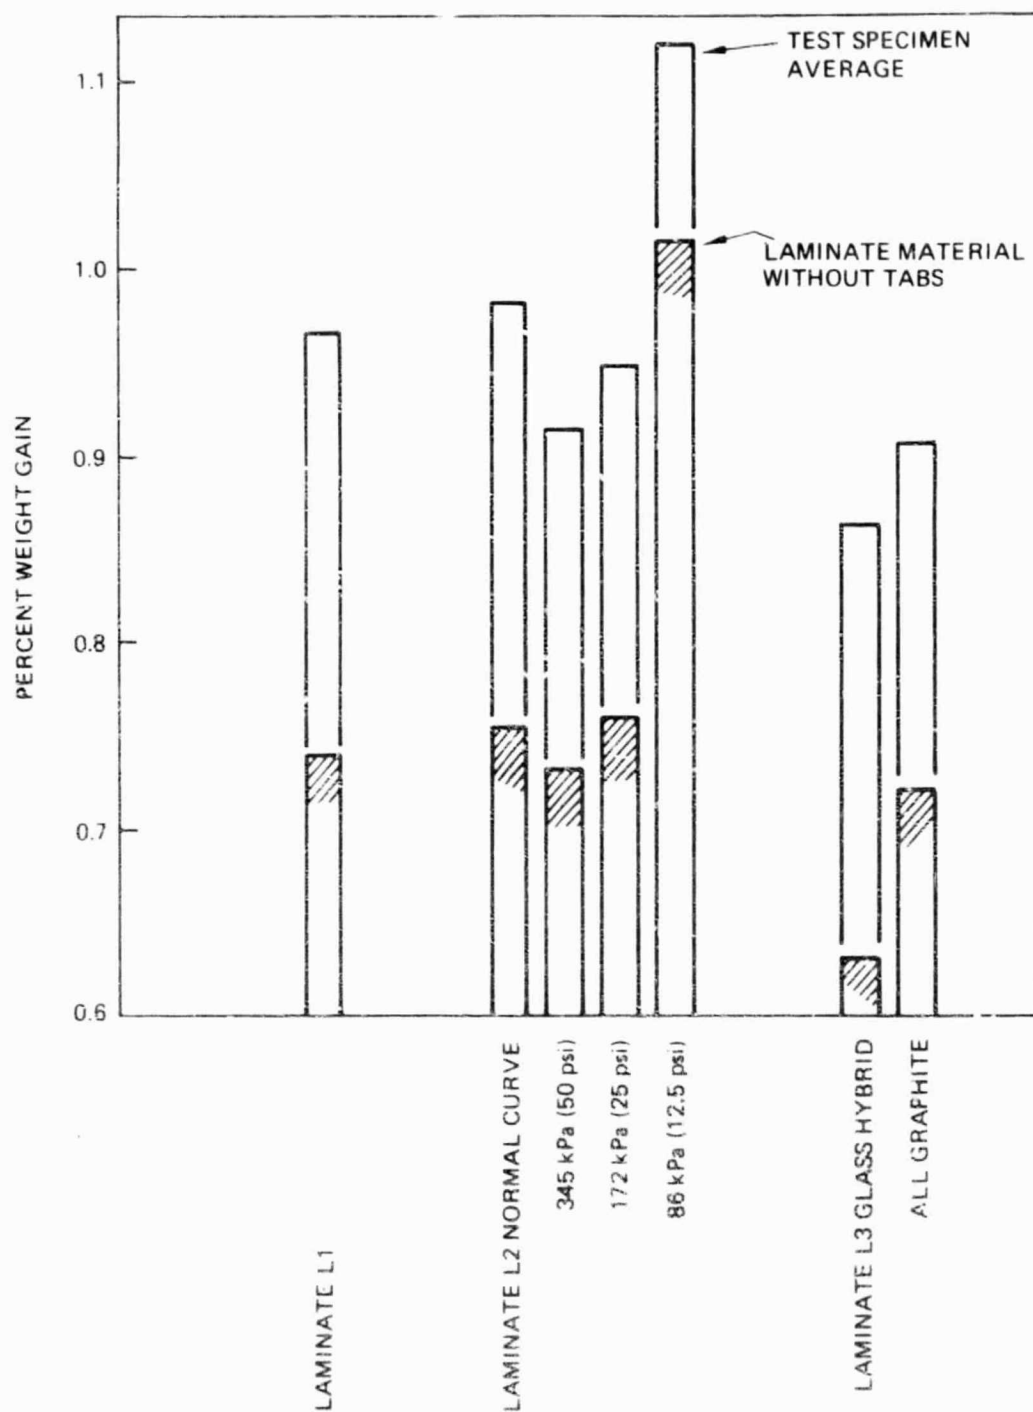


Figure 16. Weight Gain After One Week Exposure



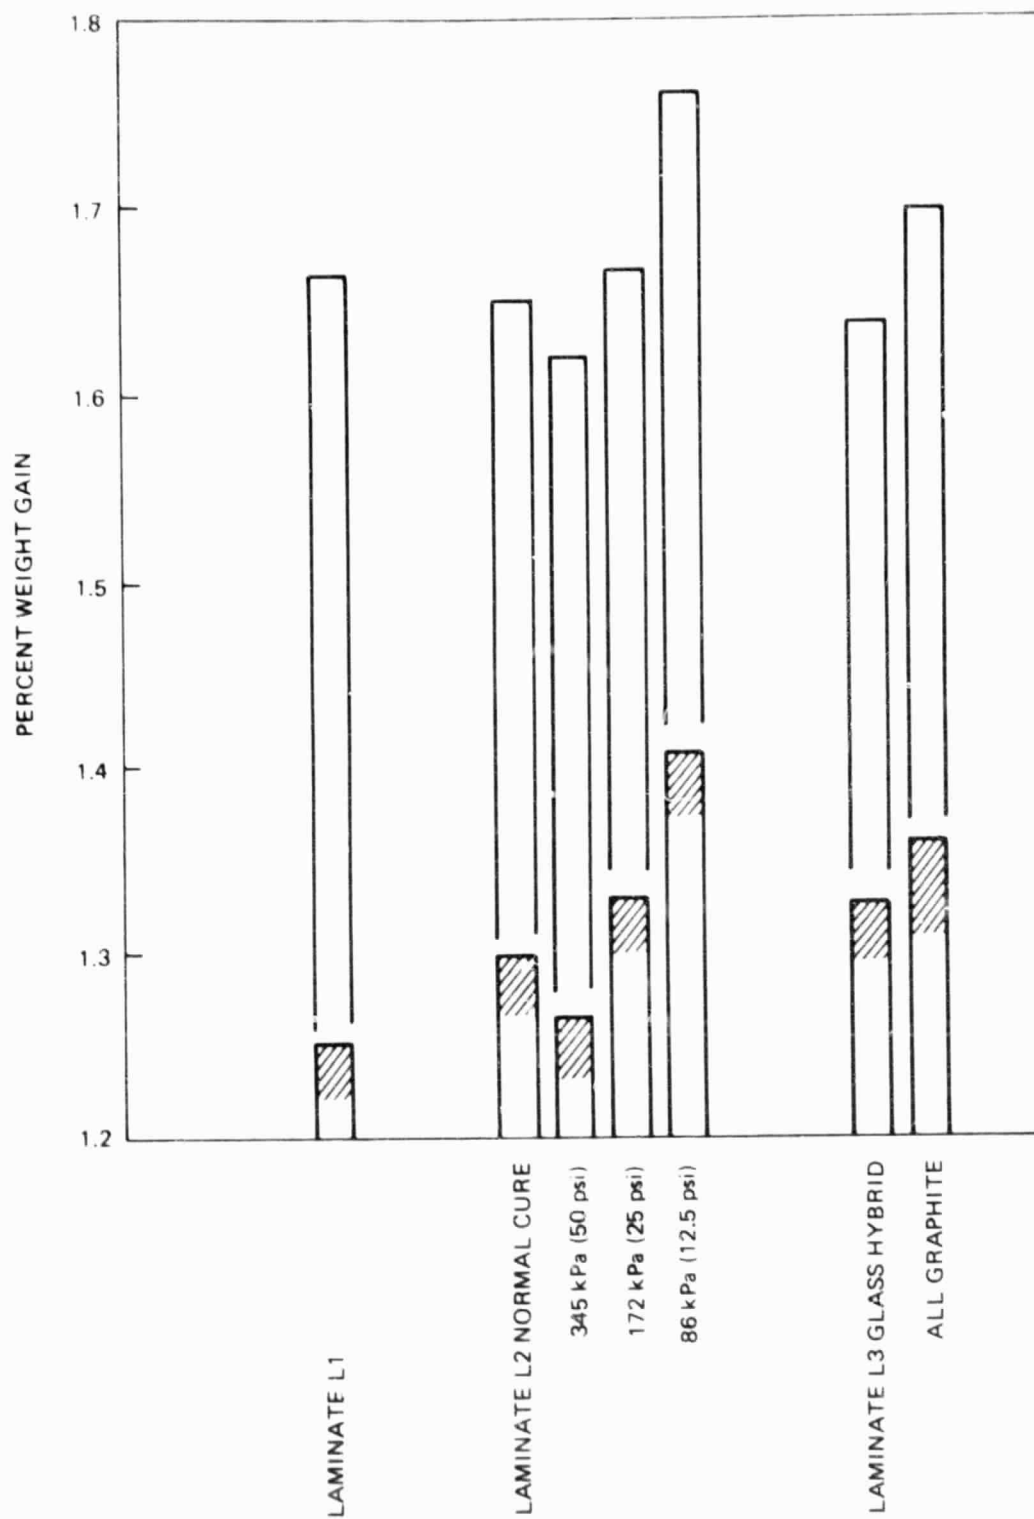


Figure 17. Weight Gain After Four Weeks Exposure

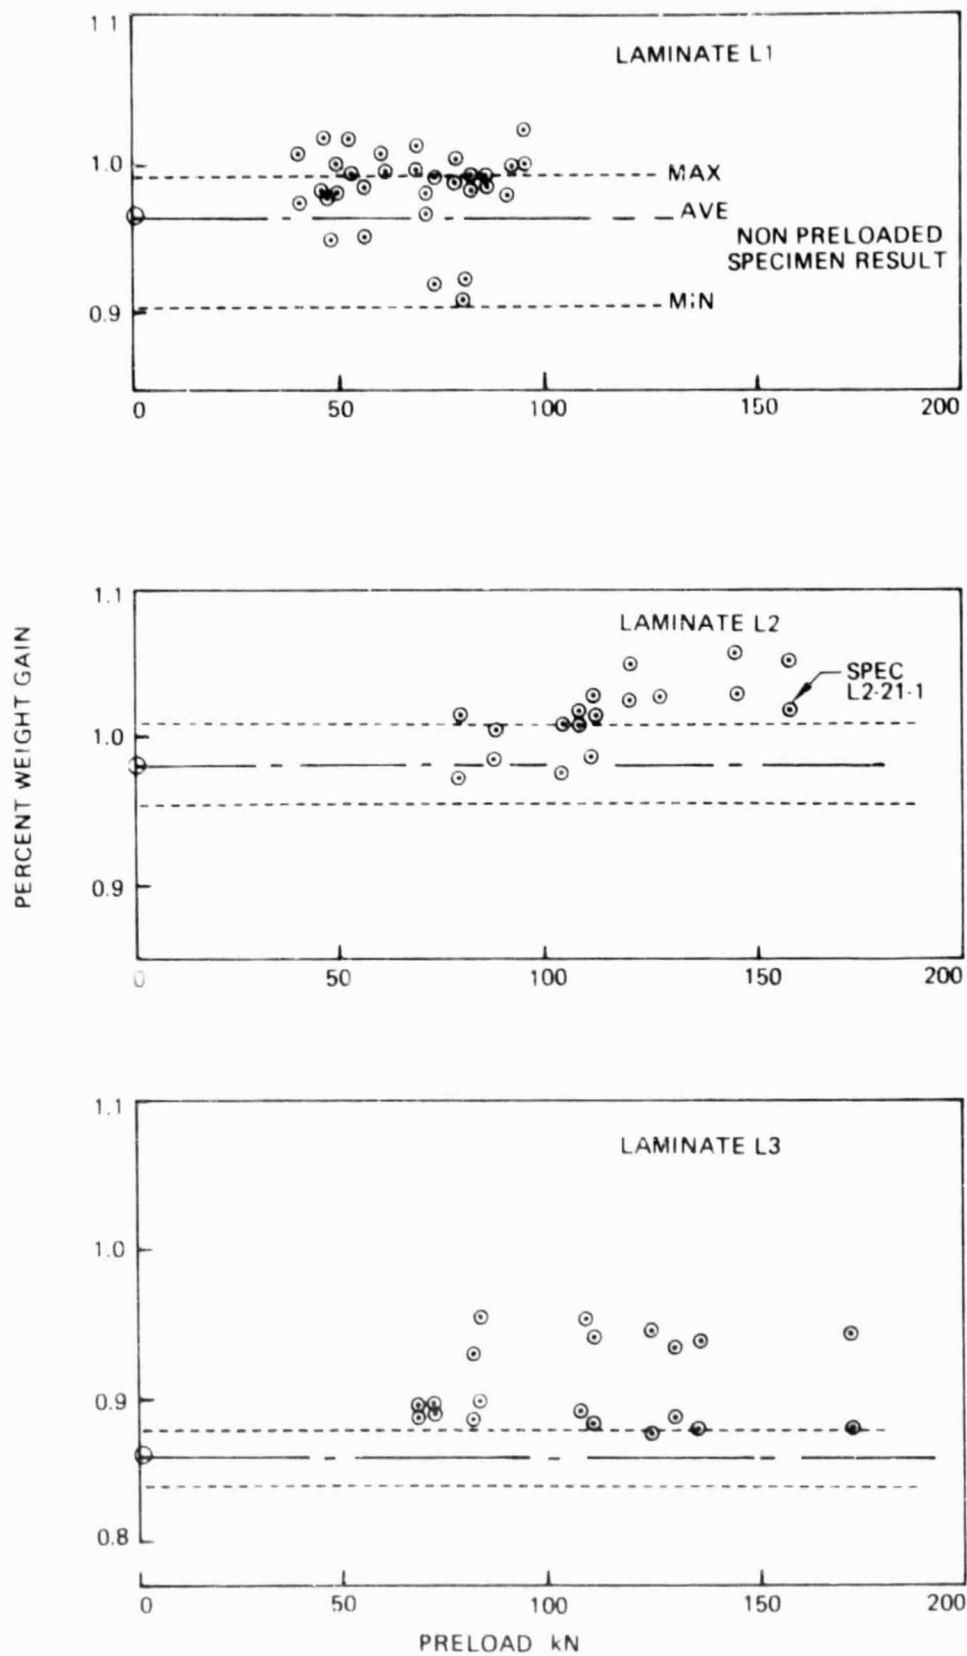


Figure 18. Influence of Preload on Weight Gain After One Week of Exposure

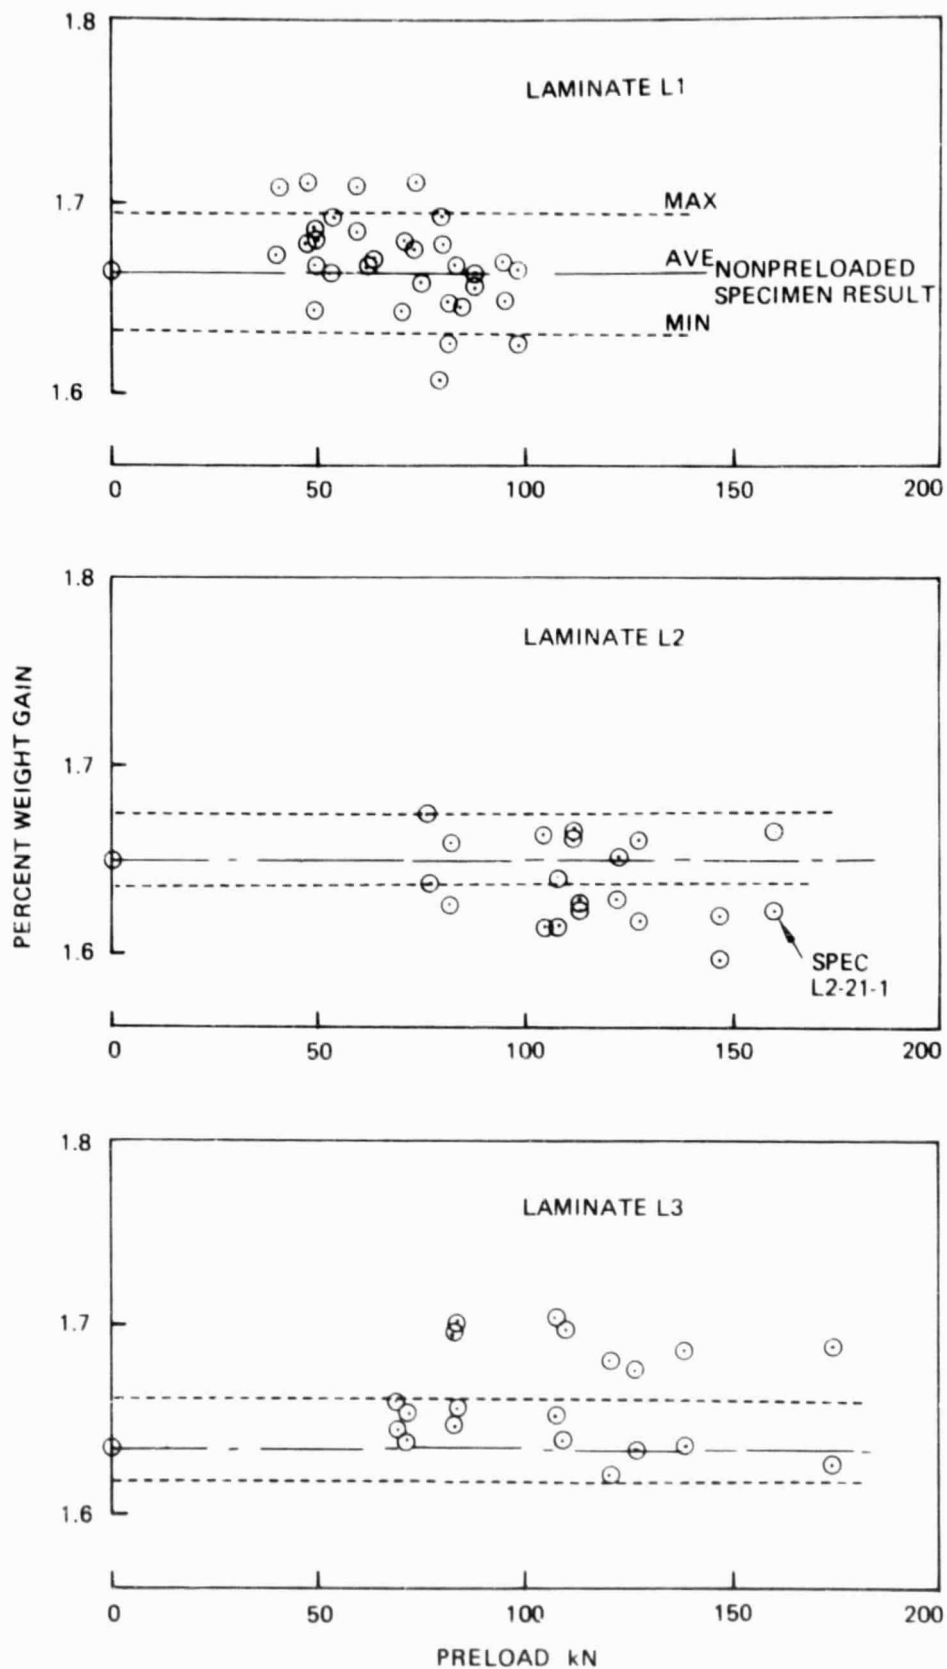


Figure 19. Influence of Preload on Weight Gain After Four Weeks of Exposure

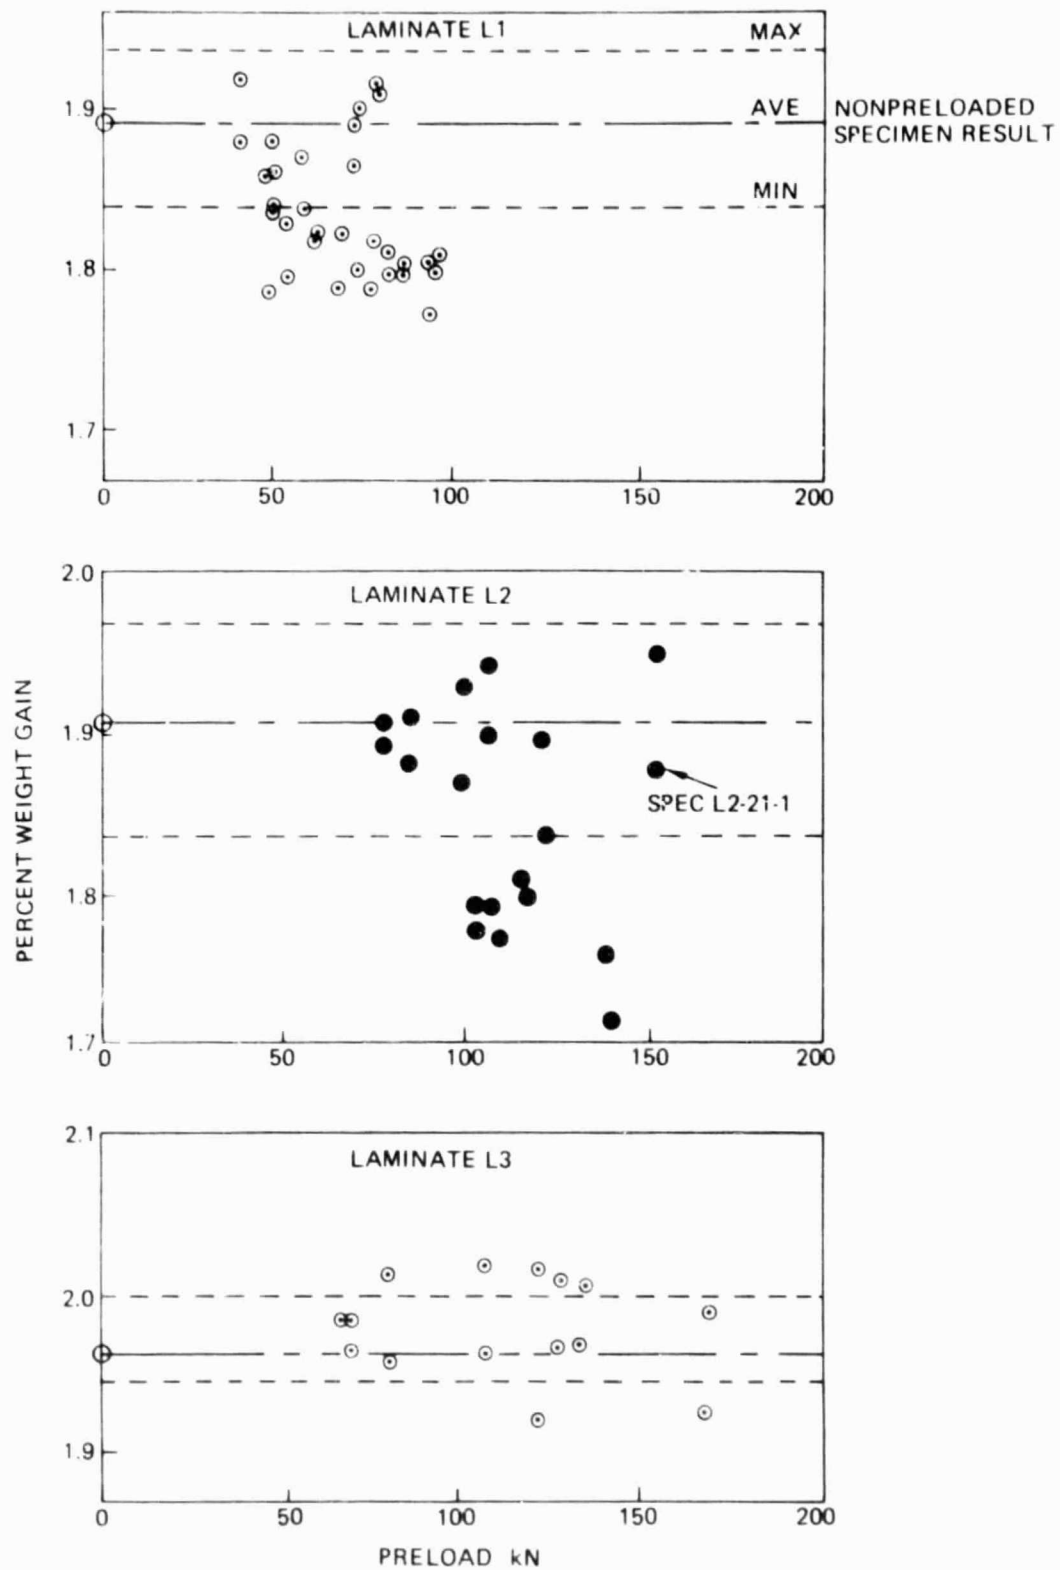


Figure 20. Influence of Preload on Weight Gain After Eight Weeks of Exposure

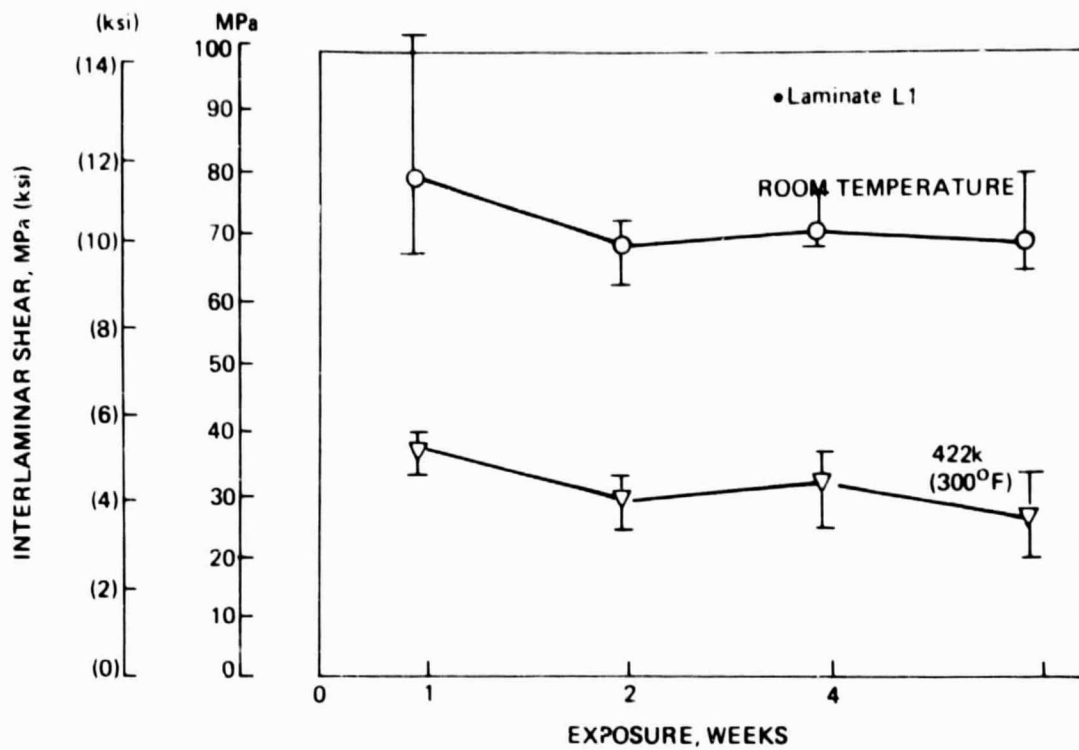


Figure 21. Influence of Moisture Exposure on Laminate L1 Shear Strength

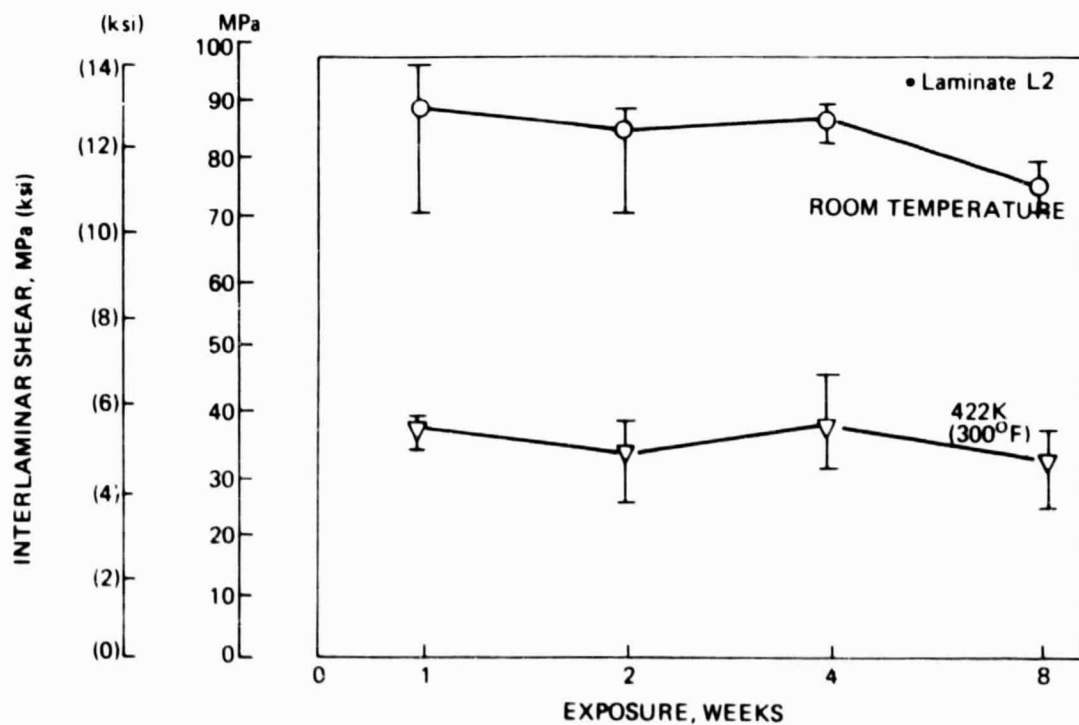


Figure 22. Influence of Moisture Exposure on Laminate L2 Shear Strength

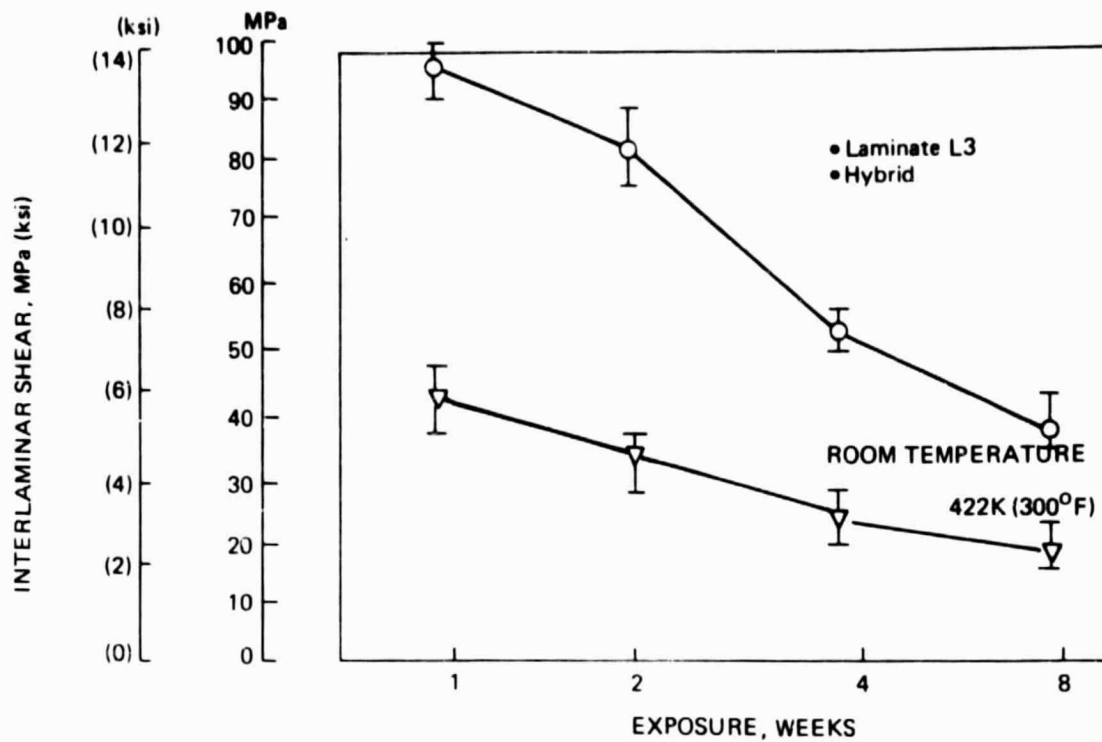


Figure 23. Influence of Moisture Exposure on Laminate L3 Shear Strength

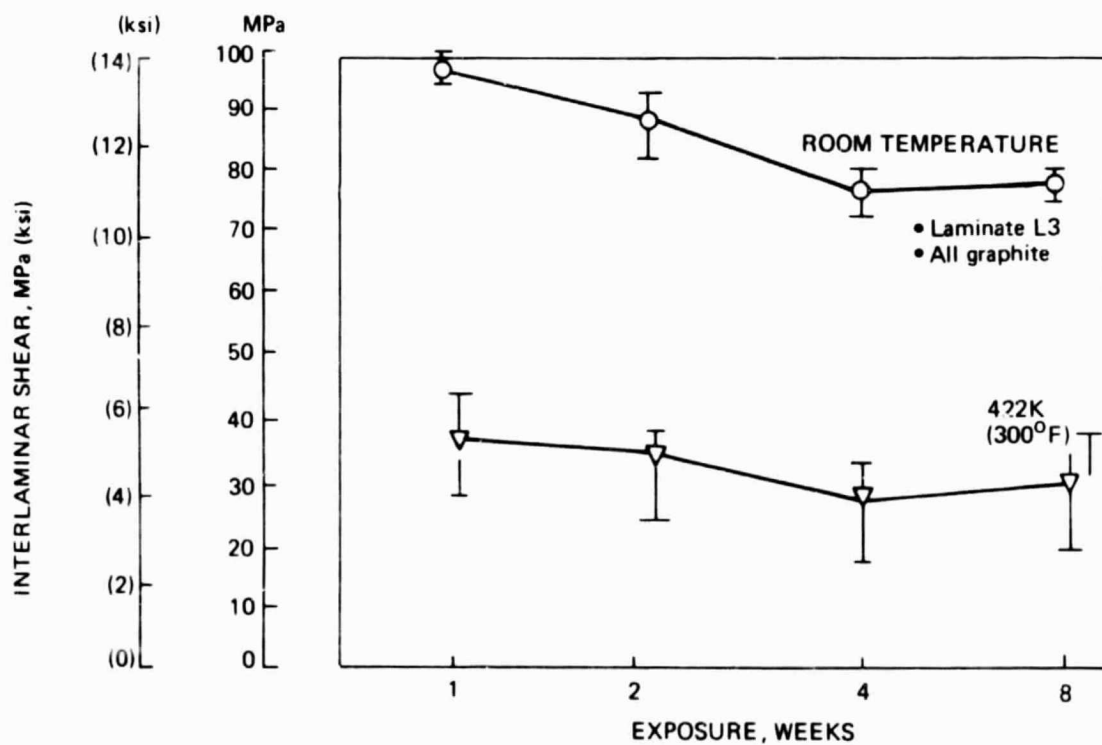


Figure 24. Influence of Moisture Exposure on All Graphite Laminate L3 Shear Strength

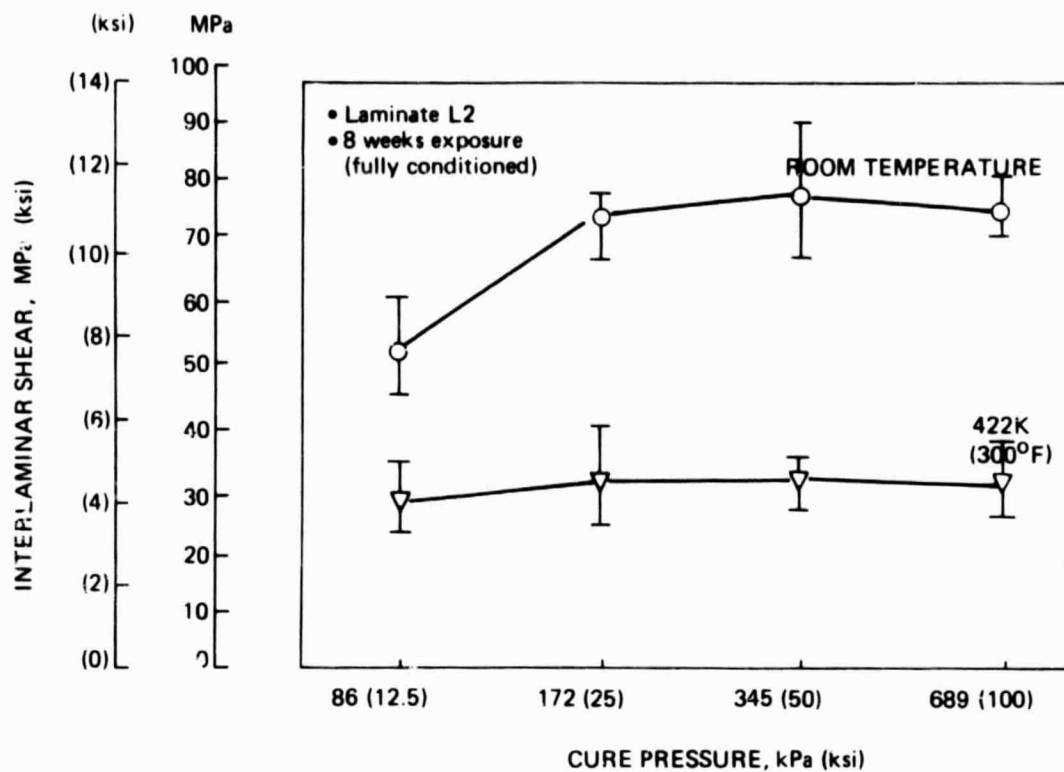


Figure 25. Influence of Cure Pressure on Laminate L2 Shear Strength

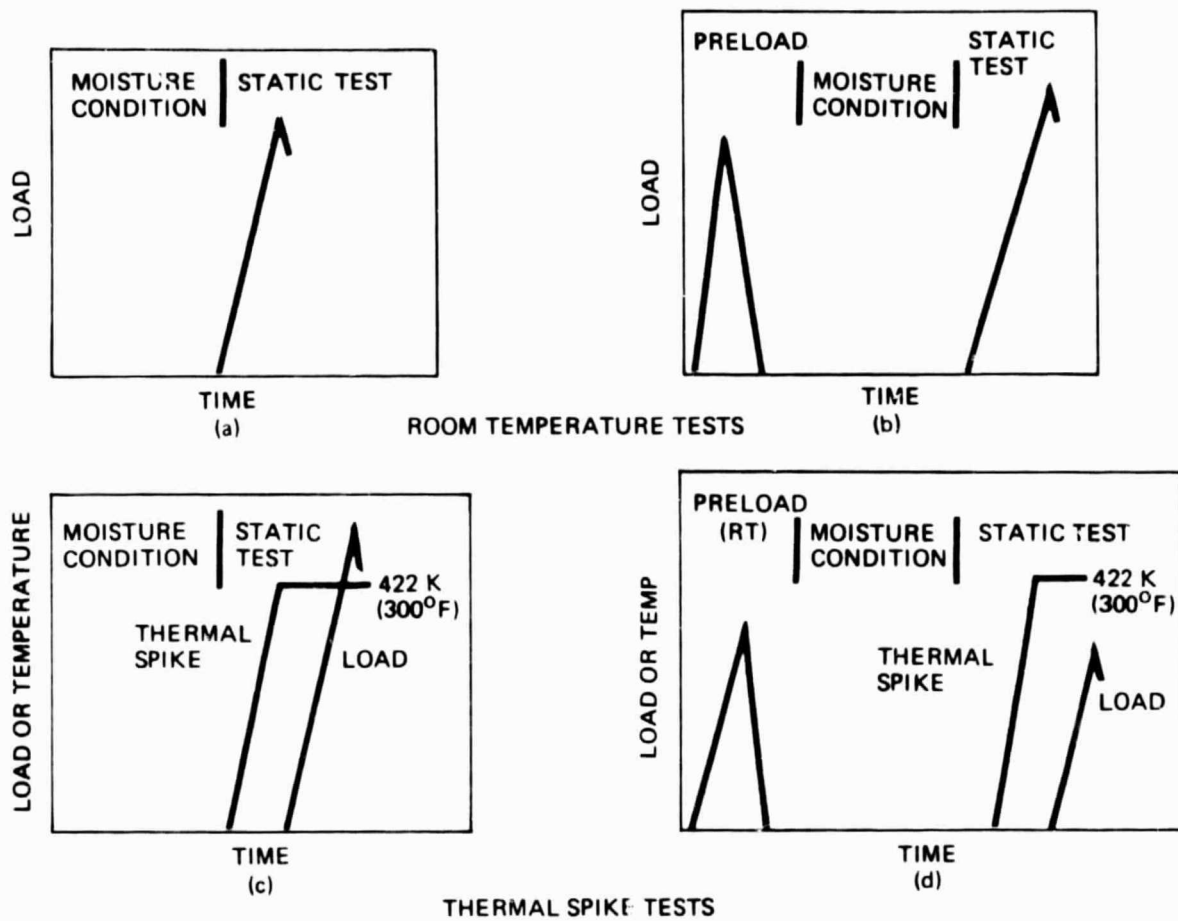


Figure 26. Static Test Load Sequences



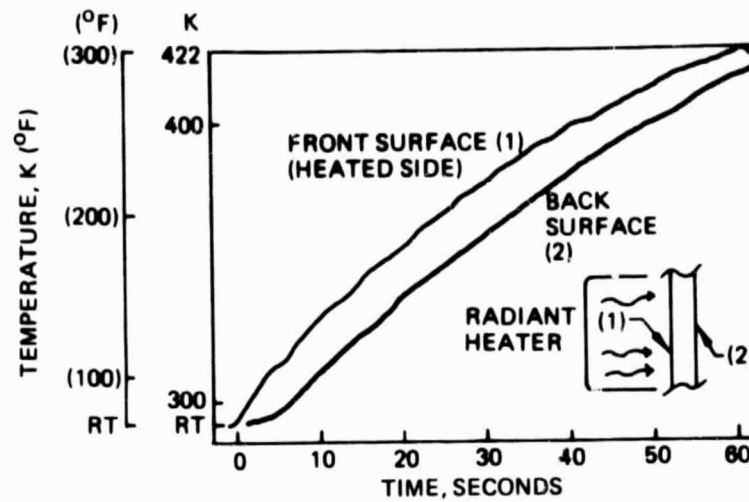


Figure 27. Front and Back Surface Temperatures for 60-Second Heatup

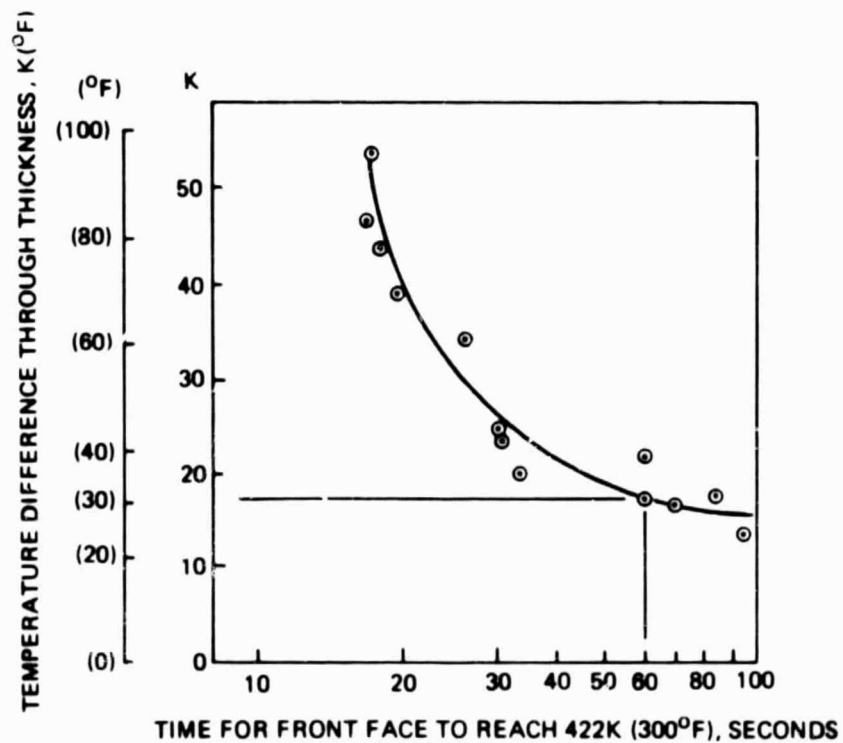


Figure 28. Through-the-Thickness Temperature Difference for Various Heating Rates

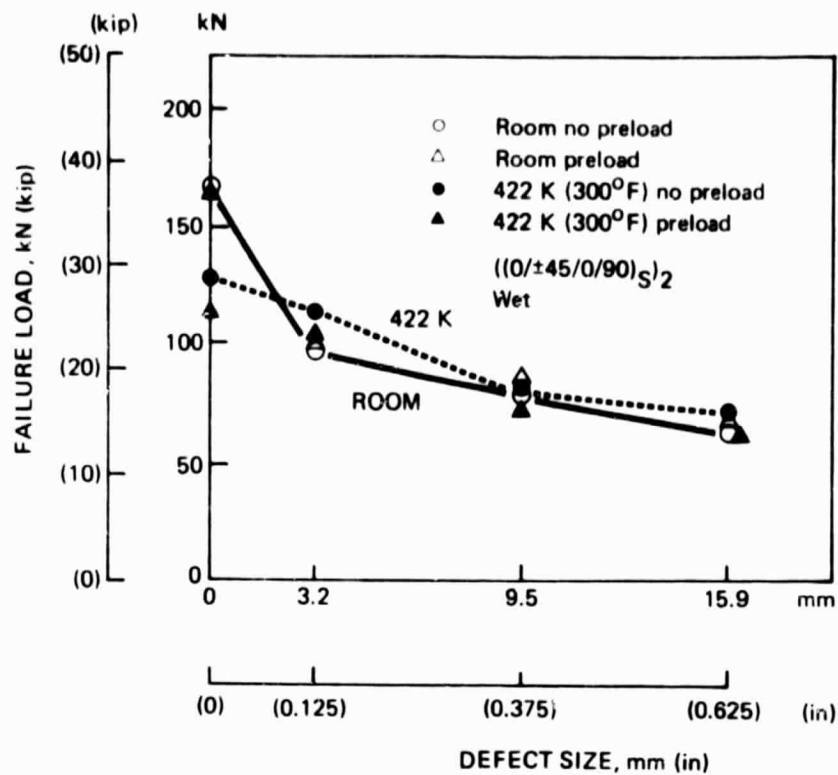


Figure 29. Laminate L1 Static Test Data (FP Slit)

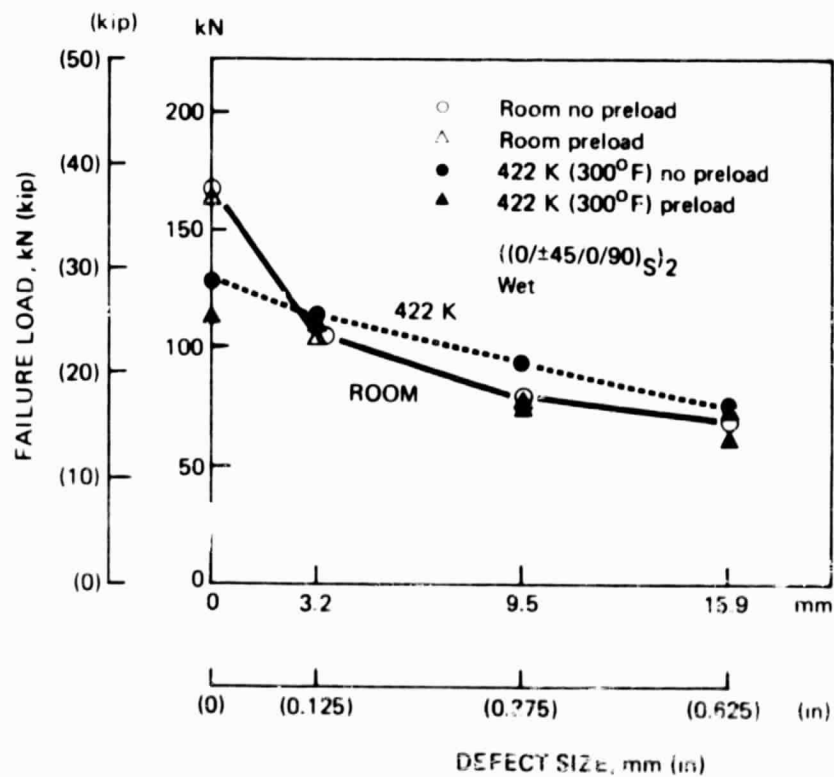


Figure 30. Laminate L1 Static Test Data (FP Hole)

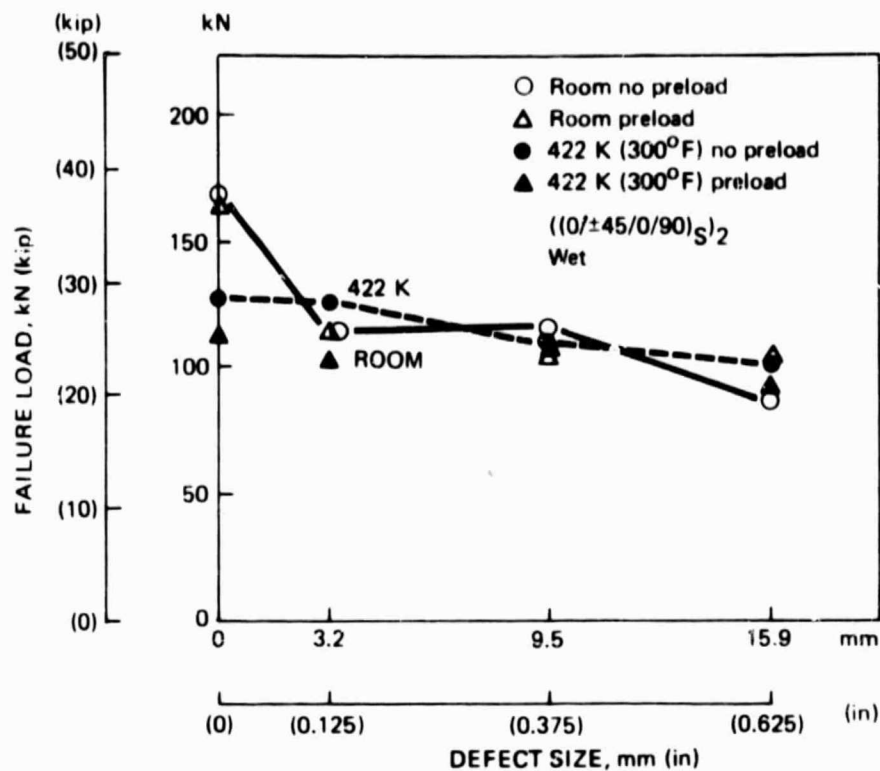


Figure 31. Laminate L1 Static Test Data (HP Slit)

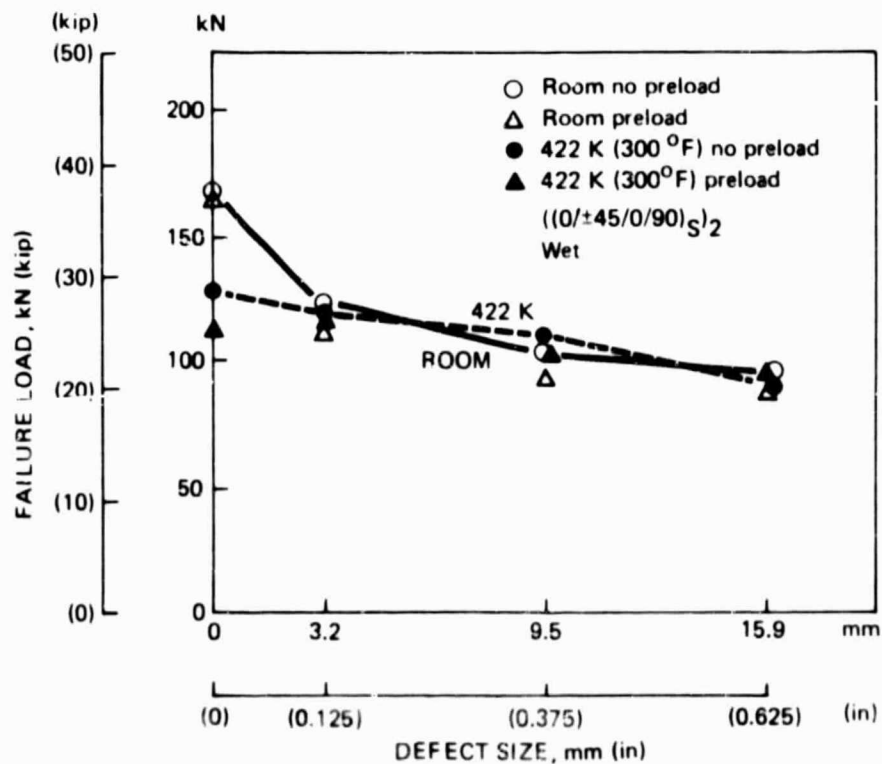


Figure 32. Laminate L1 Static Test Data (HP Hole)

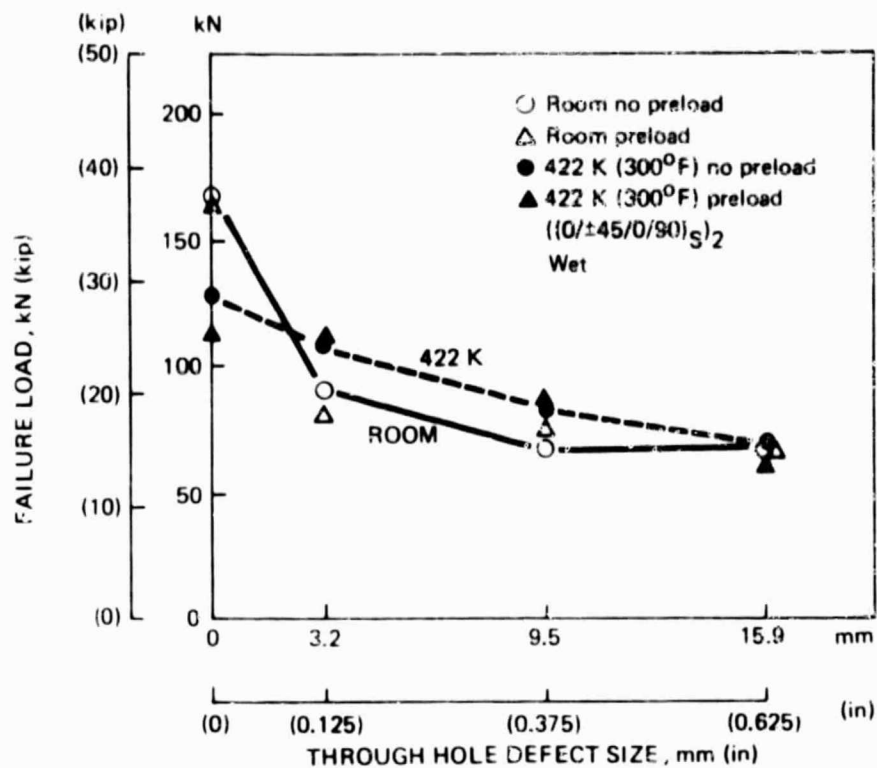


Figure 33. Laminate L1 Static Test Data (CSK Hole)

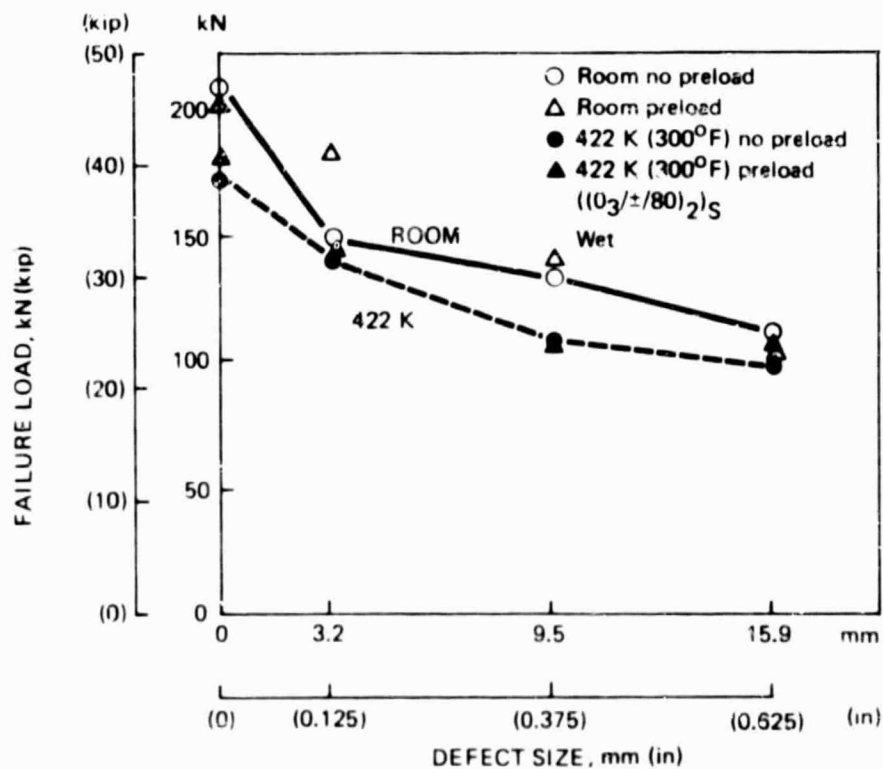


Figure 34. Laminate L2 Static Test Data (FP Slit)

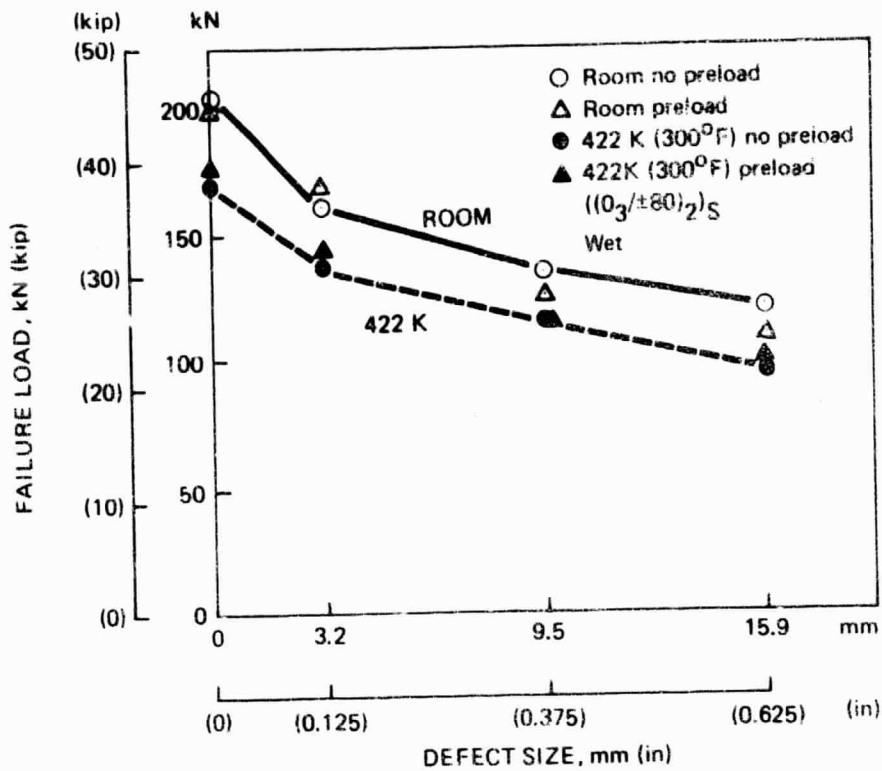


Figure 35. Laminate L2 Static Test Data (FP Hole)

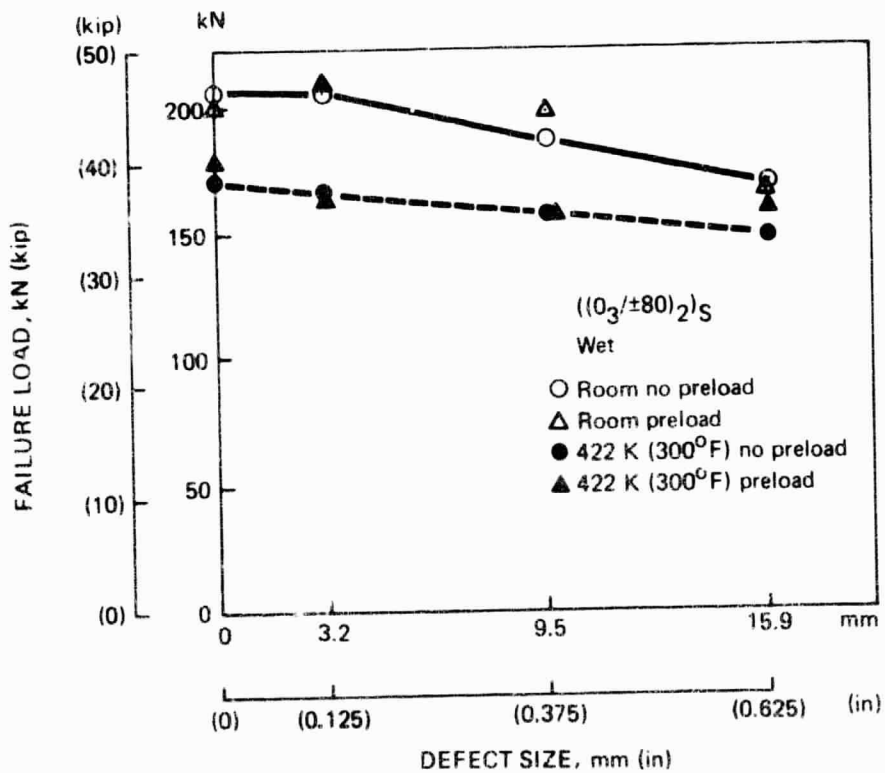


Figure 36. Laminate L2 Static Test Data (HP Slit)

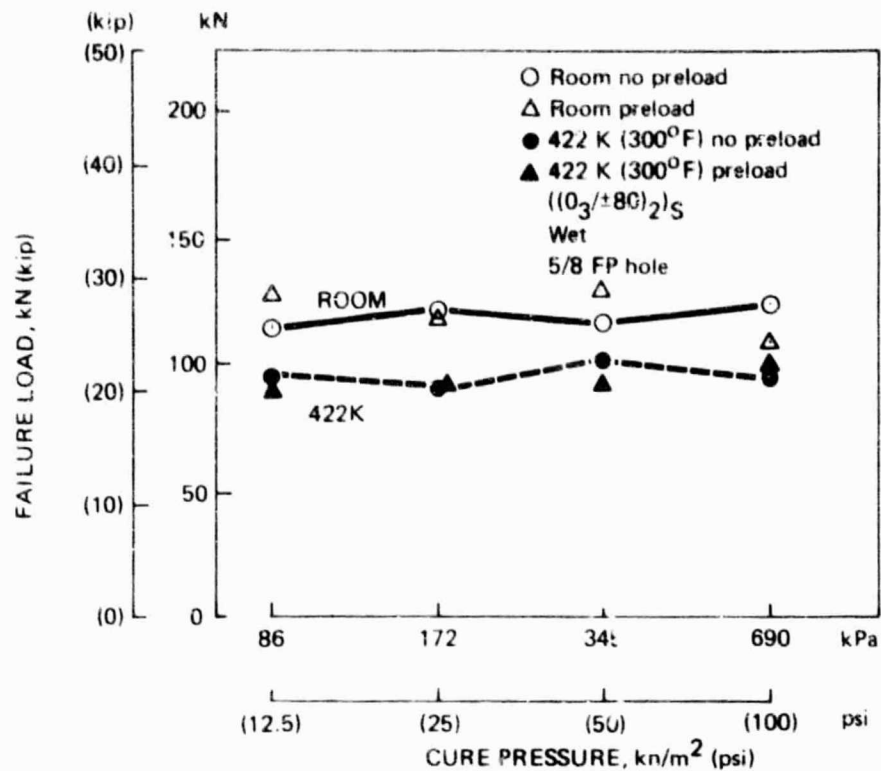


Figure 37. Laminate L2 Static Test Data (Low Cure Pressure)

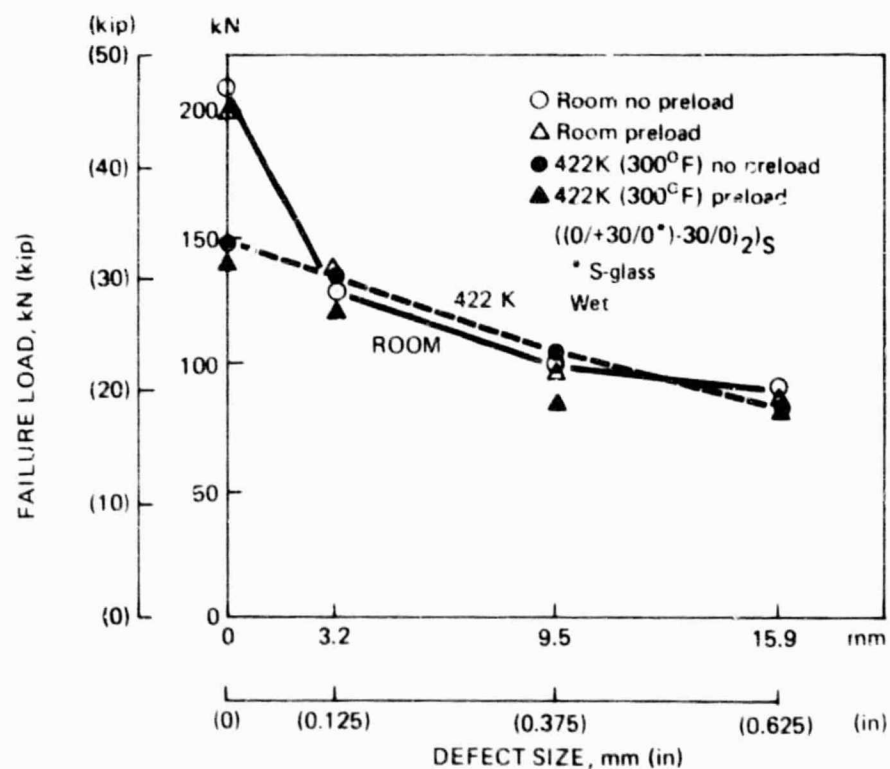


Figure 38. Laminate L3 Static Test Data (FP Slit)

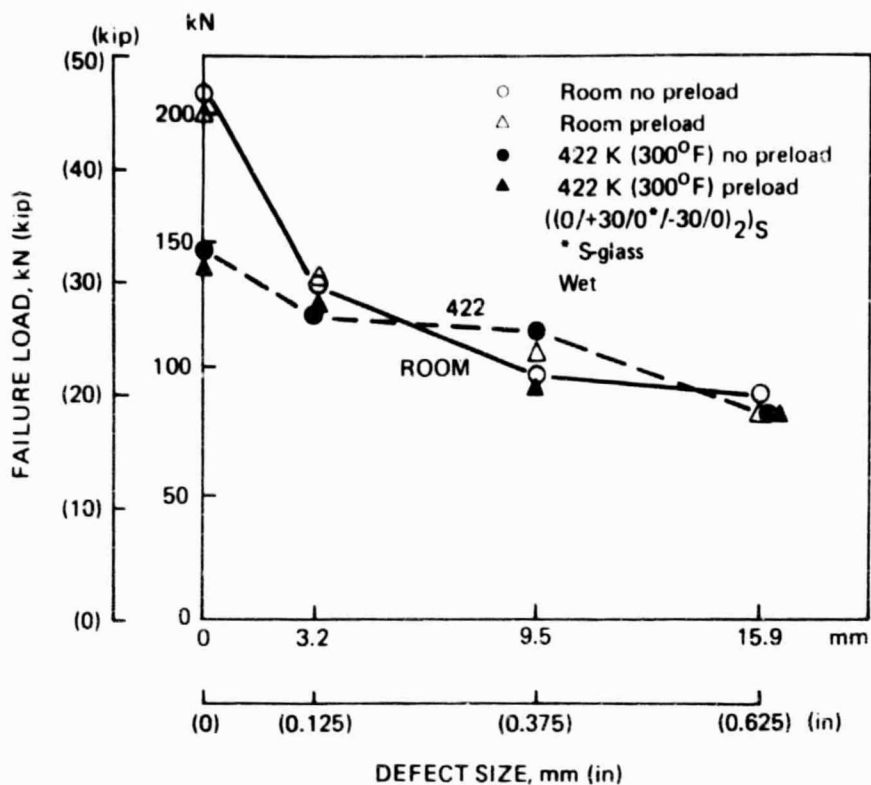


Figure 39. Laminate L3 Static Test Data (FP Hole)

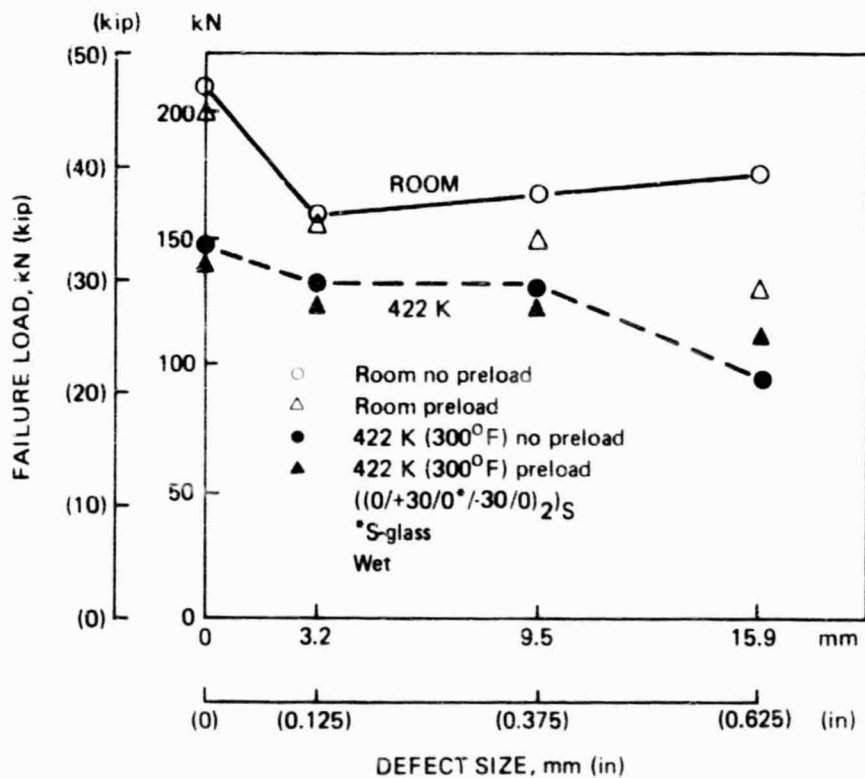


Figure 40. Laminate L3 Static Test Data (HP Slit)

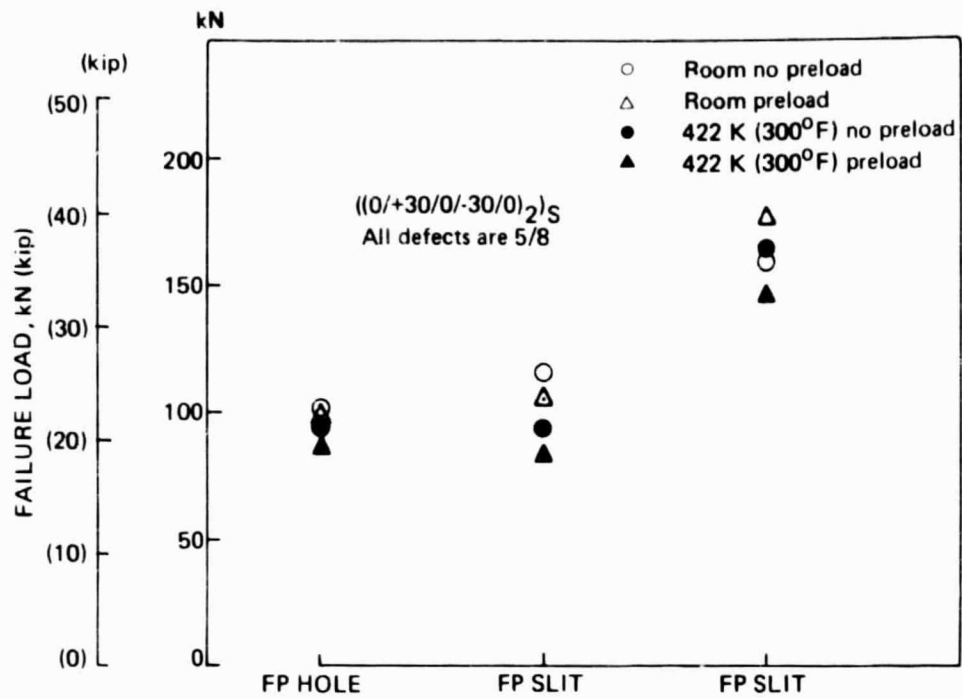


Figure 41. Laminate L3 Static Test Data (All Graphite Laminate)

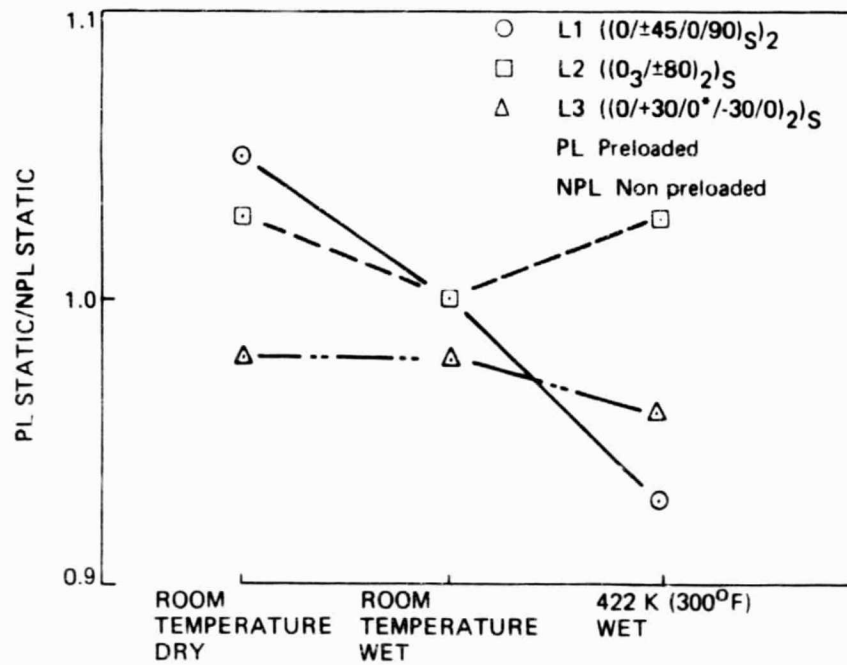


Figure 42. Average Ratio of PL to NPL Specimen Fracture Strength



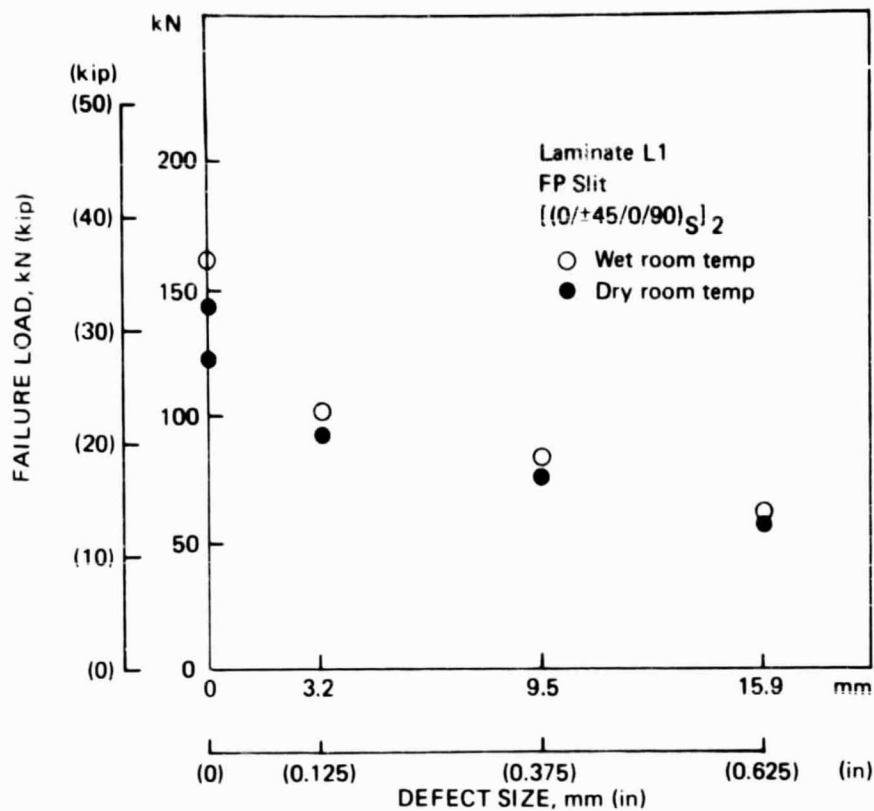


Figure 43. Effect of Moisture on Laminate L1 Fracture (FP Slit)

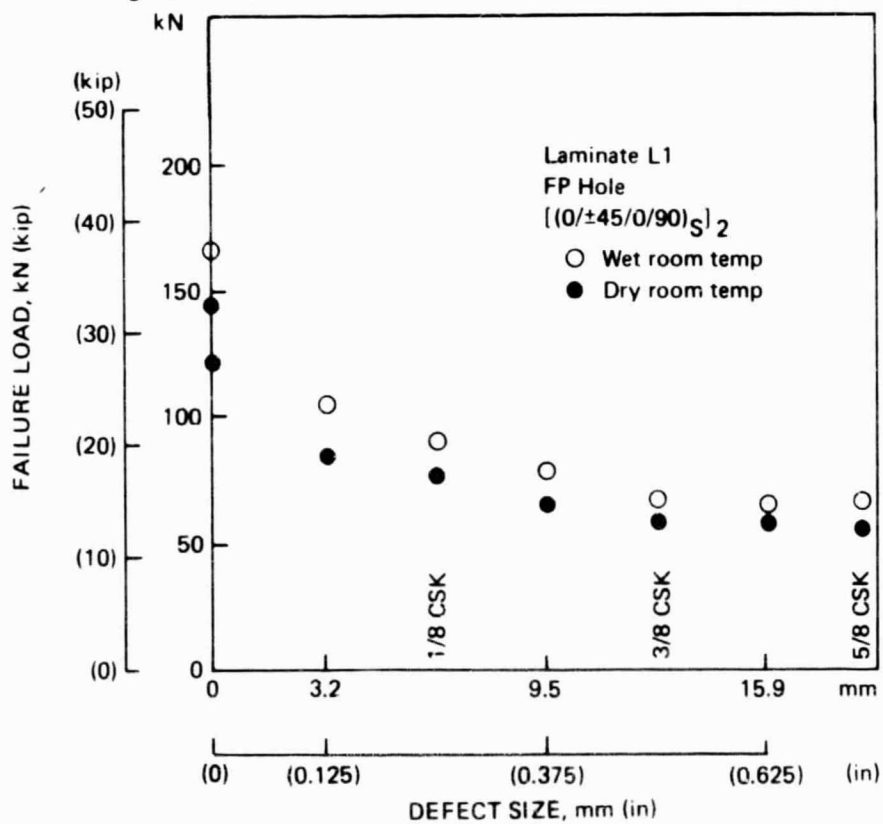


Figure 44. Effect of Moisture on Laminate L1 Fracture (FP Hole)

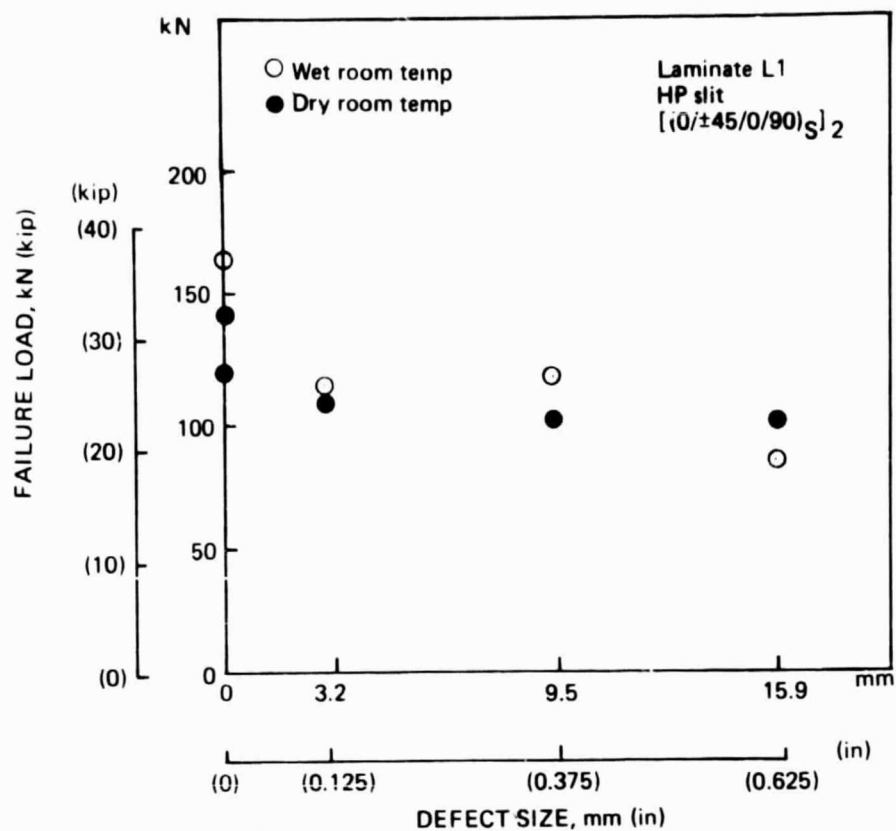


Figure 45. Effect of Moisture on Laminate L1 Fracture (HP Slit)

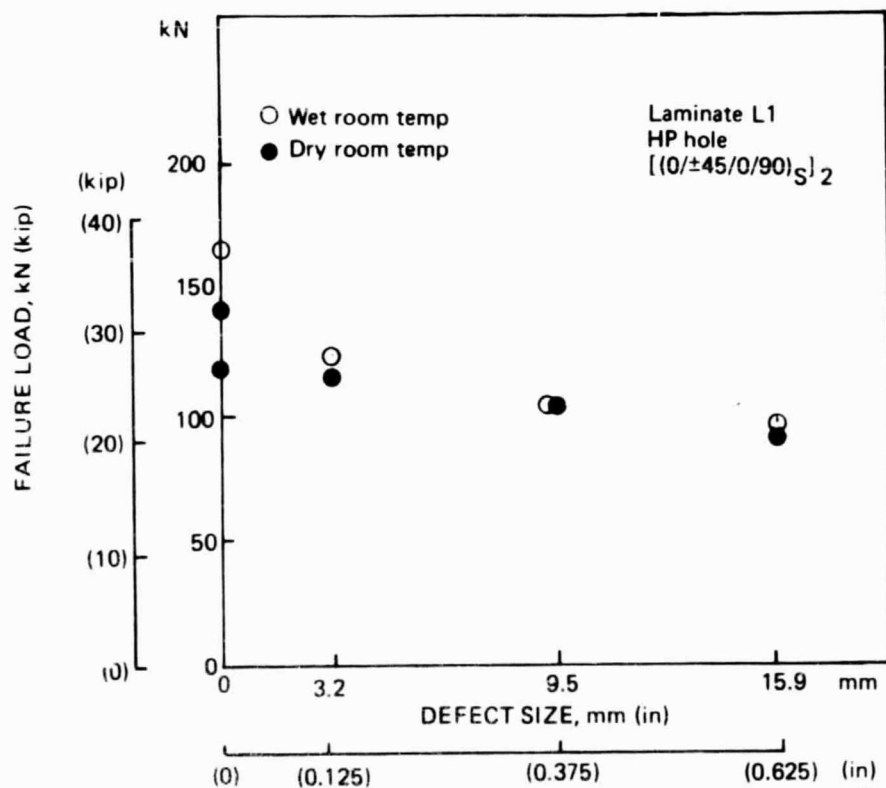


Figure 46. Effect of Moisture on Laminate L1 Fracture (HP Hole)

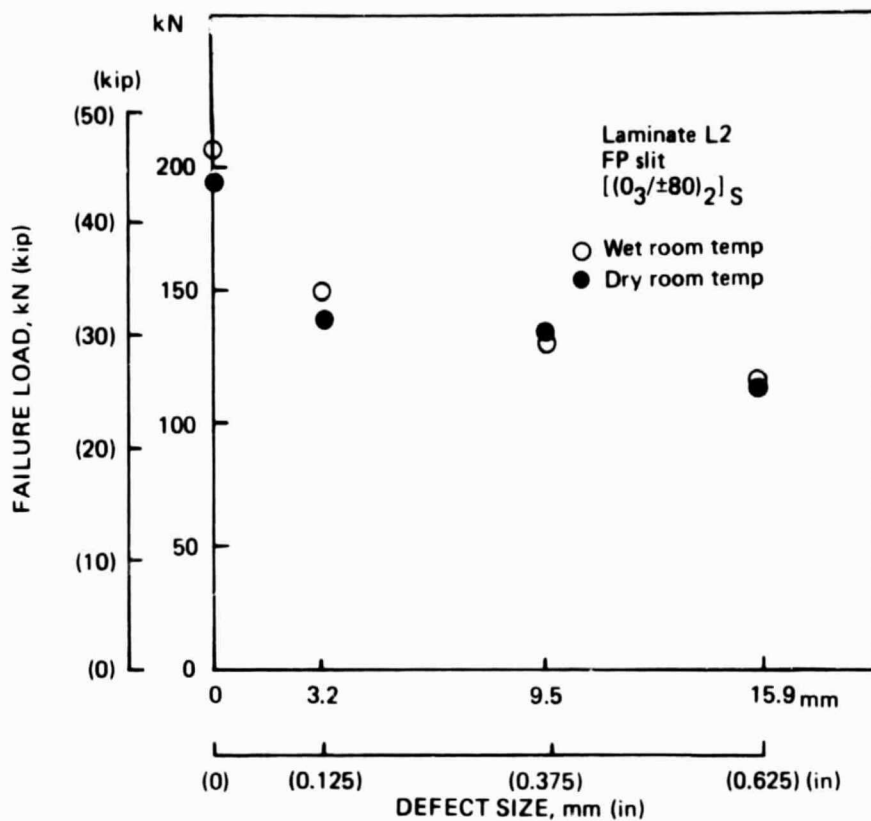


Figure 47. Effect of Moisture on Laminate L2 Fracture (FP Slit)

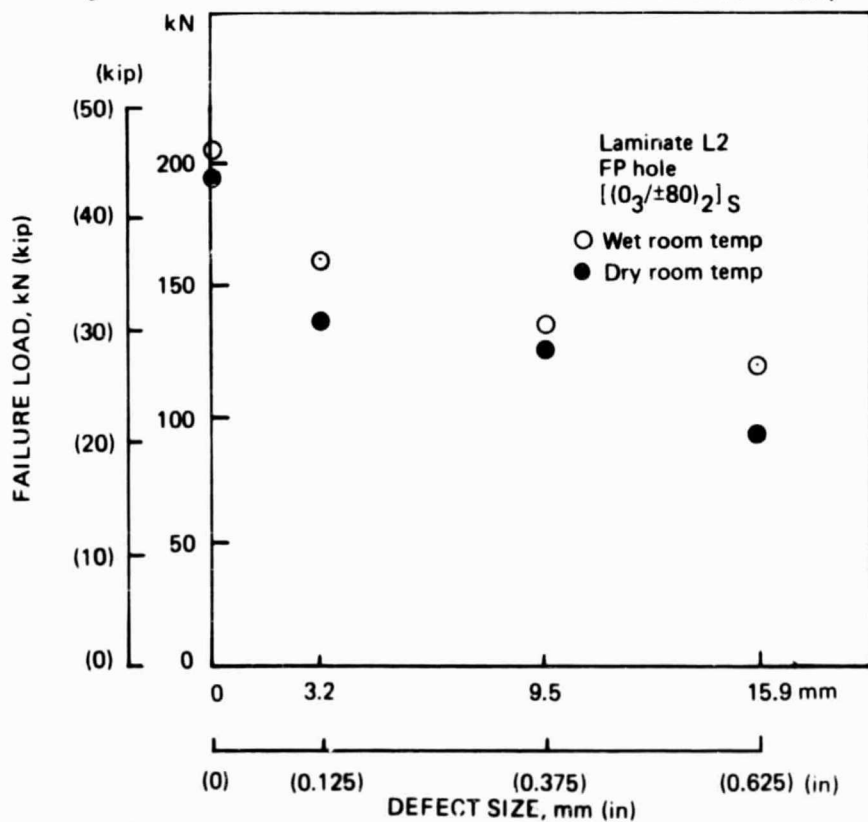


Figure 48. Effect of Moisture on Laminate L2 Fracture (FP Hole)

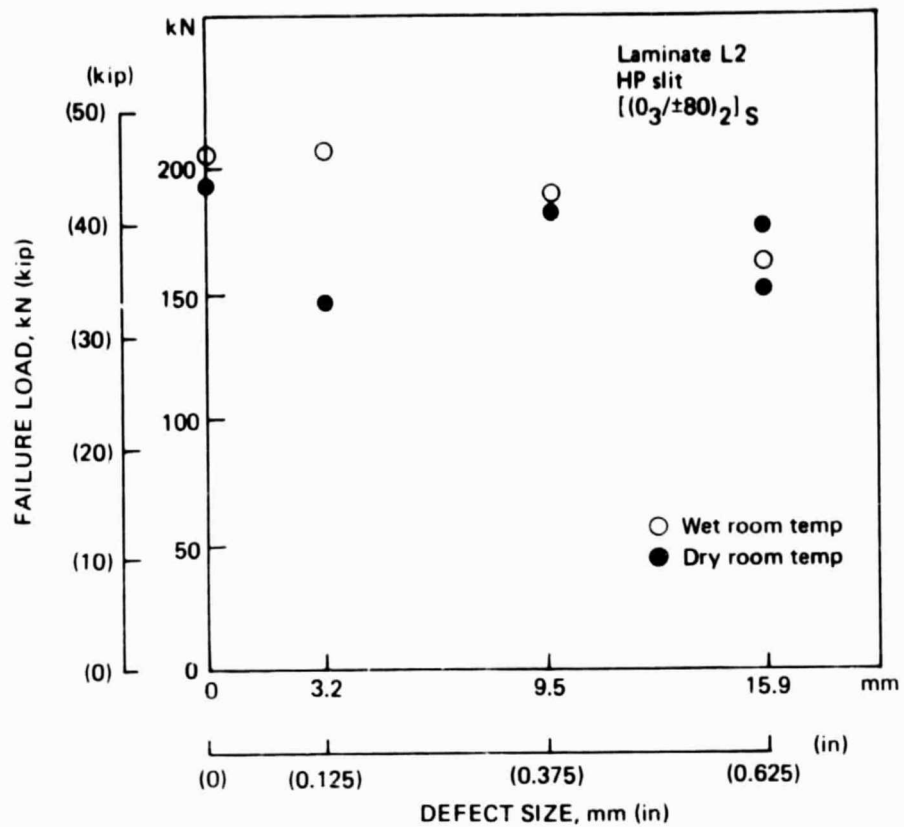


Figure 49. Effect of Moisture on Laminate L2 Fracture (HP Slit)

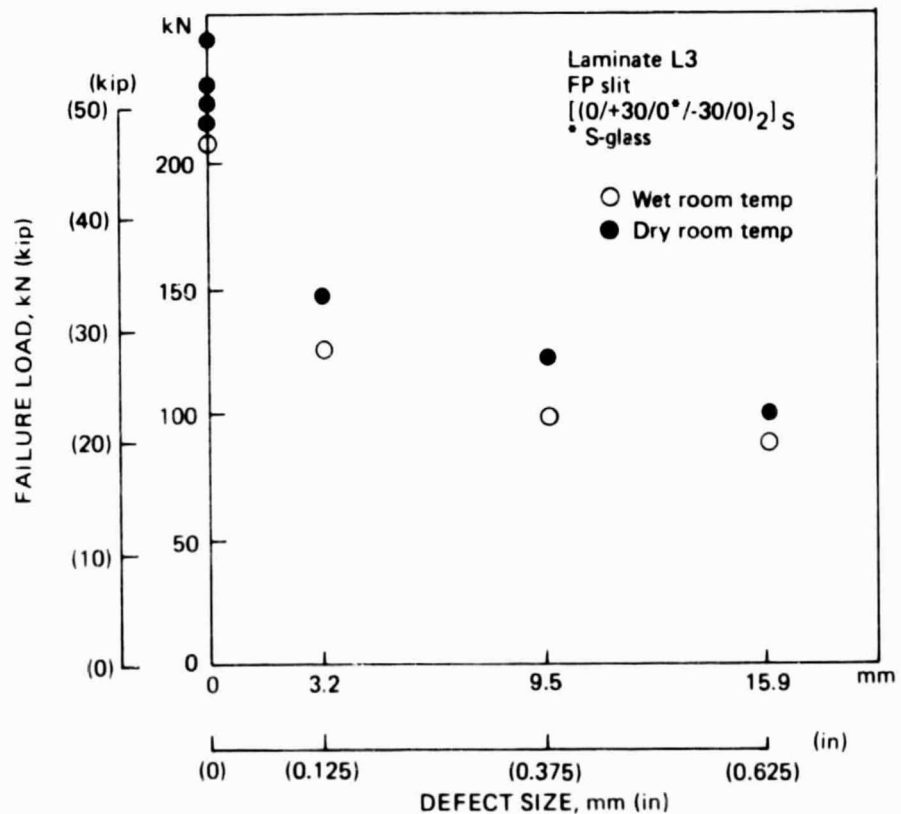


Figure 50. Effect of Moisture on Laminate L3 Fracture (FP Slit)

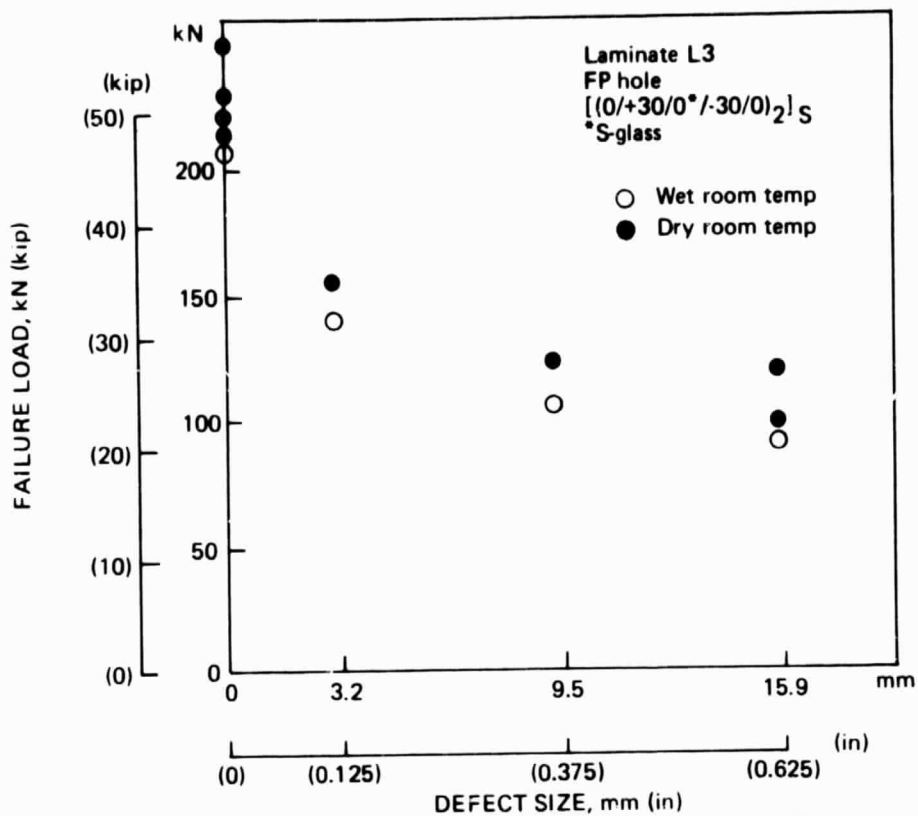


Figure 51. Effect of Moisture on Laminate L3 Fracture (FP Hole)

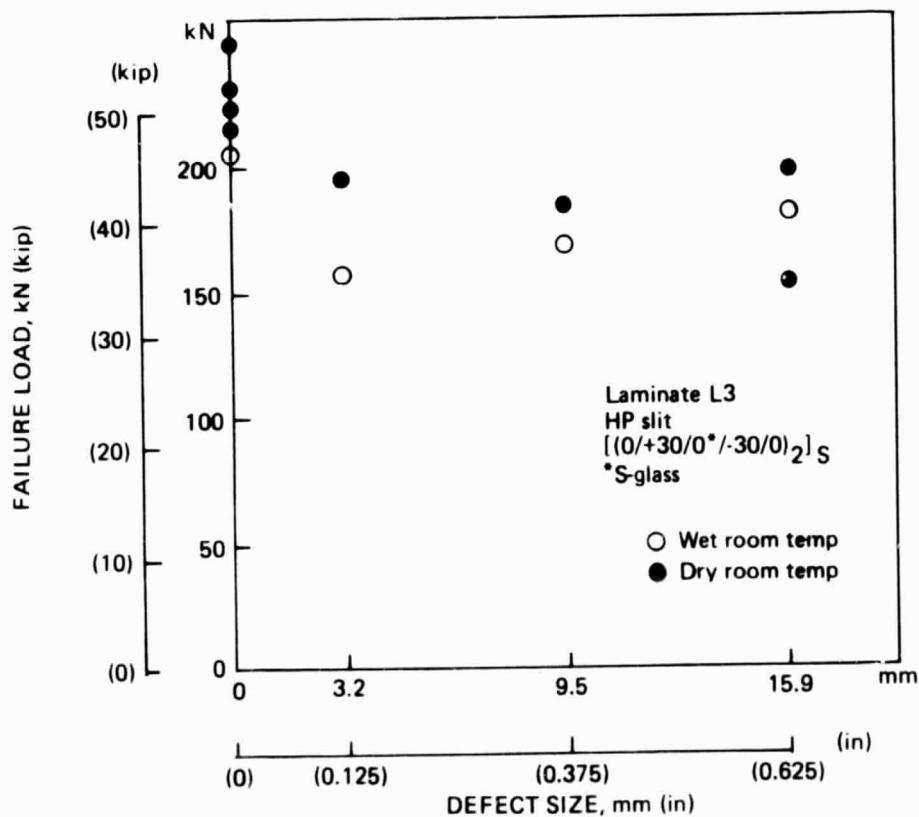


Figure 52. Effect of Moisture on Laminate L3 Fracture (HP Slit)

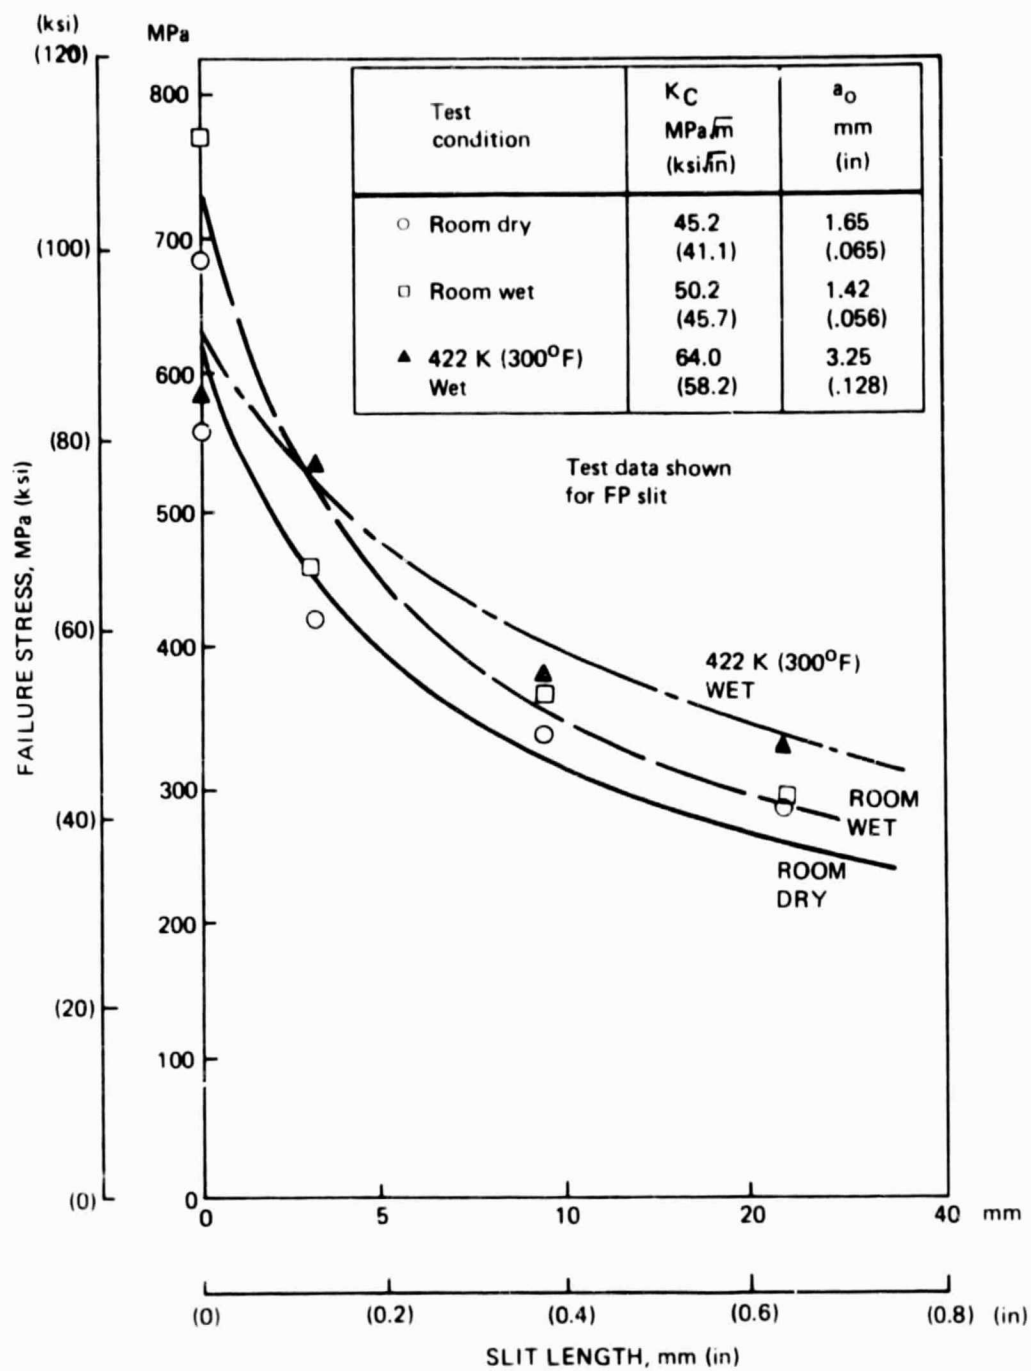


Figure 53. Comparison of Laminate L1 Fracture Data and Inherent Flaw Analysis

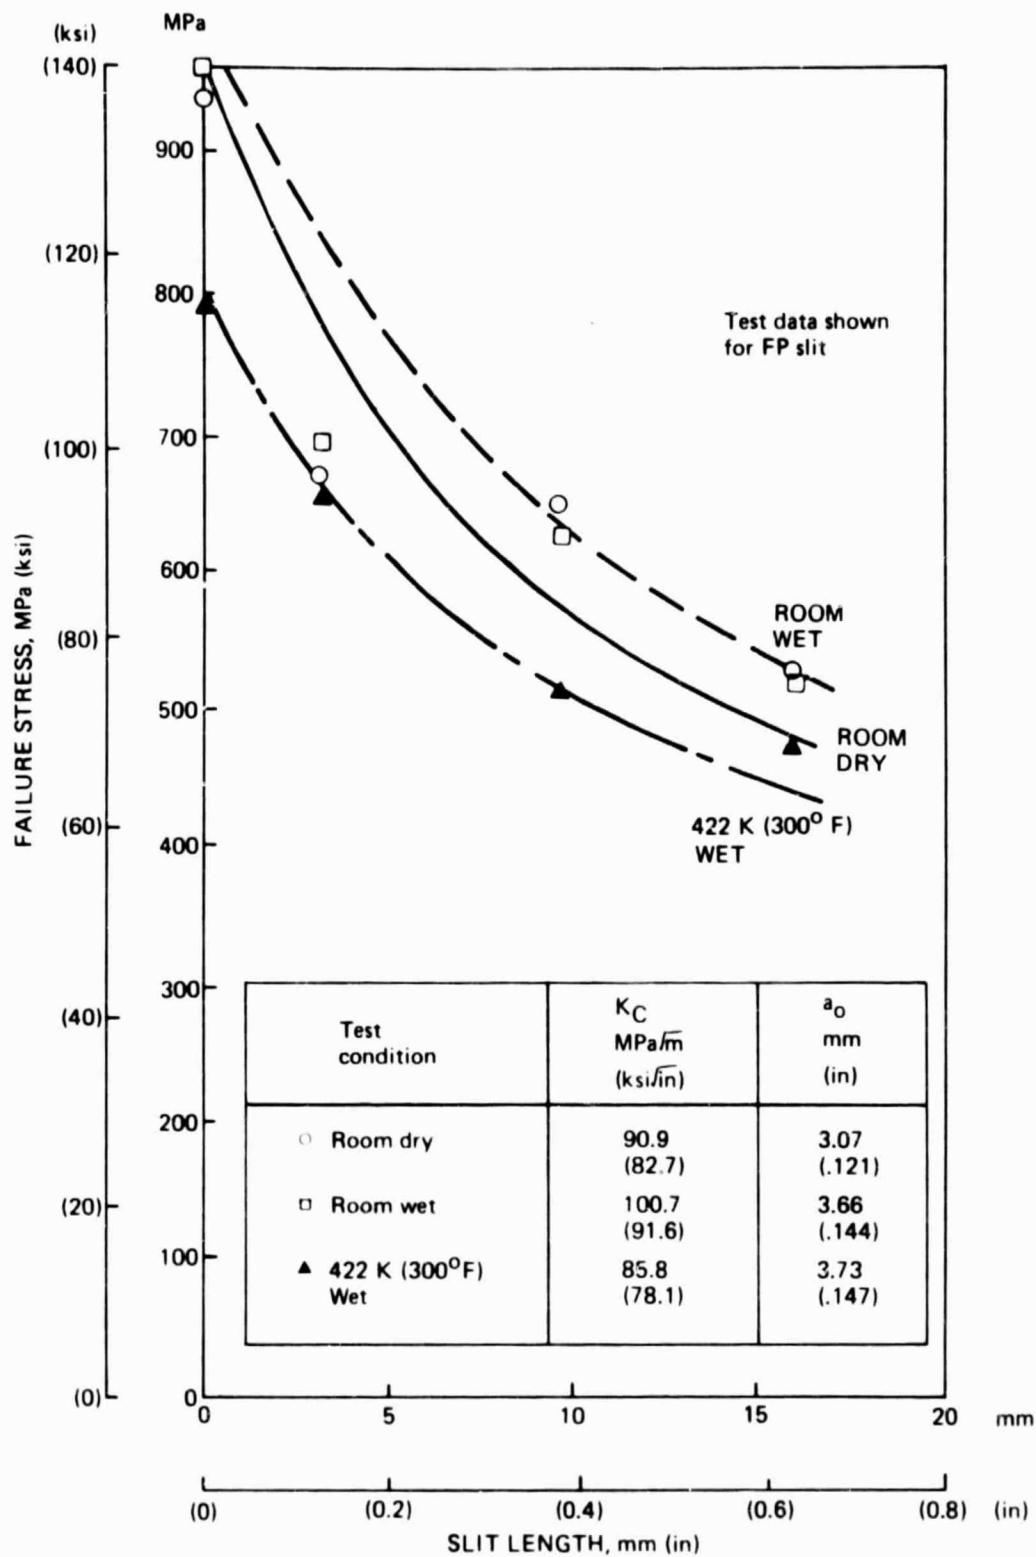


Figure 54. Comparison of Laminate L2 Fracture Data and Inherent Flaw Analysis

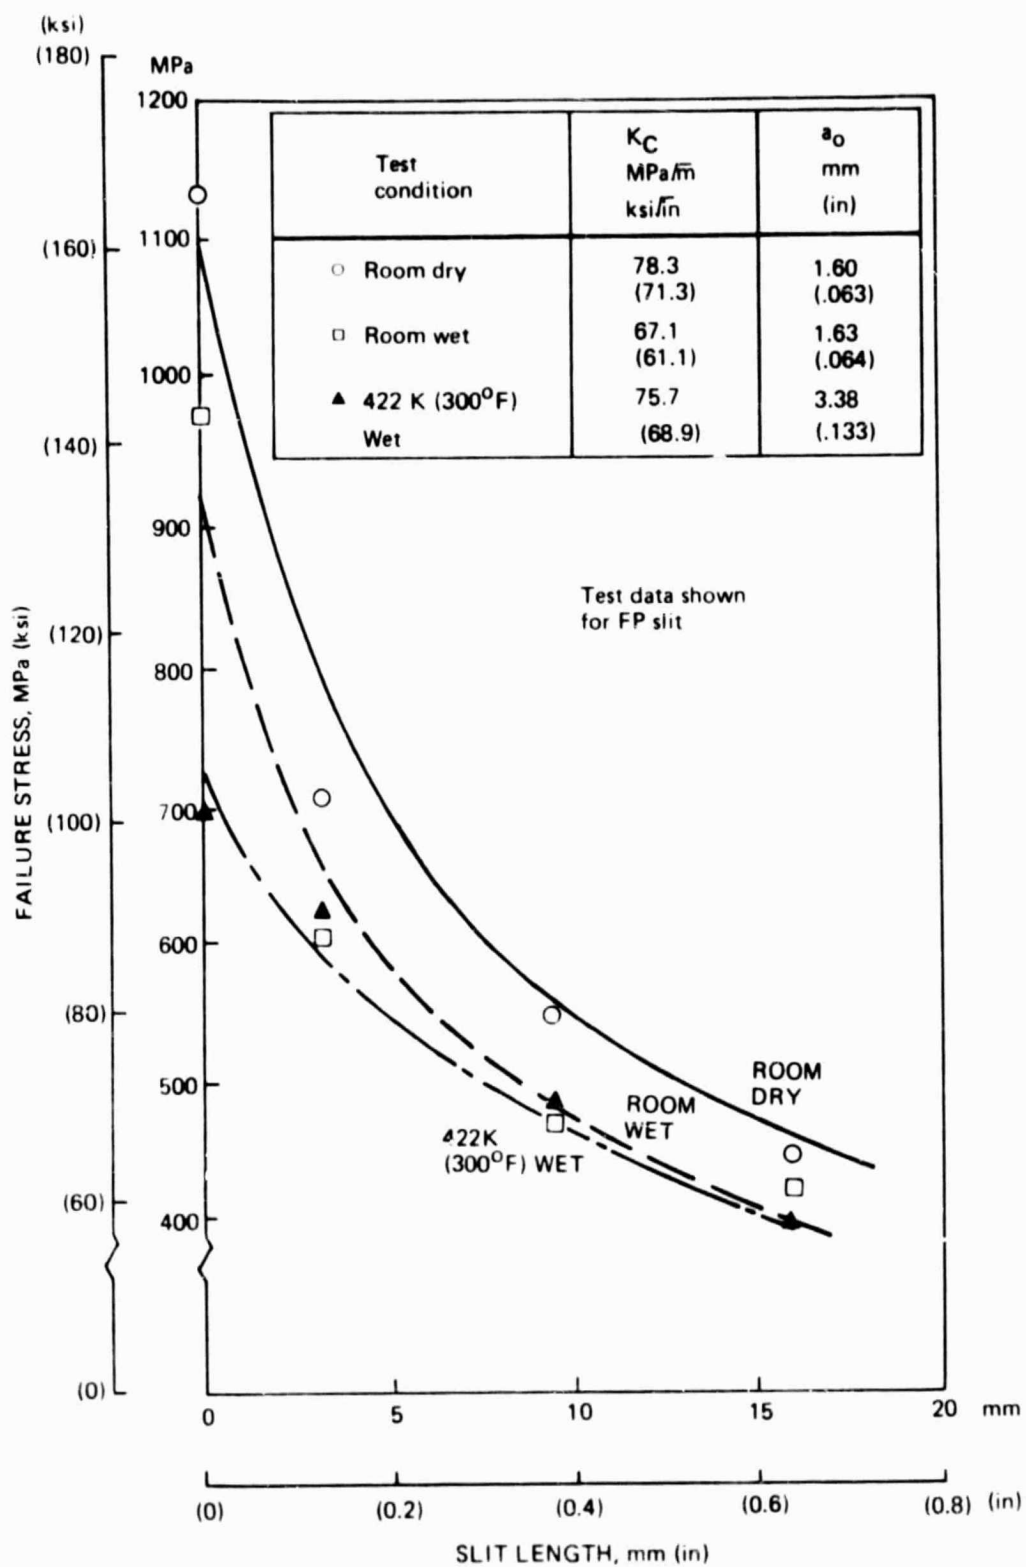


Figure 55. Comparison of Laminate L3 Fracture Data and Inherent Flaw Analysis



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1



L1-21-32

L2



L2-21-28

L3



L3-21-12

5/8 FP SLIT

LAMINATE L1



L1-21-66

L2



L2-21-32

5/8 HP SLIT

L3



L3-21-32

Figure 56. Typical C-Scan Damage in Preloaded Test Specimens

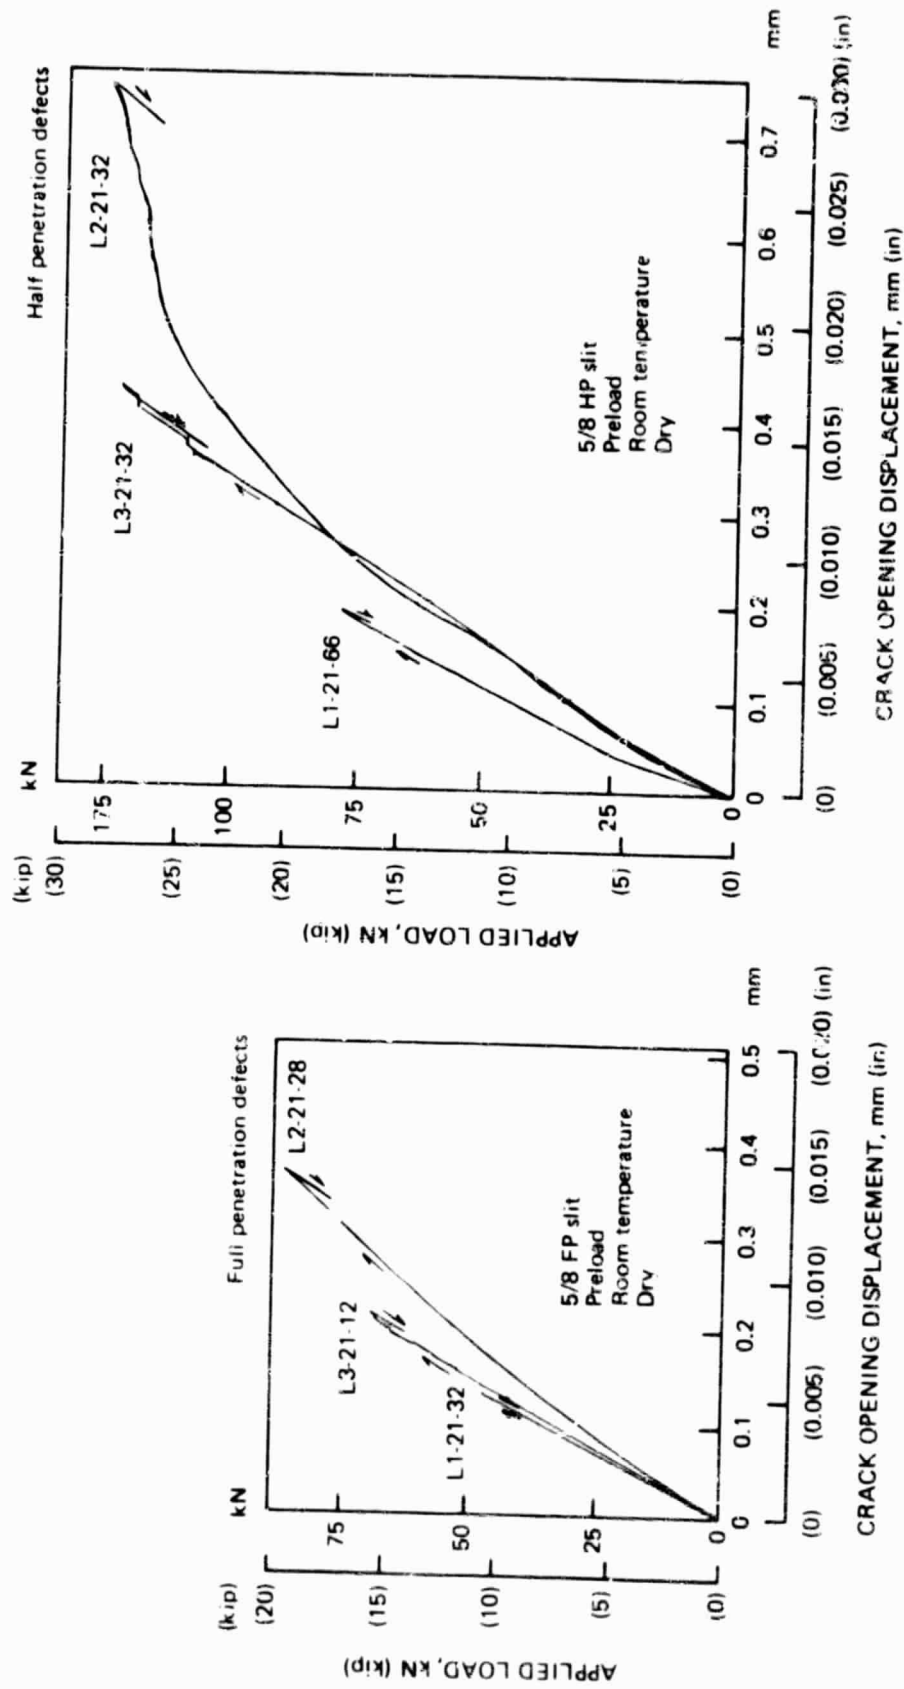


Figure 57. Typical Crack Opening Displacement Records for Preloaded Test Specimens


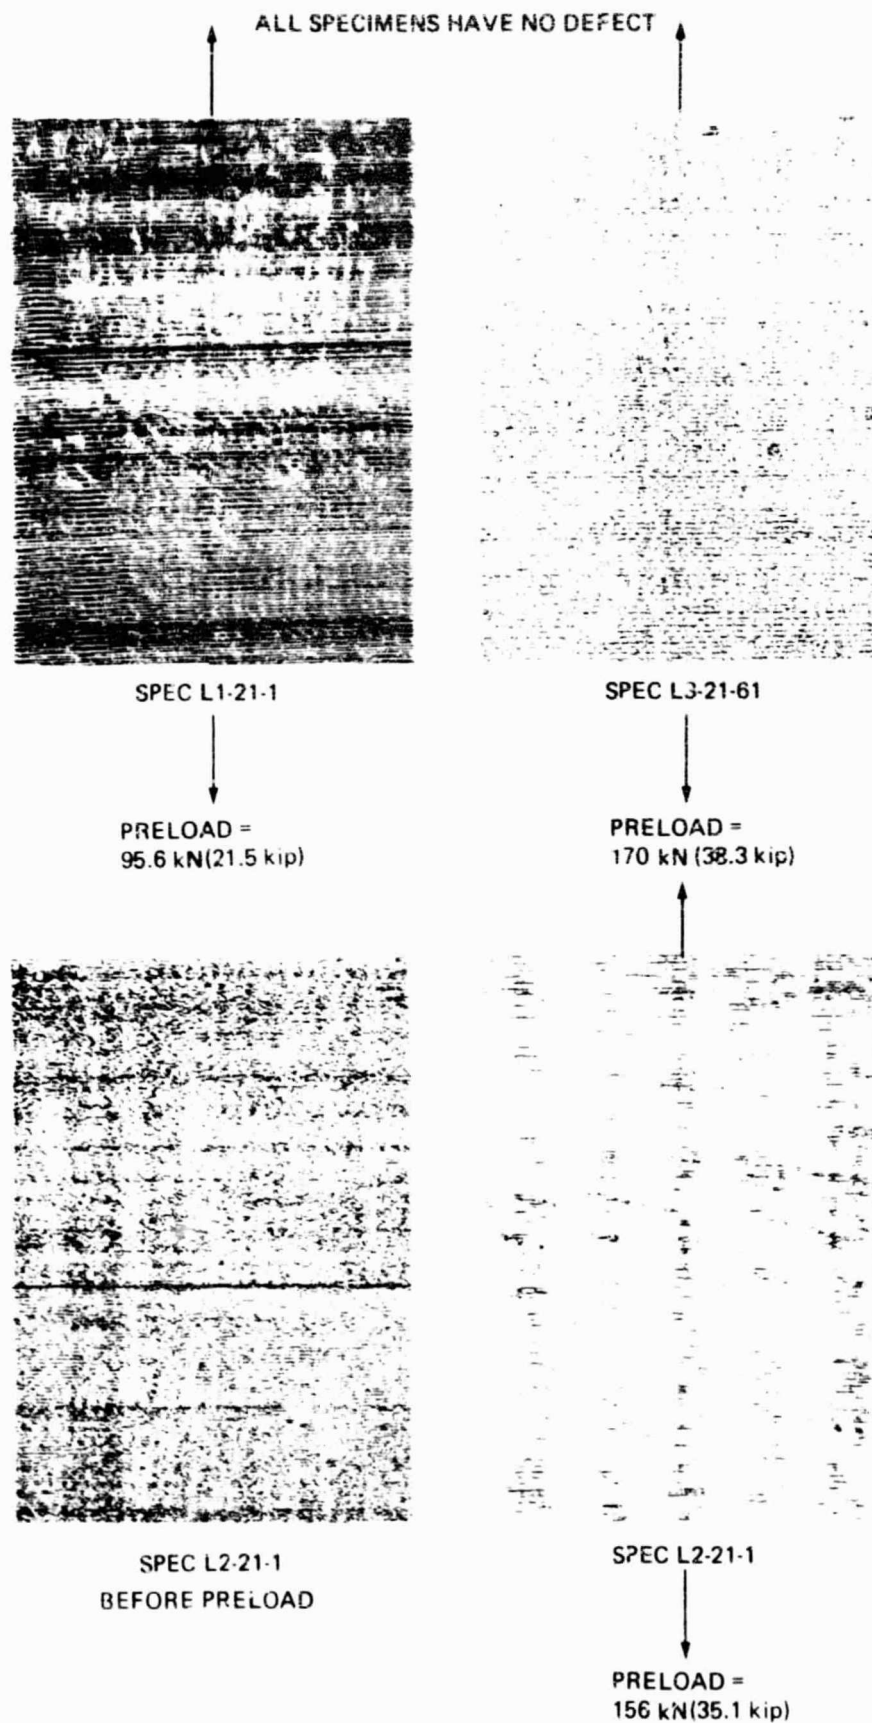


Figure 58. Effect of Preload on C-Scan Damage in Unnotched Laminates

SPEC L2-21-1

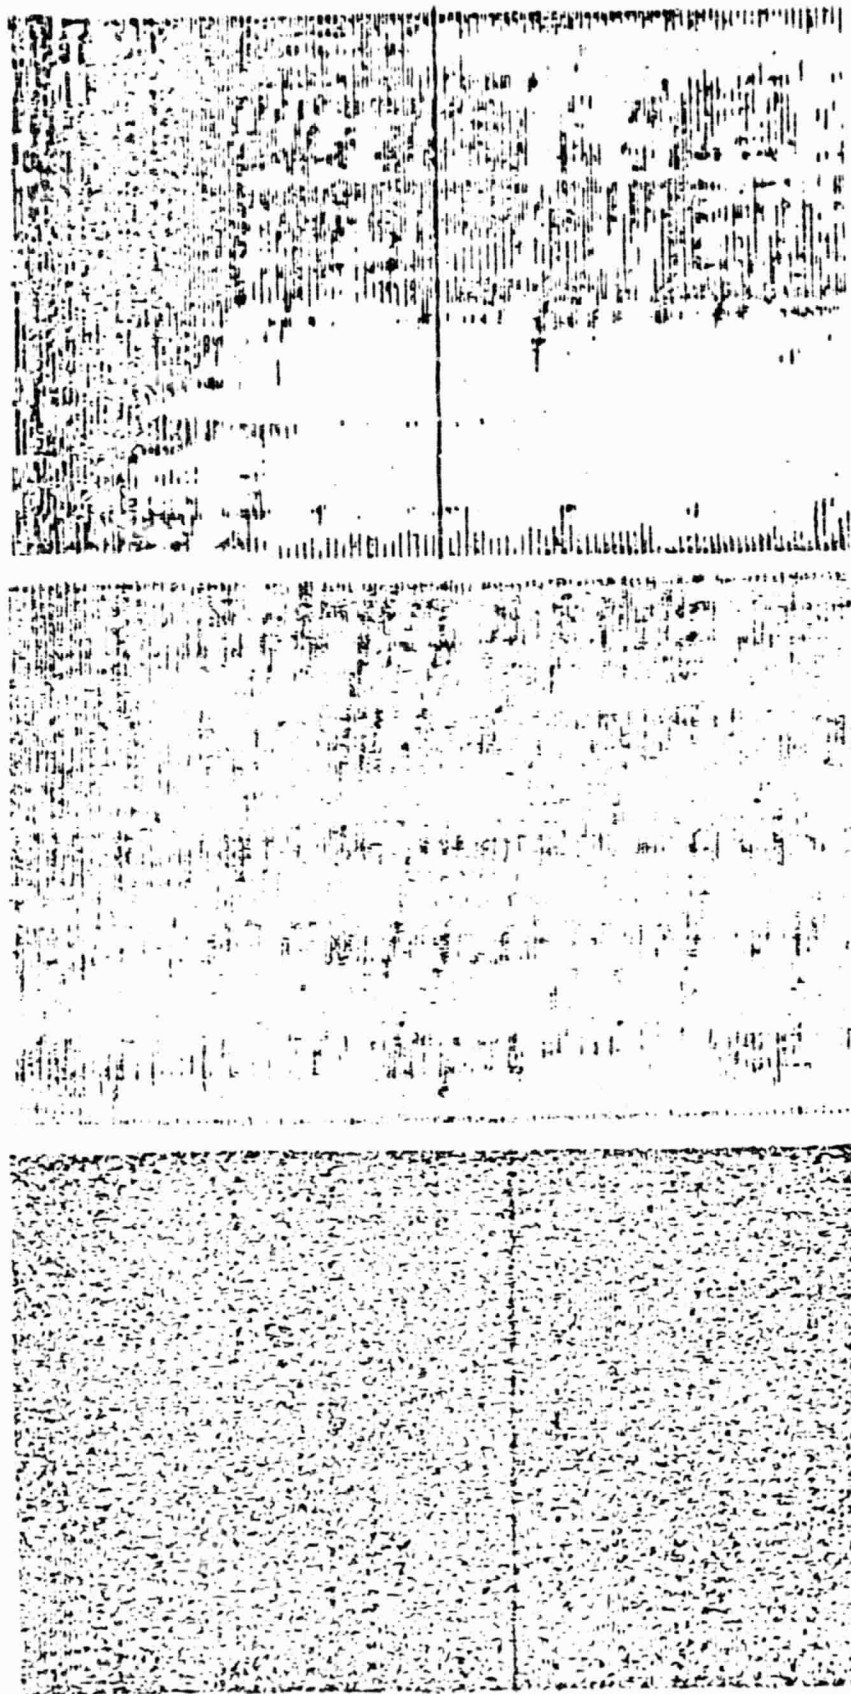


BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE  
CONDITIONING


Figure 59. Ultrasonic C-Scan Records for Unnotched Laminate L2 Specimen

ALL SPECIMENS HAVE 5/8 INCH FULL PENETRATION HOLE

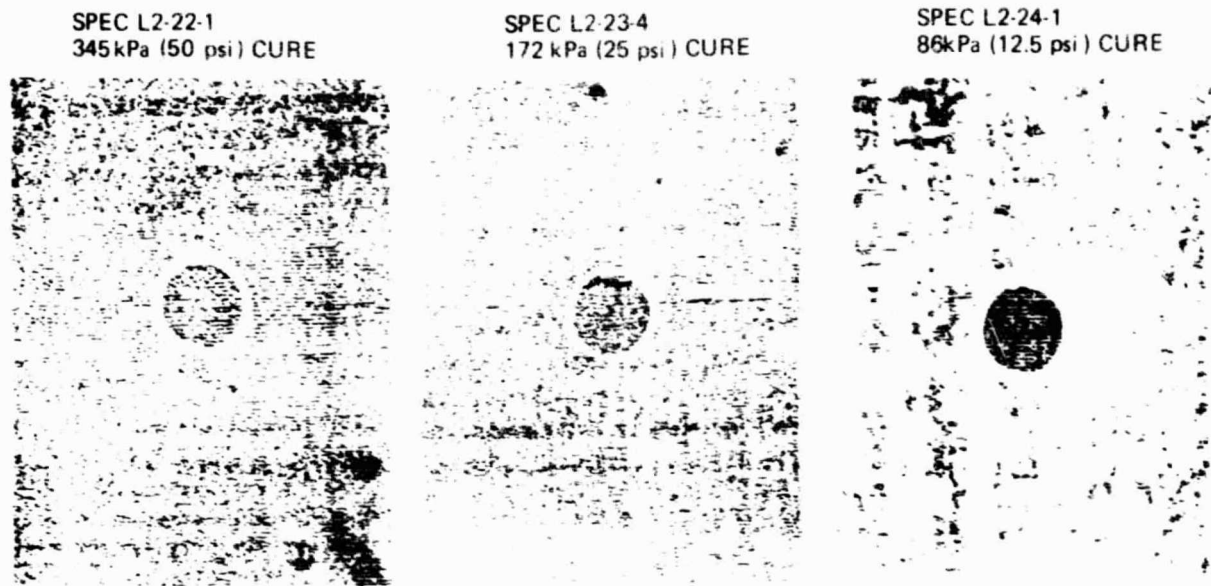

BEFORE PRELOAD

Figure 60. Effect of Autoclave Pressure on C-Scan Record

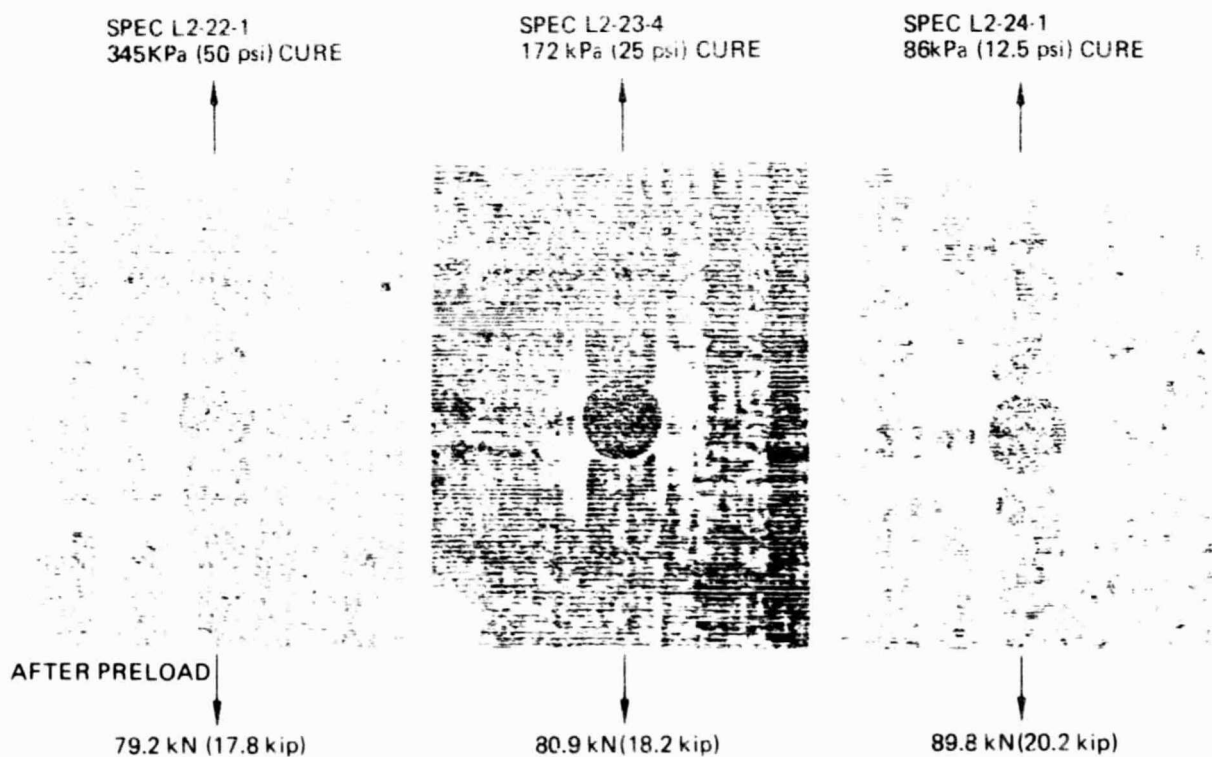

AFTER PRELOAD

79.2 kN (17.8 kip)

80.9 kN (18.2 kip)

89.8 kN (20.2 kip)

Figure 61. Effect of Autoclave Pressure and Preload on C-Scan Record


SPEC L2-22-1  
345 kPa (50 psi) CURE



SPEC L2-23-4  
172 kPa (25 psi) CURE



SPEC L2-24-1  
86 kPa (12.5 psi) CURE

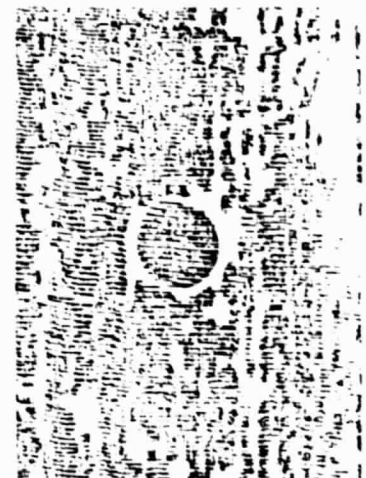

AFTER PRELOAD AND MOISTURE CONDITIONING

*Figure 62. Effect of Autoclave Pressure, Preload and Moisture on C-Scan Record*

ORIGINAL PAGE IS  
OF POOR QUALITY

● Test at —

- Room temperature and 422K (300°F)
- Wet and dry


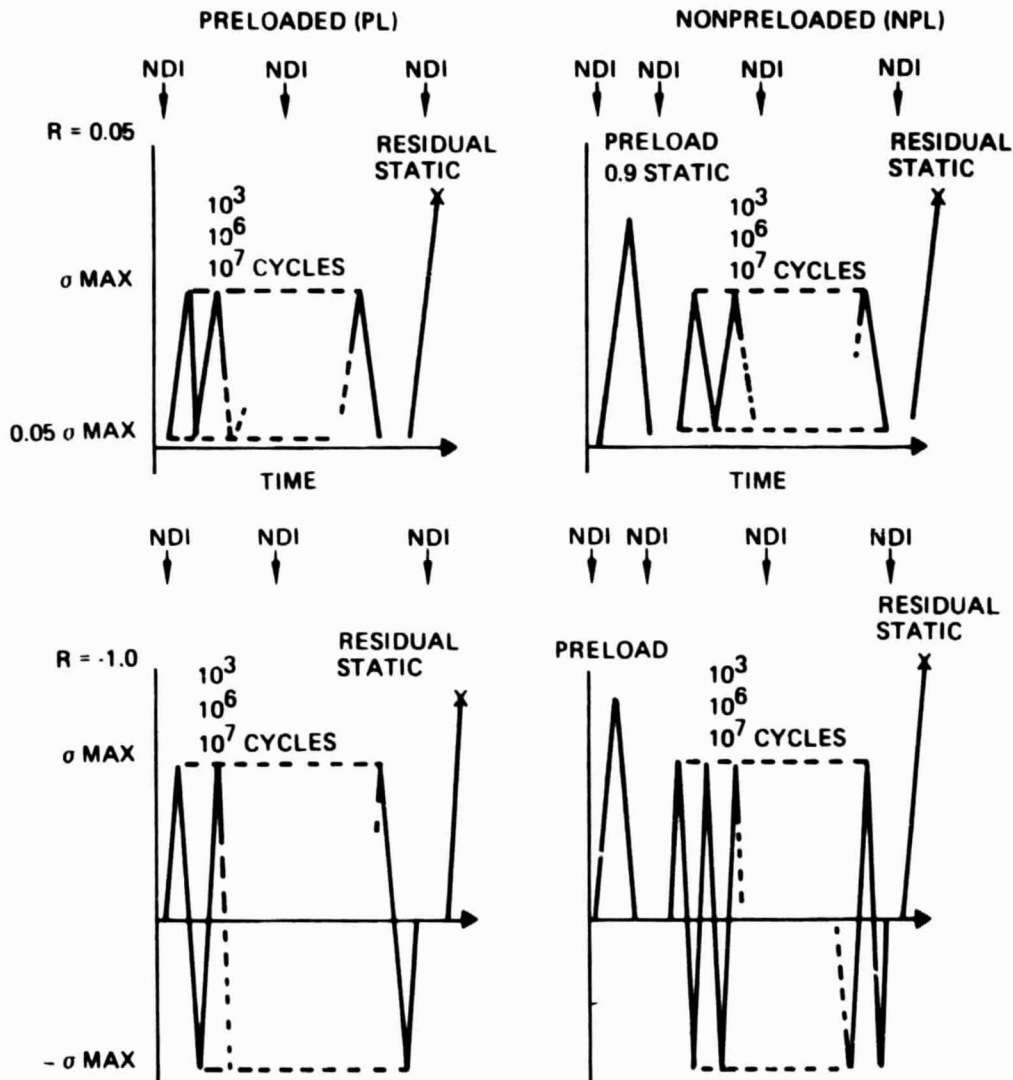


Figure 63. Environmental Cyclic Test Loading Patterns



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

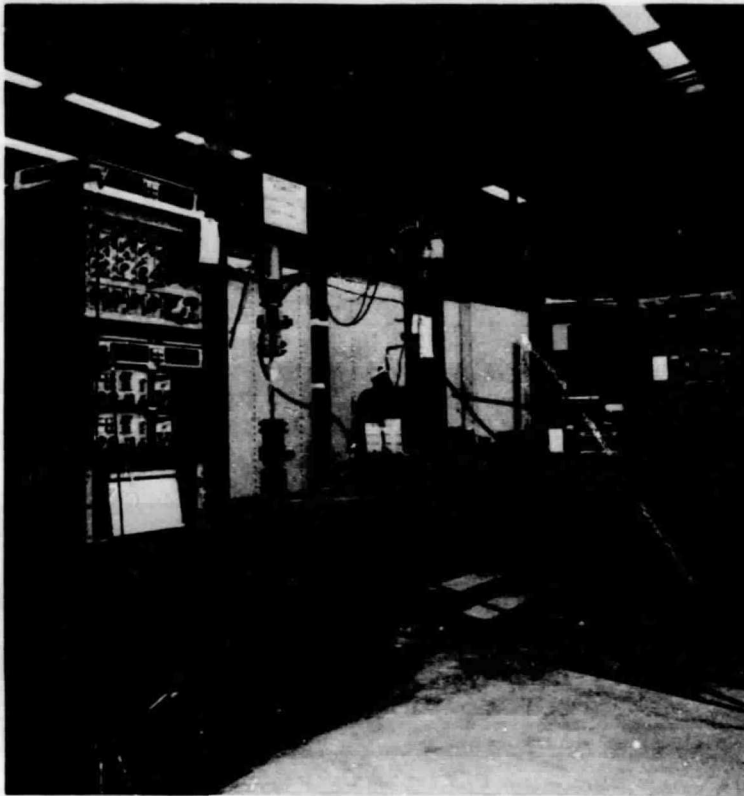

TEMPERATURE CONTROL  
AND MONITORING  
INSTRUMENTATION

30-kip FRAME (HOT,  
DRY TEST IN PROGRESS)

AMETEK 30-kip FRAME  
(ROOM TEMP, WET TEST  
IN PROGRESS)

TEST CONTROL  
AND MONITORING  
INSTRUMENTATION  
(LOAD, COD)

*Figure 64. Environmental Cyclic Test Setup*



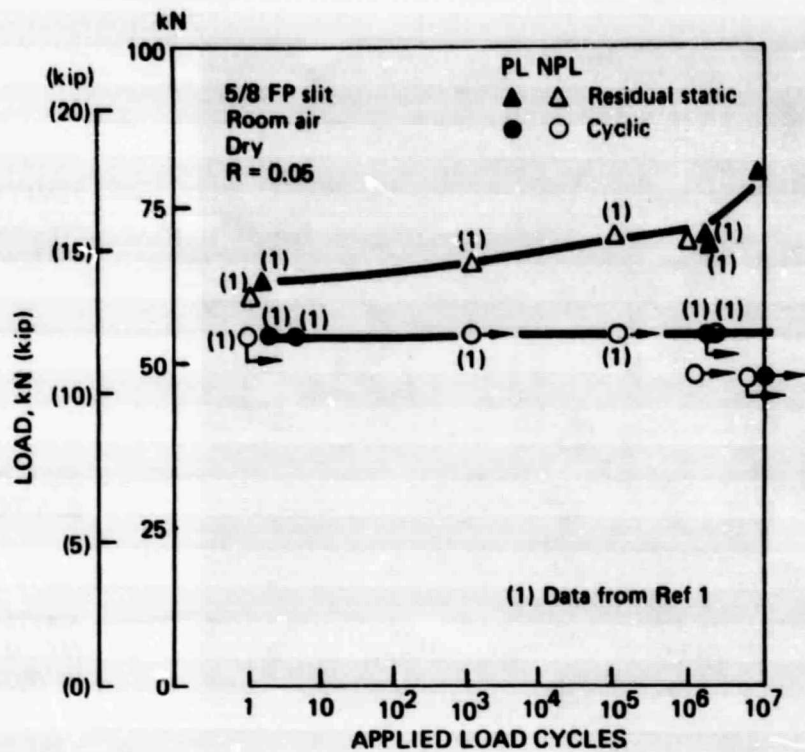


Figure 65. Room Temperature Dry Tension/Tension Tests (5/8 FP Slit)

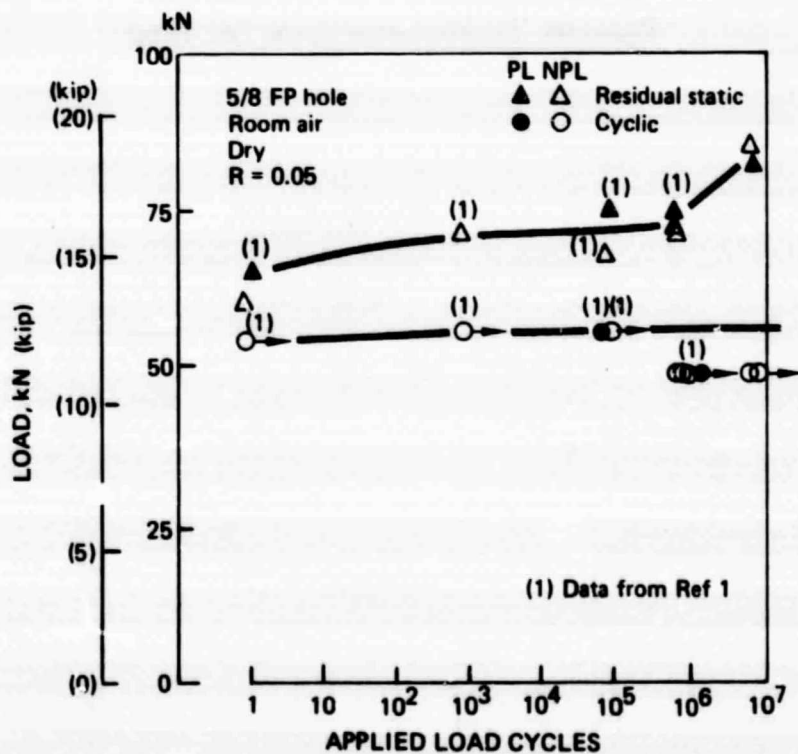


Figure 66. Room Temperature Dry Tension/Tension Tests (5/8 FP Hole)

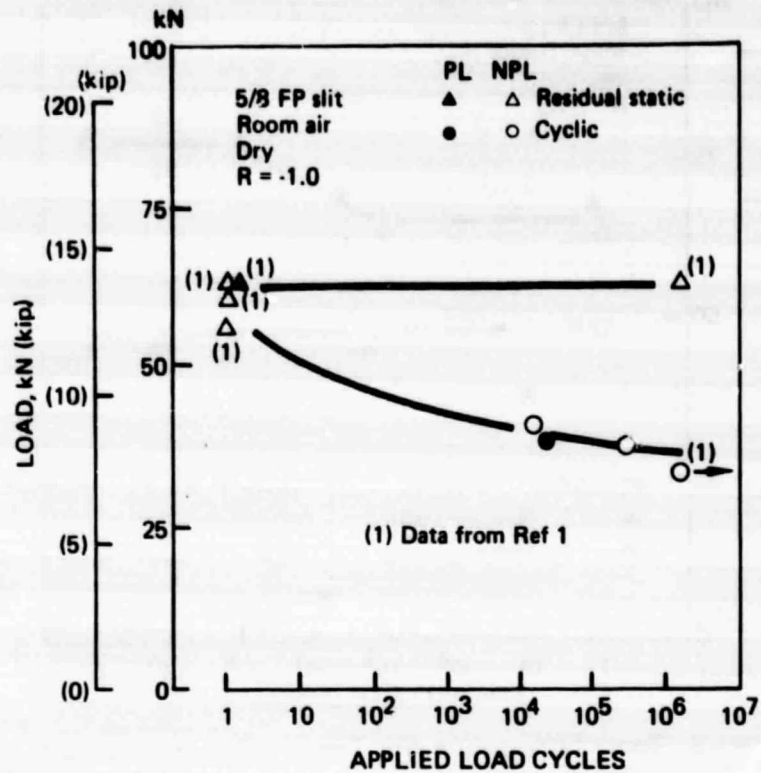


Figure 67. Room Temperature Dry Tension/Compression Tests (5/8 FP Slit)

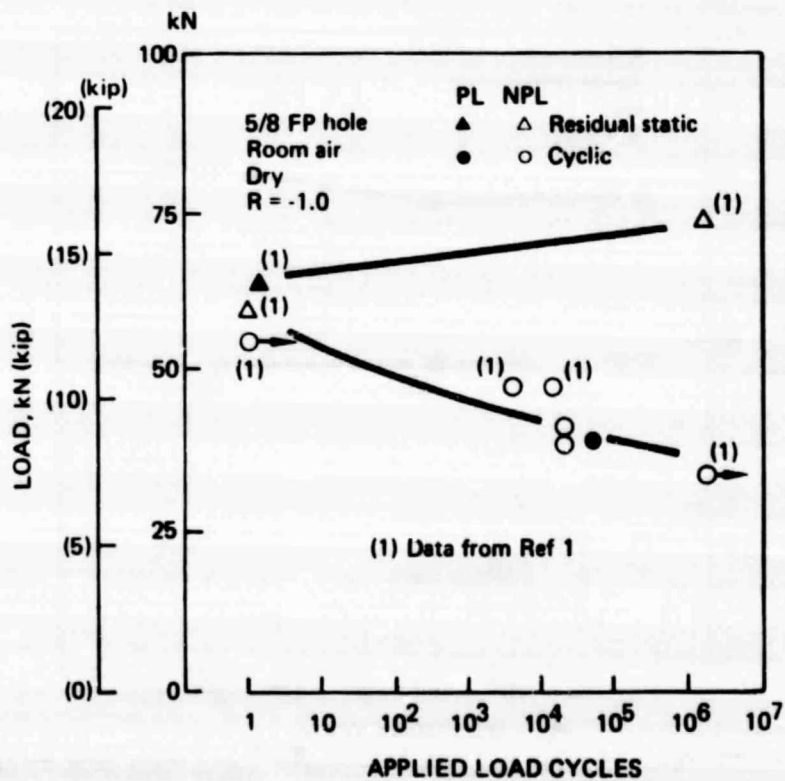


Figure 68. Room Temperature Dry Tension/Compression Tests (5/8 FP Hole)

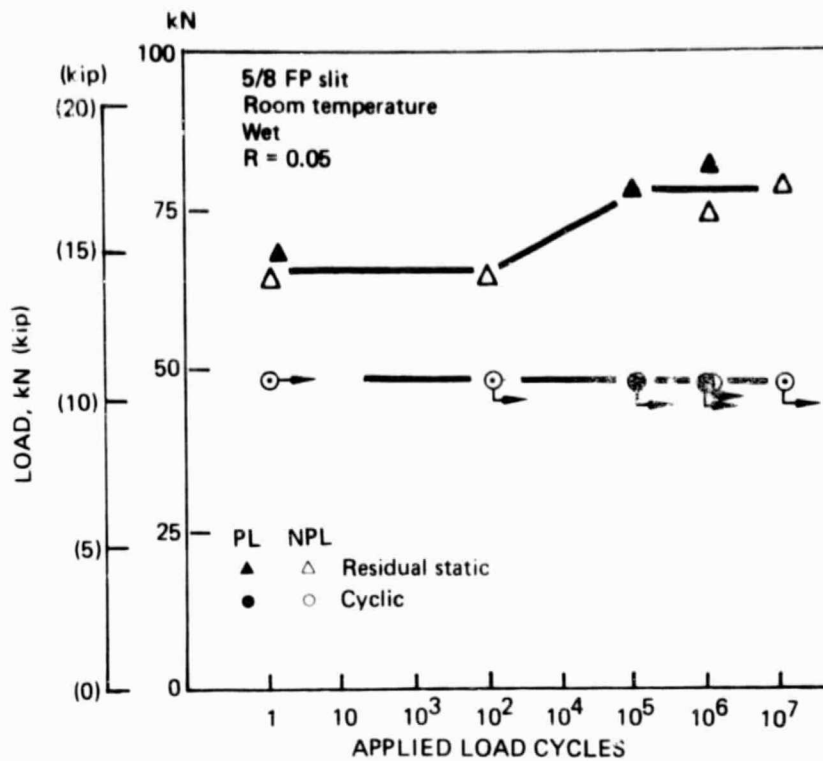


Figure 69. Room Temperature Wet Tension/Tension Tests (5/8 FP Slit)

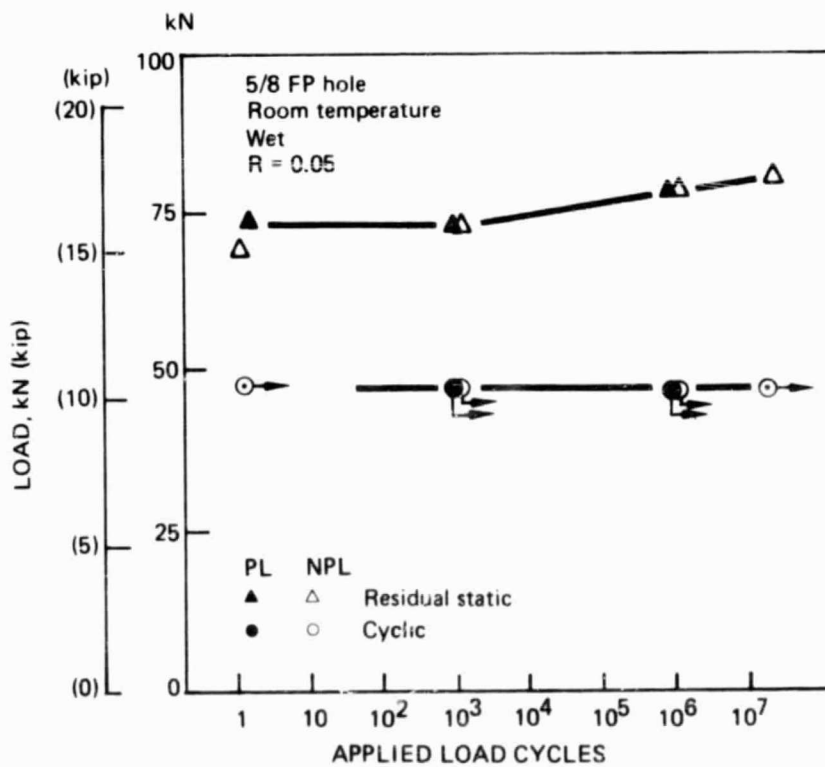


Figure 70. Room Temperature Wet Tension/Tension Tests (5/8 FP Hole)

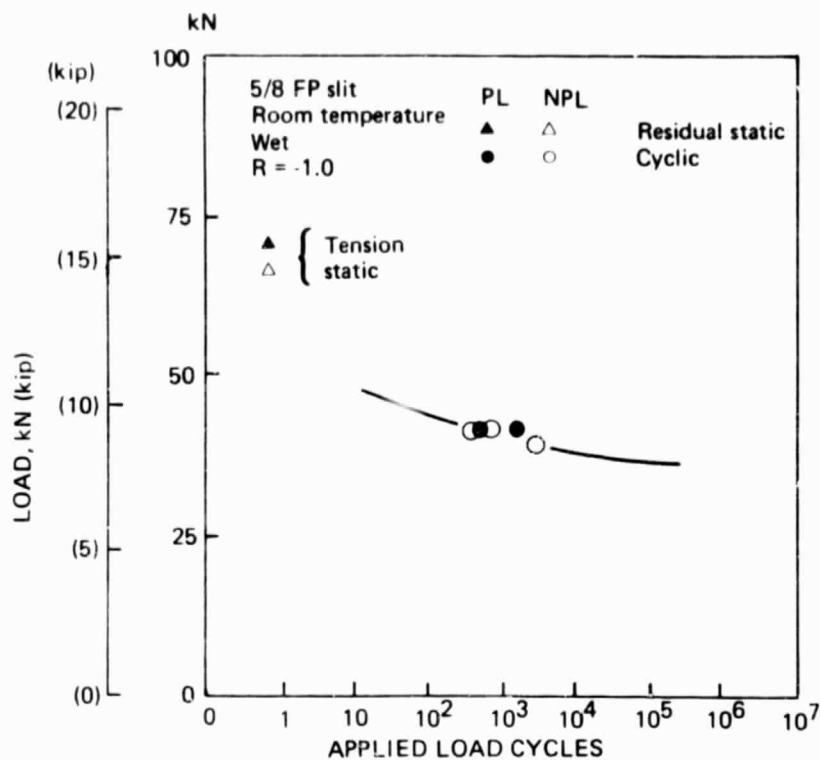


Figure 71. Room Temperature Wet Tension/Compression Tests (5/8 FP Slit)

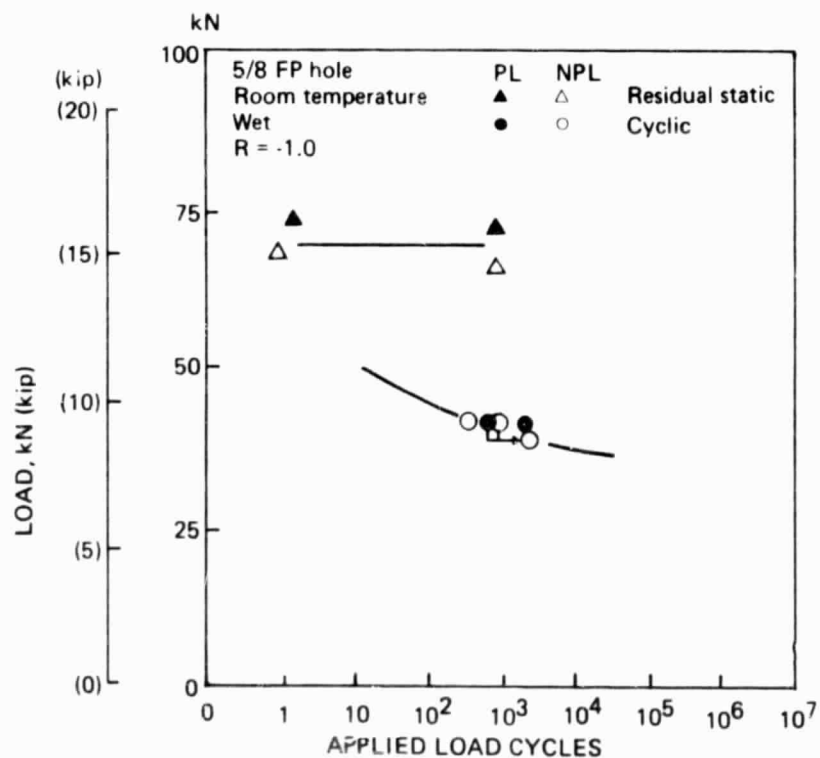


Figure 72. Room Temperature Wet Tension/Compression Tests (5/8 FP Hole)

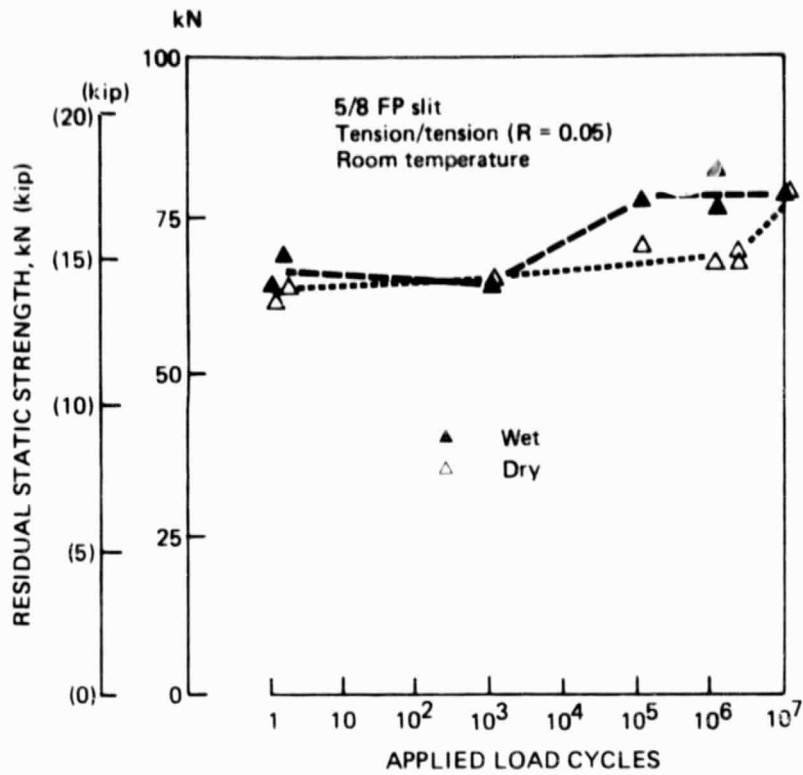


Figure 73. Influence of Moisture on Residual Static Strength for Slit Specimens

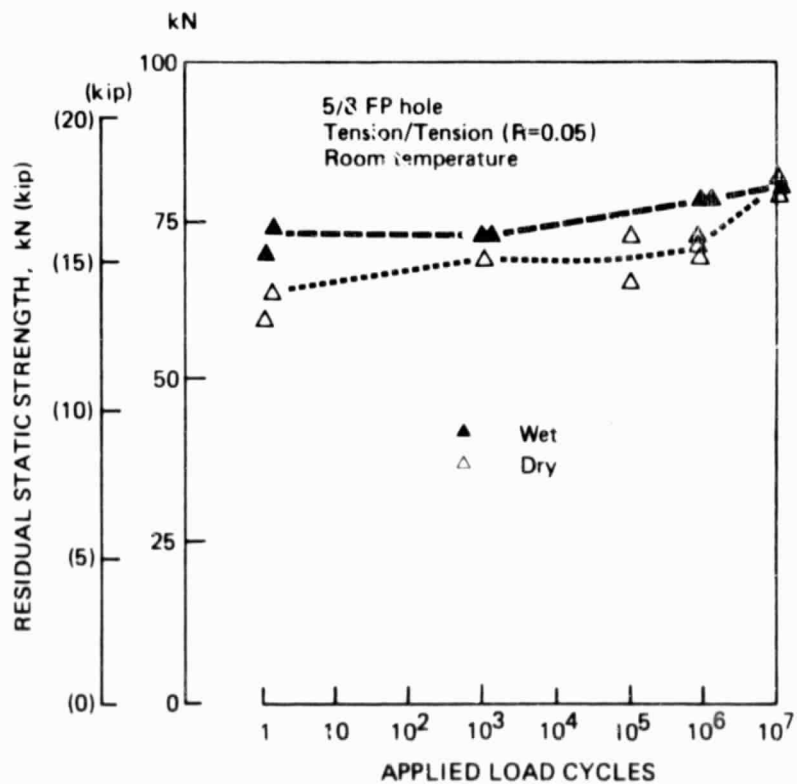


Figure 74. Influence of Moisture on Residual Static Strength for Hole Specimens

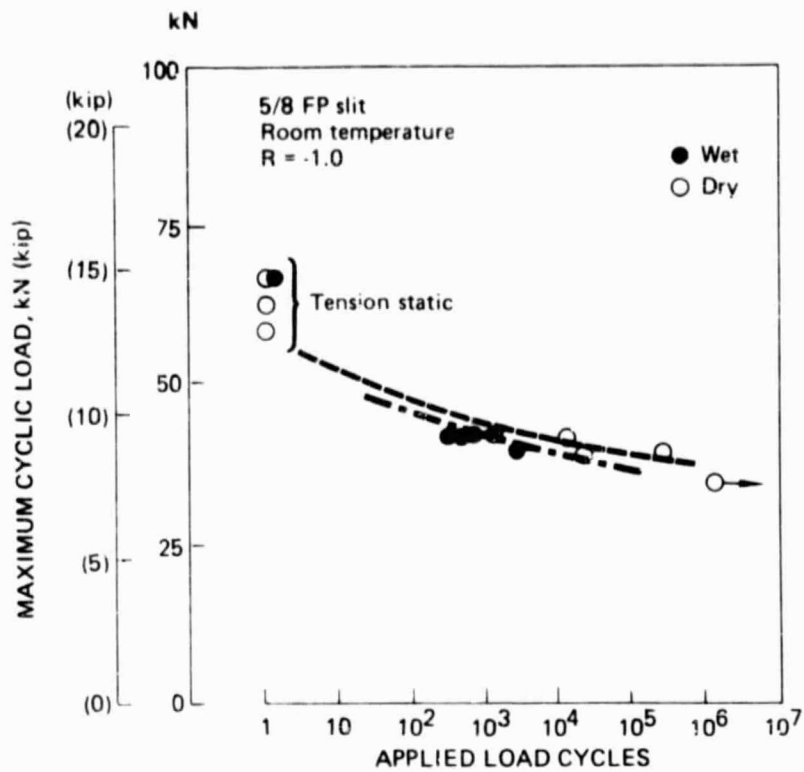


Figure 75. Influence of Moisture on Tension/Compression Fatigue for Slit Specimens

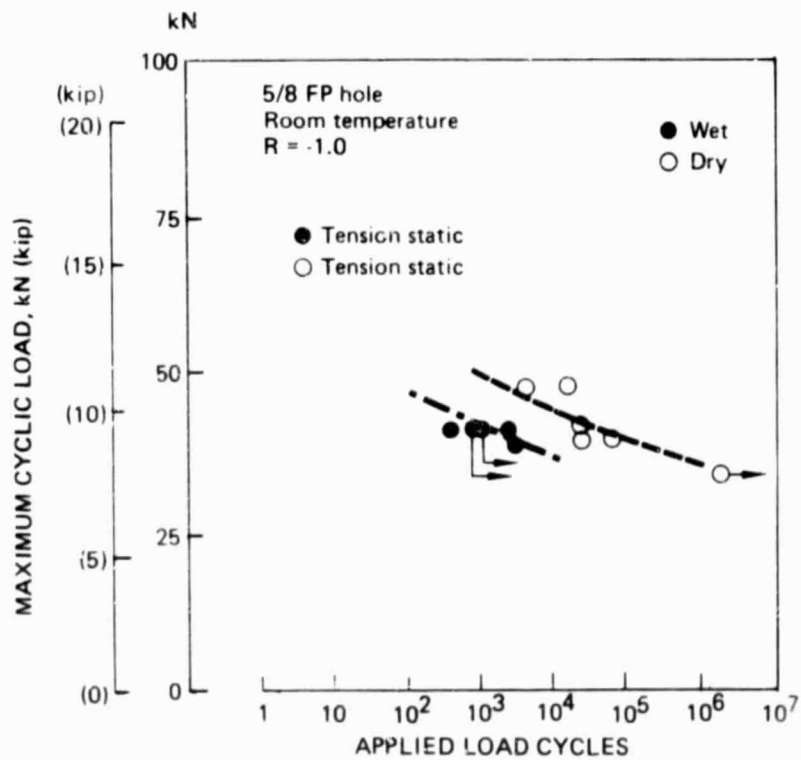


Figure 76. Influence of Moisture on Tension/Compression Fatigue for Hole Specimens

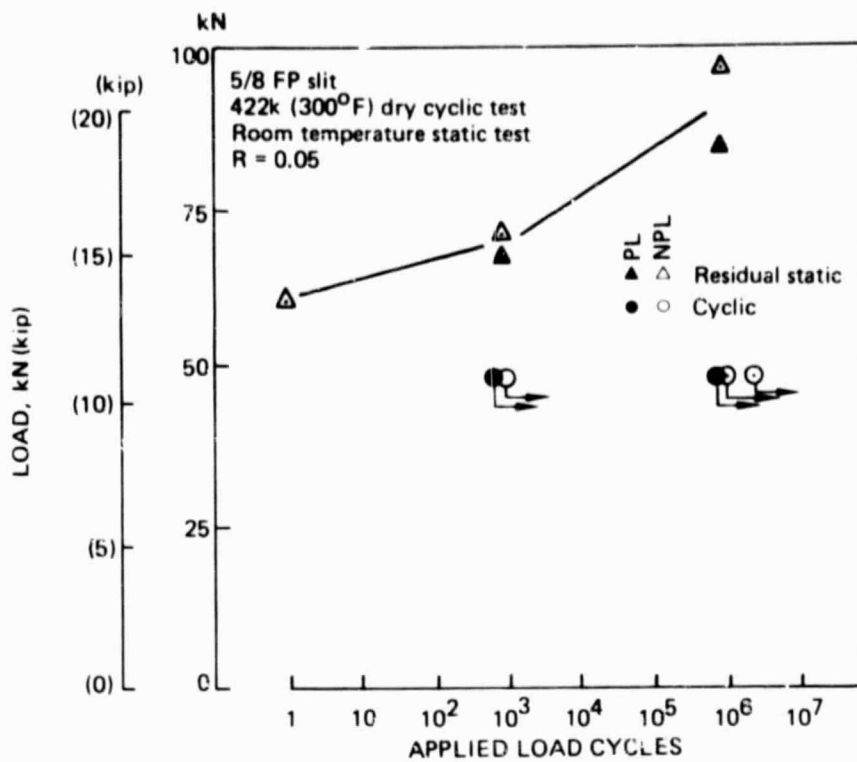


Figure 77. Elevated Temperature Dry Tension/Tension Tests (5/8 FP Slit)

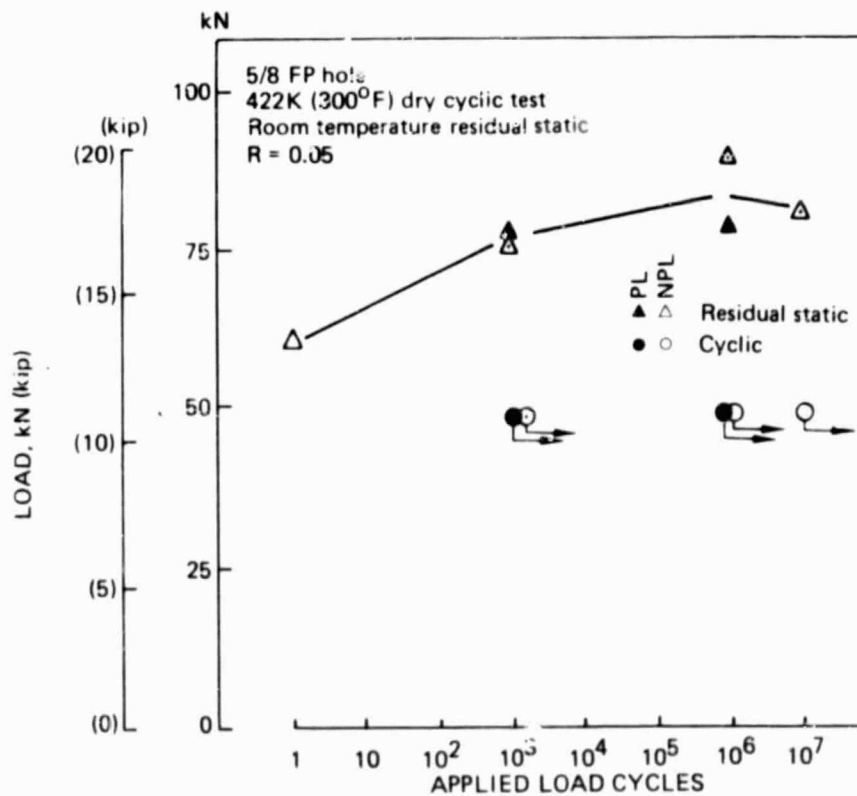


Figure 78. Elevated Temperature Dry Tension/Tension Tests (5/8 FP Hole)

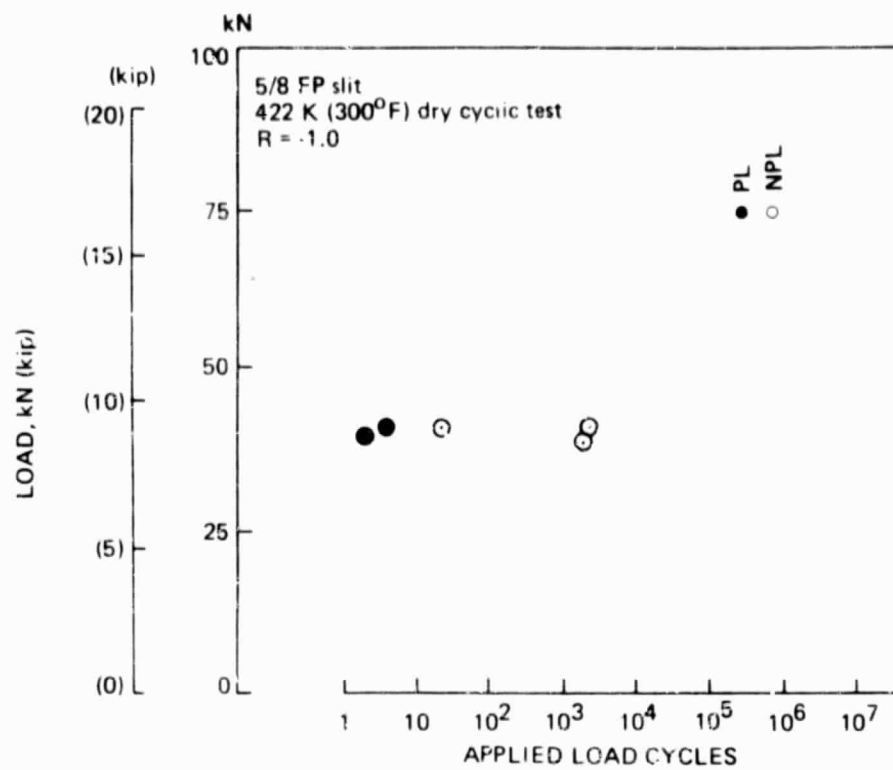


Figure 79. Elevated Temperature Dry Tension/Compression Tests (5/8 FP Slit)

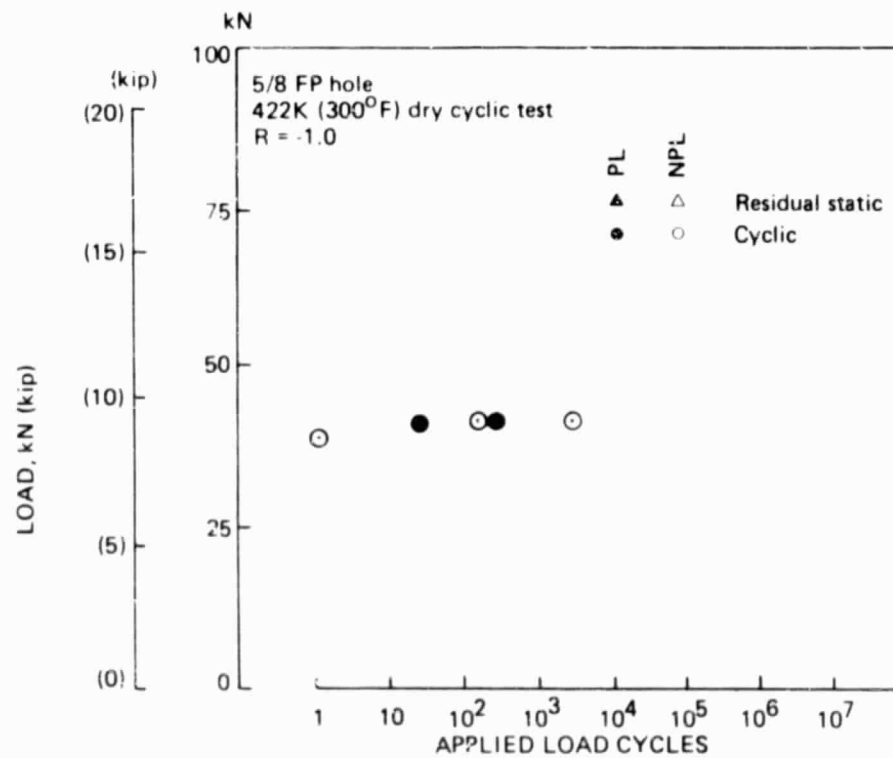


Figure 80. Elevated Temperature Dry Tension/Compression Tests (5/8 FP Hole)



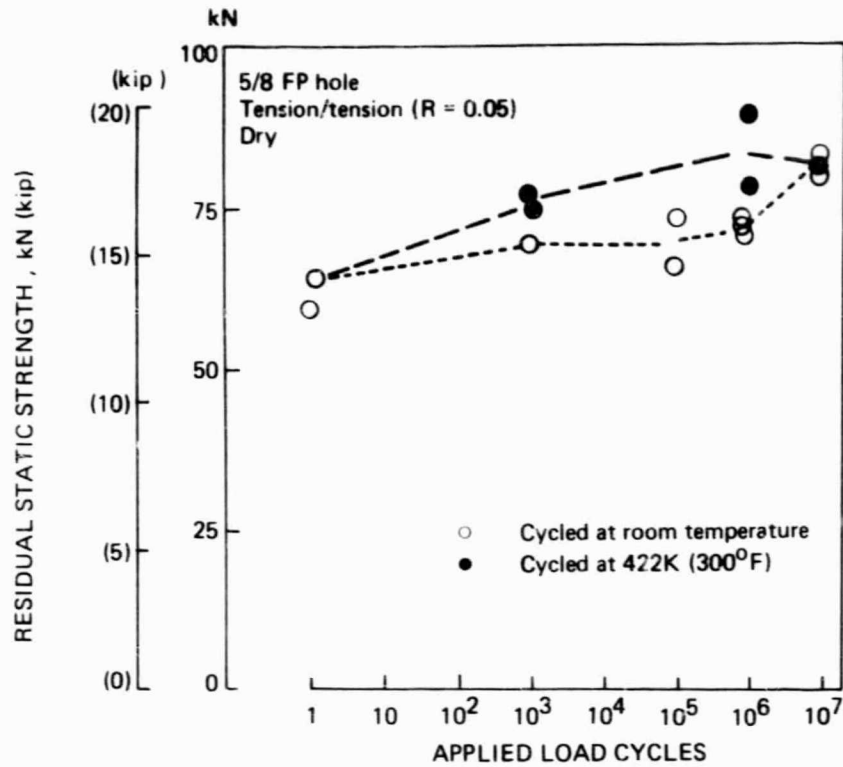


Figure 81. Influence of Cycling Temperature on Residual Strength of Dry Slit Specimens

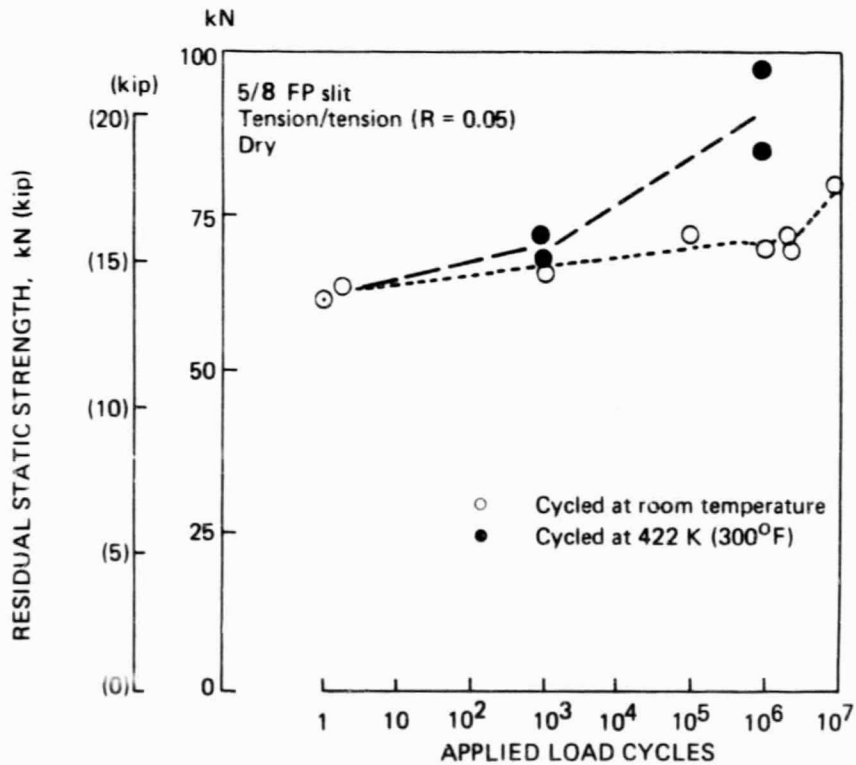


Figure 82. Influence of Cycling Temperature on Residual Strength of Dry Hole Specimens

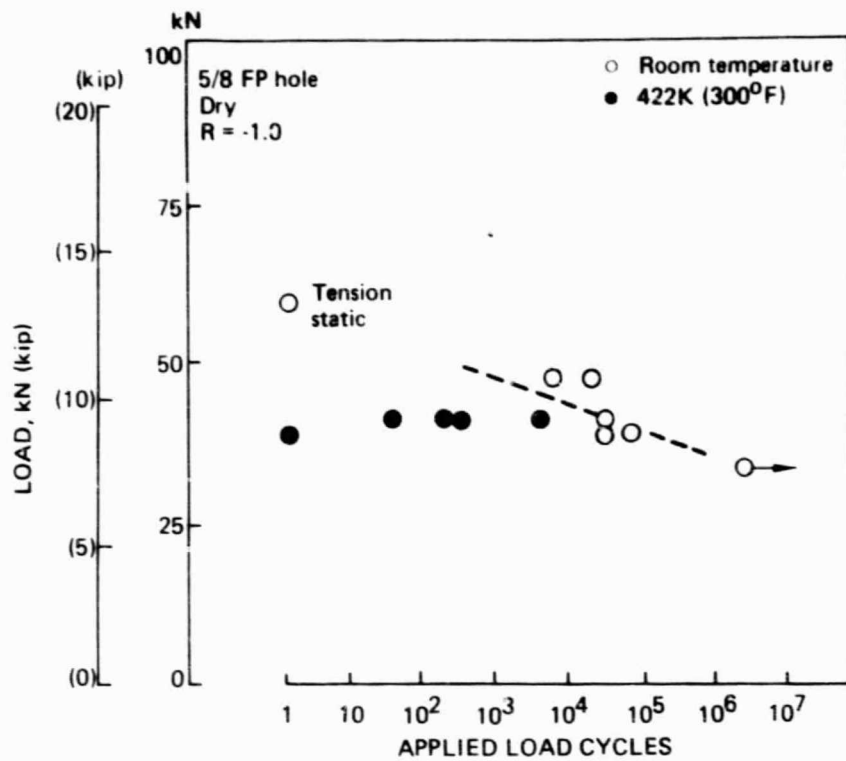


Figure 83. Influence of Cycling Temperature on Fatigue Strength of Dry Slit Specimens

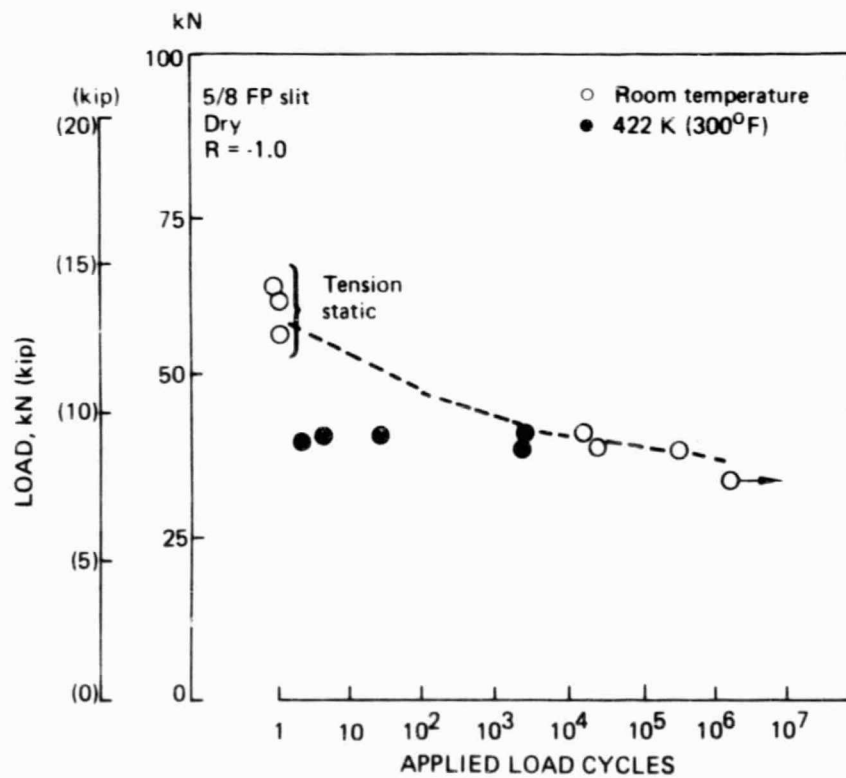


Figure 84. Influence of Cycling Temperature on Fatigue Strength of Dry Hole Specimens

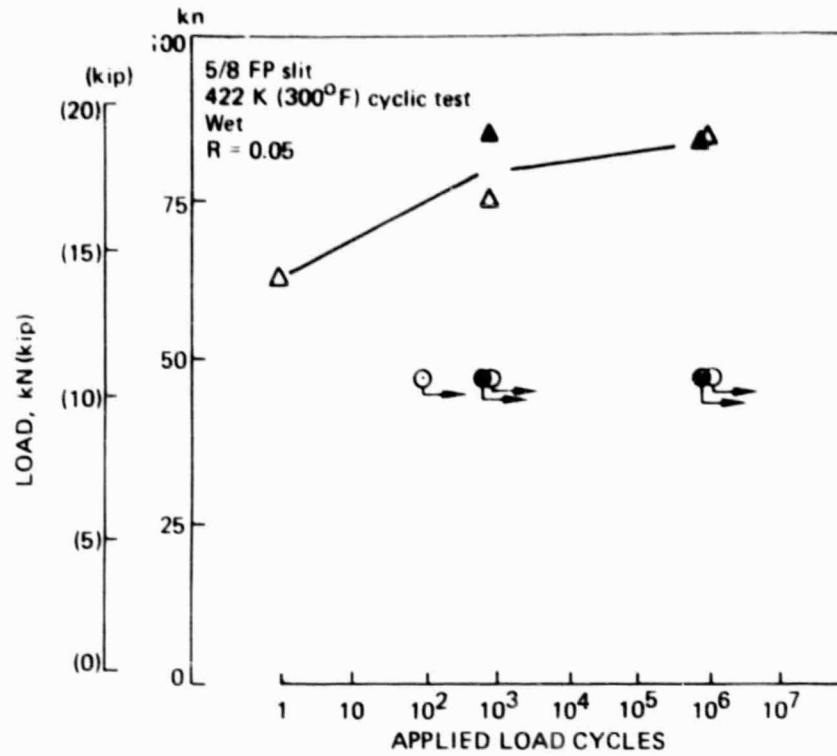


Figure 85. Elevated Temperature Wet Tension/Tension Tests (5/8 FP Slit)

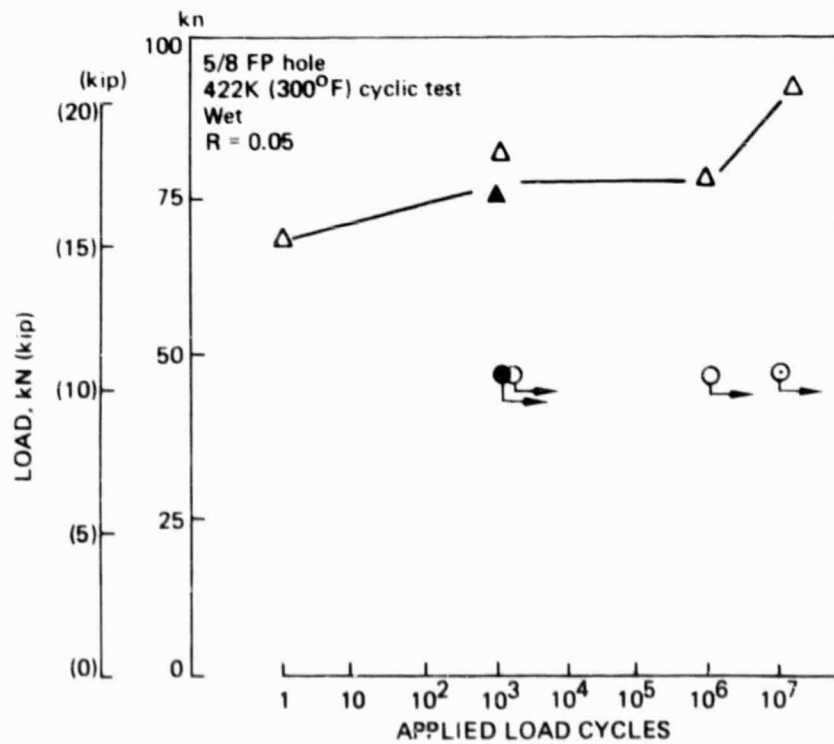


Figure 86. Elevated Temperature Wet Tension/Tension Tests (5/8 FP Hole)

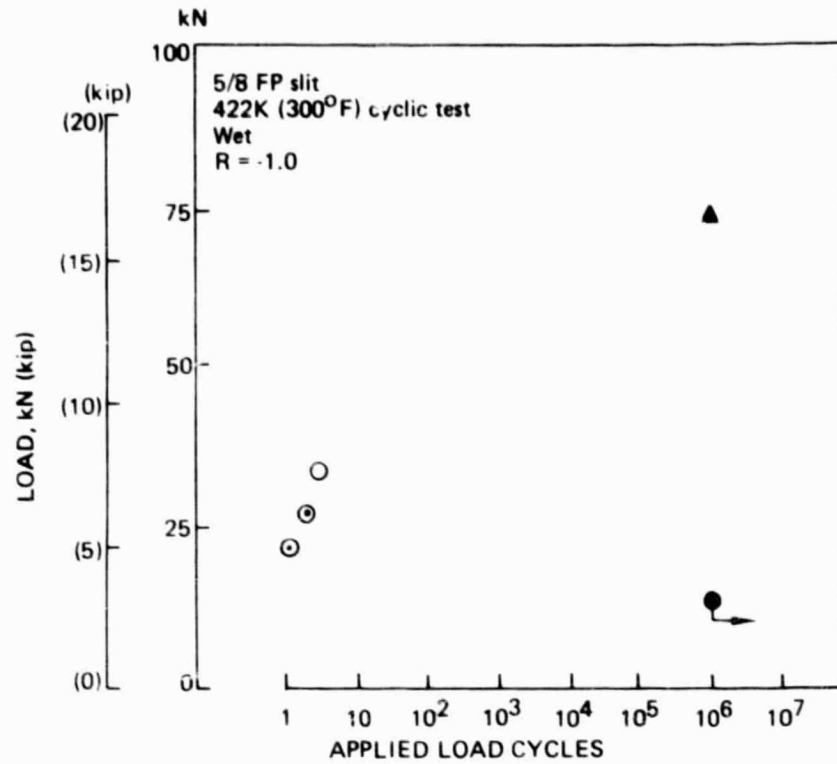


Figure 87. Elevated Temperature Wet Tension/Compression Tests (5/8 FP Slit

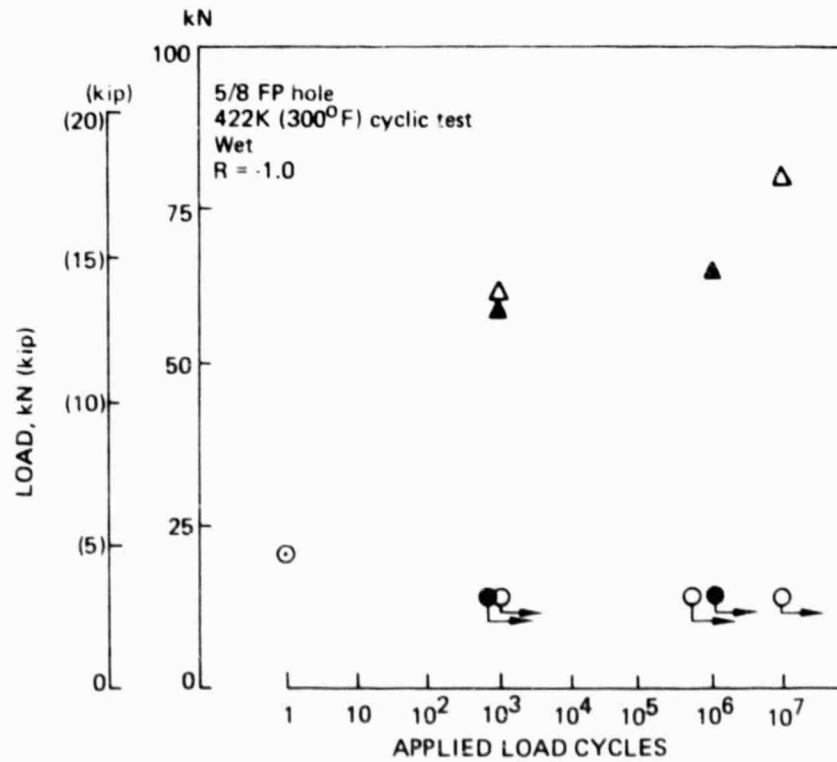


Figure 88. Elevated Temperature Wet Tension/Compression Tests (5/8 FP Hole

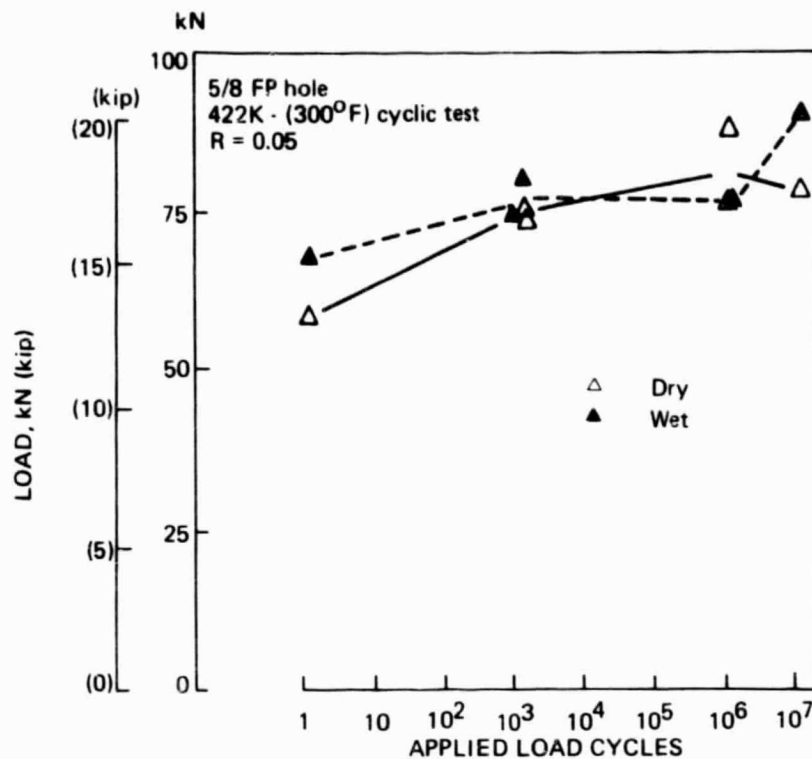


Figure 89. Influence of Moisture Content, on Residual Strength of Hole Specimens Cycled at Elevated Temperature

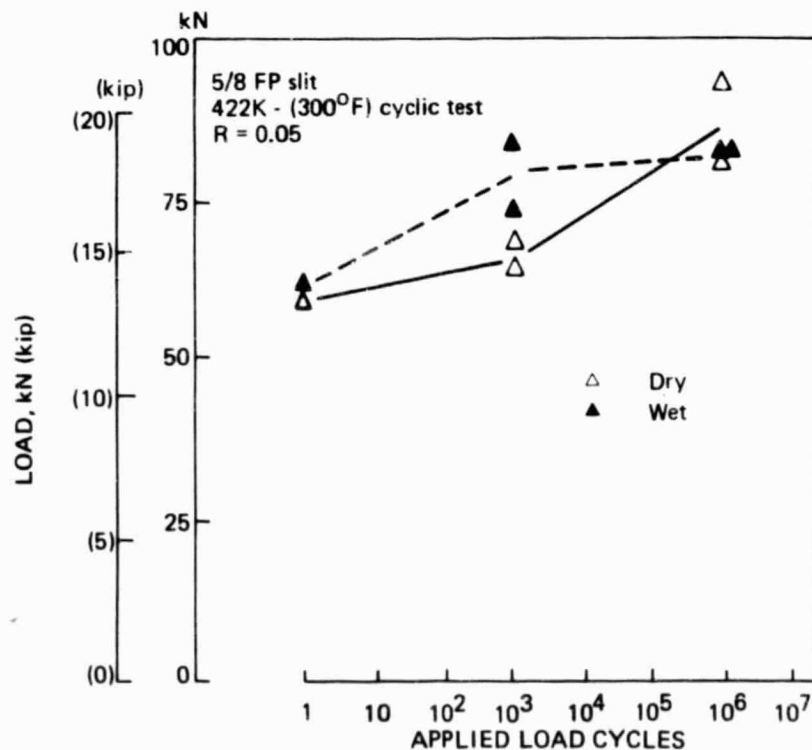


Figure 90. Influence of Moisture Content, on Residual Strength of Slit Specimens Cycled at Elevated Temperature

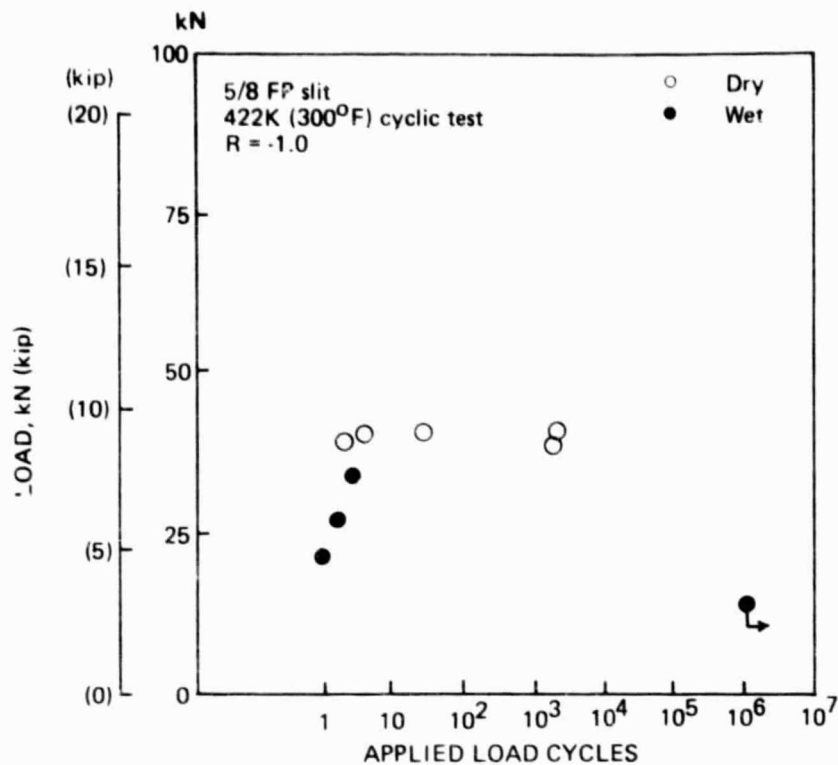


Figure 91. Influence of Moisture Content on Elevated Temperature Fatigue of Slit Specimens

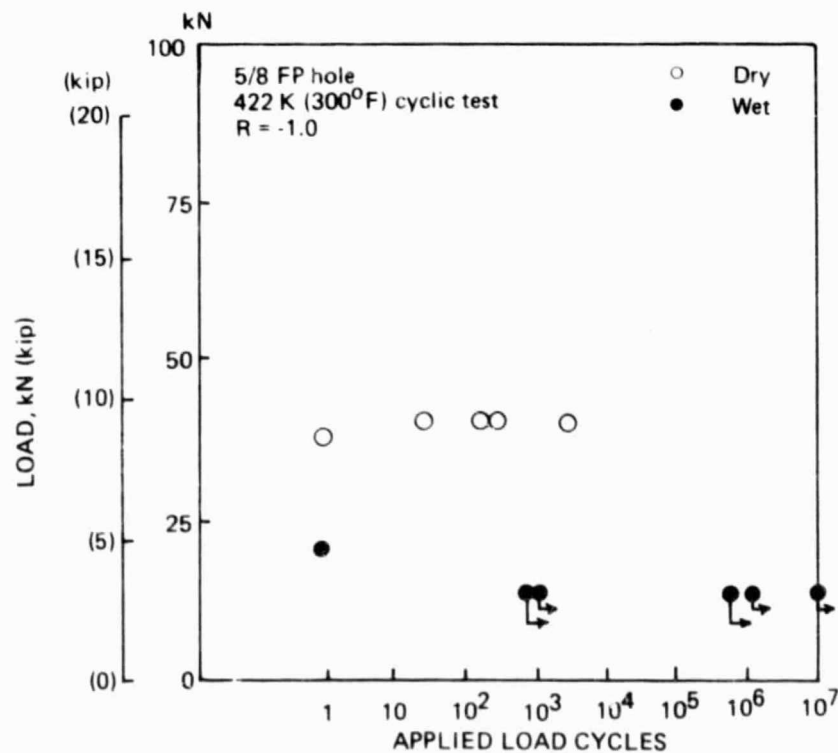


Figure 92. Influence of Moisture Content on Elevated Temperature Fatigue of Hole Specimens

## REFERENCES

1. Porter, T.R.: Evaluation of Flawed Composite Structural Components Under Static and Cyclic Loading, NASA CR-135403, prepared under Boeing Contract NAS3-19709 with NASA-Lewis Research Center, February 1979.
2. Waddoups, M.E., Eisenmann, J.R., and Kaminski, B.E.: Microscopic Fracture Mechanics of Advanced Composite Materials, Journal of Composite Materials, vol. 5, October 1971.

PRECEDING PAGE BLANK NOT FILMED

PRECEDING PAGE BLANK NOT FILMED

**APPENDIX A**  
**STATIC AND CYCLIC TEST DATA**

This appendix contains the static and cyclic test data for all specimens. The reported data includes specimen geometry, loads, and test parameters. The gross section stresses have been reported for all the critical test conditions.



SPEC. NO.	LAYOUT	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
ORIGINAL PAGE IS OF POOR QUALITY																		
LI-31A	LD	2.67 (.105)	47.5 (1.869)	S/S EP	15.9 (.621)	15.6 (.613)	THRU	Tension Static	Room	-	-	-	-	-	-	30,870 (6,940)	243 (35.1)	
- 1	L1	2.64 (.104)	98.6 (3.881)	S/S	15.9 (.621)	5.9 (.228)				-	-	-	-	-	-	74,700 (16,800)	281 (40.8)	
- 5		2.71 (.107)	149.4 (5.881)		15.9 (.621)	16.0 (.631)				-	-	-	-	-	-	121,000 (27,000)	298 (43.4)	
- 2	L1	2.77 (.109)	47.4 (1.868)	S/S EP	16.2 (.638)	15.9 (.628)	THRU	Compression Static	Room	-	-	-	-	-	-	-33,000 (7,412)	-251 (36.4)	
- 6		2.74 (.108)	48.6 (1.908)	S/S	16.0 (.631)	15.8 (.623)				-	-	-	-	-	-	-44,590 (10,023)	-164 (-23.9)	
- 10		2.74 (.108)	149.4 (5.880)		16.0 (.631)	16.1 (.632)				-	-	-	-	-	-	-103,400 (-23,240)	-252 (-36.6)	
- 3	L1	2.77 (.109)	49.8 (1.926)	IMPACT				Tension Static	Room	-	-	-	-	-	-	80,000 (18,000)	590 (85.7)	
- 7		2.72 (.107)	100.3 (3.951)							-	-	-	-	-	-	149,900 (33,700)	549 (79.1)	
- 11		2.54 (.100)	149.3 (5.884)							-	-	-	-	-	-	143,000 (32,200)	377 (54.8)	
- 4	L1	2.77 (.109)	48.9 (1.926)	IMPACT				Compression Static	Room	-	-	-	-	-	-	-28,400 (-6,390)	-209 (-30.4)	
- 8		2.77 (.109)	140.4 (5.529)							-	-	-	-	-	-	-74,600 (-16,775)	-268 (-39.0)	
- 12	LD	2.69 (.106)	149.3 (5.882)							-	-	-	-	-	-	-105,400 (-23,700)	-261 (-38.0)	

GRIP AREA TRAINING

LI [ (0/145/0/140) ]<sub>2</sub>

GOLD AREA TAILLINE

LI [(0.145/0.140)]<sub>2</sub>

WIDTH REPORT TEST DATA

SPEC. NO.	LAYUP	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STRESS		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
L3-31 -13	L3 ↓	2.51 (.099)	41.3 (1.624)	5/8 PP SLIT	15.8 (.622)	15.9 (.624)	THRU	TENSION STATIC	ROOM	-	-	-	-	-	-	47590 (10700)	400 (58.0)	GRIP AREA FAILURE
-17	↓	2.64 (.104)	48.6 (1.911)	↓	15.9 (.624)	15.9 (.624)	↓	↓	↓	-	-	-	-	-	-	124100 (27700)	476 (69.1)	
-21	↓	2.64 (.104)	149.3 (5.880)	↓	16.1 (.633)	16.0 (.629)	↓	↓	↓	-	-	-	-	-	-	148100 (33300)	375 (54.4)	
-14	L3 ↓	2.56 (.101)	47.4 (1.865)	5/8 PP SLIT	15.8 (.621)	16.1 (.632)	THRU	COMPRESSION STATIC	ROOM	-	-	-	-	-	-	-33400 (-7500)	-274 (-39.9)	
-18	↓	2.62 (.103)	98.4 (3.874)	↓	16.0 (.630)	16.1 (.632)	↓	↓	↓	-	-	-	-	-	-	69400 (15600)	-269 (-39.1)	GRIP AREA FAILURE
-22	↓	2.62 (.103)	149.4 (5.881)	↓	15.9 (.624)	16.1 (.634)	↓	↓	↓	-	-	-	-	-	-	-107600 (-24200)	-279 (-40.9)	
-15	L3 ↓	2.59 (.102)	50.0 (1.969)	IMPACT	↓	↓	↓	TENSION STATIC	ROOM	-	-	-	-	-	-	122000 (27500)	943 (136.4)	
-19	↓	2.64 (.104)	99.9 (3.932)	↓	↓	↓	↓	↓	↓	-	-	-	-	-	-	281000 (62500)	816 (117.0)	
-23	↓	2.64 (.104)	149.4 (5.882)	↓	↓	↓	↓	↓	↓	-	-	-	-	-	-	-	-	GRIP AREA FAILURE
-16	L3 ↓	2.59 (.102)	50.2 (1.976)	IMPACT	↓	↓	↓	COMPRESSION STATIC	ROOM	-	-	-	-	-	-	-41300 (-9300)	-317 (-46.0)	
-20	↓	2.64 (.104)	100.2 (3.945)	↓	↓	↓	↓	↓	↓	-	-	-	-	-	-	-90100 (-20200)	-333 (-48.5)	
-24	↓	2.62 (.103)	149.4 (5.882)	↓	↓	↓	↓	↓	↓	-	-	-	-	-	-	-114700 (-25800)	-293 (-42.6)	

L3 - (60/30/0°/30/0°)2 J5 - 3 GLASS PLY

ORIGINAL PAGE IS  
OF POOR QUALITY

WEEK 5 - 1964 - 1965 STATIC TEST DATA

ORIGINAL PAGE IS  
OF POOR QUALITY

TEST SUMMARY DATA	SPEC NO.	LAYUP	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH mm (INCH)	FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	RESIDUAL STATIC	REMARKS
LOAD	STRESS	LOAD	STRESS	LOAD	STRESS	LOAD	STRESS	LOAD	STRESS	LOAD	STRESS	LOAD	STRESS	LOAD	STRESS	REMARKS
mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)	mm (INCH)
1-21-1	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-2	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-3	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-4	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-5	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-6	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-7	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-8	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-9	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-10	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-11	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-12	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-13	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-14	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-15	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	
-16	2.54 (.102)	76.2 (2.998)	NONE	0	0	0	0	0	0	95400 (21500)	484 (7.03)	164000 (36900)	831 (120.7)	164000 (36900)	831 (120.7)	

ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

SHEET NO.	LAYOUT	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH (INCH)		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING			RESIDUAL STRESS		REMARKS	
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MM/IN <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MM/IN <sup>2</sup> (KSI)	H	CYCLES	LOAD N (LB)		STRESS MM/IN <sup>2</sup> (KSI)
11-21-17	L1	2.57 (.102)	76.2 (2.999)	3/8 CS HOLE	9.53 (.375)			PRELOAD SMALL	Room	49600 (110800)	243 (35.3)					74700 (16800)	378 (54.9)	
-18		2.57 (.102)	76.2 (2.998)	1/8 CS HOLE	3.15 (.125)			PRELOAD SMALL	Room	60900 (13700)	315 (45.7)					80500 (18100)	416 (60.4)	
-19		2.62 (.103)	76.2 (2.998)		3.30 (.130)			SMALL	Room	—	—					89900 (20100)	448 (65.1)	
-21		2.64 (.104)	76.0 (2.990)	1/8 FP SLIT	3.15 (.125)			PRELOAD SMALL	Room	70700 (15900)	352 (51.1)					99600 (22400)	496 (72.0)	
-22		2.64 (.104)	76.0 (2.991)		3.30 (.130)			SMALL	Room	—	—					121900 (27400)	555 (80.4)	
-23		2.69 (.106)	76.1 (2.996)		3.30 (.130)			SMALL	422 (300)	—	—					113800 (25500)	555 (80.4)	
-24		2.62 (.103)	76.1 (2.997)		3.15 (.125)			PRELOAD SMALL	422 (300)	70700 (15900)	355 (51.2)					104500 (23500)	534 (76.1)	
-25		2.67 (.105)	76.1 (2.997)	3/8 FP SLIT	9.65 (.380)			PRELOAD SMALL	Room	54500 (12300)	278 (40.4)					84500 (19000)	416 (60.4)	
-26		2.67 (.105)	76.2 (2.998)		9.91 (.390)			SMALL	Room	—	—					71800 (16000)	383 (55.4)	
-27		2.67 (.105)	76.1 (2.997)		9.65 (.380)			SMALL	422 (300)	—	—					90500 (20300)	480 (68.1)	
-28		2.62 (.103)	76.1 (2.997)		9.65 (.380)			PRELOAD SMALL	422 (300)	56500 (12700)	283 (41.1)					72400 (16200)	362 (52.2)	
-29		2.69 (.106)	76.0 (2.993)	5/8 FP SLIT	16.0 (.630)			PRELOAD SMALL	Room	47100 (10600)	230 (33.4)					67600 (15200)	330 (47.9)	
-30		2.67 (.105)	76.1 (2.997)		15.15 (.596)			SMALL	Room	—	—					62300 (14000)	307 (44.5)	
-31		2.67 (.105)	76.2 (2.998)		16.0 (.630)			SMALL	422 (300)	—	—					67800 (15100)	344 (49.4)	
-32		2.67 (.105)	76.2 (2.998)		16.0 (.630)			PRELOAD SMALL	422 (300)	47100 (10600)	230 (33.4)					62300 (14000)	312 (45.3)	

LIST 304C.17000 STAIN TEST DATA

ORIGINAL PAGE IS  
OF POOR QUALITY

SPEC. NO.	LAYUP	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/mm <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/mm <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/mm <sup>2</sup> (KSI)	
31-33	L1	2.67 (.106)	76.2 (2.998)	5/8 CLX MARK	16.3 (.640)			PRELOAD STATIC	Room	39600 (8900)	193 (28.0)					66700 (15000)	325 (47.2)	
34		2.67 (.106)	76.2 (2.998)		16.0 (.634)			STATIC	Room	-	-					66700 (15000)	325 (47.2)	
35		2.67 (.106)	76.2 (2.998)		16.3 (.640)			STATIC	422	-	-					66700 (15000)	325 (47.2)	
36		2.67 (.106)	76.2 (2.998)		16.1 (.634)			PRELOAD STATIC	422	39600 (8900)	193 (28.0)					66700 (15000)	325 (47.2)	
37		2.67 (.106)	76.2 (2.998)	3/8 CLX MARK	9.91 (.390)			STATIC	Room	-	-					66700 (15000)	325 (47.2)	
38		2.67 (.106)	76.2 (2.998)		9.91 (.390)			STATIC	422	-	-					66700 (15000)	325 (47.2)	
39		2.67 (.106)	76.2 (2.998)		9.53 (.375)			PRELOAD STATIC	422	48000 (10800)	236 (34.3)					66700 (15000)	325 (47.2)	
41		2.57 (.101)	76.1 (2.991)	1/8 HP MARK	3.18 (.125)		1.5 (.06)	PRELOAD STATIC	Room	92100 (20700)	476 (69.1)					112000 (25200)	579 (84.1)	
42		2.67 (.106)	76.1 (2.991)		3.05 (.120)		1.5 (.06)	STATIC	Room	-	-					121400 (27300)	603 (87.1)	
43		2.67 (.106)	76.2 (2.991)		3.18 (.125)		1.5 (.06)	STATIC	422	-	-					112000 (25200)	579 (84.1)	
44		2.67 (.106)	76.2 (2.991)		3.18 (.125)		1.5 (.06)	PRELOAD STATIC	422	92100 (20700)	476 (69.1)					121400 (27300)	603 (87.1)	
45		2.57 (.101)	76.1 (2.991)	1/8 HP MARK	3.18 (.125)		1.5 (.06)	PRELOAD STATIC	Room	85000 (19100)	435 (63.1)					112000 (25200)	579 (84.1)	
46		2.57 (.101)	76.1 (2.991)		3.18 (.125)		1.5 (.06)	STATIC	Room	-	-					112000 (25200)	579 (84.1)	
47		2.67 (.106)	76.1 (2.991)		3.05 (.120)		1.5 (.06)	STATIC	422	-	-					121400 (27300)	603 (87.1)	
48		2.67 (.106)	76.1 (2.991)		3.18 (.125)		1.5 (.06)	PRELOAD STATIC	422	85000 (19100)	435 (63.1)					112000 (25200)	579 (84.1)	

ORIGINAL PAGE IS  
OF POOR QUALITY

WET SPECIMEN STATIC TEST DATA

SPEC. NO.	LAYOUT	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
LI 21-49	L1	2.62 (.103)	76.2 (2.998)	3/8 HP MAX	1.53 (.375)	0	1.5 (.06)	PRELOAD STATIC	ROOM	81400 (18300)	409 (59.3)					92100 (20700)	462 (67.0)	
-50		2.64 (.104)	76.2 (2.998)		9.40 (.370)	0	1.5 (.06)	STATIC	ROOM	-	-					102300 (23000)	508 (73.8)	
-51		2.57 (.101)	76.2 (2.998)		9.53 (.375)	0	1.5 (.06)	STATIC	422 (300)	-	-					105900 (24300)	522 (81.6)	
-52		2.54 (.100)	76.2 (2.998)		9.53 (.375)	0	1.5 (.06)	PRELOAD STATIC	422 (300)	81400 (18300)	420 (61.0)					101400 (22900)	522 (76.4)	
-53		2.62 (.103)	76.2 (2.998)	3/8 HP SLIT	9.53 (.375)	0	1.5 (.06)	PRELOAD STATIC	ROOM	76500 (17300)	382 (55.0)					105400 (23500)	529 (76.8)	
-54		2.64 (.104)	76.2 (2.998)		9.40 (.370)	0	1.5 (.06)	STATIC	ROOM	-	-					112500 (25200)	579 (84.1)	
-55		2.64 (.104)	76.2 (2.998)		9.40 (.370)	0	1.5 (.06)	STATIC	422 (300)	-	-					109400 (24700)	546 (79.2)	
-56		2.59 (.102)	76.2 (2.998)		9.40 (.370)	0	1.5 (.06)	PRELOAD STATIC	422 (300)	76500 (17300)	382 (55.0)					107200 (24100)	543 (78.3)	
-57		2.57 (.102)	76.2 (2.998)	1/8 CLK MAX	3.30 (.130)	0	1.5 (.06)	STATIC	422 (300)	-	-					108300 (24400)	550 (79.8)	
-58		2.62 (.103)	76.2 (2.998)		3.18 (.125)	0	1.5 (.06)	PRELOAD STATIC	422 (300)	60900 (13700)	302 (44.4)					110800 (24900)	555 (80.6)	
-59		2.62 (.103)	76.2 (2.998)	5/8 HP MAX	15.9 (.625)	0	1.5 (.06)	PRELOAD STATIC	ROOM	71400 (16100)	360 (52.2)					84700 (19300)	432 (62.3)	
-61		2.64 (.104)	76.2 (2.998)		15.8 (.620)	0	1.5 (.06)	STATIC	ROOM	-	-					44300 (9900)	460 (66.8)	
-62		2.67 (.105)	76.2 (2.998)		15.9 (.625)	0	1.5 (.06)	STATIC	422 (300)	-	-					87600 (19700)	431 (62.6)	
-63		2.69 (.106)	76.2 (2.998)	6/8 HP SLIT	16.3 (.640)	0	1.5 (.06)	PRELOAD STATIC	ROOM	78700 (17700)	381 (55.7)					103200 (23200)	504 (73.1)	
-64		2.62 (.103)	76.2 (2.998)		16.5 (.650)	0	1.5 (.06)	STATIC	ROOM	-	-					86700 (19300)	435 (63.2)	

ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

WET SPIN-UPPED STATIC TEST DATA

SPEC. NO.	LAYUP	THICK- NESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH (INCH)		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
LI-21-45	L1	2.69 (.106)	76.1 (2.997)	5/8 HIP SLIT	14.5 (.57)	0	1.5 (.06)	STATIC	422 (300)	-	-	-	-	-	-	102 300 (23 000)	494 (72.4)	
-66	L1	2.69 (.106)	76.1 (2.997)	5/8 HIP SLIT	14.7 (.58)	0	1.5 (.06)	PRELOAD	422 (300)	7800 (17 700)	384 (55.7)	-	-	-	-	92 100 (20 700)	449 (65.2)	
-67	L1	2.72 (.107)	76.1 (2.996)	5/8 HIP HOLES	15.9 (.625)	0	1.5 (.06)	PRELOAD	422 (300)	71600 (16 180)	346 (50.2)	-	-	-	-	93 400 (21 100)	453 (65.8)	

ORIGINAL PAGE IS  
OF POOR QUALITY

NOTE: SPECIMEN SIZE TEST DATA

ORIGINAL PAGE IS  
OF POOR QUALITY

NAME: SPEL-MED SATIN TEST DATA

SPEC NO.	LAYUP	THICKNESS (INCH)	WIDTH (INCH)	FLAW TYPE	FLAW LENGTH (INCH)		FLAW DEPTH (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING			RESIDUAL STRESS		REMARKS	
					FRONT (INCH)	BACK (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)		STRESS MN/m <sup>2</sup> (KSI)
12-21-1	L2	2.59 (.102)	76.1 (2.995)	MONOC	0	0		PRELOAD	ROOM	152,100 (35,100)	74.2 (41.9)					200,000 (45,200)	102.0 (198.0)	
-2		2.64 (.104)	76.1 (2.995)		0	0		STATIC	ROOM	-	-					200,000 (45,200)	100.2 (195.5)	
-3		2.69 (.106)	76.1 (2.996)		0	0		STATIC	422	-	-					171,500 (38,500)	83.5 (152.2)	
-4		2.64 (.104)	76.1 (2.997)		0	0		PRELOAD	422	152,100 (35,100)	74.1 (41.8)					177,000 (40,000)	86.1 (161.5)	
-5		2.62 (.103)	76.1 (2.997)	1/8	3.18 (.125)			PRELOAD	ROOM	108,600 (24,400)	51.4 (29.0)					79,100 (18,000)	84.8 (162.1)	
-6		2.63 (.105)	76.2 (2.998)	5/8 HOLE	8.05 (.317)			STATIC	ROOM	-	-					162,300 (36,500)	79.9 (150.6)	
-7		2.64 (.104)	76.1 (2.997)		3.18 (.125)			STATIC	422	-	-					137,900 (31,000)	67.2 (127.6)	
-8		2.72 (.107)	76.2 (2.998)		3.18 (.125)			PRELOAD	422	108,600 (24,400)	51.4 (29.1)					144,000 (32,500)	69.8 (131.3)	
-9		2.62 (.103)	76.2 (2.998)	3/8	9.53 (.375)			PRELOAD	ROOM	108,600 (24,400)	51.1 (29.2)					126,100 (28,300)	62.1 (118.6)	
-10		2.67 (.105)	76.1 (2.997)	1/8 HOLE	9.45 (.370)			STATIC	ROOM	-	-					126,100 (28,300)	62.1 (127.2)	
-11		2.67 (.105)	76.1 (2.997)		9.45 (.370)			STATIC	422	-	-					116,300 (26,200)	57.2 (113.0)	
-12		2.63 (.104)	76.1 (2.997)		9.53 (.375)			PRELOAD	422	108,600 (24,400)	49.7 (28.1)					177,000 (40,000)	57.2 (113.1)	
-21		2.62 (.103)	76.2 (2.998)	5/8	15.4 (.602)			PRELOAD	ROOM	78,700 (17,700)	34.5 (19.3)					104,400 (23,600)	54.8 (107.4)	
-22		2.67 (.105)	76.2 (2.998)	1/8 HOLE	15.8 (.620)			STATIC	ROOM	-	-					121,300 (27,200)	59.7 (124.6)	
-23		2.67 (.104)	76.2 (2.998)		15.3 (.600)			STATIC	422	-	-					94,700 (21,300)	46.1 (91.6)	
-24		2.74 (.108)	76.2 (2.996)		15.4 (.612)			PRELOAD	422	78,700 (17,700)	37.1 (20.6)					101,400 (22,800)	49.5 (100.4)	

ORIGINAL PAGE IS  
OF POOR QUALITY

L2 ((0.3 / 2.81))<sub>2</sub>



# TEST SPECIMEN DATA

SPEC. NO.	LAYUP	THICK. INCH	WIDTH INCH	FLAW TYPE	FLAW LENGTH INCH		FLAW DEPTH INCH	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STRESS		REMARKS
					FRONT INCH	BACK INCH				LOAD N (LB)	STRESS MN/mm <sup>2</sup> (KSI)	MAX. LOAD N (LB)	MAX. STRESS MN/mm <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/mm <sup>2</sup> (KSI)	
12-21-25	12	2.64 (104)	76.2 (3041)	5/8 FP 24IT	15.9 (625)			PRELOAD	ROOM	86700 (19500)	421 (62.5)					103 200 (23 300)	812 (74.3)	
-26		2.72 (107)	76.2 (3041)		16.1 (635)			STATIC	ROOM	-	-					110 200 (24 900)	832 (77.2)	
-27		2.64 (104)	76.2 (3041)		16.2 (637)			STATIC	422 (300)	-	-					98 200 (22 100)	479 (63.5)	
-28		2.72 (107)	76.2 (3041)		15.5 (610)			PRELOAD	422 (300)	86700 (19500)	418 (60.7)					104 200 (23 300)	815 (74.7)	
-29		2.64 (104)	76.2 (3041)	5/8 FP 24IT	15.8 (620)		1.5	PRELOAD	ROOM	124500 (28000)	601 (87.2)					163 200 (36 800)	740 (84.6)	
-30		2.64 (104)	76.3 (3043)		16.8 (660)		1.5	STATIC	ROOM	-	-					164 200 (37 000)	801 (84.8)	
-31		2.64 (104)	76.3 (3043)		16.0 (620)		1.5	STATIC	422 (300)	-	-					115 200 (25 900)	724 (80.1)	
-32		2.64 (104)	76.1 (3032)		16.5 (650)		1.5	PRELOAD	422 (300)	124500 (28000)	619 (89.9)					132 200 (29 800)	779 (105.1)	
-33		2.64 (104)	76.3 (3043)	3/8 FP 24IT	16.5 (650)		1.5	PRELOAD	ROOM	105400 (23800)	515 (74.8)					133 200 (29 800)	779 (105.1)	
-34		2.64 (104)	76.3 (3043)		16.3 (640)			STATIC	ROOM	105400 (23800)	515 (74.8)					132 200 (29 800)	779 (105.1)	
-35		2.64 (104)	76.3 (3043)	5/8 FP 24IT	16.3 (640)			STATIC	ROOM	-	-					132 200 (29 800)	779 (105.1)	
-36		2.72 (107)	76.2 (3041)		16.1 (635)			STATIC	422 (300)	-	-					107 200 (24 000)	506 (70.4)	
-37		2.64 (104)	76.1 (3032)		16.1 (635)			PRELOAD	422 (300)	105400 (23800)	511 (73.6)					104 200 (23 300)	511 (73.6)	
-38		2.72 (107)	76.1 (3041)		16.1 (635)			PRELOAD	ROOM	113200 (25400)	642 (92.4)					147 200 (33 200)	942 (133.3)	
-39		2.72 (107)	76.1 (3041)	3/8 FP 24IT	16.1 (635)		1.5	PRELOAD	ROOM	113200 (25400)	642 (92.4)					147 200 (33 200)	942 (133.3)	
-40		2.72 (107)	76.2 (3041)		16.2 (640)		1.5	STATIC	ROOM	-	-					138 200 (31 000)	844 (121.7)	
-41		2.72 (107)	76.1 (3041)		16.2 (640)		1.5	STATIC	422 (300)	-	-					141 200 (31 500)	844 (121.7)	
-42		2.64 (104)	76.1 (3041)		16.2 (640)		1.5	PRELOAD	422 (300)	113200 (25400)	719 (104.3)					155 200 (35 000)	781 (113.4)	
-43		2.64 (104)	76.1 (3041)		16.2 (640)		1.5	PRELOAD	ROOM	113200 (25400)	719 (104.3)					155 200 (35 000)	781 (113.4)	

ORIGINAL PAGE IS  
OF POOR QUALITY

12-21-25 (104/180) 2.5

WET SPECIMENS STATIC TEST DATA

SPE. NO.	LAYUP	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MM/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MM/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MM/m <sup>2</sup> (KSI)	
L2-21	L2	2.67 (.106)	76.1 (2.99)	1/8 FP SLIT	3.18 (.125)			PRELOAD STATIC	Room	110800 (24400)	570 (78.4)					182400 (41000)	881 (122.1)	ORIGINAL PAGE IS OF POOR QUALITY
-49		2.67 (.106)	76.1 (2.99)		3.30 (.130)			STATIC	Room	-	-					146800 (32800)	712 (101.4)	
-50		2.67 (.106)	76.1 (2.99)		3.18 (.125)			STATIC	422	-	-					138200 (30600)	694 (100.8)	
-51		2.67 (.106)	76.1 (2.99)		3.18 (.125)			PRELOAD STATIC	422	110800 (24400)	566 (82.2)					146800 (32800)	712 (101.4)	
-52		2.72 (.107)	76.2 (2.99)		3.05 (.120)			PRELOAD STATIC	Room	119700 (26400)	576 (82.6)					207000 (46000)	1006 (144.1)	
-61		2.67 (.106)	76.3 (3.00)	1/8 FP SLIT	3.18 (.125)	0	1.5 (.06)	STATIC	Room	-	-					203300 (45700)	989 (139.4)	
-62		2.67 (.106)	76.3 (3.00)		3.18 (.125)	0	1.5 (.06)	STATIC	422	-	-					164600 (36800)	808 (115.3)	
-63		2.67 (.106)	76.3 (3.00)		3.18 (.125)	0	1.5 (.06)	PRELOAD STATIC	422	119700 (26400)	576 (82.6)					164600 (36800)	808 (115.3)	
-64		2.67 (.106)	76.3 (3.00)		3.18 (.125)	0	1.5 (.06)	STATIC	Room	119700 (26400)	576 (82.6)					164600 (36800)	808 (115.3)	
L2-22		2.67 (.106)	76.2 (3.00)	5/8	15.88 (.625)			PRELOAD STATIC	Room	79200 (17800)	404 (58.2)					129900 (29200)	663 (94.2)	LOW PRESSURE CORE 345 kPa (50 psi)
-1		2.67 (.106)	76.2 (3.00)		15.88 (.625)			STATIC	Room	-	-					117000 (26200)	576 (82.6)	
-2		2.72 (.107)	76.3 (3.01)		15.88 (.625)			STATIC	422	-	-					102300 (22800)	493 (71.6)	
-3		2.67 (.106)	76.3 (3.01)		15.88 (.625)			PRELOAD STATIC	422	79200 (17800)	397 (57.0)					93400 (21000)	468 (67.9)	LOW PRESSURE CORE
-4		2.67 (.106)	76.2 (3.00)	5/8	15.88 (.625)			STATIC	Room	80900 (18200)	394 (57.2)					119200 (26600)	580 (84.2)	172 kPa (25 psi)
L2-23		2.67 (.106)	76.2 (3.01)		15.88 (.625)			PRELOAD STATIC	Room	119700 (26400)	576 (82.6)					120100 (26900)	574 (83.3)	
-1		2.74 (.108)	76.3 (3.00)		15.88 (.625)			STATIC	422	-	-					90700 (20400)	433 (62.9)	
-2		2.74 (.108)	76.2 (3.00)		15.88 (.625)			PRELOAD STATIC	422	80950 (18200)	394 (57.2)					92100 (20700)	449 (65.1)	
-3		2.67 (.106)	76.3 (3.00)		15.88 (.625)			PRELOAD STATIC	422	119700 (26400)	576 (82.6)					129900 (29200)	663 (94.2)	
-4		2.67 (.106)	76.3 (3.00)		15.88 (.625)			PRELOAD STATIC	422	119700 (26400)	576 (82.6)					129900 (29200)	663 (94.2)	

[2] L2 [(0.1 ± 80)2]5

WET SPALLING STATIC TEST DATA

SPEC. NO.	LAYUP	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH (INCH)		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STRESS		REMARKS	
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)		
L2-24	L2	2.74 (.108)	76.2 (3.000)	5/8	15.9 (.625)			PRELOAD	ROOM	81800 (20400)	42.9 (62.3)					129000 (29000)	6.17 (89.3)	Low pressure core 96 kPa (12.5 psi)	
-1				FP MARK			STATIC	ROOM	-	-						115200 (25900)	5.51 (79.9)		
-2							STATIC	422								95600 (21500)	4.57 (66.3)		
-3							STATIC									89800 (20200)	4.42 (64.7)		
-4						PRELOAD	422	81800 (20400)	44.6 (64.7)						20200 (4547)	6.47 (92.4)			
L3-21	L3	2.62 (.103)	76.3 (3.002)	1/8	2.18 (.122)			PRELOAD	ROOM	105000 (23400)	58.6 (84.7)					176600 (39700)	6.84 (99.3)		
-1				FP MARK			STATIC	ROOM	-	-						128300 (28900)	6.57 (95.3)		
-2							STATIC									120100 (26900)	6.33 (91.8)		
-3							STATIC	422								98200 (22100)	4.93 (71.3)		
-4						PRELOAD	422	105000 (23400)	55.3 (80.2)						100000 (22300)	5.11 (74.2)			
-5						PRELOAD		FP MARK	ROOM	81400 (18300)	40.8 (59.2)					104800 (23500)	5.34 (77.5)		
-6						STATIC			ROOM	-	-					84500 (19000)	4.45 (64.3)		
-7						STATIC			422							87600 (19700)	4.43 (64.3)		
-8						PRELOAD		FP MARK	422	81400 (18300)	42.9 (62.2)					89000 (20000)	4.46 (64.7)		
-9						STATIC			ROOM	15800 (3530)	3.23 (51.3)					82700 (18600)	4.31 (62.4)		
-10						STATIC			ROOM	-	-					81400 (18300)	4.28 (62.2)		
-11						PRELOAD		FP MARK	422	17900 (4000)	32.8 (51.4)					118300 (26500)	6.22 (89.3)		
-12						STATIC			422										

ORIGINAL PAGE  
OF POOR QUALITY

L2 L3 [(O<sub>2</sub> / ± 80) / 2]<sub>1</sub>  
L3 [(O<sub>2</sub> / ± 30 / 0) / 2]<sub>1</sub> \* 5-CLASS TAY

ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

SPEC. NO.	WGT	SPECIMEN				STATIC TEST DATA				TEST TYPE	TEST TEMP.	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
		LAYOUT	THICKNESS	WIDTH	FLAW TYPE	FRONT	BACK	FLAW DEPTH	FLAW LENGTH			LOAD	STRESS	MAX LOAD	MAX STRESS	R	CYCLES	LOAD	STRESS	
			mm (INCH)	mm (INCH)		mm (INCH)	mm (INCH)	mm (INCH)			N (LB)	MIN/m <sup>2</sup> (KSI)	N (LB)	MIN/m <sup>2</sup> (KSI)			N (LB)	MIN/m <sup>2</sup> (KSI)		
12-21		13	2.51 (.099)	76.2 (3.00)	1/8 HP SLT	2.79 (.110)	0	1.5 (.06)	PRELOAD	Room	134 800 (30 300)	6.99 (101.3)					153 800 (34 200)	79.6 (115.5)		
-21			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	Room							157 500 (35 400)	81.3 (118.0)		
-22			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	422							132 100 (29 700)	66.9 (97.1)		
-23			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	422							132 300 (29 700)	67.0 (97.1)		
-24			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	PRELOAD	Room	134 800 (30 300)	6.99 (101.3)					149 000 (33 500)	78.5 (114.0)		
-25			2.51 (.099)	76.2 (3.00)	3/8 HP SLT	2.79 (.110)	0	1.5 (.06)	STATIC	Room	128 100 (28 800)	6.75 (98.4)					166 800 (37 500)	84.4 (122.2)		
-26			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	Room							131 200 (29 500)	67.0 (97.3)		
-27			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	422							122 800 (27 800)	63.9 (92.8)		
-28			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	PRELOAD	Room	128 100 (28 800)	6.75 (98.4)					131 700 (29 600)	69.3 (100.4)		
-29			2.51 (.099)	76.2 (3.00)	6/8 HP SLT	2.79 (.110)	0	1.5 (.06)	STATIC	Room	122 300 (27 500)	6.44 (93.2)					174 800 (39 300)	88.5 (128.4)		
-30			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	Room							94 300 (21 200)	49.2 (71.2)		
-31			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	422							116 100 (26 100)	59.2 (86.0)		
-32			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	PRELOAD	Room	122 300 (27 500)	6.44 (93.2)					134 300 (30 200)	69.7 (100.7)		
-41			2.51 (.099)	76.2 (3.00)	1/8 HP SLT	2.79 (.110)	0	1.5 (.06)	STATIC	Room	106 700 (24 000)	5.41 (78.5)					133 900 (30 100)	67.8 (98.1)		
-42			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	Room							120 100 (27 000)	62.0 (90.0)		
-43			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	STATIC	422							123 700 (27 800)	65.8 (95.5)		
-44			2.51 (.099)	76.2 (3.00)		2.79 (.110)	0	1.5 (.06)	PRELOAD	Room	106 700 (24 000)	5.41 (78.5)								

13- L3 [(0/30/0/-30/0)2]6 \* S-GLASS PLY



# WET SPECIMEN STATIC TEST DATA

SPEC. NO.	LAYUP	THICK. INCH	WIDTH INCH	FLAW TYPE	FLAW LENGTH INCH		FLAW DEPTH INCH	TEST TYPE	TEST TEMP. °F	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT INCH	BACK INCH				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX. LOAD N (LB)	MAX. STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
L3-22	13-2	2.74 (.108)	76.2 (3.002)	S/E	15.9 (.625)			PRELOAD	Room	54300 (12200)	260 (37.7)					104300 (23900)	508 (73.8)	
-5		2.64 (.104)	76.2 (3.002)	FP S/LIT	16.3 (.642)			STATIC	Room	-	-					116100 (26100)	517 (73.7)	
-6		2.74 (.108)	76.2 (3.002)		16.3 (.642)			STATIC	422 (300)	-	-					93400 (20900)	444 (64.5)	
-7		2.62 (.103)	76.2 (3.002)		16.0 (.630)			PRELOAD	422 (300)	54300 (12200)	272 (39.5)					83200 (18700)	417 (60.5)	
-8		2.74 (.108)	76.3 (3.003)	UO				STATIC	Room	-	-					245000 (55100)	1171 (169.9)	
-9		2.67 (.105)	76.3 (3.003)	DEFEAT	15.9 (.625)			PRELOAD	Room	54300 (12200)	267 (38.7)					98800 (22200)	485 (68.5)	
-21		2.67 (.105)	76.2 (3.002)	S/E	15.9 (.625)			STATIC	Room	-	-					101400 (22800)	449 (64.9)	
-22		2.67 (.105)	76.2 (3.002)	FP HOLE	15.9 (.625)			STATIC	422 (300)	-	-					94300 (21200)	455 (64.0)	
-23		2.72 (.107)	76.2 (3.001)		15.9 (.625)			STATIC	422 (300)	-	-					85400 (19200)	424 (60.5)	
-24		2.64 (.104)	76.3 (3.002)		15.9 (.625)			PRELOAD	422 (300)	54300 (12200)	269 (39.1)							

ORIGINAL PAGE IS  
OF POOR QUALITY

L3-2 [W 1330/0 (-30/0)]<sub>2</sub> ALL GRAPHIC FILES

CYCLIC DATA  
ROOM TEMPERATURE DRY TESTS

SPEC. NO.	LAYUP	THICK. NESS	WIDTH	FLAW TYPE	FLAW LENGTH		FLAW DEPTH	TEST TYPE	TEST TEMP.	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT	BACK				LOAD	STRESS	MAX. LOAD	MAX. STRESS	R	CYCLES	LOAD	STRESS	
		mm	mm		mm	mm	mm		°K	(LB)	(KSI)	(LB)	(KSI)	(LB)	(KSI)	(LB)	(KSI)	
L1-31	U	2.84	75.0	5/8 FP	15.9	-	THRU	CYCLIC	ROOM	-	-	46,700	207	0.05	10 <sup>6</sup>	71,600	336	COMPRESSIVE OVERLOAD FATIGUE SPECIFIED
-32	L1	(.1118)	(2.9518)	HOLE	(.624)	-	↑	↑	↑	-	-	(10800)	(30.1)	↑	10 <sup>6</sup>	(16100)	(49.8)	
-33		2.73	76.1	5/8 FP	15.9	-	THRU	PRELOAD CYCLIC	↑	-	-	46,700	224	↑	10 <sup>7</sup>	81,200	370	
-34		(.1075)	(2.4657)	SLIT	(.624)	-	↑	↑	↑	48,900	235	(10800)	(32.6)	↑	10 <sup>7</sup>	(16100)	(50.7)	
-35		2.74	74.6	5/8 FP	15.9	-	THRU	CYCLIC	ROOM	(11000)	(34.1)	46,700	224	0.05	10 <sup>7</sup>	77,800	374	
-36		(.1093)	(2.9310)	SLIT	(.624)	-	↑	↑	↑	(11000)	(34.1)	(10800)	(32.6)	↑	10 <sup>7</sup>	(17500)	(51.3)	
-37		2.77	74.5	5/8 FP	16.1	15.9	THRU	CYCLIC	ROOM	-	-	46,700	226	0.05	10 <sup>6</sup>	66,700	323	
-38		(.1080)	(2.9345)	SLIT	(.632)	(.623)	↑	↑	↑	-	-	(102500)	(32.8)	↑	10 <sup>6</sup>	(15000)	(46.9)	
-39		2.81	75.2	5/8 FP	16.2	15.9	THRU	PRELOAD CYCLIC	↑	-	-	46,700	220	↑	7x10 <sup>6</sup>	-	-	
-40		(.1107)	(2.9088)	SLIT	(.637)	(.623)	↑	↑	↑	48,900	234	(10300)	(32.0)	↑	10 <sup>7</sup>	71,600	372	
-41		2.78	75.0	5/8 FP	16.1	15.9	THRU	CYCLIC	ROOM	(11000)	(34.0)	(10500)	(32.5)	↑	10 <sup>7</sup>	(17400)	(54.0)	
-42		(.1093)	(2.9314)	SLIT	(.635)	(.623)	↑	↑	↑	(11000)	(34.0)	(10500)	(32.5)	↑	10 <sup>7</sup>	(17400)	(54.0)	
-43		2.78	74.3	5/8 FP	15.9	-	THRU	CYCLIC	ROOM	-	-	40,000	193	-1.0	12,970	-	-	
-44		(.1053)	(2.669)	HOLE	(.624)	-	↑	↑	↑	-	-	(9000)	(28.1)	-1.0	12,970	-	-	
-45		2.82	76.4	5/8 FP	15.9	-	THRU	↑	↑	-	-	37,200	175	↑	12,320	-	-	
-46		(.1110)	(3.0081)	SLIT	(.627)	-	↑	↑	↑	-	-	(8300)	(25.3)	↑	12,320	-	-	
-47		2.81	76.3	5/8 FP	16.0	-	THRU	PRELOAD CYCLIC	↑	48,900	227	37,800	175	↑	70,000	-	-	
-48		(.1108)	(3.0071)	SLIT	(.629)	-	↑	↑	↑	(11000)	(33.1)	(8300)	(25.3)	↑	70,000	-	-	
-49		2.81	74.9	5/8 FP	15.9	16.1	THRU	CYCLIC	ROOM	-	-	40,000	190	-1.0	10,730	-	-	
-50		(.1105)	(2.900)	SLIT	(.624)	(.632)	↑	↑	↑	-	-	(9000)	(27.6)	-1.0	10,730	-	-	
-51		2.84	75.0	5/8 FP	15.9	16.1	THRU	↑	↑	-	-	37,800	176	↑	219,320	-	-	
-52		(.1120)	(2.954)	SLIT	(.624)	(.634)	↑	↑	↑	-	-	(8300)	(25.7)	↑	219,320	-	-	
-53		2.73	75.2	5/8 FP	16.2	16.0	THRU	PRELOAD CYCLIC	↑	48,900	238	37,800	183	↑	16,700	-	-	
-54		(.1075)	(2.9310)	SLIT	(.637)	(.630)	↑	↑	↑	(11000)	(34.6)	(9300)	(26.7)	↑	16,700	-	-	

ORIGINAL PAGE 16  
OF POOR QUALITY

CONTINUOUS OVERLOAD  
DURING SPECIFIED

ORIGINAL PAGE 18  
OF POOR QUALITY

U1 - [(0.245/0.90) 5] 2  
13 - FAILURE DURING FATIGUE TEST

CYCLIC DATA ROOM TEMPERATURE WET TESTS

SPEC. NO.	LAYUP	TEMPERATURE		FLAW TYPE	FLAW LENGTH		FLAW DEPTH	TEST TYPE	TEST TEMP.	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
		THICK. (INCH)	WIDTH (INCH)		FRONT (INCH)	BACK (INCH)				LOAD (LB)	STRESS MN/in <sup>2</sup> (KSI)	MAX. LOAD (LB)	MAX. STRESS MN/in <sup>2</sup> (KSI)	R	CYCLES	LOAD (LB)	STRESS MN/in <sup>2</sup> (KSI)	
L1-31-24	L1	2.87 (1150)	75.1 (2955)	5/8 PP	15.9 (.62)	-	THRU	CYCLIC	Room Temp	-	-	46,700 (10,500)	216 (31.4)	0.05	10 <sup>3</sup>	71,600 (16,100)	332 (48.2)	
-43		2.86 (1135)	74.8 (2943)		15.8 (.619)	-				-	-	46,700 (10,500)	216 (31.4)		10 <sup>6</sup>	71,100 (15,825)	327 (47.1)	
-40		2.84 (1120)	76.3 (2998)		15.9 (.623)	-				-	-	46,700 (10,500)	216 (31.4)		10 <sup>7</sup>	74,100 (16,475)	324 (46.8)	
-44		2.79 (1095)	75.2 (2961)		15.9 (.62)	-		PRELOAD CYCLIC		48,900 (11,000)	233 (33.9)	46,700 (10,500)	222 (32.3)		10 <sup>3</sup>	71,500 (16,075)	340 (49.3)	
-47		2.75 (1081)	74.6 (2938)		15.9 (.62)	-				48,900 (11,000)	237 (34.2)	46,700 (10,500)	227 (33.0)		10 <sup>6</sup>	70,500 (15,500)	372 (53.0)	
L1-31-25		2.77 (1090)	75.0 (2941)	5/8 PP SLIT	16.7 (.658)	16.6 (.652)		CYCLIC		-	-	46,700 (10,500)	224 (32.6)		10 <sup>3</sup>	73,200 (16,225)	364 (52.2)	
-26		2.81 (1105)	74.8 (2946)		16.1 (.635)	15.8 (.622)				-	-	46,700 (10,500)	222 (32.3)		10 <sup>6</sup>	74,800 (16,525)	356 (51.7)	
-27		2.78 (1095)	75.2 (2961)		16.0 (.630)	16.2 (.638)				-	-	46,700 (10,500)	223 (32.4)		10 <sup>7</sup>	76,500 (17,000)	345 (50.0)	
-46		2.74 (1078)	74.6 (2938)		16.2 (.636)	16.0 (.624)		PRELOAD CYCLIC		48,900 (11,000)	239 (34.7)	46,700 (10,500)	228 (33.1)		10 <sup>5</sup>	76,400 (17,125)	373 (53.3)	
-47		2.73 (1073)	75.1 (2956)		16.2 (.638)	16.1 (.632)				48,900 (11,000)	238 (34.6)	46,700 (10,500)	227 (33.0)		10 <sup>6</sup>	80,400 (18,125)	392 (56.0)	

ORIGINAL PAGE IS  
OF POOR QUALITY

L1 [(10/245/0/40)<sub>5</sub>]<sub>2</sub>

ORIGINAL PAGE IS  
OF POOR QUALITY



CYCLIC DATA  
ROOM TEMPERATURE WET TESTS

SPEC. NO.	LAYUP	THICK. mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH (INCH)		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX. LOAD N (LB)	MAX. STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
11-31	L1	2.62 (1113)	76.4 (3007)	S/G FP none	15.8 (423)	-	THRU	CYCLIC	ROOM TEMP	-	-	40000 (9000)	183 (26.6)	-1	10 <sup>3</sup>	64800 (14515)	296 (43.1)	
- 94		2.83 (1119)	76.0 (2992)		15.9 (423)	-				-	-	40000 (9000)	185 (27.0)		450	-	-	
- 95		2.86 (1123)	75.1 (2954)		15.8 (423)	-				-	-	37800 (8500)	176 (25.6)		1350	-	-	
- 96		2.83 (1116)	75.2 (2960)		15.9 (423)	-		PRELOAD CYCLIC		48900 (11000)	229 (33.3)	40000 (9000)	187 (27.2)		10 <sup>3</sup>	64800 (14515)	327 (47.5)	
- 70		2.71 (1046)	76.1 (2991)		15.9 (427)	-				48900 (11000)	227 (34.4)	40000 (9000)	194 (28.2)		1250	-	-	
11-31		2.78 (1093)	75.1 (2954)	S/G FP none	16.1 (423)	15.9 (421)	THRU	CYCLIC		-	-	40000 (9000)	191 (27.8)	-1.0	750	-	-	
- 31		2.81 (1103)	75.1 (2954)		16.1 (424)	16.0 (424)				-	-	40000 (9000)	189 (27.5)		650	-	-	
- 32		2.86 (1123)	75.0 (2953)		16.1 (432)	16.0 (430)				-	-	37800 (8500)	176 (25.6)		2800	-	-	
- 33		2.77 (1090)	75.1 (2954)		16.2 (424)	15.9 (424)		PRELOAD CYCLIC		48900 (11000)	235 (34.2)	40000 (9000)	192 (27.9)		750	-	-	
- 50		2.82 (1112)	74.4 (2931)		15.8 (423)	16.0 (430)				48900 (11000)	232 (33.7)	40000 (9000)	190 (27.6)		1100	-	-	

ORIGINAL PAGE IS  
OF POOR QUALITY

11-31 - (10/25/0/90)8<sub>2</sub>  
FAILURE OVER 10% CYCLIC TEST

CYCLIC U.M.A.

422K (300°F) DRY TESTS

SPEC. NO.	LAYUP	THICK. INCH		WIDTH INCH		FLAW TYPE	FLAW LENGTH INCH		FLAW DEPTH INCH	TEST TYPE	TEST TEMP. °F	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
		min	max	min	max		LOAD N (LB)	STRESS MN/in <sup>2</sup> (KSI)				MAX. LOAD N (LB)	MAX. STRESS MN/in <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/in <sup>2</sup> (KSI)			
L1-31	L1	2.85 (.1123)	74.7 (2.981)	5/8 FP HOLE	15.9 (.623)		THRU	CYCLIC	422 (300)	—	—	46,700 (10,500)	219 (31.8)	0.05	10 <sup>3</sup>	73,200 (16,430)	343 (49.8)	ORIGINAL PAGE IS OF POOR QUALITY  CONTINUOUS STRESS AND DYNAMIC CYCLIC LOADING  STATIC FAILURE DURING PRELOAD		
- 32		2.75 (.1084)	74.9 (2.949)		15.9 (.623)					—	—	46,700 (10,500)	226 (32.8)		10 <sup>6</sup>	87,100 (19,575)	42.1 (6.12)			
- 33		2.81 (.1106)	74.8 (2.943)		15.9 (.626)					—	—	46,700 (10,500)	222 (32.2)		10 <sup>7</sup>	77,400 (17,400)	24.8 (3.54)			
- 34		2.81 (.1106)	74.5 (2.933)		15.9 (.626)			PRELOAD CYCLIC		48,900 (11,000)	234 (34.0)	46,700 (10,500)	223 (32.4)		10 <sup>3</sup>	74,600 (16,725)	35.2 (5.11)			
- 75		2.76 (.1093)	75.2 (2.961)		15.9 (.626)					48,900 (11,000)	234 (34.0)	46,700 (10,500)	223 (32.4)		10 <sup>6</sup>	75,300 (16,913)	36.0 (5.23)			
- 76																				
L1-31		2.82 (.1112)	75.0 (2.931)	5/8 FP SUT	16.0 (.631)	16.1 (.634)	THRU	CYCLIC	422 (300)	—	—	46,700 (10,500)	220 (32.0)	0.05	10 <sup>3</sup>	69,900 (15,500)	327 (47.5)			
- 31		2.74 (.1080)	74.3 (2.926)		16.1 (.636)	16.0 (.629)				—	—	46,700 (10,500)	228 (33.2)		10 <sup>6</sup>	94,000 (21,125)	46.0 (6.63)			
- 48		2.79 (.1100)	75.1 (2.956)		15.8 (.622)	16.2 (.631)				—	—	46,700 (10,500)	222 (32.3)		2,000,000	—	—			
- 39		2.75 (.1082)	75.0 (2.951)		16.1 (.634)	15.9 (.627)		PRELOAD CYCLIC		48,900 (11,000)	236 (34.4)	46,700 (10,500)	225 (32.5)		10 <sup>3</sup>	65,500 (14,713)	316 (45.0)			
- 55		2.70 (.1063)	74.9 (2.930)		16.2 (.631)	16.0 (.621)				—	—	—	—		—	—	—			
- 56		2.74 (.1080)	75.0 (2.934)		16.2 (.631)	16.0 (.621)				48,900 (11,000)	237 (34.5)	46,700 (10,500)	226 (32.6)		10 <sup>6</sup>	92,100 (18,430)	39.8 (5.78)			
- 61																				

ORIGINAL PAGE IS  
OF POOR QUALITYCONTINUOUS STRESS AND  
DYNAMIC CYCLIC LOADINGSTATIC FAILURE DURING  
PRELOADL1 - [(10/245/0/40)S]<sub>2</sub>  
CYCLIC TEST TEMPERATURE - ROOM TEMPERATURE STATIC

CYCLIC DATA  
422 K (300°F) DRY TESTS

ORIGINAL PAGE IS  
OF POOR QUALITY

SPEC. NO.	LAYUP	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH mm (INCH)		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STATIC		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
11-31 - 87	L1	2.86 (.113)	74.5 (2.93)	5/8 FP HOLE	15.9 (.628)		THRU	CYCLIC	422 (300)	-	-	40000 (9000)	187 (27.2)	-1.0	13	-	-	
- 88		2.77 (.109)	76.1 (2.99)		15.9 (.628)					-	-	40000 (9000)	189 (27.5)		117	-	-	
- 89		2.80 (.110)	75.1 (2.95)		15.9 (.628)					-	-	37800 (8500)	179 (26.1)		41	-	-	
- 78		2.75 (.108)	74.3 (2.92)		15.9 (.628)			PRELOAD CYCLIC		48900 (11000)	239 (34.8)	40000 (9000)			197	-	-	
- 79		2.78 (.109)	76.4 (2.99)		15.9 (.628)					48900 (11000)	230 (33.4)	40000 (9000)	188 (27.3)		25	-	-	
11-31 - 42	L1	2.73 (.107)	75.1 (2.95)	5/8 FP S&H	16.3 (.640)	16.1 (.632)	THRU	CYCLIC	422 (300)	-	-	40000 (9000)	194 (28.3)	-1.0	25	-	-	
- 43		2.77 (.109)	75.0 (2.95)		16.2 (.638)	16.3 (.640)				-	-	40000 (9000)	192 (27.7)		1750	-	-	
- 44		2.77 (.109)	75.0 (2.95)		16.2 (.638)	16.0 (.630)				-	-	37800 (8500)	181 (26.4)		1550	-	-	
- 58		2.76 (.108)	75.2 (2.97)		16.0 (.636)	16.2 (.640)		PRELOAD CYCLIC		48900 (11000)	236 (34.3)	40000 (9000)	193 (28.0)		3	-	-	
- 59		2.79 (.109)	75.2 (2.97)		16.1 (.632)	15.9 (.626)				48900 (11000)	233 (33.8)	39100 (8800)	186 (27.1)		2	-	-	

ORIGINAL PAGE IS  
OF POOR QUALITY

D L1 [(0.245/0.90)<sub>2</sub>]  
E CYCLIC TEST TEMPERATURE ROOM TEMPERATURE 300°F  
F FAILURE DUE TO FATIGUE TEST

CYCLIC DATA 12  
422 K (300 °F) WET TESTS

TESTS										WET										300°F										422 K									
SPEC NO.	LAYUP	THICKNESS	WIDTH	FLAW TYPE	FLAW LENGTH		FLAW DEPTH	TEST TYPE	TEST TEMP.	PRELOAD		CYCLIC LOADING		RESIDUAL STATIC		REMARKS																							
					FRONT	BACK				LOAD	STRESS	MAX LOAD	MAX STRESS	R	CYCLES		LOAD	STRESS																					
		mm (INCH)	mm (INCH)		mm (INCH)	mm (INCH)	mm (INCH)		°K (°F)	N (LB)	MM/m <sup>2</sup> (KSI)	N (LB)	MM/m <sup>2</sup> (KSI)	N (LB)	MM/m <sup>2</sup> (KSI)																								
L1-21	L1	2.87 (.113)	76.3 (3.004)	S/B FP HOLE	15.9 (.625)		THRU	CYCLIC	422 (3200)			46700 (10500)	212 (30.9)	0.05	10 <sup>3</sup>	81300 (18315)	370 (53.8)																						
-91		2.82 (.111)	75.0 (2.954)		15.8 (.624)							46700 (10500)	220 (32.0)		10 <sup>6</sup>	76800 (17275)	362 (52.7)																						
-92		2.85 (.112)	78.7 (3.100)		15.9 (.625)							46700 (10500)	207 (30.6)		10 <sup>7</sup>	91400 (20540)	406 (59.0)																						
-93		2.77 (.109)	76.0 (2.992)		15.1 (.624)			PRELOAD CYCLIC		48900 (11000)	230 (33.3)	46700 (10500)	220 (32.0)		10 <sup>3</sup>	74800 (16855)	353 (51.3)	COMPRESSIVE OVERLOAD DURING FATIGUE TEST																					
-68		2.78 (.109)	74.4 (2.944)		15.9 (.624)					48900 (11000)	234 (34.1)	46700 (10500)	224 (32.5)		11	-	-																						
L1-31	L1	2.73 (.107)	75.3 (2.969)	S/B FP SLIT	16.2 (.639)	16.0 (.629)	THRU	CYCLIC	422 (3200)			46700 (10500)	227 (33.0)	0.05	10 <sup>3</sup>	74640 (16780)	363 (52.7)																						
-28		2.68 (.105)	75.2 (2.960)		15.9 (.624)	16.1 (.633)						46700 (10500)	231 (33.4)		10 <sup>6</sup>	83500 (18780)	413 (60.1)																						
-29		2.69 (.106)	75.2 (2.960)		16.0 (.630)	16.1 (.633)						46700 (10500)	230 (33.3)		10 <sup>2</sup>	-	-	COMPRESSIVE OVERLOAD DURING FATIGUE TEST																					
-30		2.86 (.112)	74.9 (2.949)		16.1 (.634)	16.0 (.629)		PRELOAD CYCLIC		48900 (11000)	228 (33.2)	46700 (10500)	218 (31.7)		10 <sup>3</sup>	84500 (19060)	394 (57.3)																						
-48		2.72 (.107)	74.9 (2.950)		16.1 (.634)	15.9 (.627)				48900 (11000)	240 (34.8)	46700 (10500)	229 (33.3)		10 <sup>6</sup>	83200 (18700)	408 (59.2)																						

O'ORIGINAL PAGE  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

12 L1 - [(0.445/0.40)] 2  
12 CYCLIC TEST TEMPERATURE - ROOM TEMPERATURE STATIC

CYCLIC DATA  
422 K (300 °F) WST

SPEC. NO.	LAYUP	THICKNESS mm (INCH)	WIDTH mm (INCH)	FLAW TYPE	FLAW LENGTH mm (INCH)		FLAW DEPTH mm (INCH)	TEST TYPE	TEST TEMP. °K (°F)	PRELOAD		CYCLIC LOADING				RESIDUAL STRESS		REMARKS
					FRONT mm (INCH)	BACK mm (INCH)				LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	MAX LOAD N (LB)	MAX STRESS MN/m <sup>2</sup> (KSI)	R	CYCLES	LOAD N (LB)	STRESS MN/m <sup>2</sup> (KSI)	
11-31	L1	2.63 (.113)	74.6 (2.937)	5/8 SP HOLE	16.1 (.634)		THRU	CYCLIC	422 (300)	-	-	13,300 (3,000)	63 (9.11)	-1.0	3	6,100 (1,375)	289 (42.1)	OVERLOADS + (15,700) - (710)
-97		2.86 (.113)	75.2 (2.959)		15.9 (.626)					-	-	13,300 (3,000)	61 (8.94)		10	-	-	
-98		2.86 (.113)	75.2 (2.959)		15.9 (.626)					-	-	13,300 (3,000)	60 (8.85)		10	78,300 (17,400)	357 (51.9)	
-99		2.86 (.113)	75.2 (2.959)		15.9 (.626)			PRELOAD		48,900 (11,000)	238 (34.6)	13,300 (3,000)	64 (9.42)		10	57,900 (12,915)	281 (40.9)	
-72		2.73 (.107)	75.2 (2.959)		16.0 (.630)			CYCLIC		48,900 (11,000)	237 (34.4)	13,300 (3,000)	64 (9.38)		10	64,500 (14,500)	312 (45.3)	
-73		2.77 (.109)	74.3 (2.929)		15.9 (.626)													
11-31	L1	2.86 (.113)	75.2 (2.959)	5/8 SP HOLE	16.1 (.634)		THRU	CYCLIC	422 (300)	-	-	26,700 (6,000)	122 (17.8)	-1.0	2	-	-	
-34		2.69 (.106)	74.6 (2.937)		16.2 (.638)					-	-	28,900 (6,500)	143 (20.8)		1	-	-	
-45		2.81 (.110)	74.7 (2.941)		16.0 (.630)					-	-	21,800 (4,910)	103 (15.1)		1	-	-	CYCLIC LOADS { +21870 (4910) -21900 (4920)
-60		2.81 (.110)	75.1 (2.953)		15.9 (.627)			PRELOAD		48,900 (11,000)	232 (33.7)	33,800 (7,600)	140 (20.3)		3	-	-	CYCLIC LOADS { +33800 (7600) -33200 (7390)
-52		2.81 (.110)	74.9 (2.946)		16.0 (.630)			CYCLIC		48,900 (11,000)	240 (34.9)	13,300 (3,000)	65 (9.51)		10	74,200 (16,670)	364 (52.8)	
-53		2.72 (.107)	74.9 (2.946)		15.9 (.626)													
11-31	L1	2.78 (.109)	75.2 (2.959)	5/8 SP HOLE	15.9 (.625)		THRU	STATIC	422 (300)	-	-	-	-	-	-	-20,100 (-4,510)	-95 (-13.9)	COMPRESSION STATIC TEST
-100																		

FAILURE DURING FATIGUE TEST

11-31 - [10/245/0/90] 1/2

12 CYCLIC TEST TEMPERATURE - ROOM TEMPERATURE STATIC  
13 SPECIMEN 11-31-100 STATIC TESTED AT 300 °F WST COMPRESSION

PRECEDING PAGE BLANK NOT FILMED

## APPENDIX B

### WIDTH EFFECT TEST SPECIMEN GROWTH DATA

This appendix contains the ultrasonic scan and crack opening displacement COD data for the width effect tests. Since some of these tests were compression loaded, the COD record indicates closing displacement.

PRECEDING PAGE BLANK NOT FILMED

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA



NO PRELOAD

BEFORE TEST

LAMINATE

SPECIMEN NO. LI-31A-1

DEFECT

TEST TYPE

AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

CYCLES

CYCLES

ULTRASONIC C-SCAN DATA



NO PRELOAD

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

MAXIMUM LOAD

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

LAMINATE

SPECIMEN NO. L1-31A-2


DEFECT

TEST TYPE

ORIGINAL PAGE IS  
OF POOR QUALITY



ULTRASONIC C-SCAN DATA

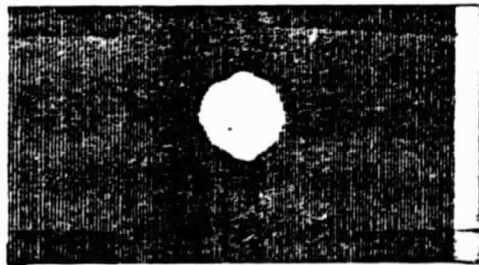

BEFORE TEST

AFTER PRELOAD  
AFTER IMPACT

MAXIMUM LOAD 30 IN-LB

AFTER MOISTURE CONDITIONING



CYCLES

CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE


LAMINATE

SPECIMEN NO. L1-31A-3


DEFECT

TEST TYPE

ULTRASONIC C-SCAN DATA

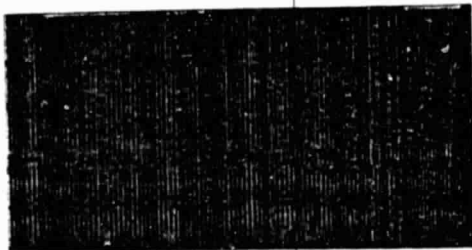

BEFORE TEST

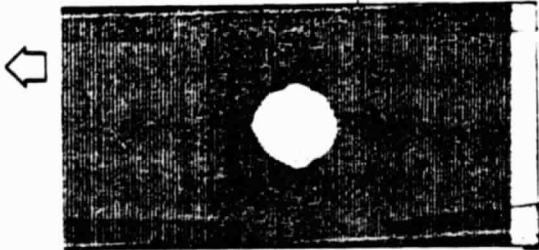

AFTER PRELOAD  
AFTER IMPACT

MAXIMUM LOAD 30 IN-LB

AFTER MOISTURE CONDITIONING

↑ CYCLES

↑ CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE


LAMINATE

SPECIMEN NO. L1-31A-4


DEFECT

TEST TYPE

ULTRASONIC C-SCAN DATA

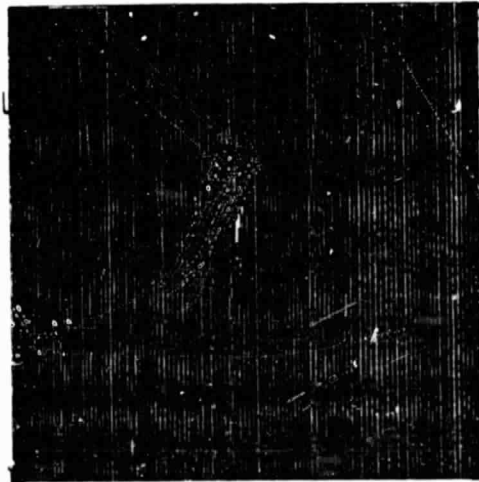

No PRE LOAD



AFTER MOISTURE CONDITIONING

AFTER PRELOAD

BEFORE TEST

CYCLIC LOAD \_\_\_\_\_  
R RATIO \_\_\_\_\_  
TEST TEMPERATURE \_\_\_\_\_

MAXIMUM LOAD \_\_\_\_\_

LAMINATE \_\_\_\_\_  
SPECIMEN NO. L1-31A-5  
DEFECT \_\_\_\_\_  
TEST TYPE \_\_\_\_\_

ULTRASONIC C-SCAN DATA



NO PRELOAD

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING

\_\_\_\_\_ CYCLES

\_\_\_\_\_ CYCLES

CYCLIC LOAD \_\_\_\_\_

R RATIO \_\_\_\_\_

TEST TEMPERATURE \_\_\_\_\_



LAMINATE \_\_\_\_\_

SPECIMEN NO. LI-31A-6

DEFECT \_\_\_\_\_

TEST TYPE \_\_\_\_\_

ULTRASONIC C-SCAN DATA

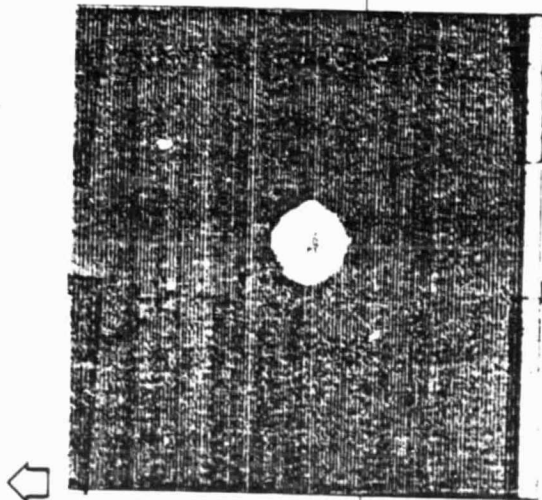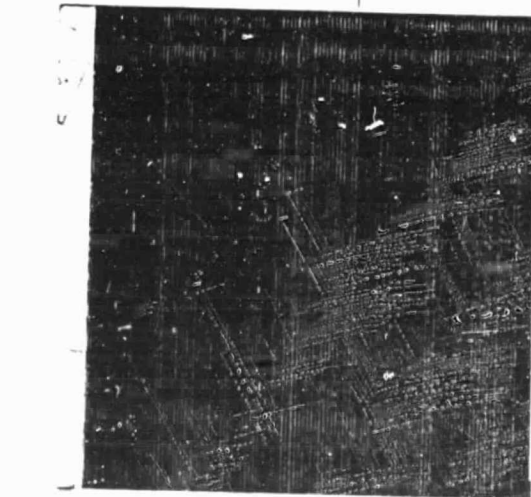

BEFORE TEST  
AFTER PRELOAD  
AFTER MOISTURE CONDITIONING  
AFTER IMPACT  
30 1/2-18




CYCLES

CYCLES


CYCLIC LOAD  
R RATIO  
TEST TEMPERATURE

LAMINATE  
SPECIMEN NO. L1-31A-7  
DEFECT  
TEST TYPE

ULTRASONIC C-SCAN DATA

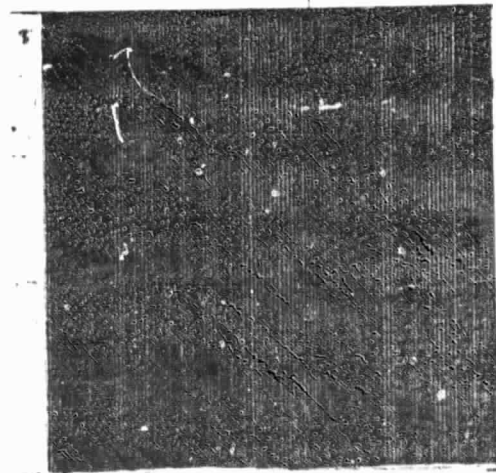

BEFORE TEST

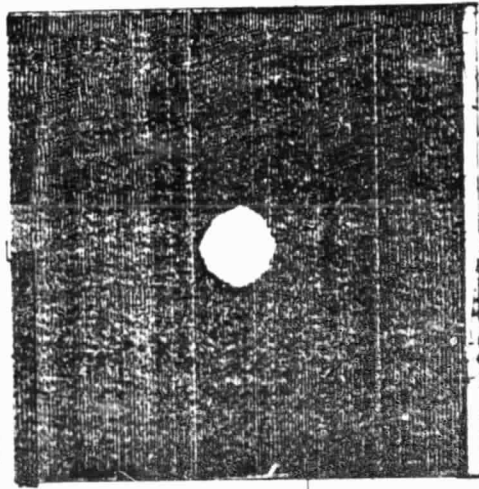

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

AFTER 1 MONET  
30 - 12 - LB

LAMINATE

SPECIMEN NO. LI-31A-8

DEFECT

TEST TYPE

CYCLIC LOAD


R RATIO

TEST TEMPERATURE

CYCLES

CYCLES

ULTRASONIC C-SCAN DATA

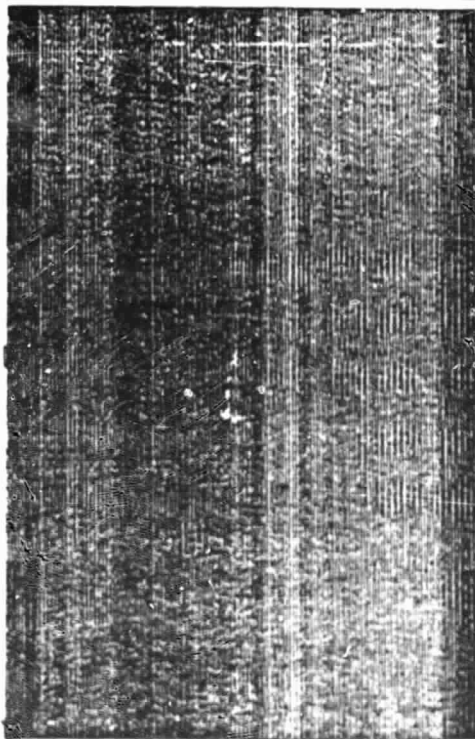

ORIGINAL PAGE  
OF POOR QUALITY



AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING



CYCLES



CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

LAMINATE


SPECIMEN NO. U-31A-9

DEFECT

TEST TYPE

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

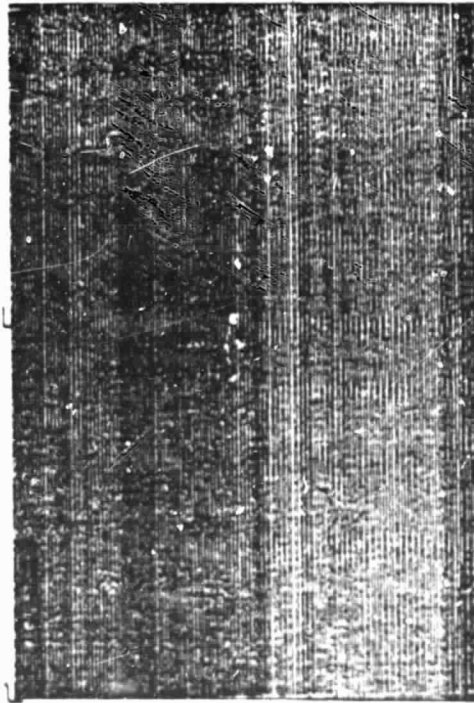

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L1-31A-10

DEFECT

TEST TYPE

CYCLIC LOAD

R RATIO

TEST TEMPERATURE


AFTER MOISTURE CONDITIONING

CYCLES

CYCLES



ORIGINAL PAGE IS  
OF POOR QUALITY

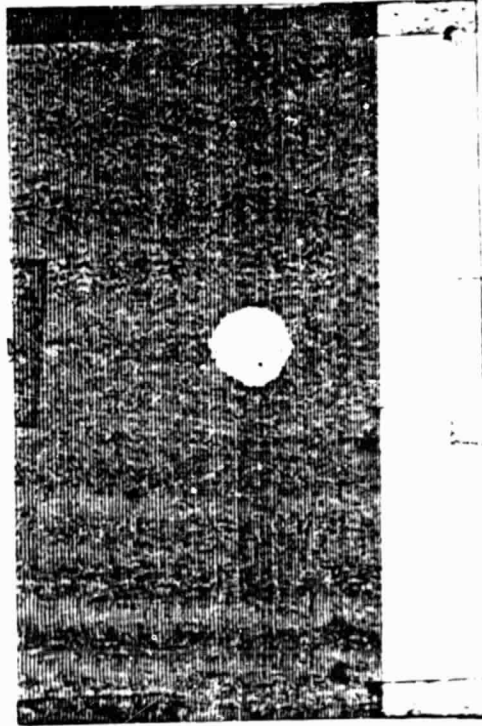

CYCLES

CYCLES


AFTER MOISTURE CONDITIONING

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

ULTRASONIC C-SCAN DATA

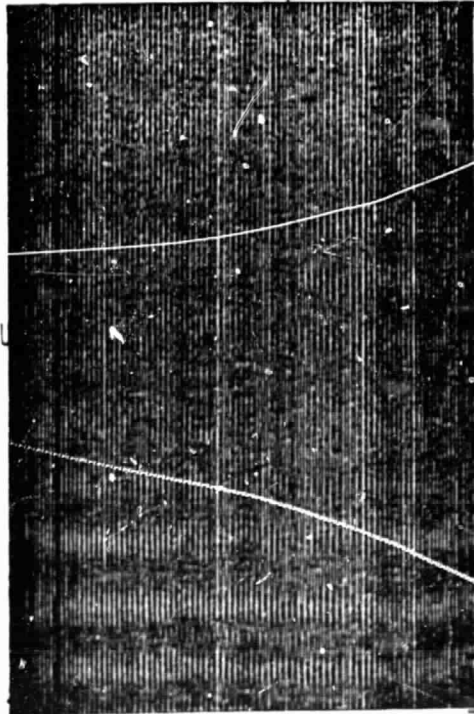

AFTER PRE-LOAD

MAXIMUM LOAD

BEFORE TEST


LAMINATE

SPECIMEN NO. L1-31A-11

DEFECT

TEST TYPE

ULTRASONIC C-SCAN DATA

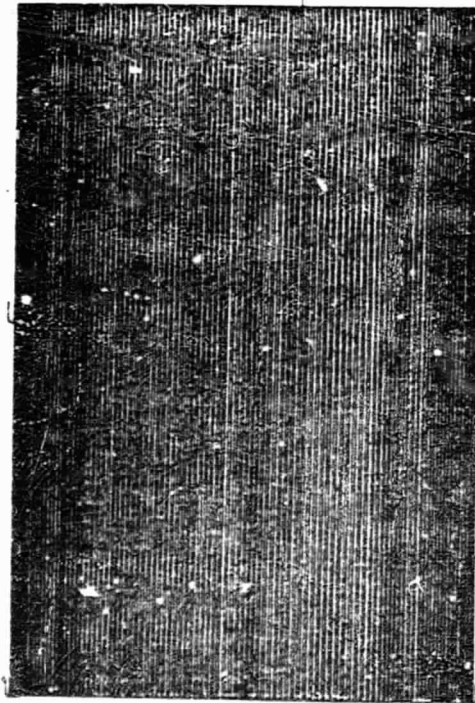

BEFORE TEST



AFTER PRELOAD


MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L1-31A-12

DEFECT

TEST TYPE

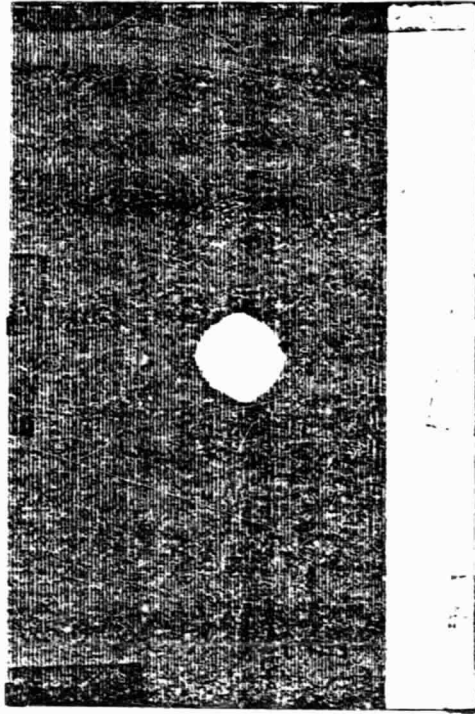

AFTER MOISTURE CONDITIONING



CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE



CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA



\_\_\_\_\_ CYCLES

\_\_\_\_\_ CYCLES

AFTER MOISTURE CONDITIONING

AFTER PRELOAD

CYCLIC LOAD \_\_\_\_\_  
R RATIO \_\_\_\_\_  
TEST TEMPERATURE \_\_\_\_\_

MAXIMUM LOAD \_\_\_\_\_

BEFORE TEST

LAMINATE \_\_\_\_\_  
SPECIMEN NO. L3-31-13  
DEFECT \_\_\_\_\_  
TEST TYPE \_\_\_\_\_

ULTRASONIC C-SCAN DATA



ORIGINAL PAGE IS  
OF POOR QUALITY

BEFORE TEST

AFTER PRELOAD  
MAXIMUM LOAD

AFTER MOISTURE CONDITIONING

CYCLES

CYCLES

LAMINATE

SPECIMEN NO. L3-31-14

DEFECT

TEST TYPE

CYCLIC LOAD

R RATIO


TEST TEMPERATURE

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA



BEFORE TEST

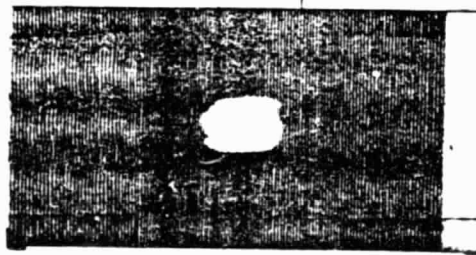

AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING



CYCLES



CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

LAMINATE


SPECIMEN NO. L3-31-15

DEFECT


TEST TYPE

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

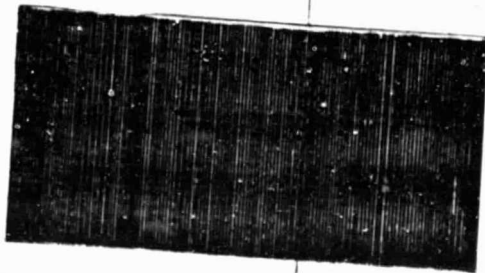

BEFORE TEST

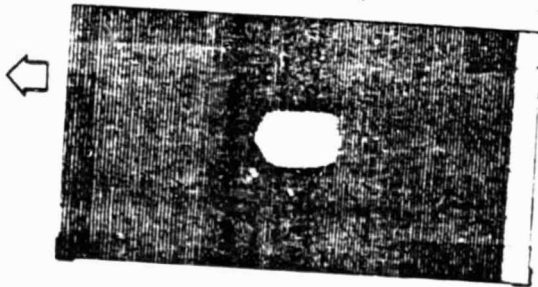

AFTER PRELOAD

MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L3-31-16

DEFECT

TEST TYPE

AFTER MOISTURE CONDITIONING



CYCLES

CYCLIC LOAD

R RATIO


TEST TEMPERATURE



CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

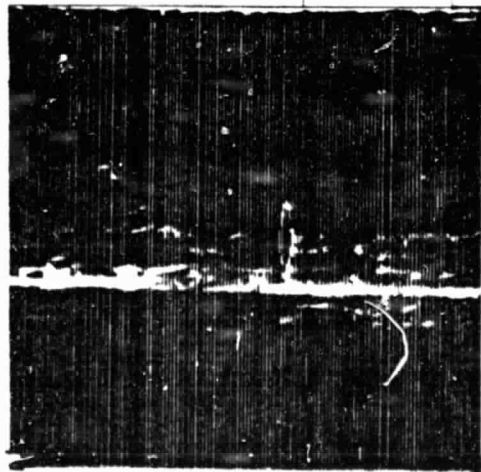

\_\_\_\_\_ CYCLES

\_\_\_\_\_ CYCLES

AFTER MOISTURE CONDITIONING

AFTER PRELOAD

CYCLIC LOAD \_\_\_\_\_

R RATIO \_\_\_\_\_

TEST TEMPERATURE \_\_\_\_\_

MAXIMUM LOAD \_\_\_\_\_

BEFORE TEST

LAMINATE \_\_\_\_\_


SPECIMEN NO. L3-31-17

DEFECT \_\_\_\_\_

TEST TYPE \_\_\_\_\_

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

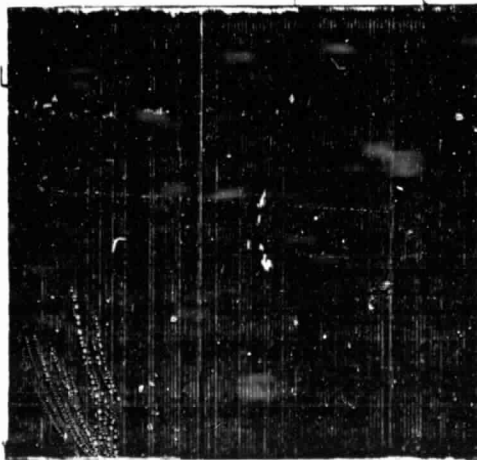

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING

\_\_\_\_\_ CYCLES

\_\_\_\_\_ CYCLES

CYCLIC LOAD \_\_\_\_\_

R RATIO \_\_\_\_\_

TEST TEMPERATURE \_\_\_\_\_

LAMINATE \_\_\_\_\_

SPECIMEN NO. 13-31-18

DEFECT \_\_\_\_\_


TEST TYPE \_\_\_\_\_



ULTRASONIC C-SCAN DATA



BEFORE TEST

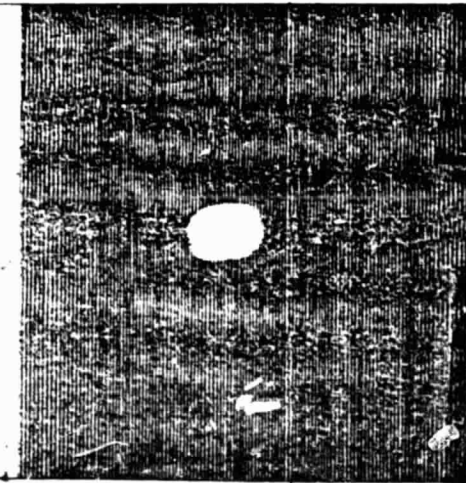

AFTER PRELOAD



MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L3-31-19

DEFECT

TEST TYPE

AFTER MOISTURE CONDITIONING



CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE




CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA



BEFORE TEST

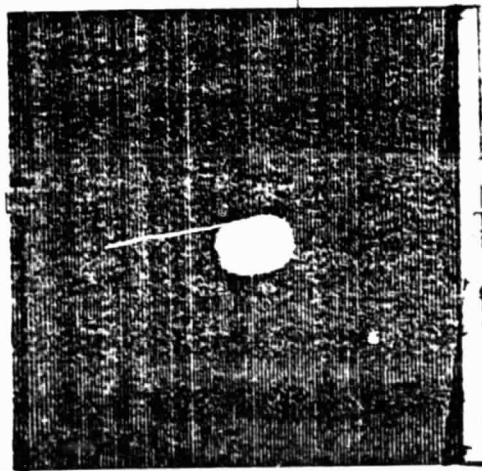

AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING

CYCLES

CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

LAMINATE


SPECIMEN NO. L3-31-20

DEFECT

TEST TYPE

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

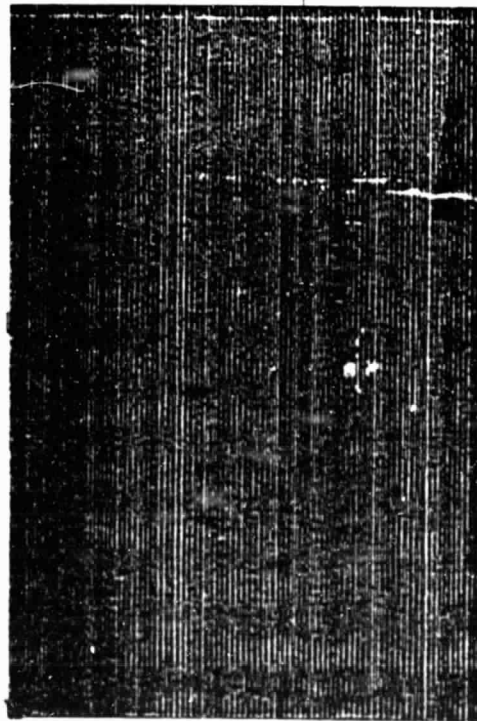

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L3-31-21

DEFECT

TEST TYPE

AFTER MOISTURE CONDITIONING

CYCLES


CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

ULTRASONIC C-SCAN DATA

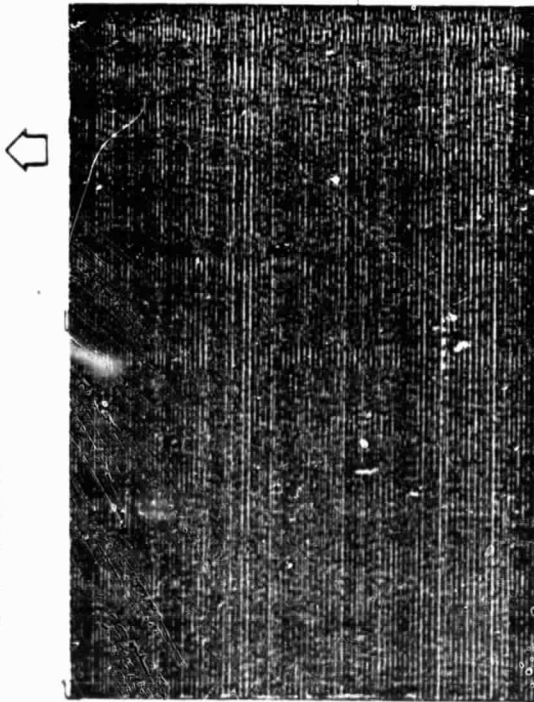

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L3-31-22

DEFECT

TEST TYPE

AFTER MOISTURE CONDITIONING

CYCLES

CYCLES


CYCLIC LOAD

R RATIO

TEST TEMPERATURE

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

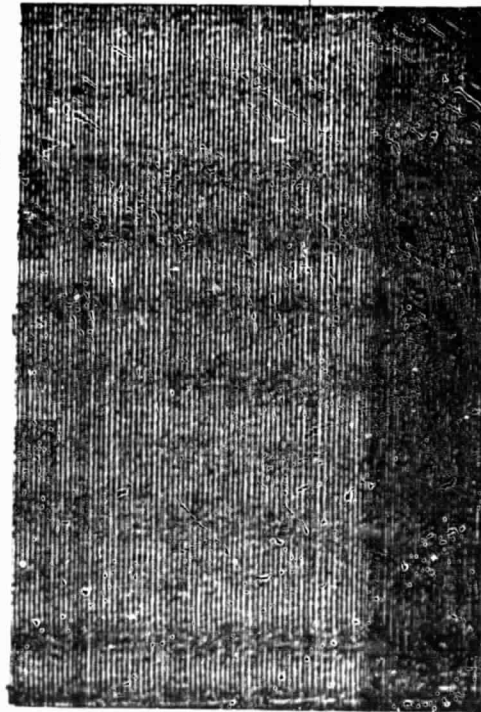

BEFORE TEST



AFTER PRELOAD


MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L3-31-23

DEFECT

TEST TYPE

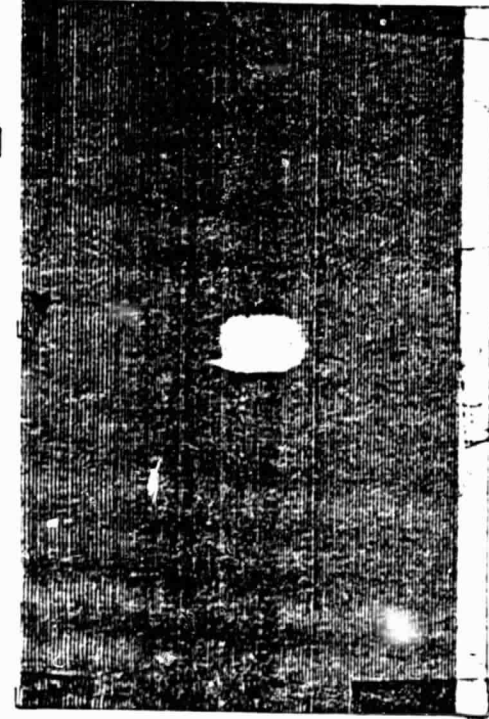

AFTER MOISTURE CONDITIONING

CYCLES


CYCLIC LOAD

R RATIO

TEST TEMPERATURE

CYCLES

ULTRASONIC C-SCAN DATA

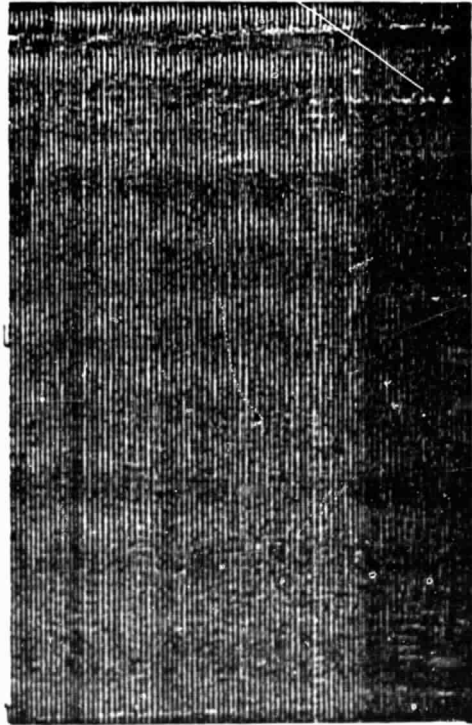

BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD

LAMINATE

SPECIMEN NO. L3-21-24

DEFECT

TEST TYPE



AFTER MOISTURE CONDITIONING

CYCLES




CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

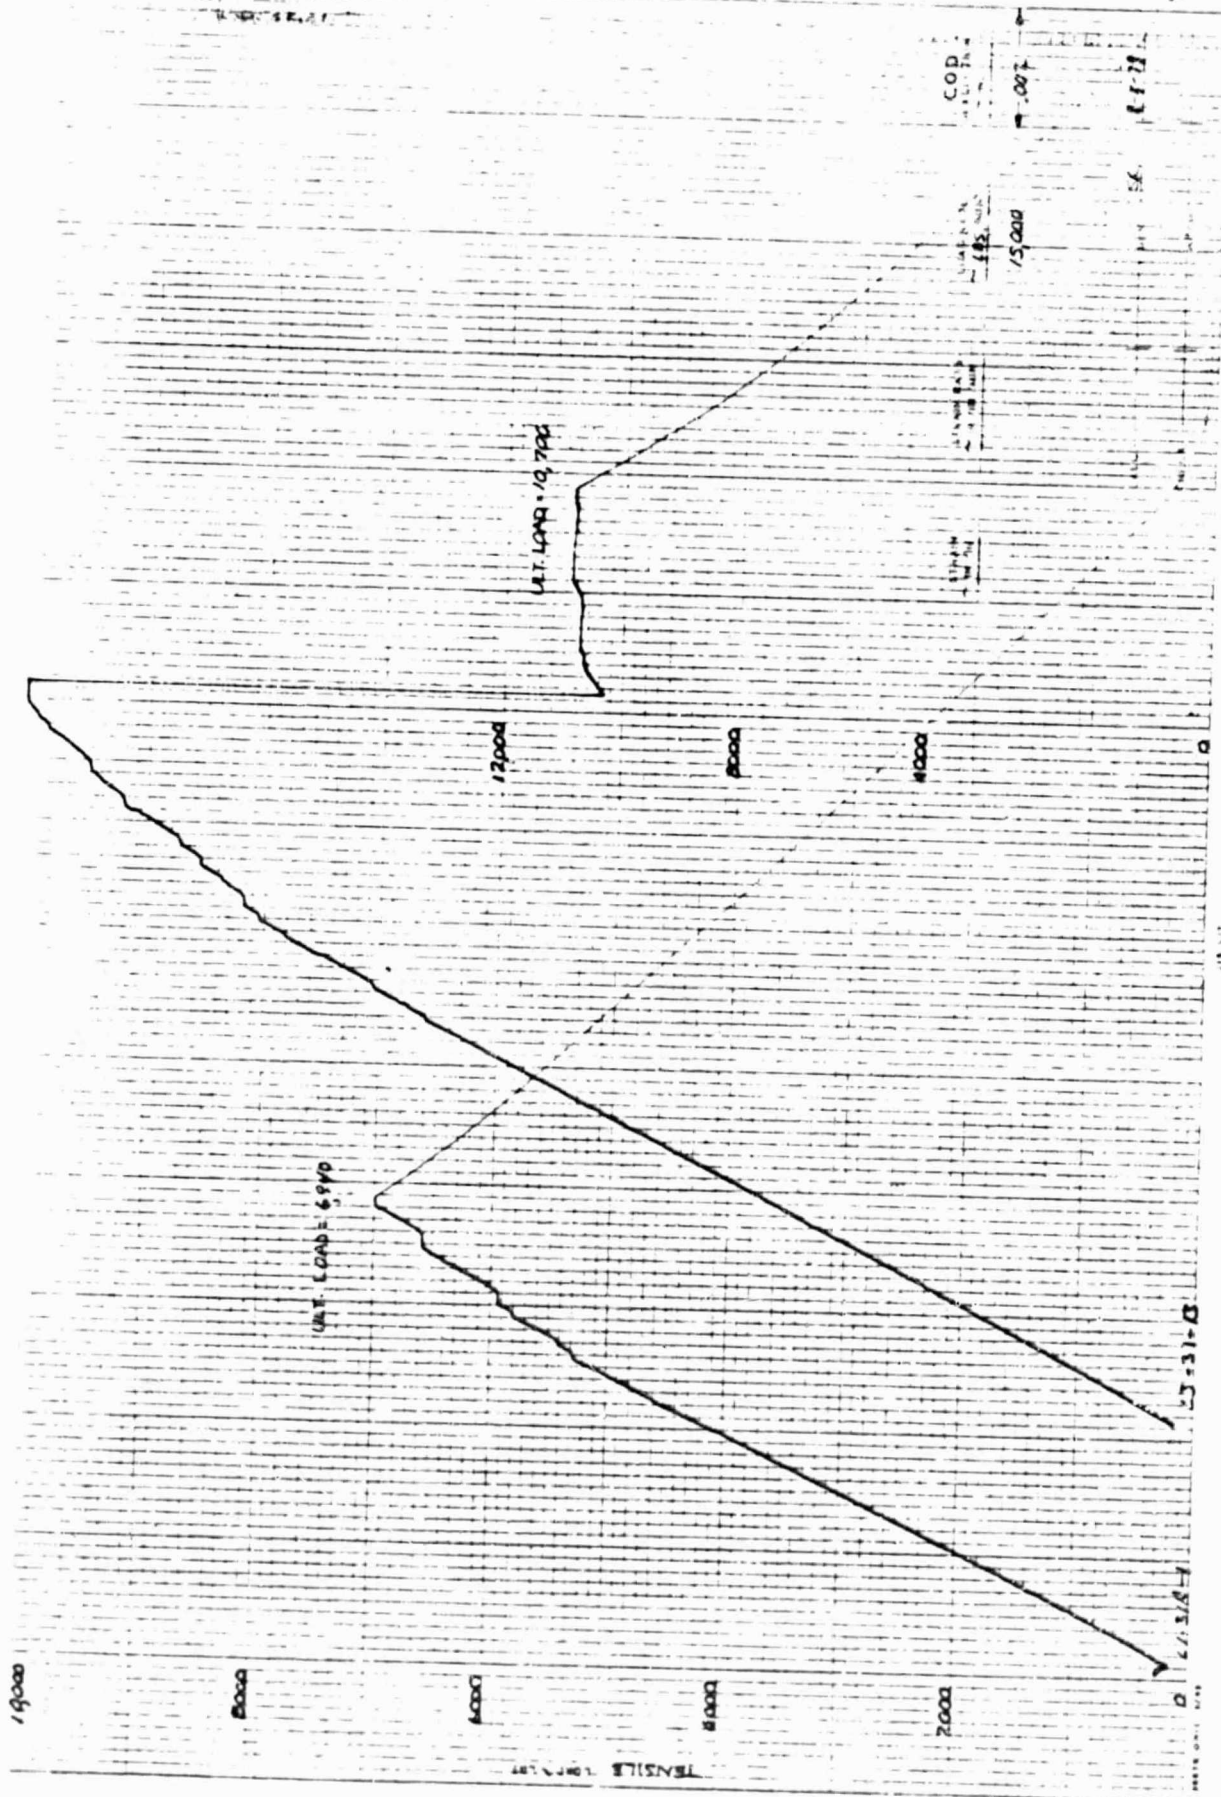



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

COD

1-10-10

002

3-11-12

1-10-10

002

1-10-10

002

1-10-10

002

0057

0057

1-10-10

1-10-10

0000


0000


0000

COMPRESSION




ORIGINAL PAGE IS  
OF POOR QUALITY

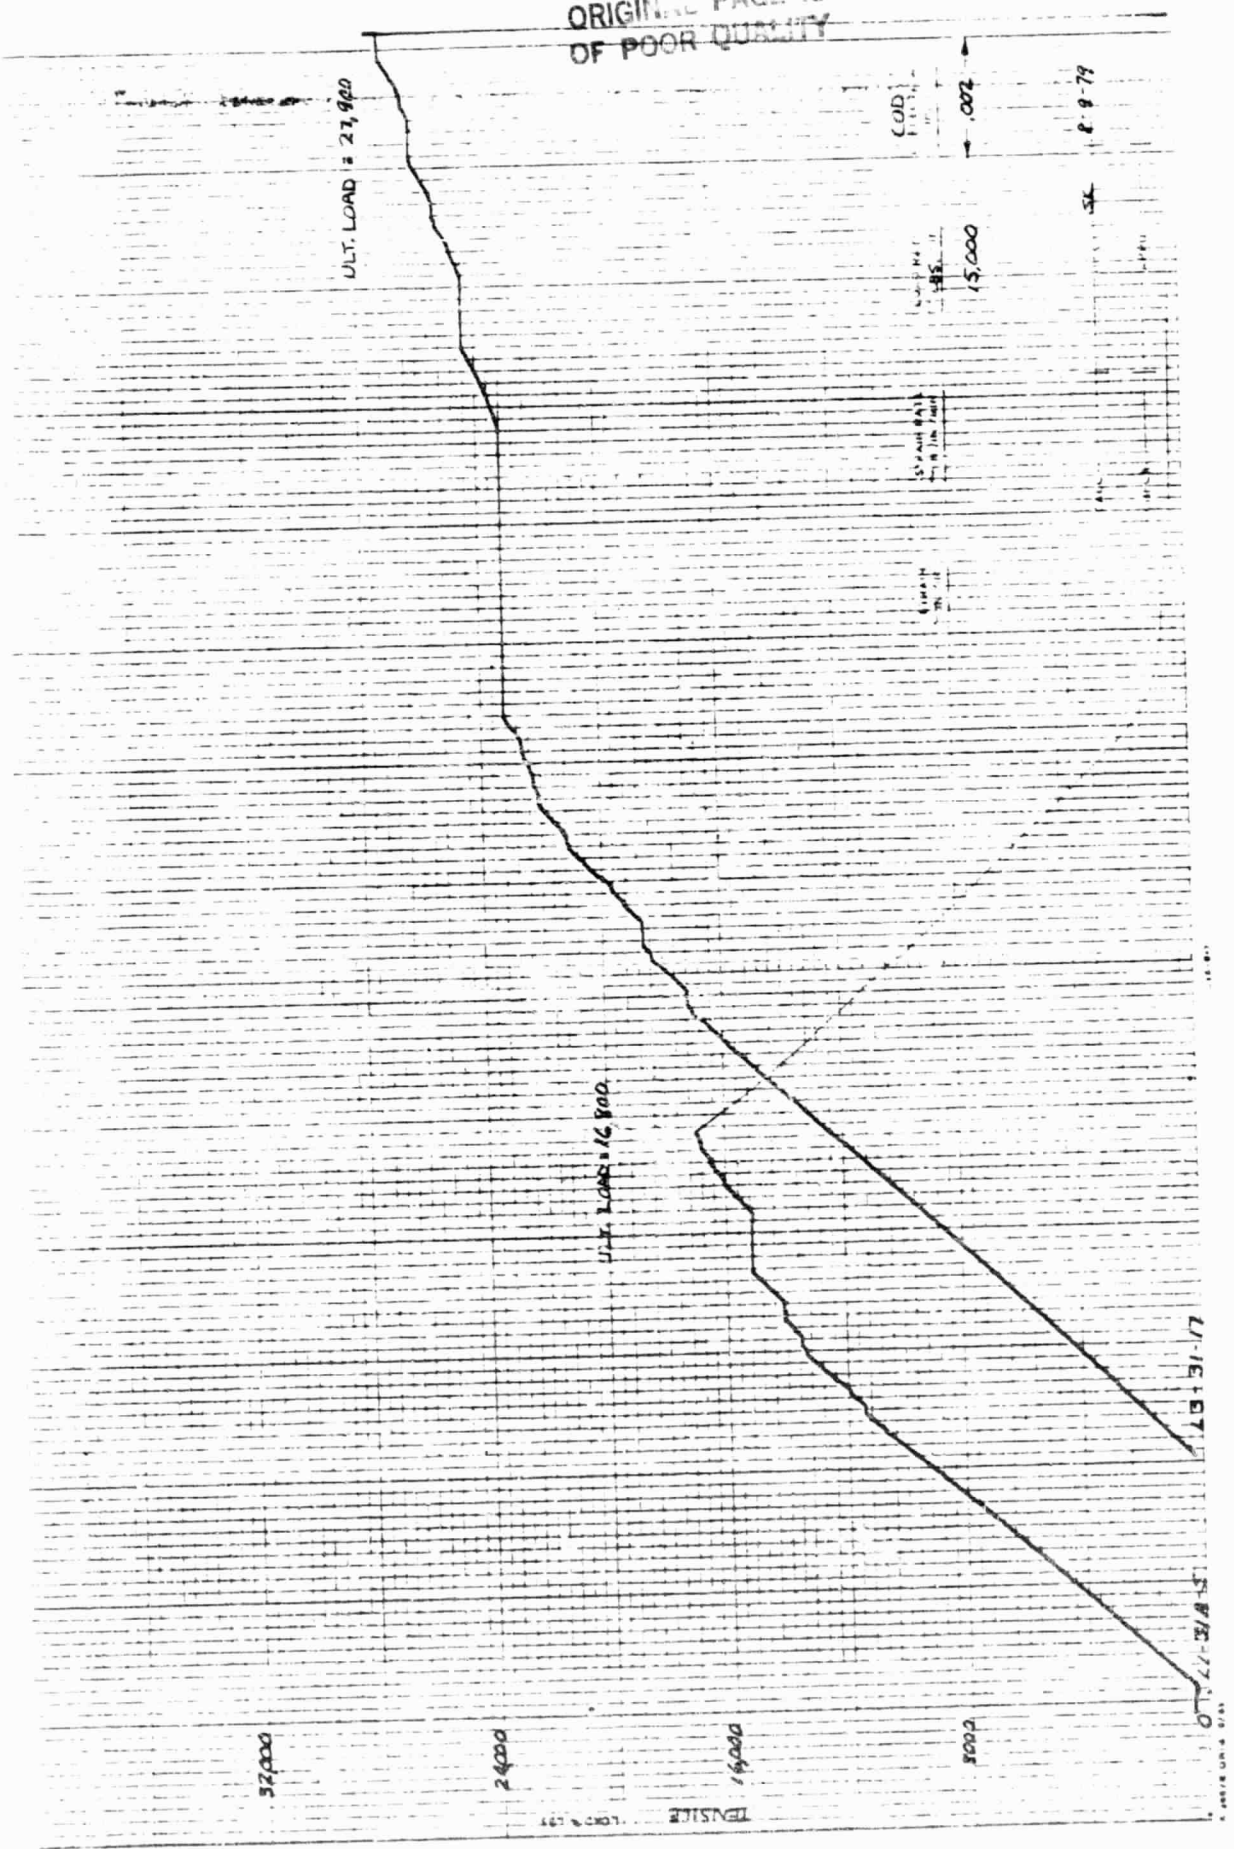

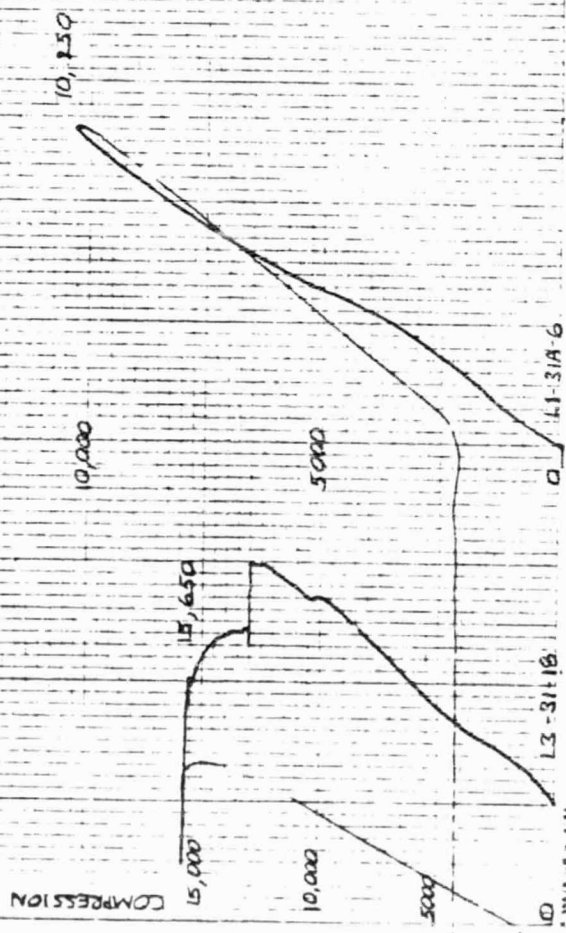

250  
 002  
 3-11-80  
 SK

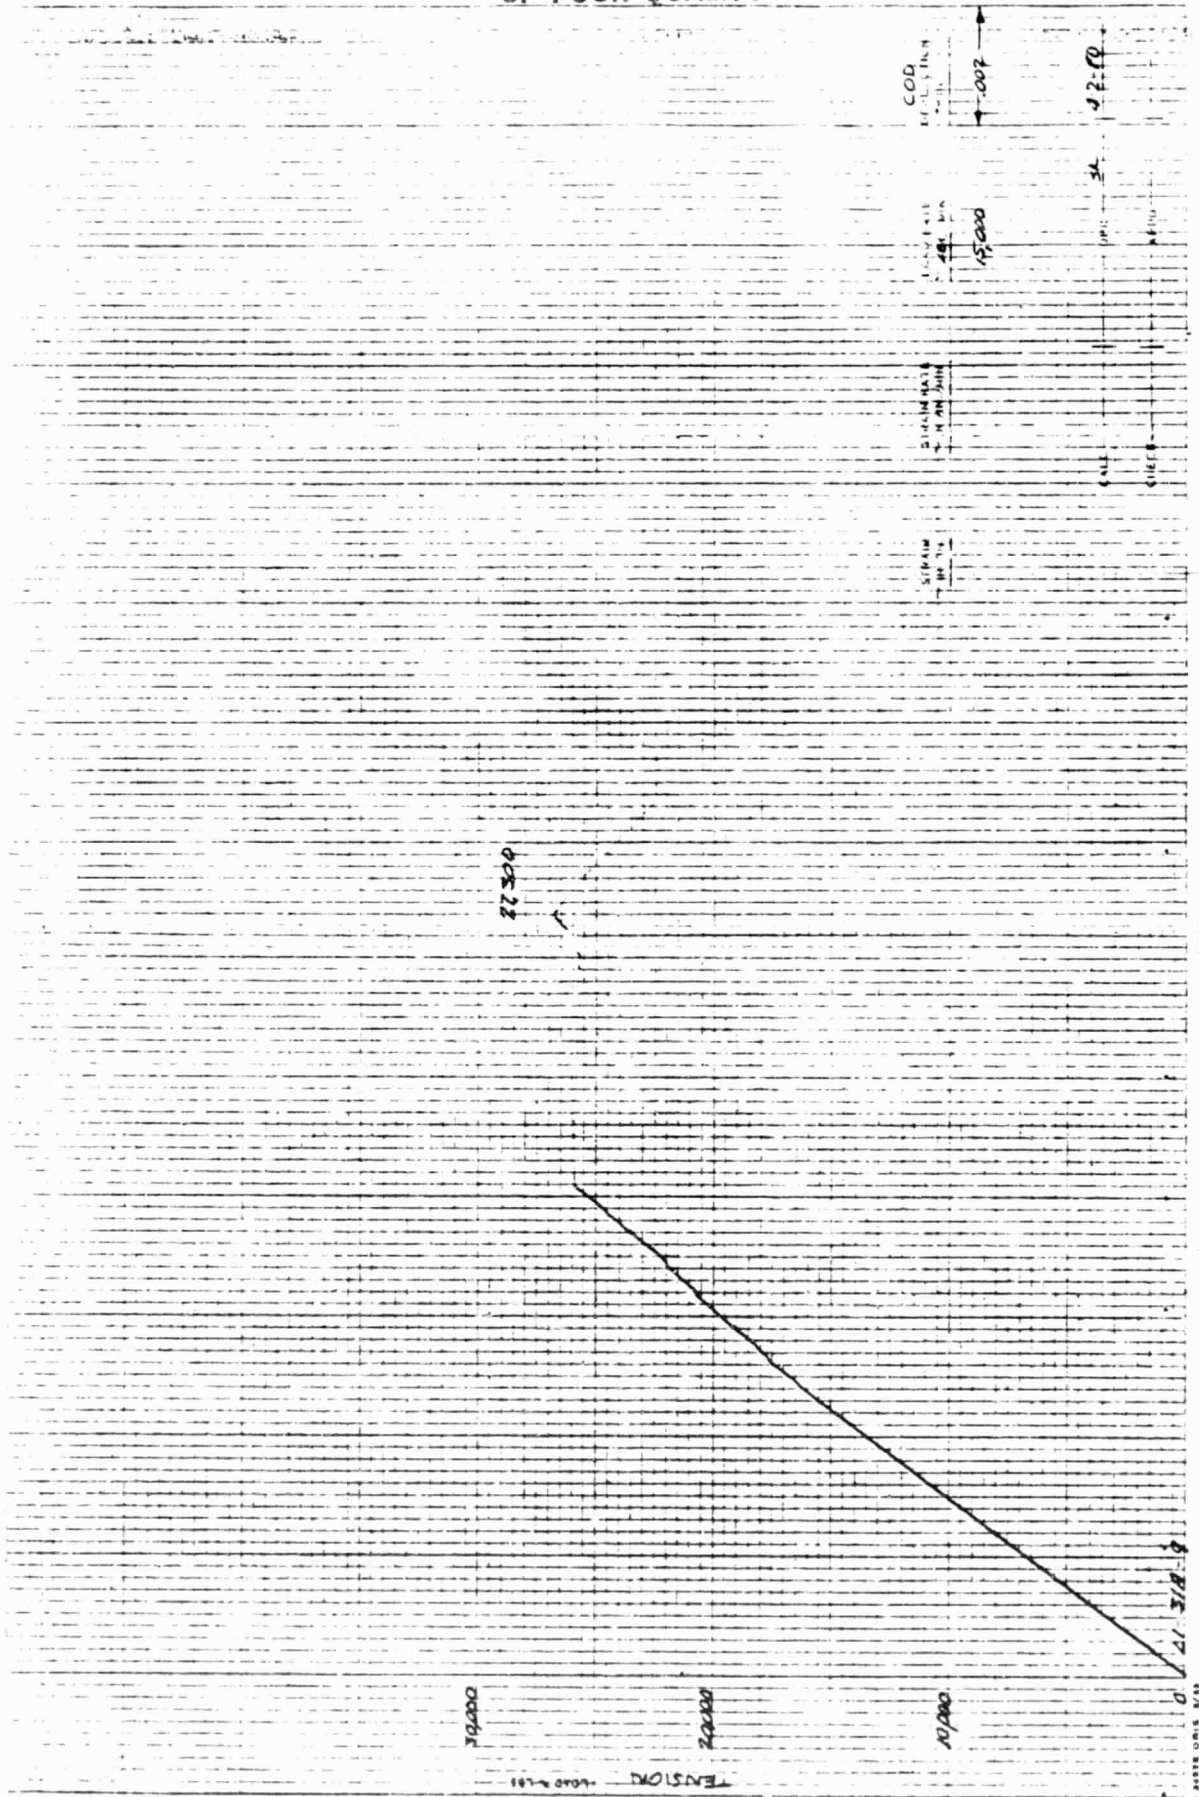

156



ORIGINAL FILED IN  
OF POOR QUALITY

(FAILED IN CRIP)

33,300

COD

1.111 in

1.002

LOAD RATE  
145 lb./min

75,000

STRAIN RATE  
1 in./min

STRAIN  
1 in./in

324 Y0

ST

L3-31-21

TENSION

ORIGINAL PAGE IS  
OF POOR QUALITY

CADU

1000 PSI

15,000

15,000

3-20-80

SK

21.4M 40.75

21.4M 40.75

21,200

13-31-22

COMPRESSION

**APPENDIX C**  
**STATIC TEST DAMAGE GROWTH DATA**

This appendix contains the crack opening displacement test machine records, the ultrasonic C-scan and the visual notes indicating the damage growth in the static test specimens. The results are grouped according to laminate type and defect. Each record is identified by specimen number and defect code.

All static test specimens were examined using these techniques at each stage in the testing process.

PRECEDING PAGE BLANK NOT FILMED

ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE L1  
NO DEFECT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-1

L1-21-2

L1-21-3

L1-21-4


INITIAL

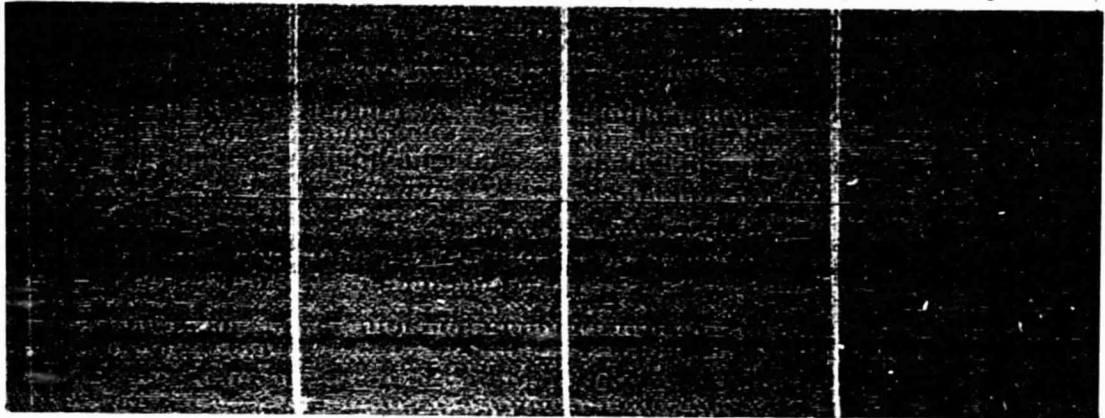


AFTER  
PRELOAD  
21.5 KIP

VISUAL DAMAGE

← NONE →

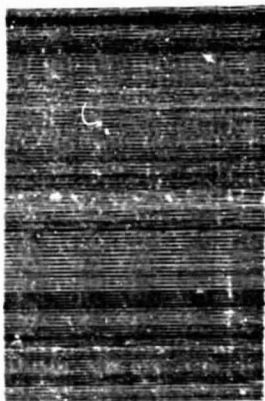


AFTER  
MOISTURE  
CONDITIONING

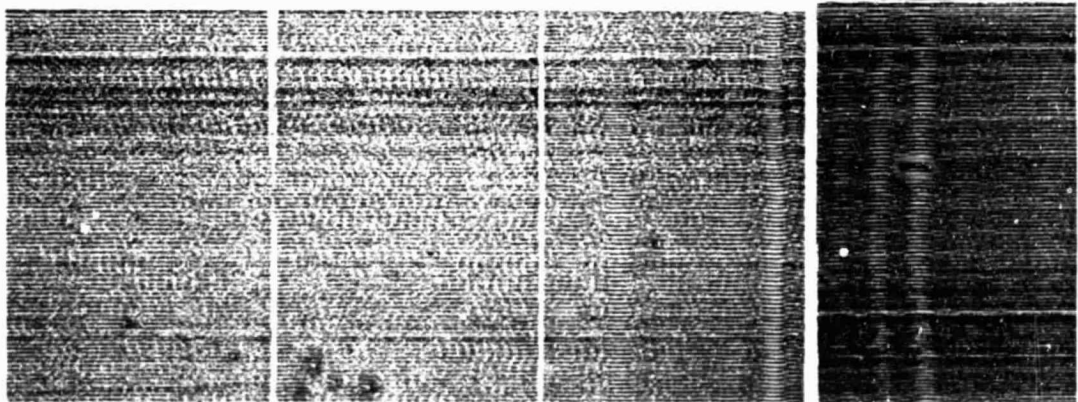



ORIGINAL PAGE IS  
OF POOR QUALITY

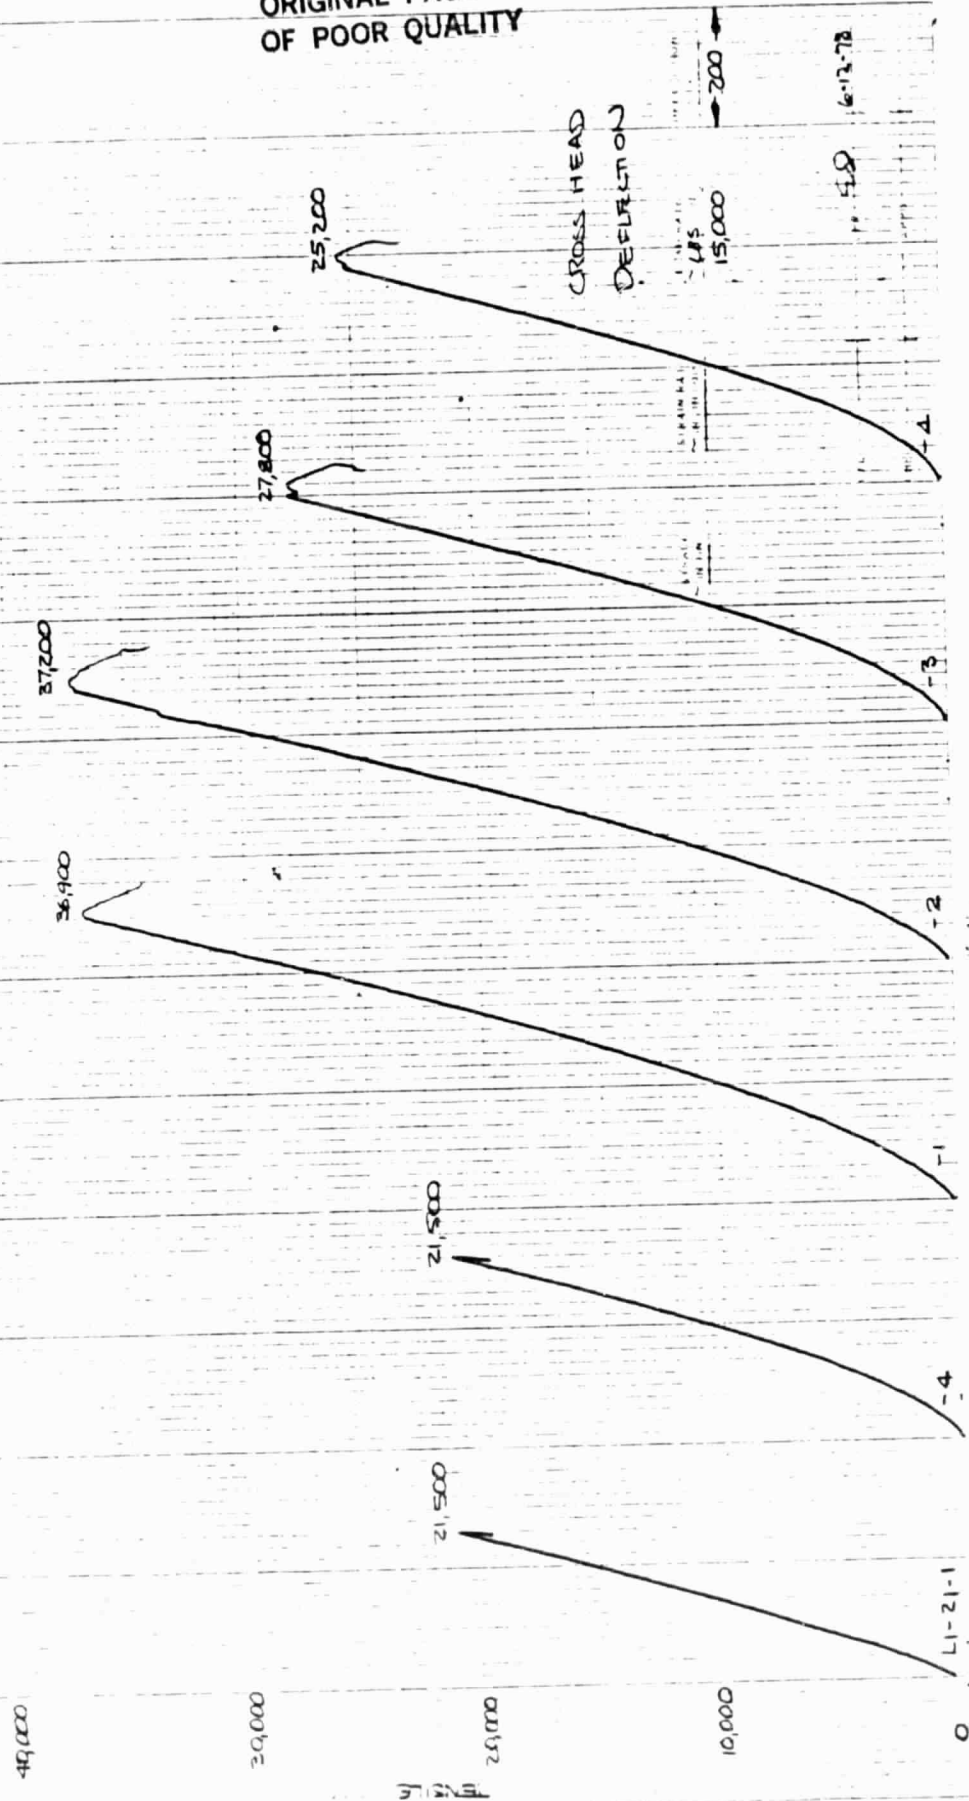

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1

1/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

L1-21-5

L1-21-6


L1-21-7

L1-21-8

INITIAL



AFTER  
PRELOAD  
15.3 KIP

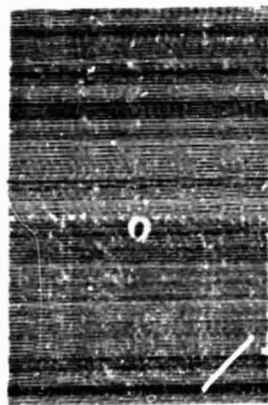


VISUAL DAMAGE


← FINE CRAZE FROM HOLE  
0.1 inch IN LENGTH →




AFTER  
MOISTURE  
CONDITIONING

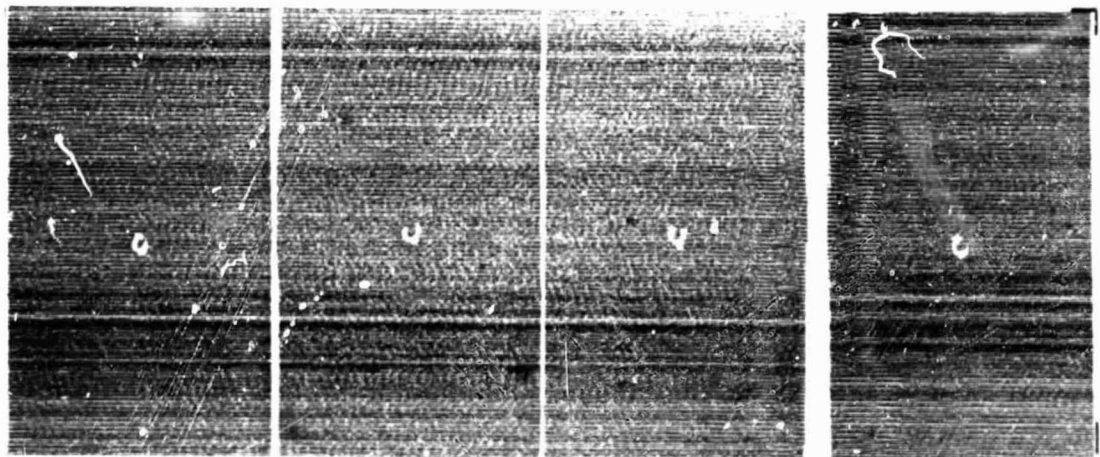

ORIGINAL PAGE IS  
OF POOR QUALITY

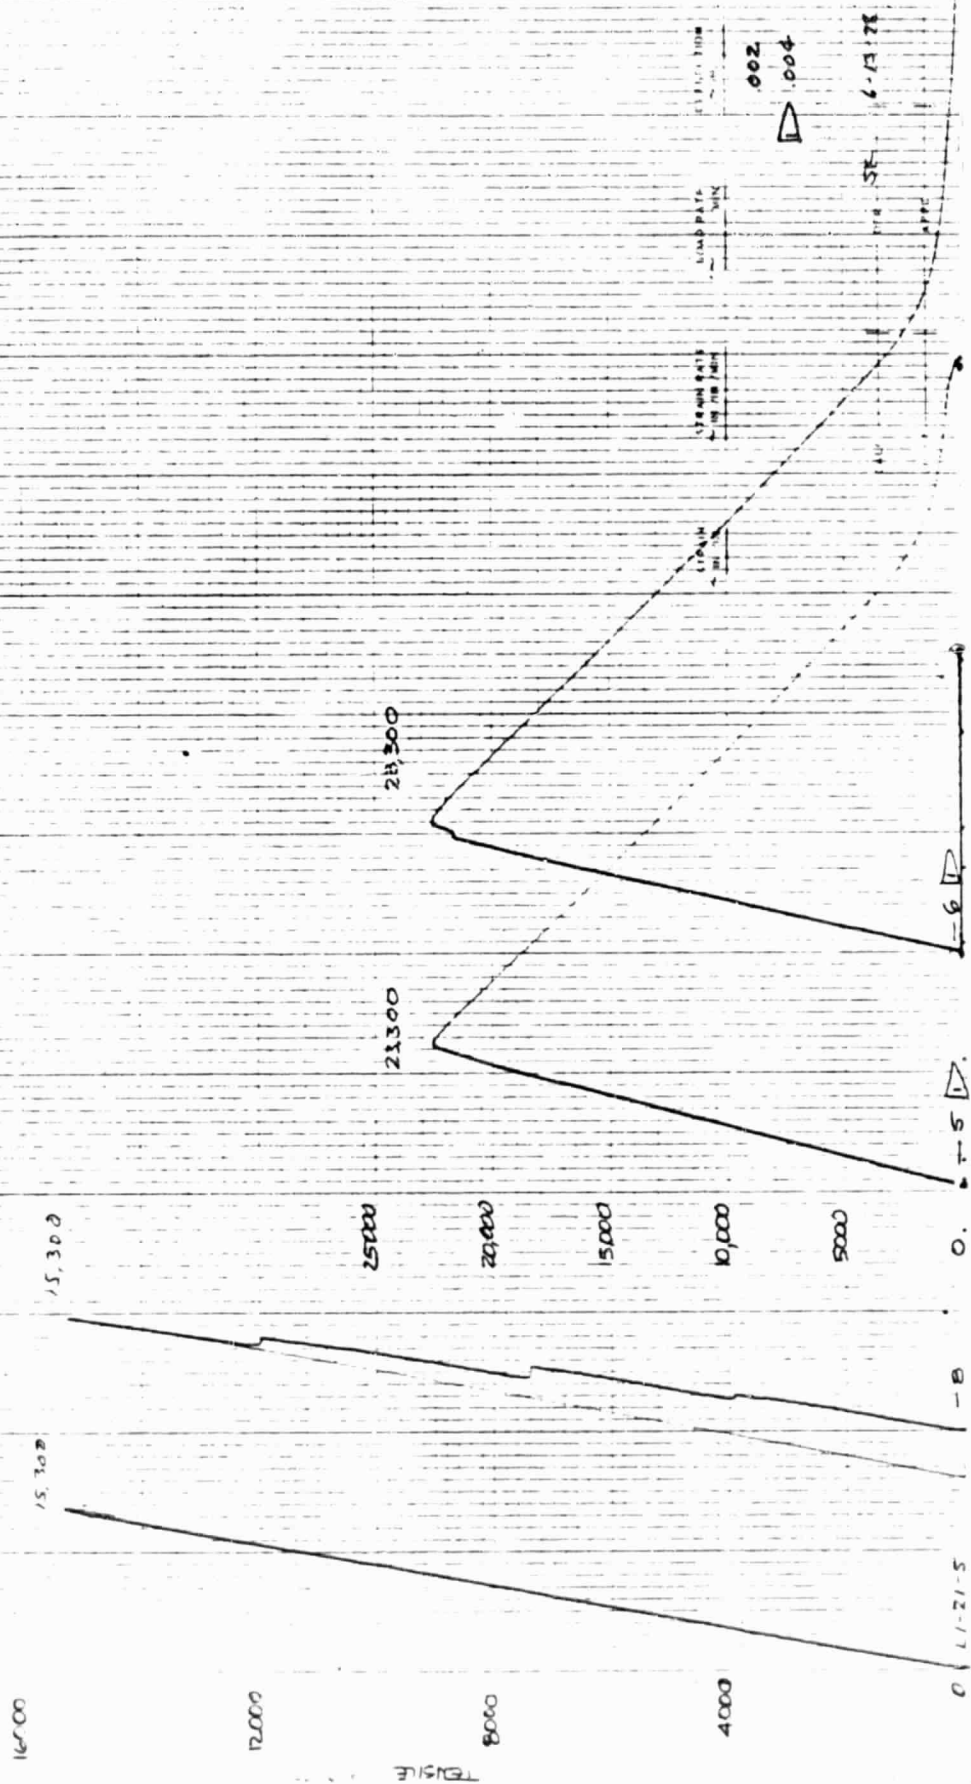

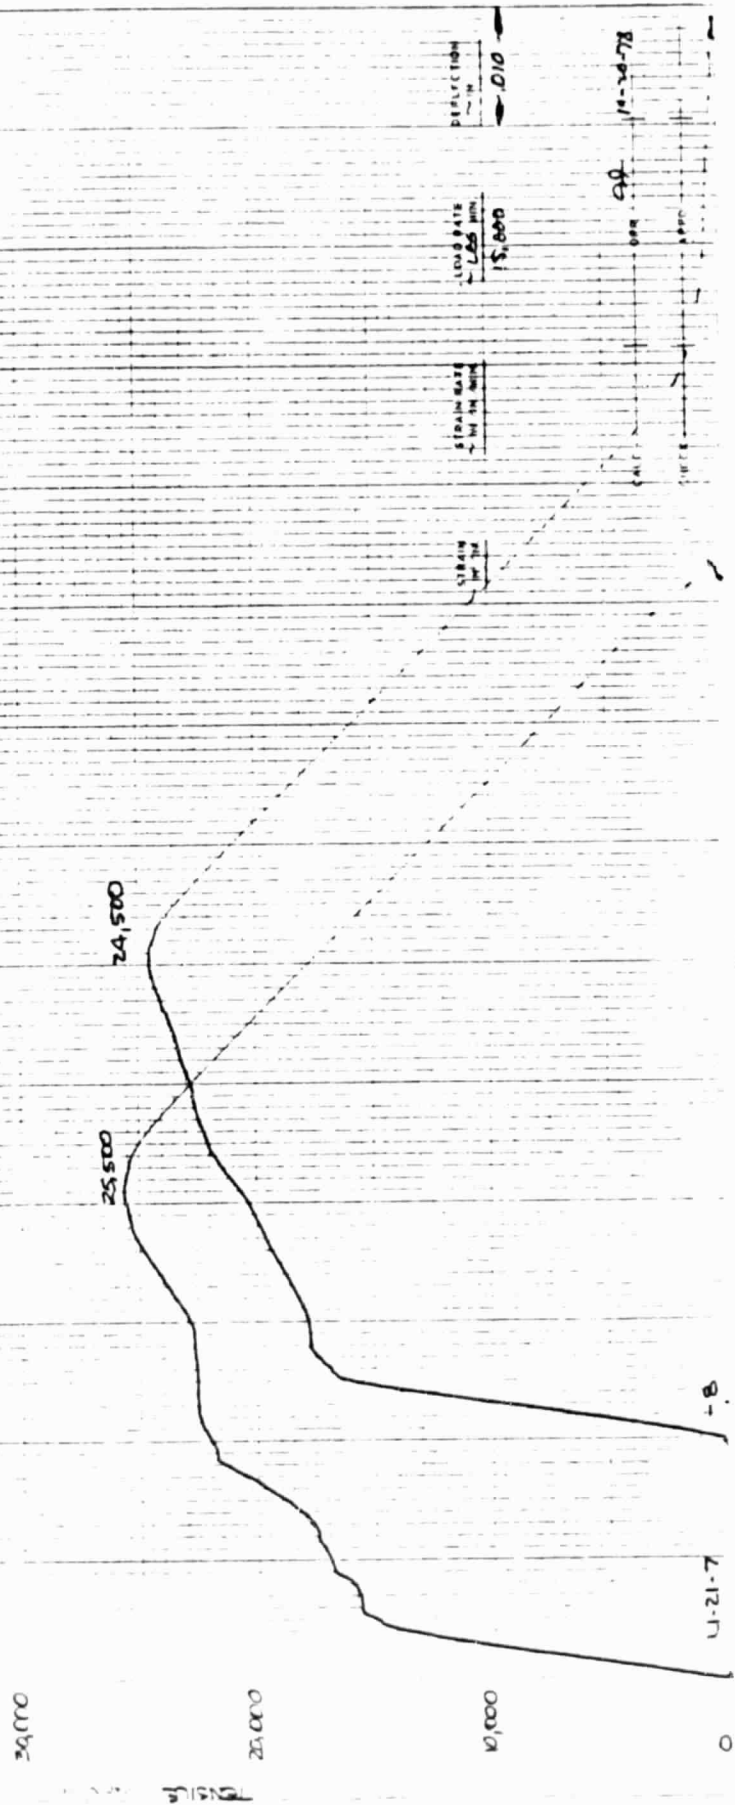

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
3/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-9

L1-21-10

L1-21-11

L1-21-12


INITIAL

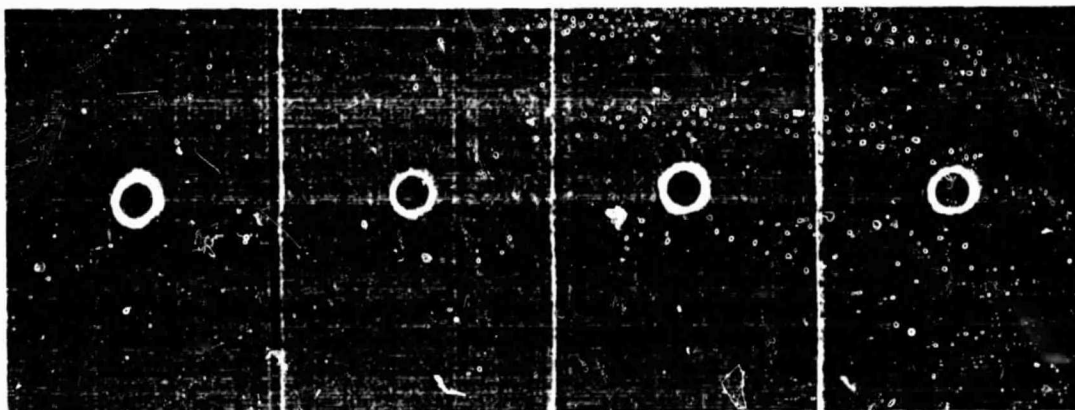


AFTER  
PRELOAD  
11.7 KIP

VISUAL DAMAGE

NONE

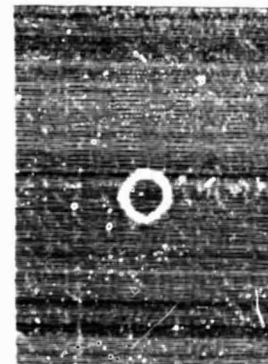



AFTER  
MOISTURE  
CONDITIONING

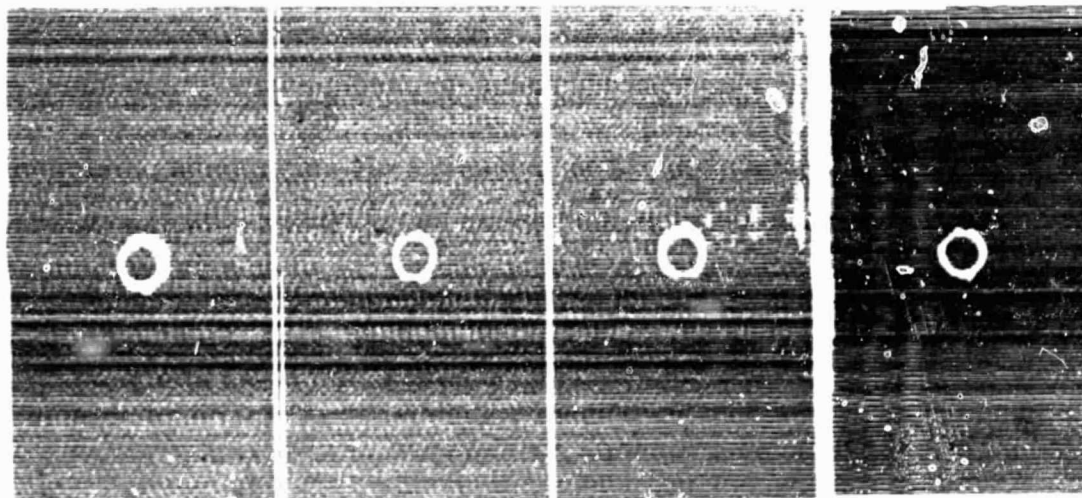



ORIGINAL PAGE IS  
OF POOR QUALITY

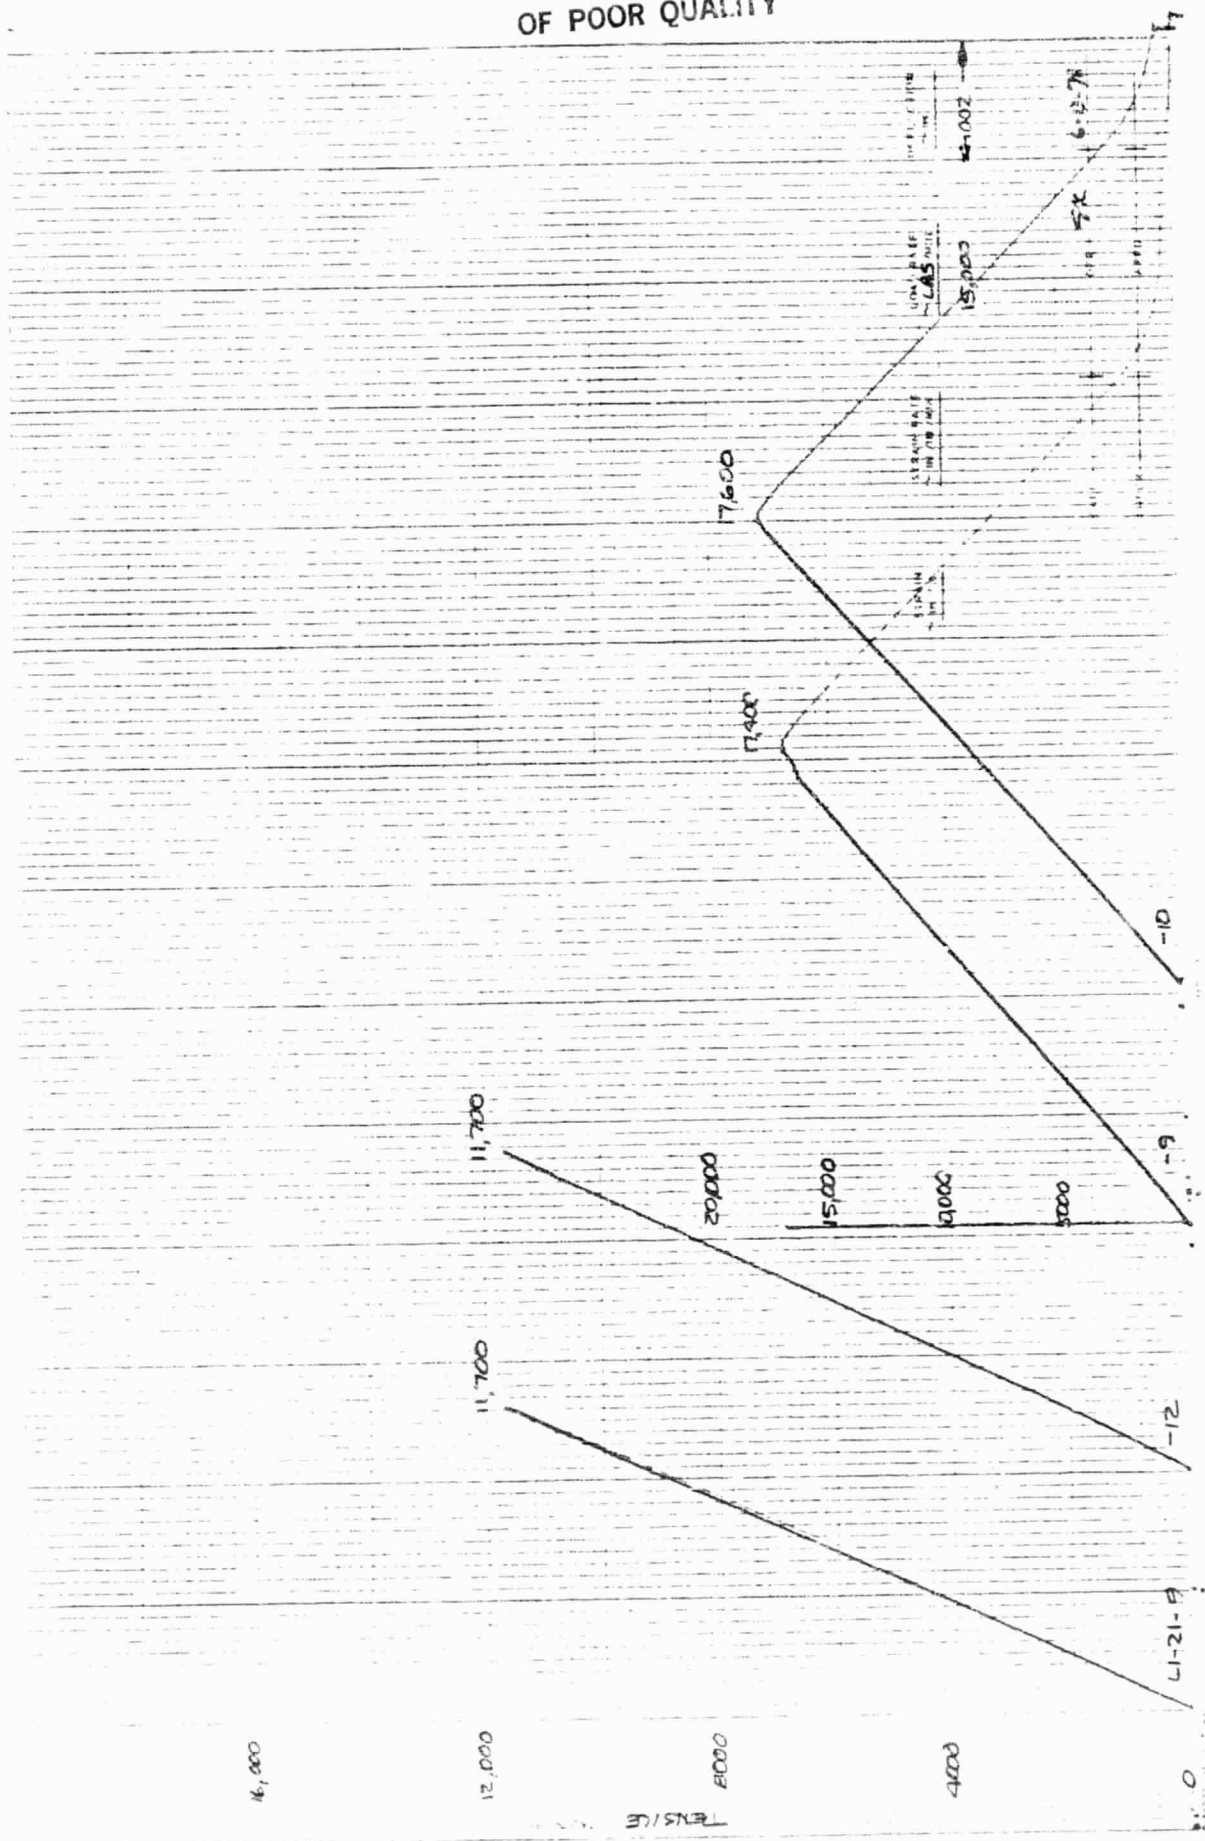

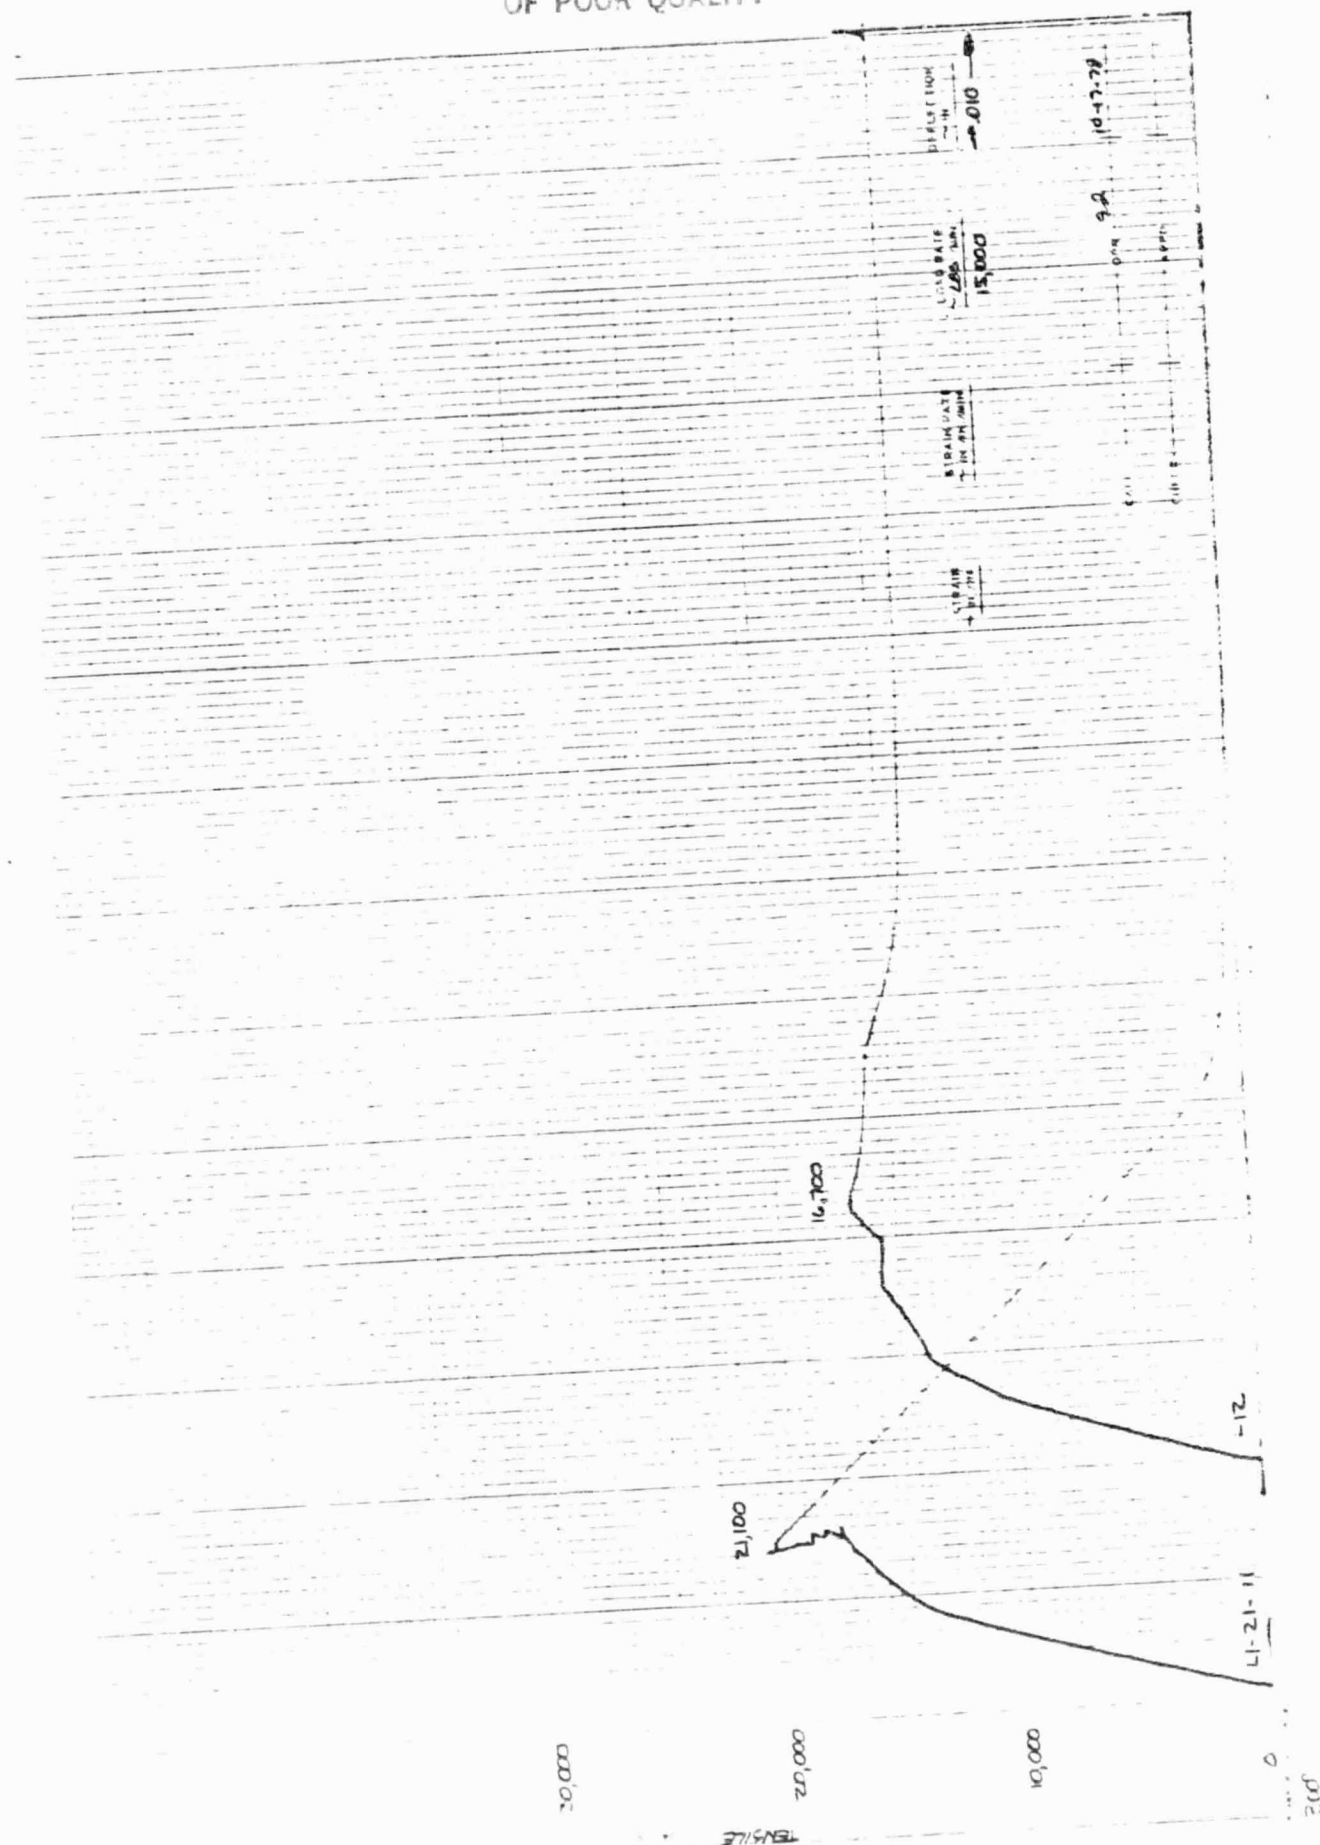

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
5/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-13

L1-21-14

L1-21-15

L1-21-16

INITIAL

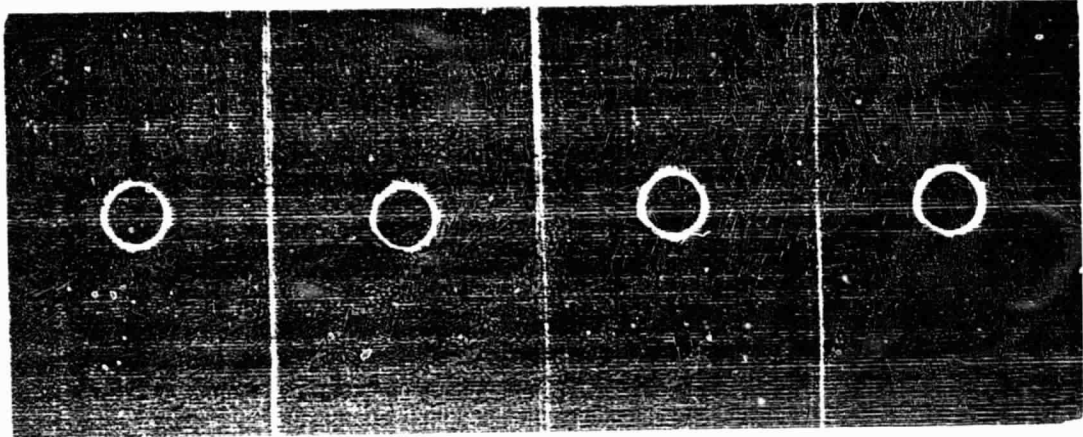


AFTER  
PRELOAD  
10.4 KIP





VISUAL DAMAGE

NONE

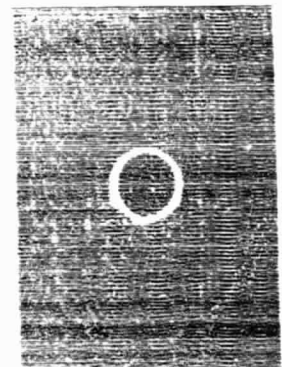



AFTER  
MOISTURE  
CONDITIONING

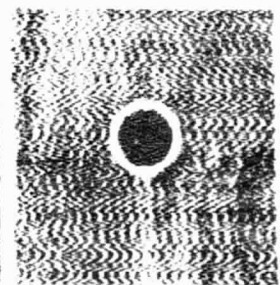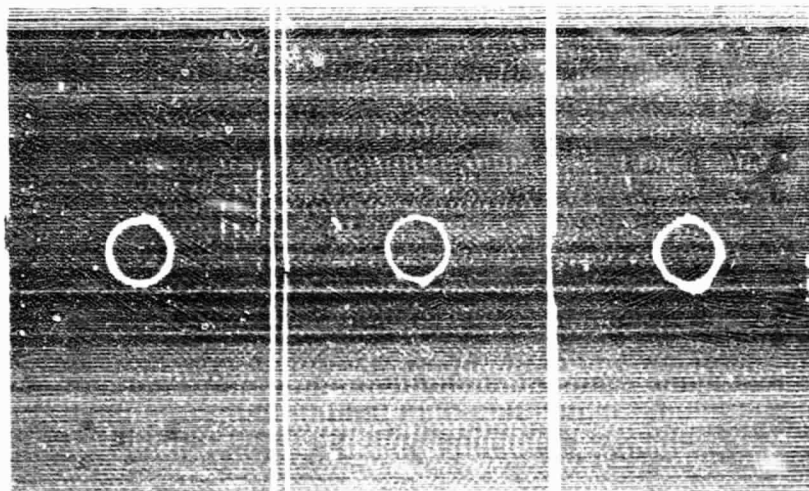



ORIGINAL PAGE IS  
OF POOR QUALITY

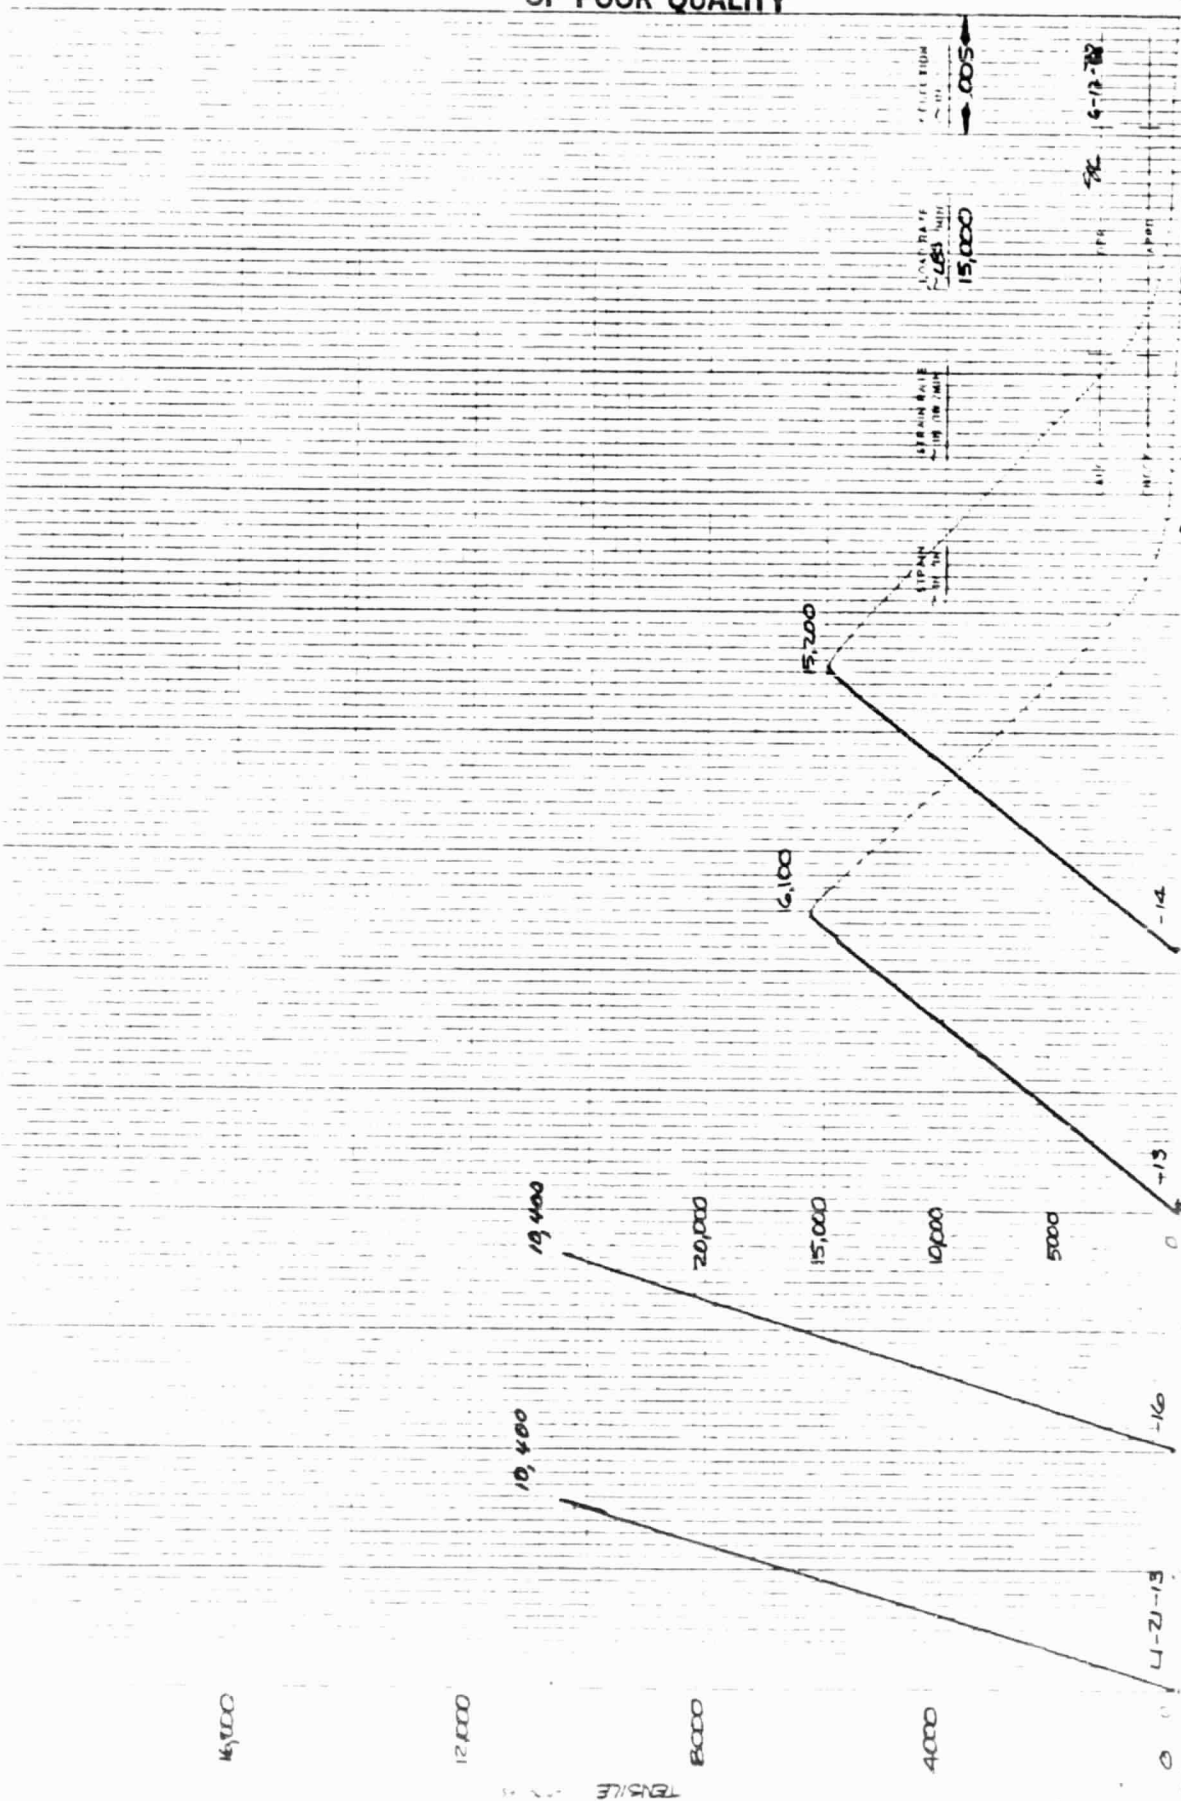

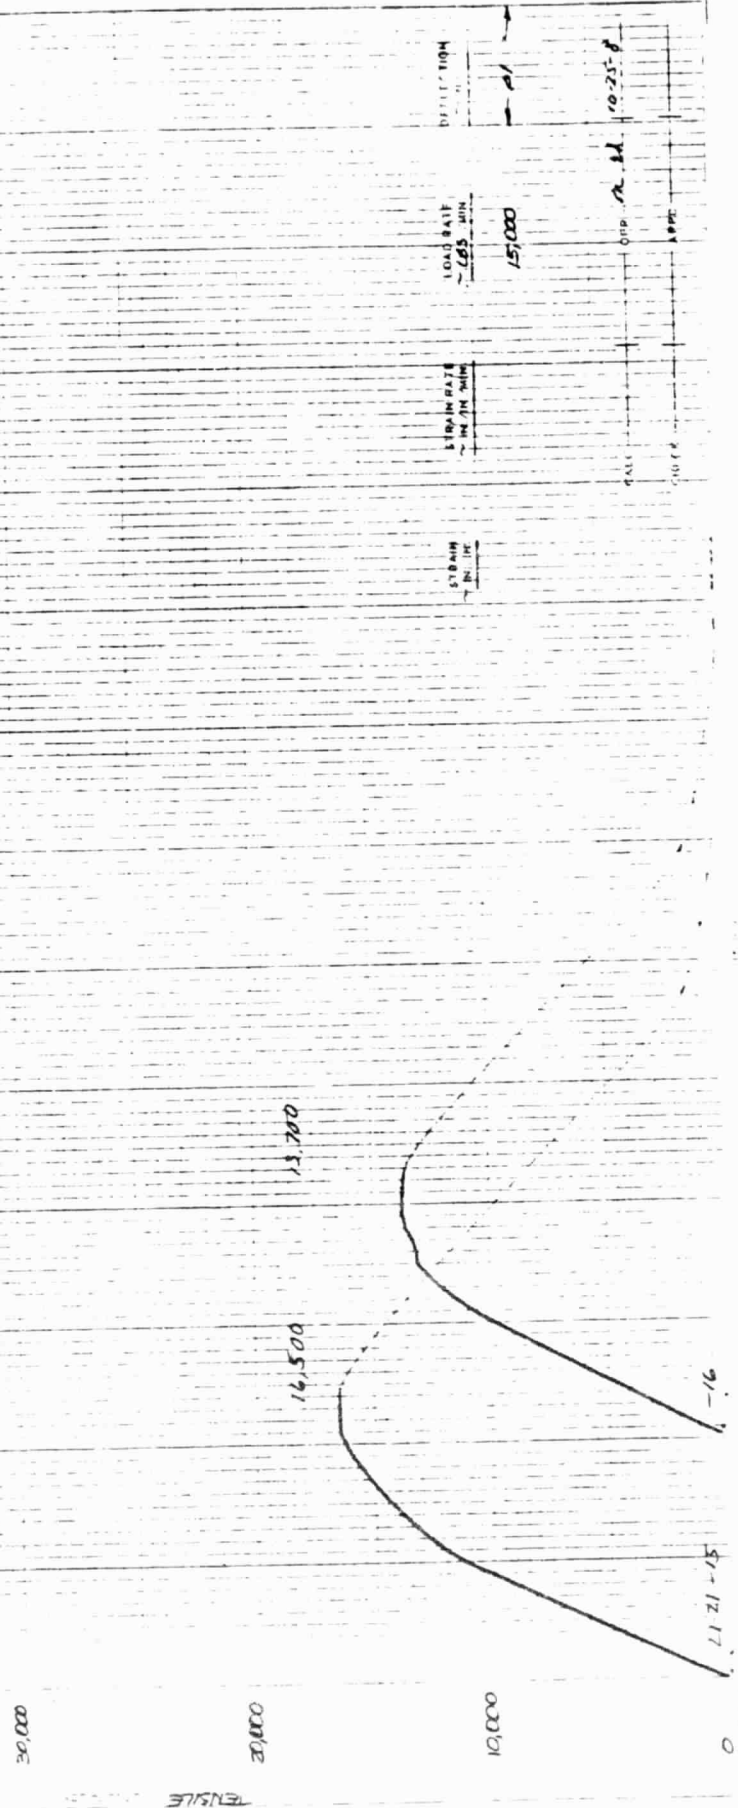

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
1/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-21

L1-21-22


L1-21-23

L1-21-24

INITIAL

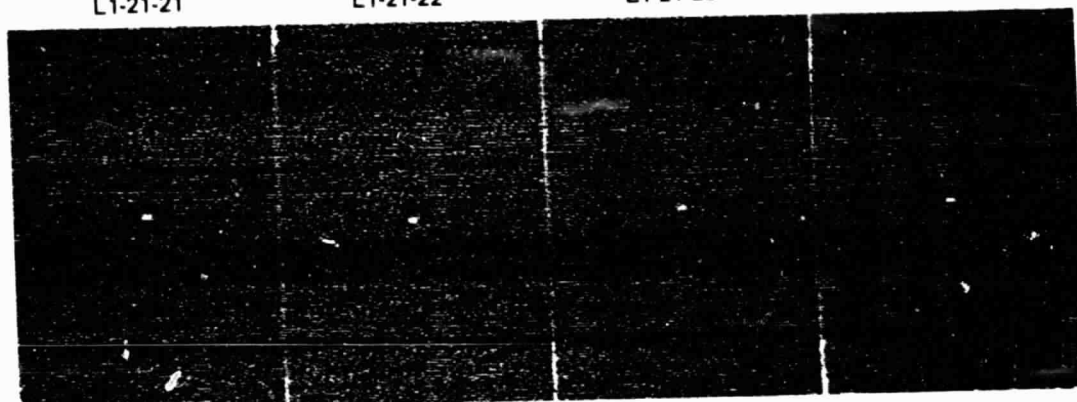


AFTER  
PRELOAD  
15.9 KIP

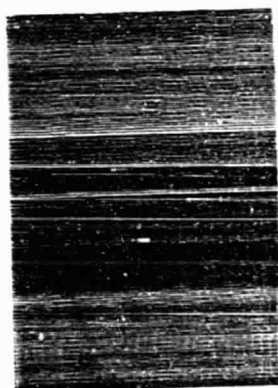


VISUAL DAMAGE


← NONE

0.1 inch FINE CRACK →

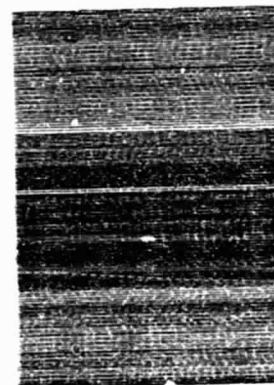


AFTER  
MOISTURE  
CONDITIONING

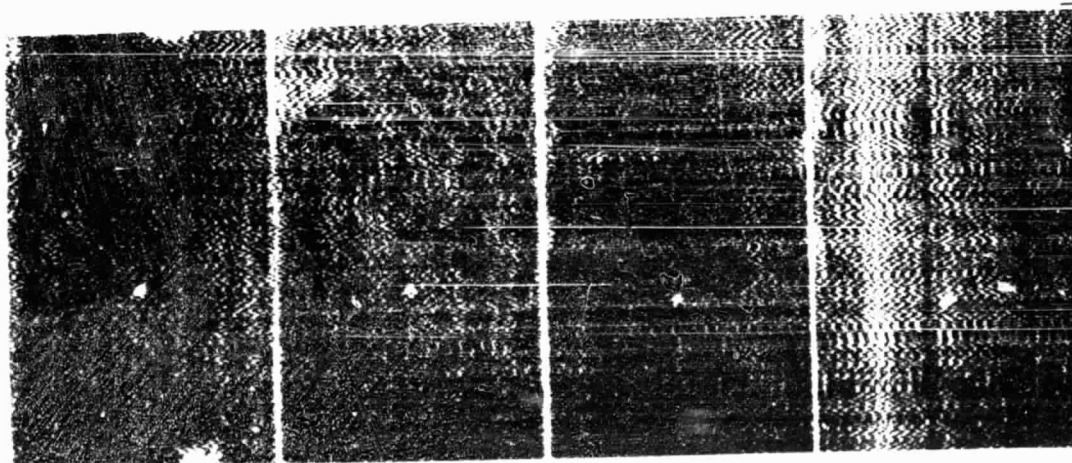

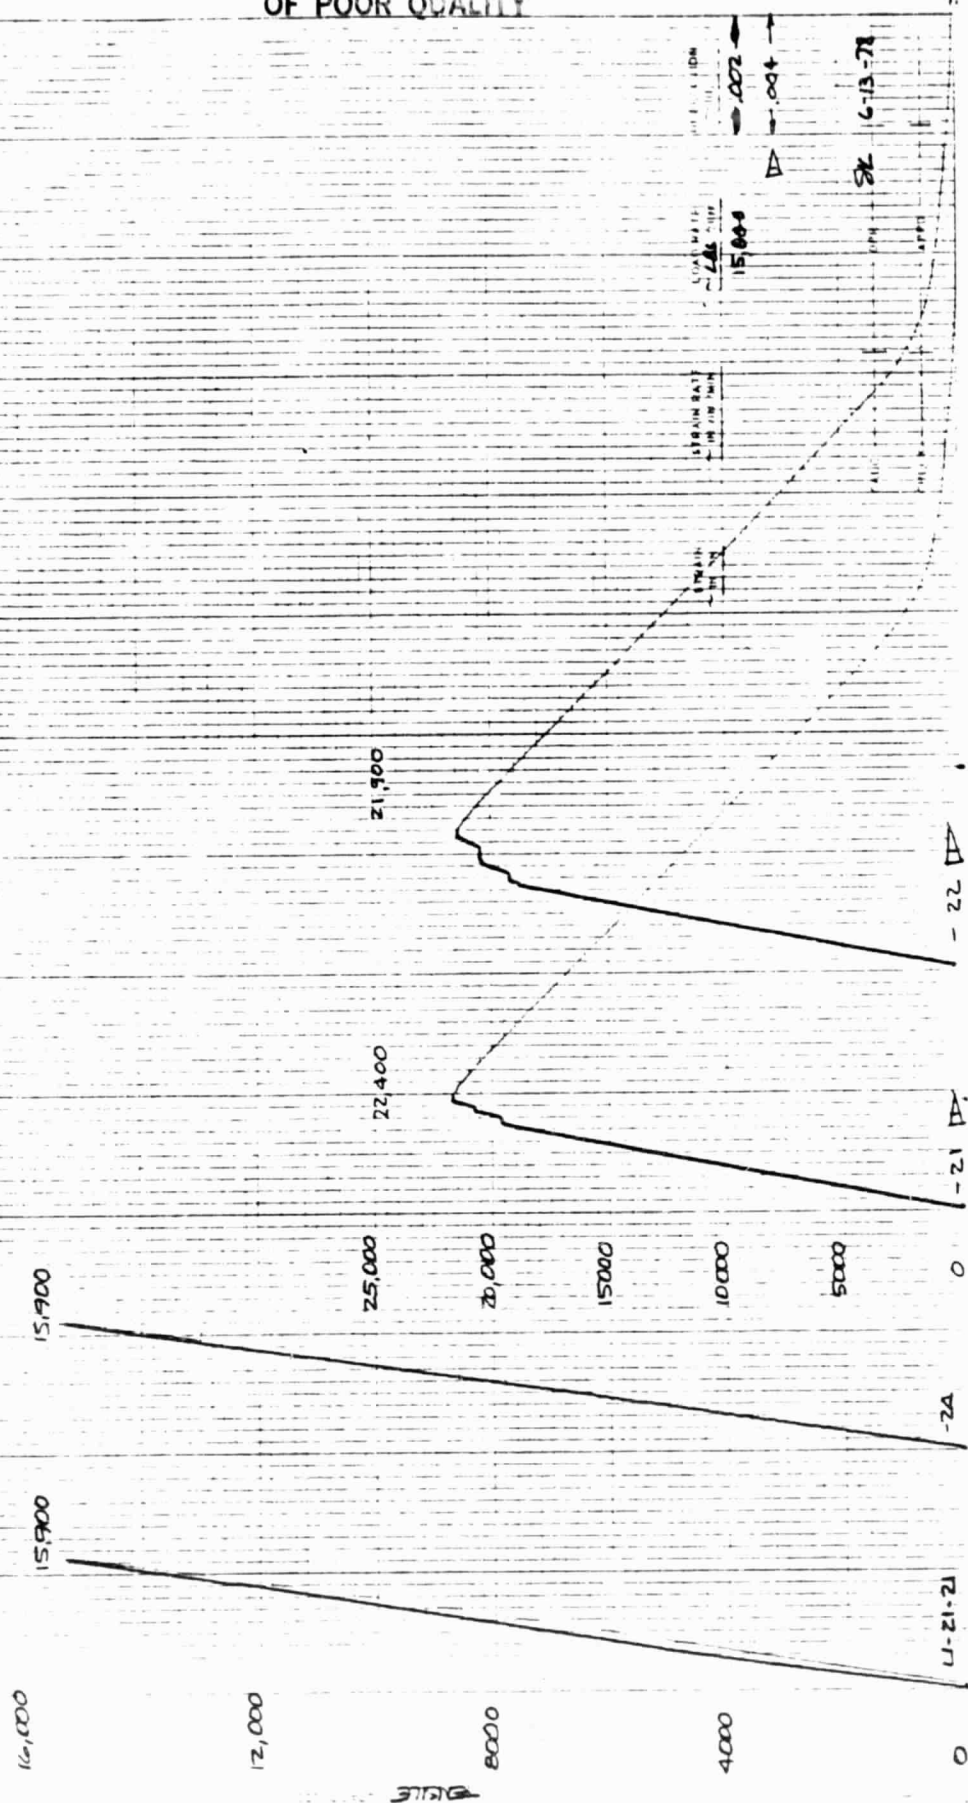

ORIGINAL PAGE IS  
OF POOR QUALITY

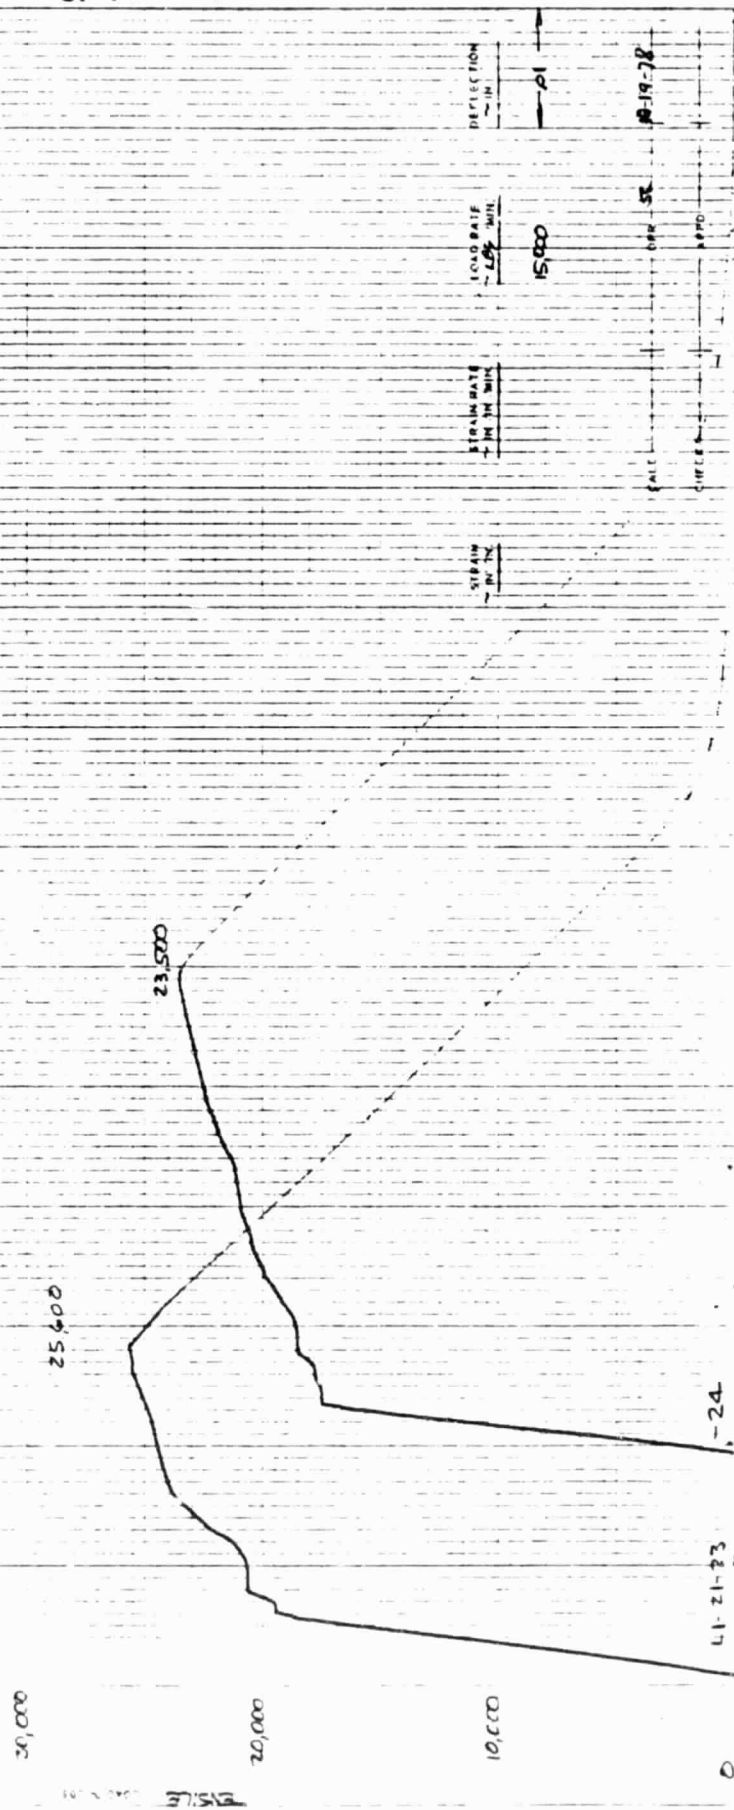



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
3/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-25

L1-21-26


L1-21-27

L1-21-28

INITIAL

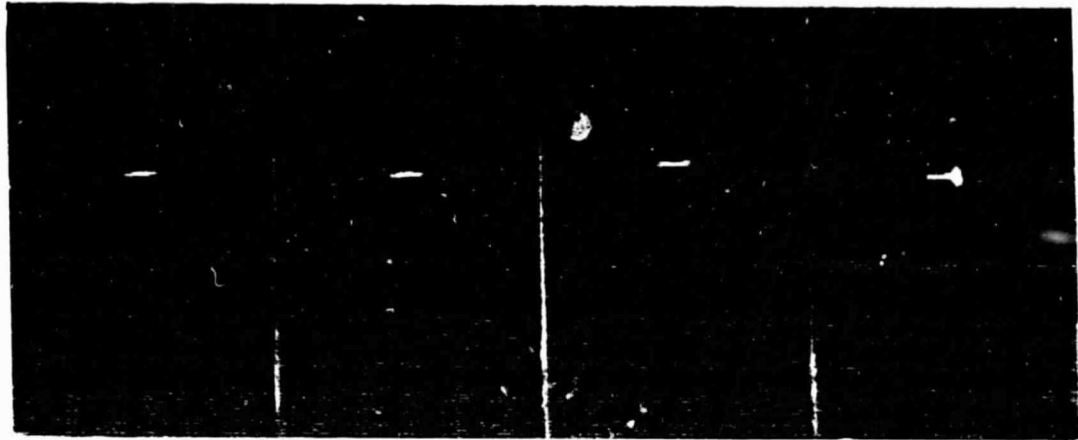


AFTER  
PRELOAD  
12.7 KIP

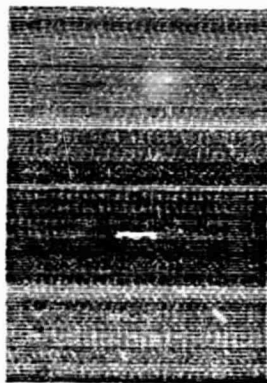


VISUAL DAMAGE

NONE

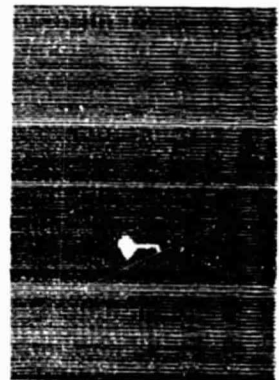


AFTER  
MOISTURE  
CONDITIONING

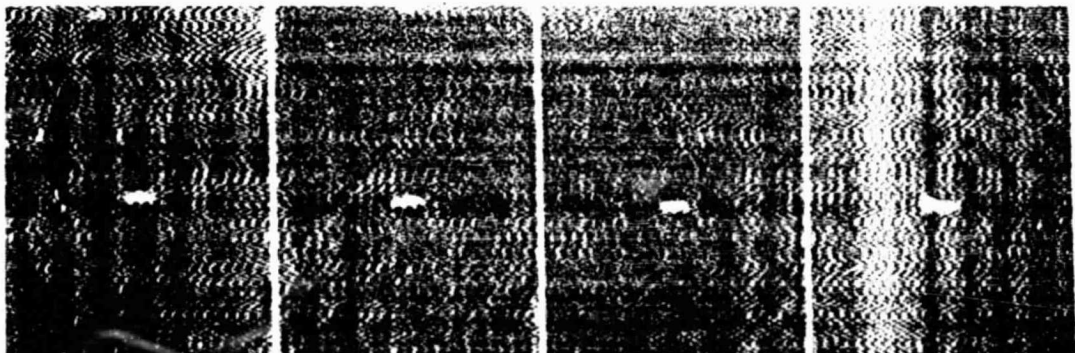

200' 400' A



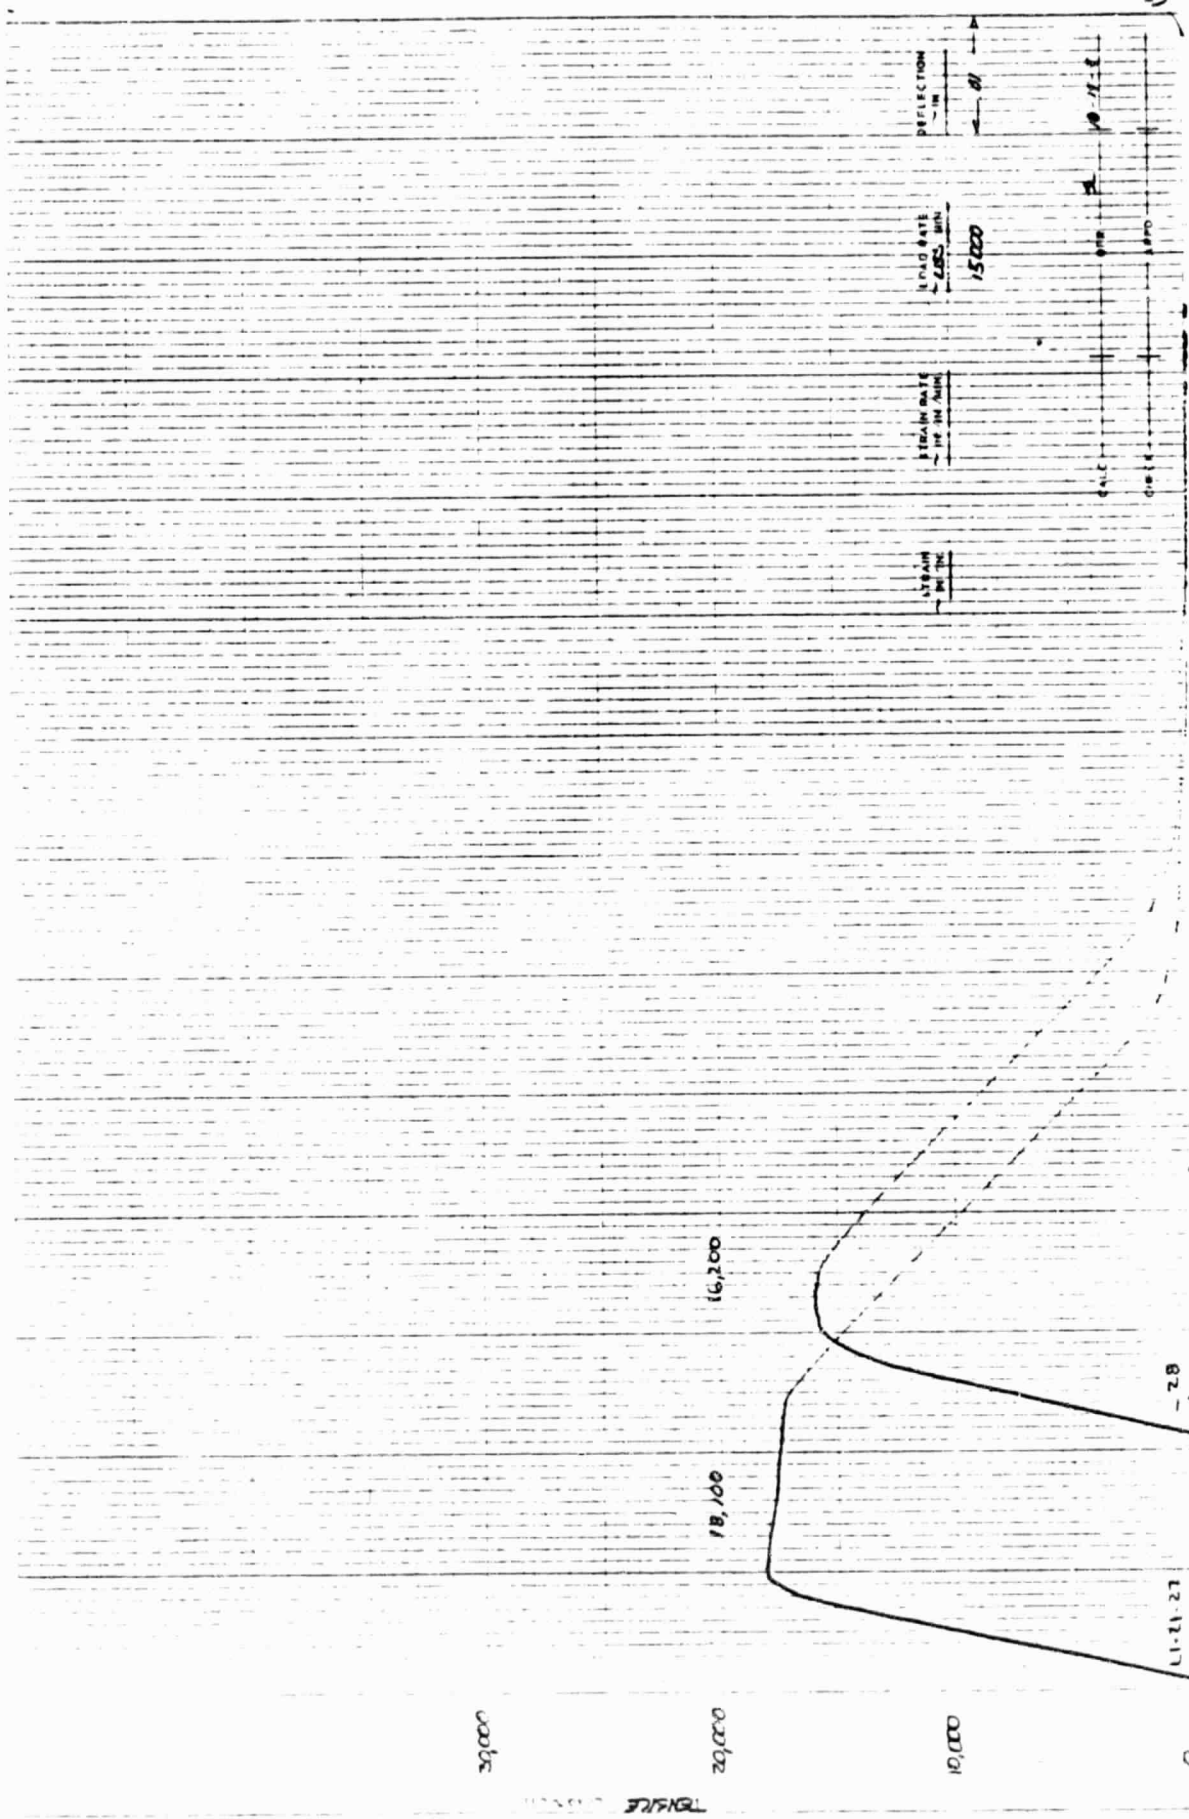



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
5/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-29

L1-21-30

L1-21-31

L1-21-32

INITIAL

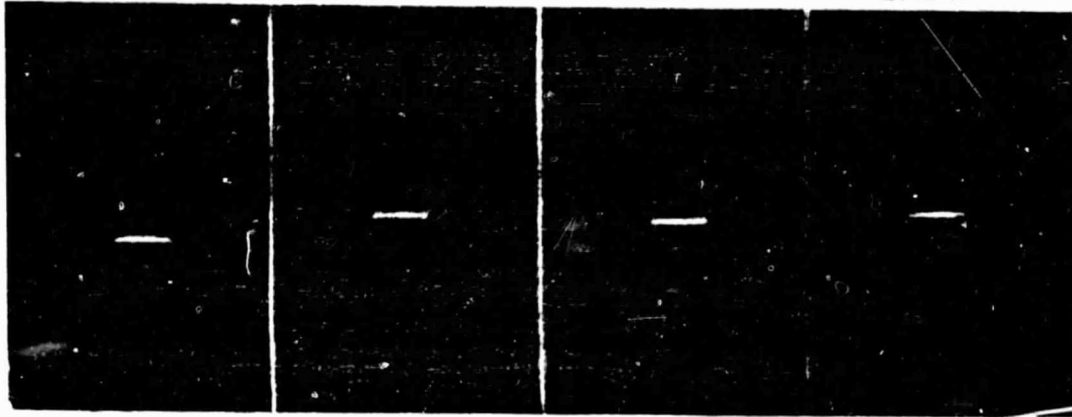


AFTER  
PRELOAD  
10.6 KIP

VISUAL DAMAGE

FINE SPLITS




AFTER  
MOISTURE  
CONDITIONING

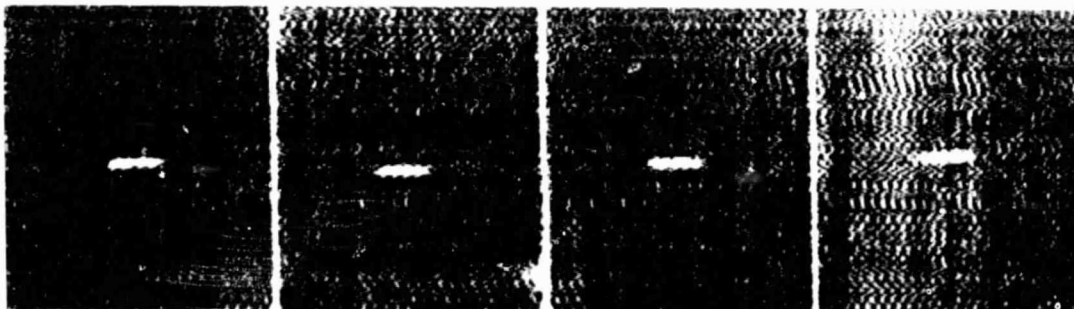

[illegible]

ORIGINAL PAGE IS  
OF POOR QUALITY

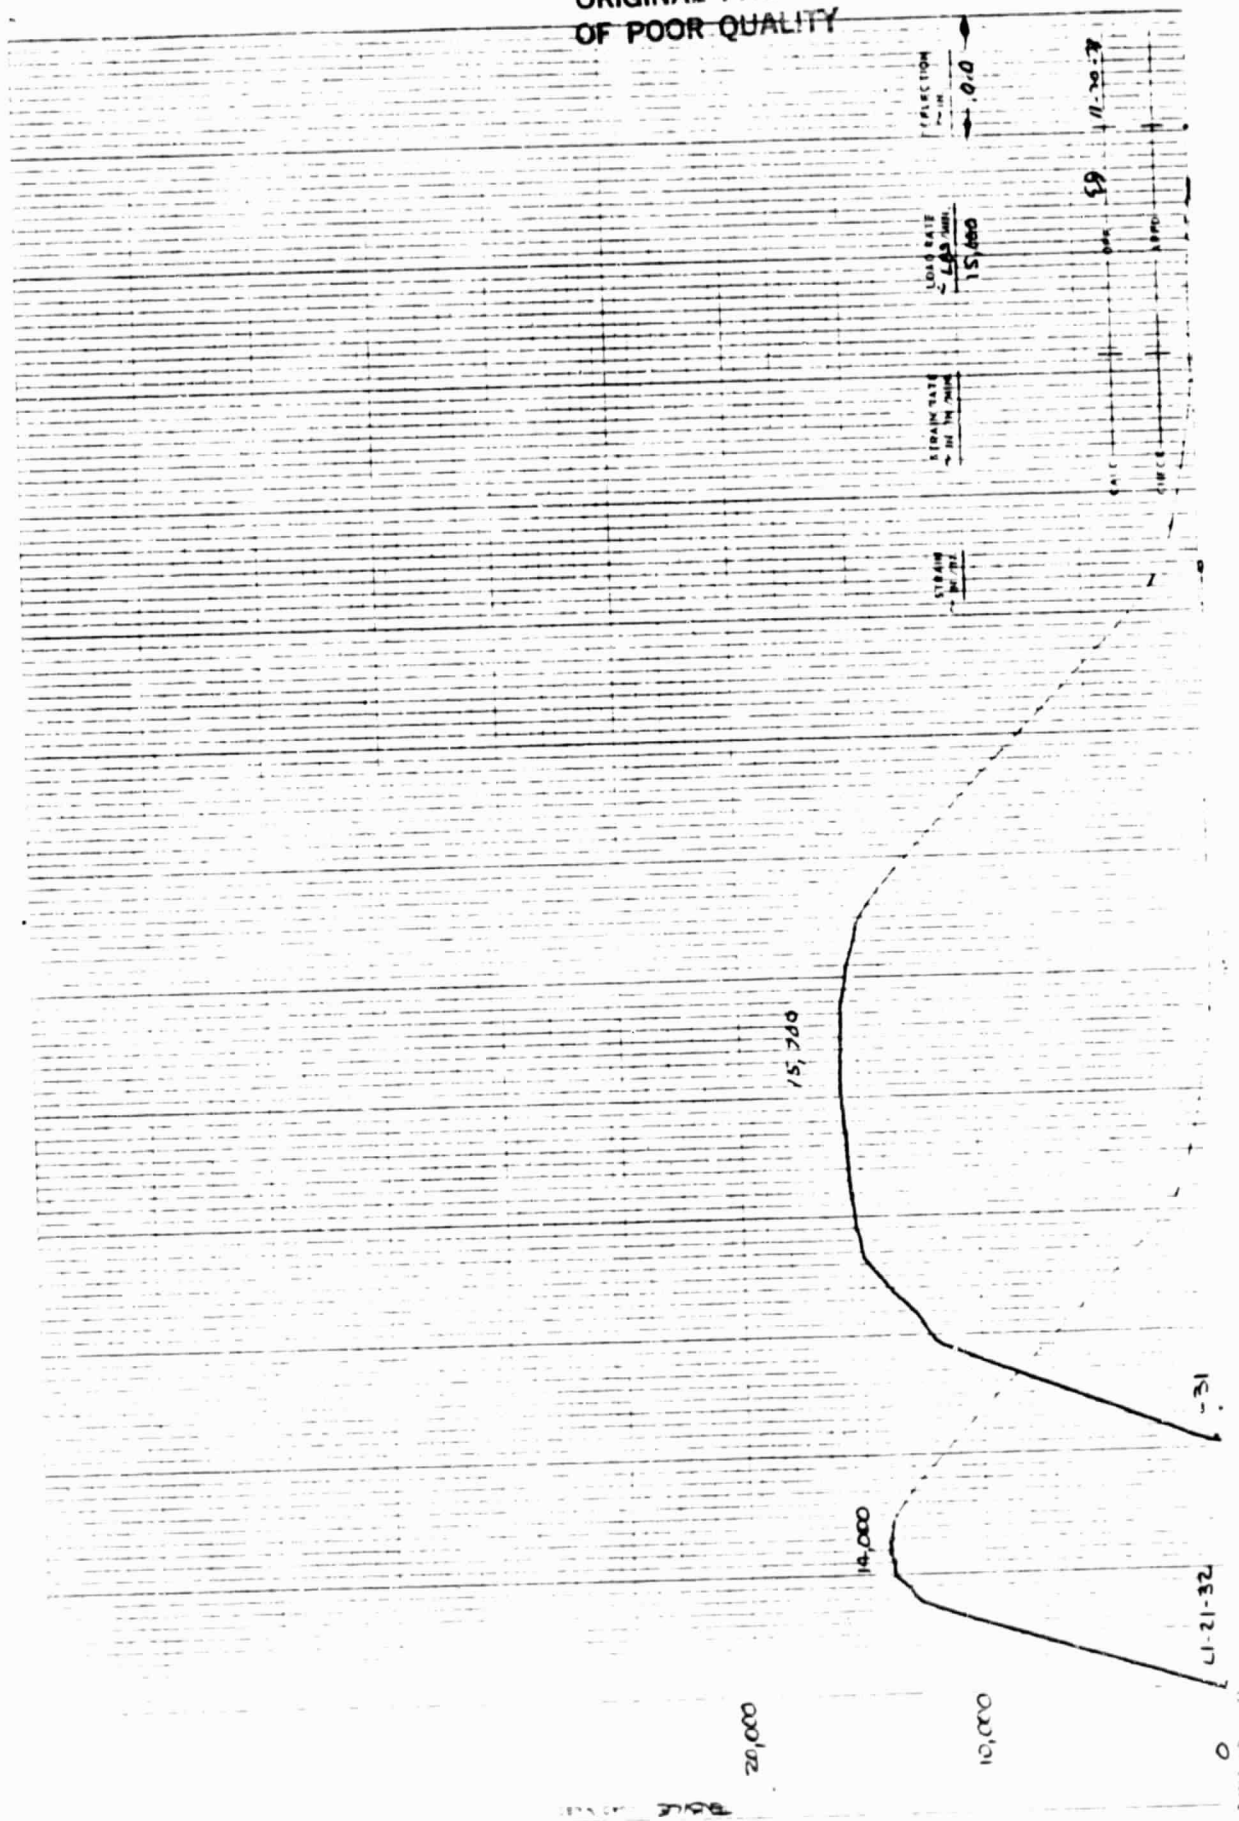


LAMINATE L1  
1/8 CSK HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

INITIAL

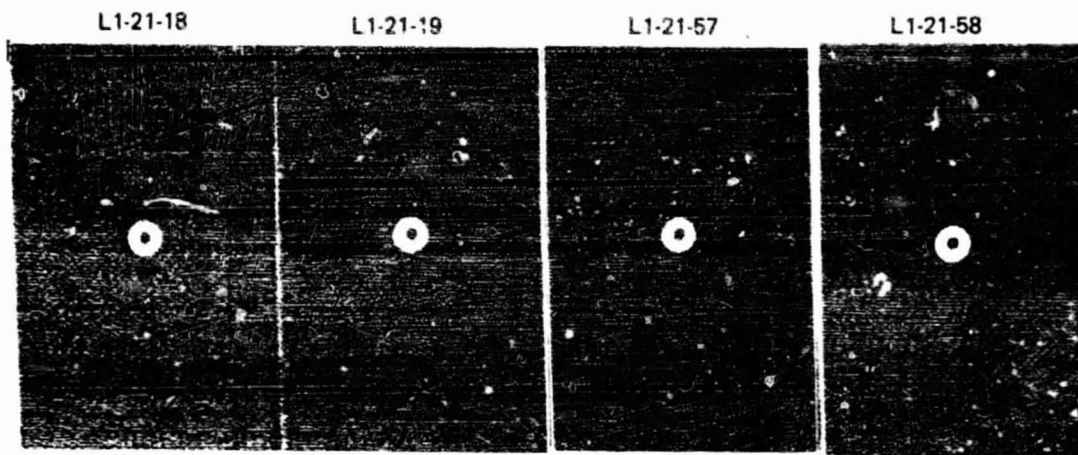

AFTER  
PRELOAD  
13.7 KIP





VISUAL DAMAGE


← NONE

FINE SPLITS ON BACK →




AFTER  
MOISTURE  
CONDITIONING

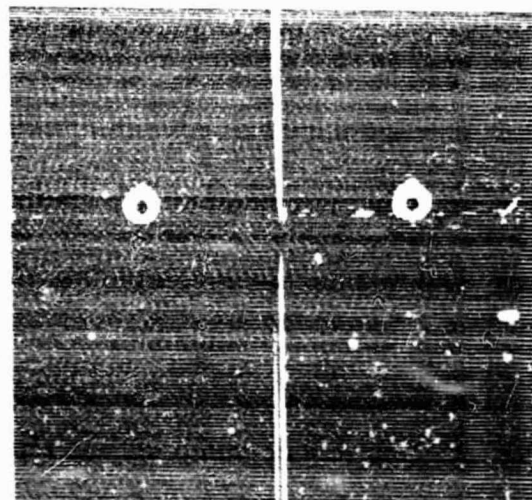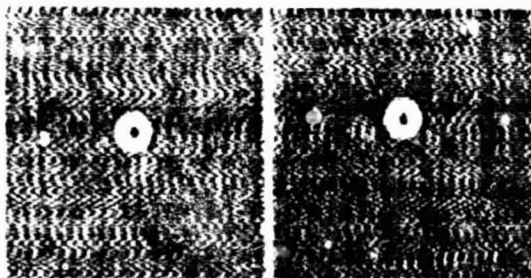


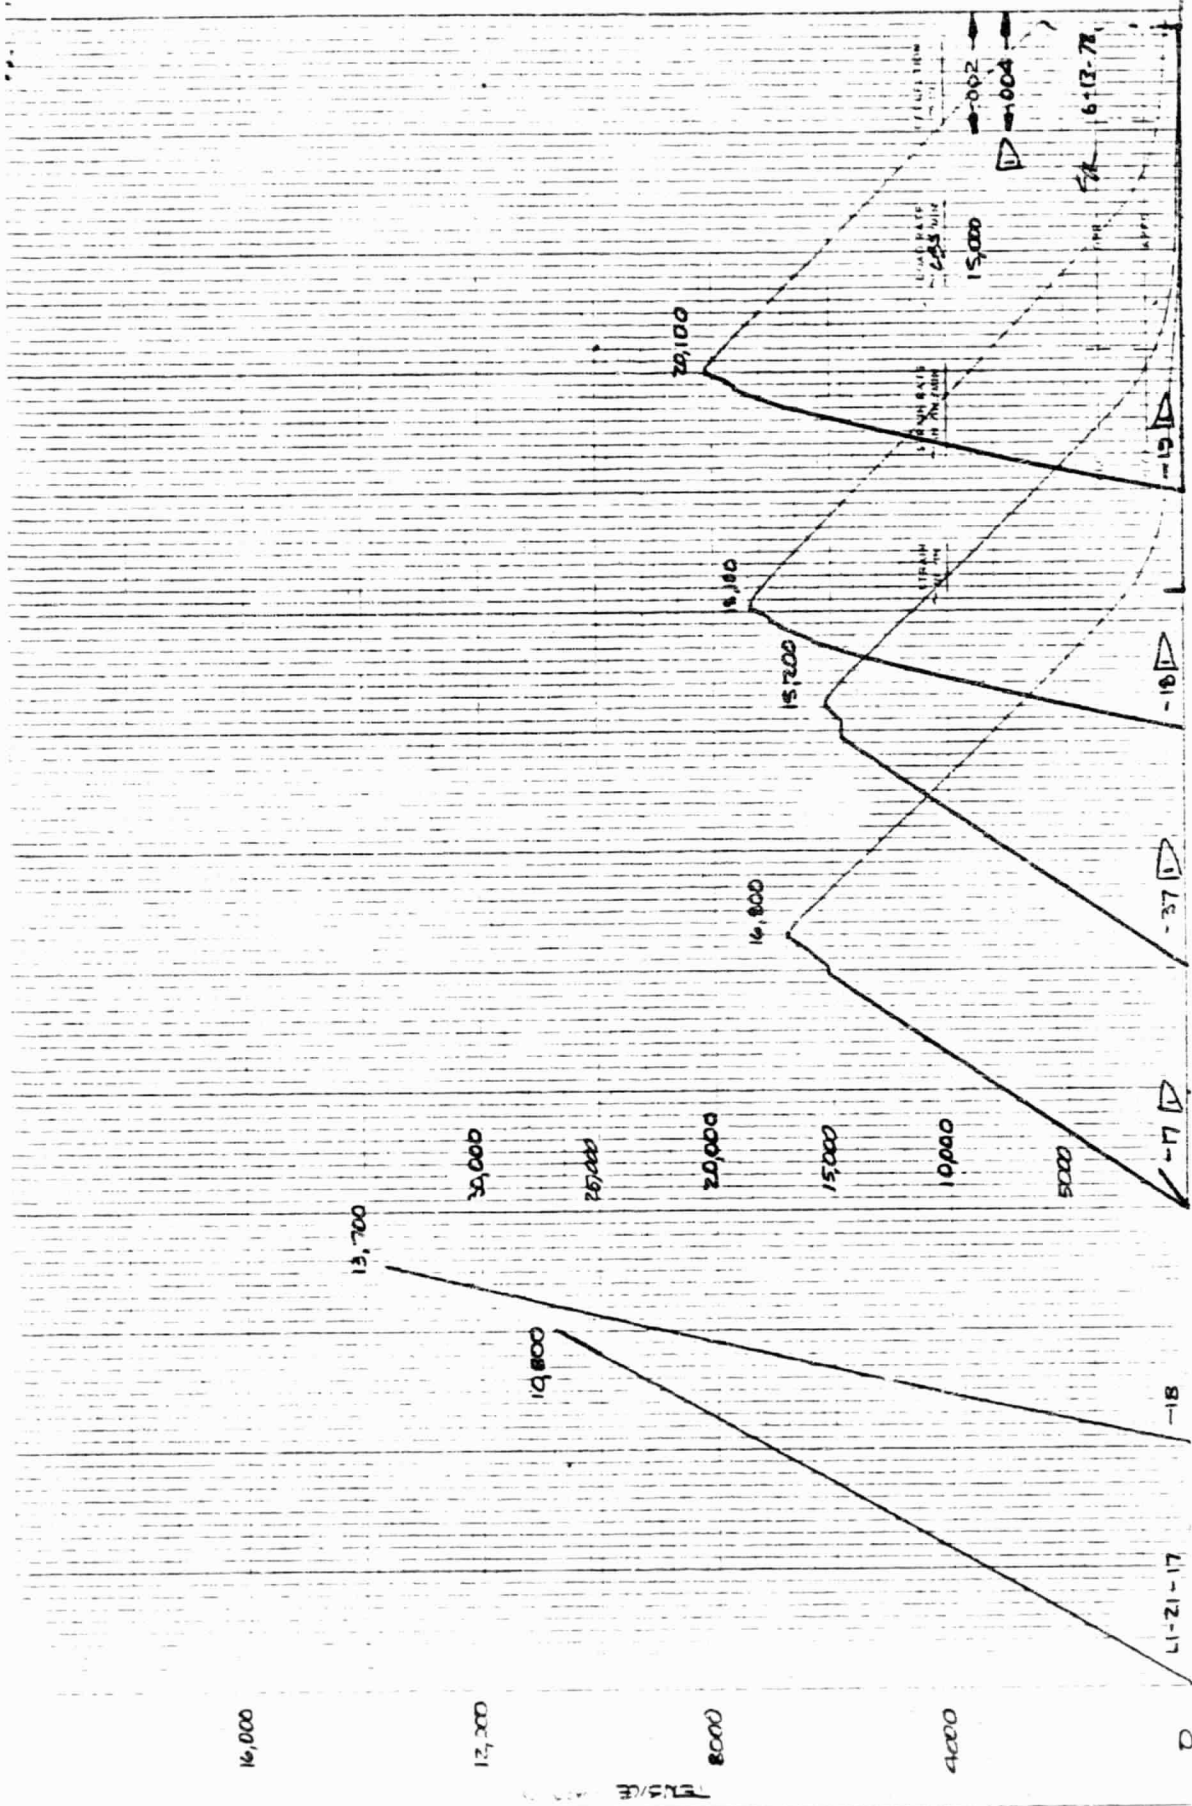



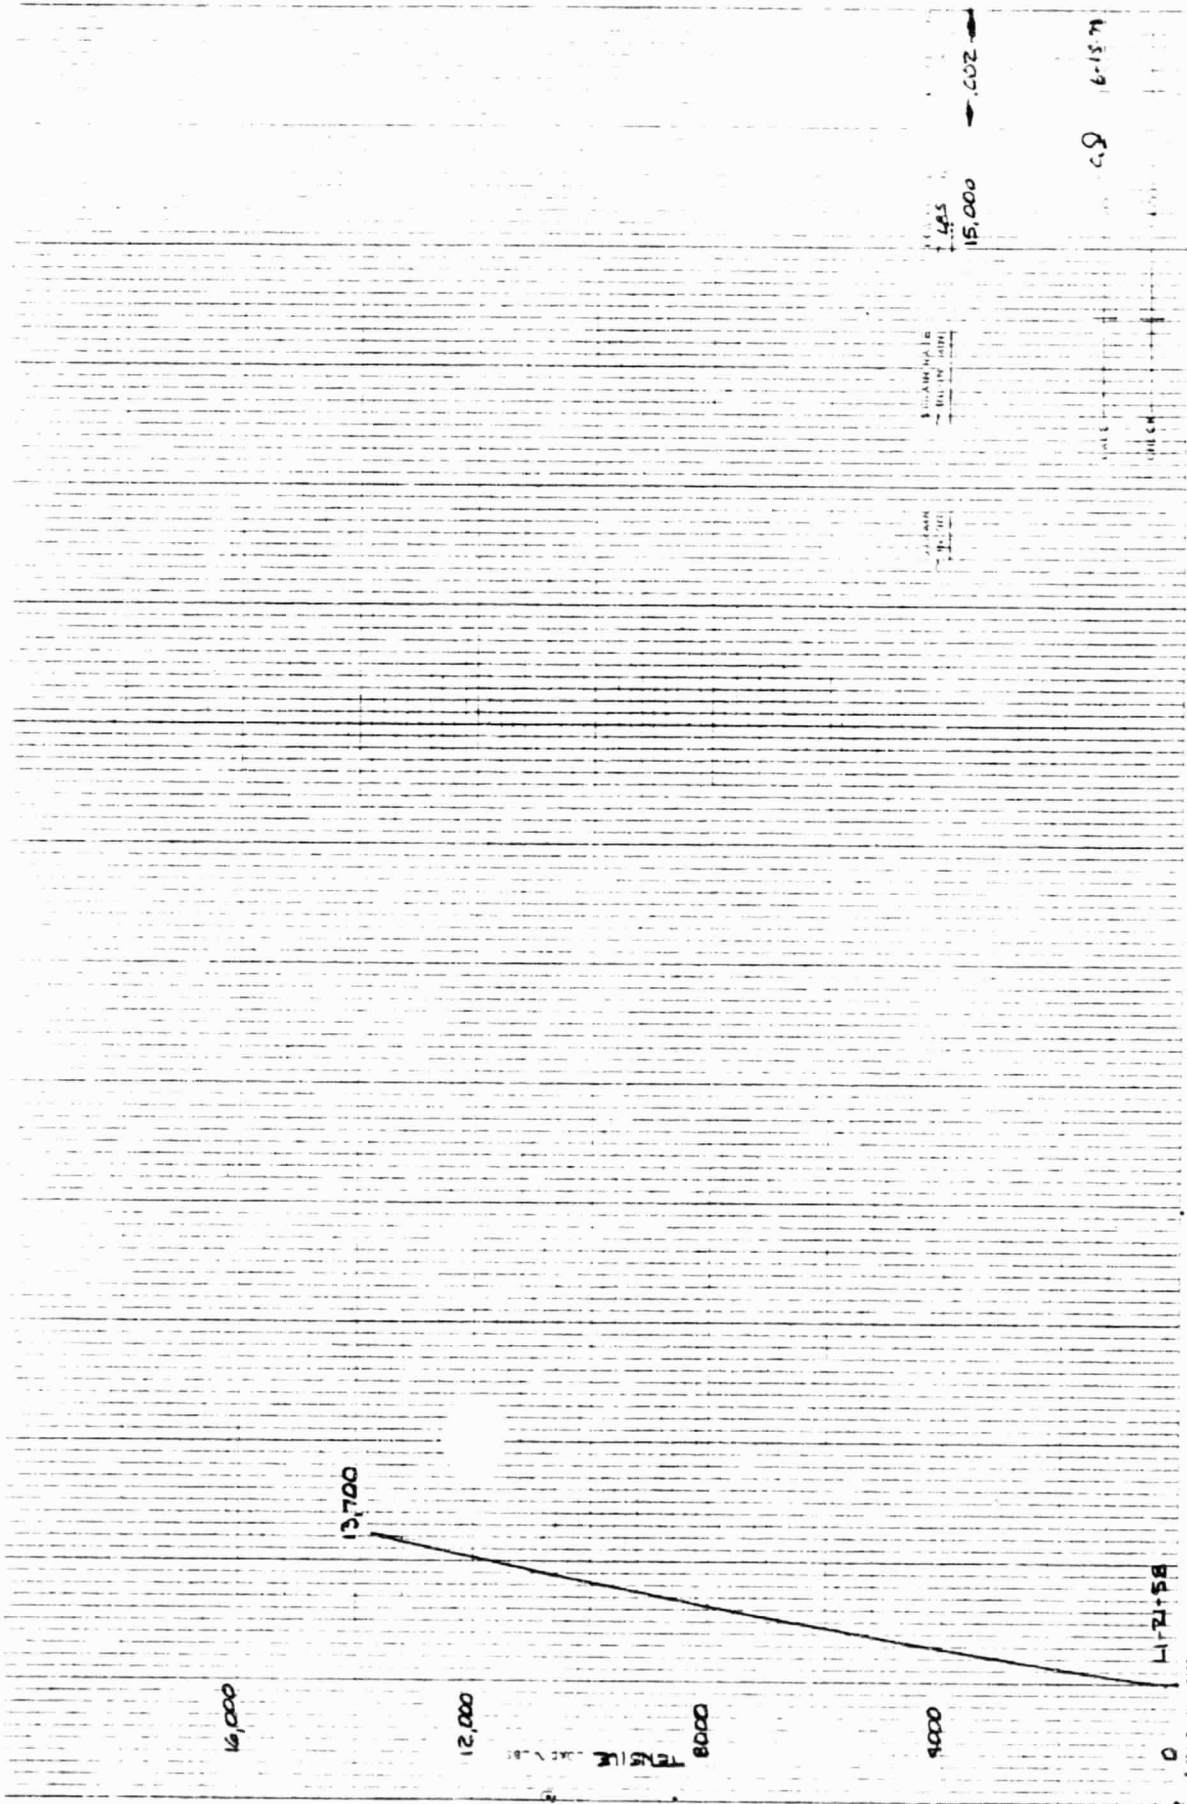

587 2 0507



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
3/8 CSK HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)




INITIAL

L1-21-17


L1-21-37

L1-21-38

L1-21-39

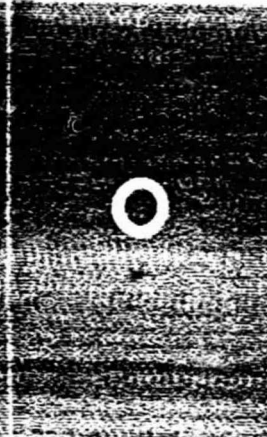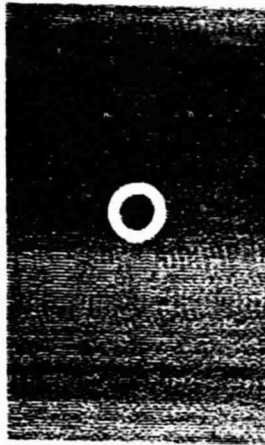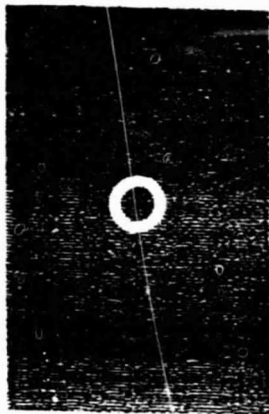


AFTER  
PRELOAD  
10.8 KIP

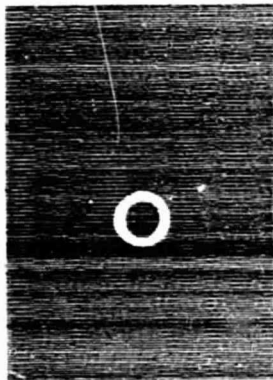





VISUAL DAMAGE

← NONE

FINE SPLITS ON BACK →

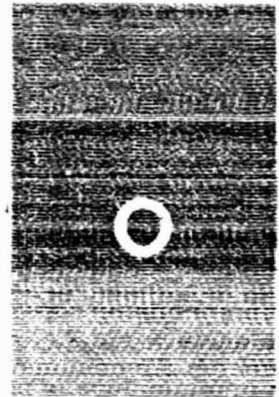

AFTER  
MOISTURE  
CONDITIONING

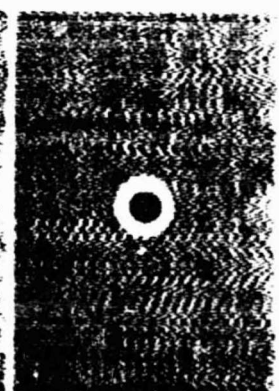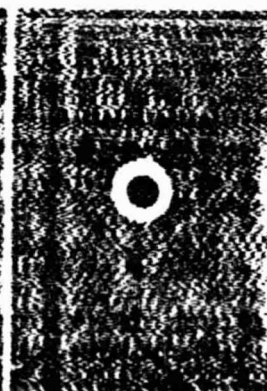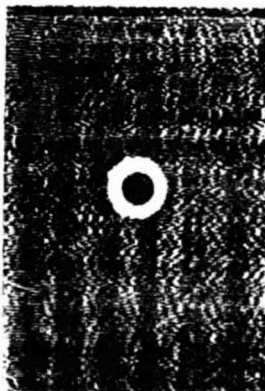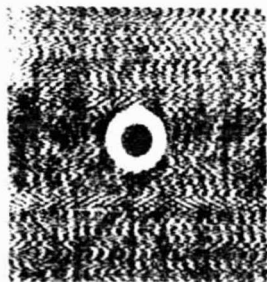



587-4407 E7/SNBL



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH


LAMINATE L1  
5/8 CSK HOLE

TEST SPECIMENS


ROOM TEMPERATURE

422° K (300° F)

INITIAL

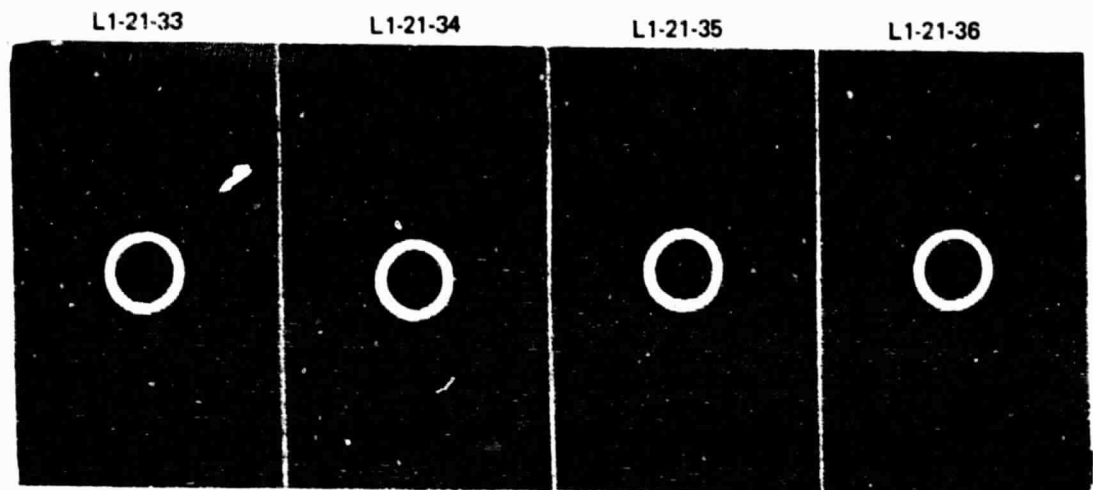

AFTER  
PRELOAD  
8.9 KIP

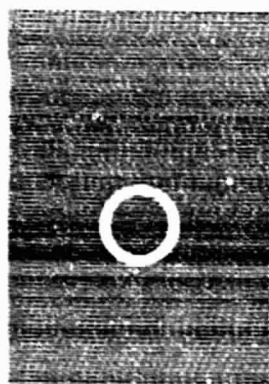



VISUAL DAMAGE

← NONE →



AFTER  
MOISTURE  
CONDITIONING

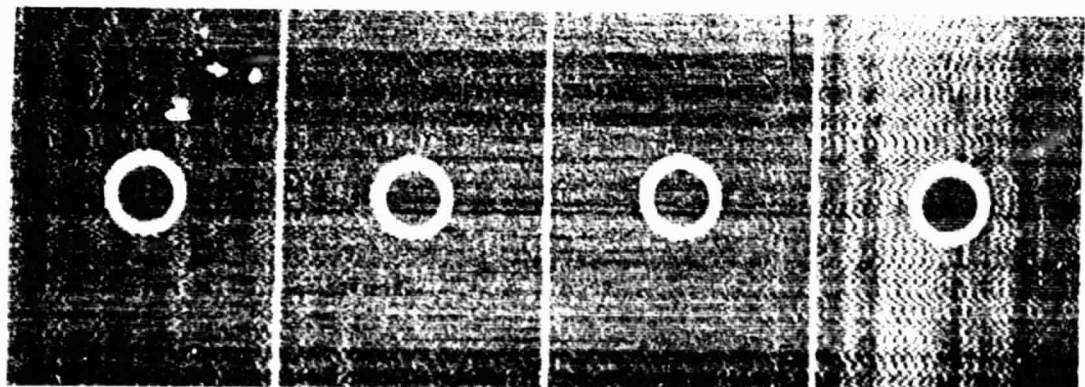

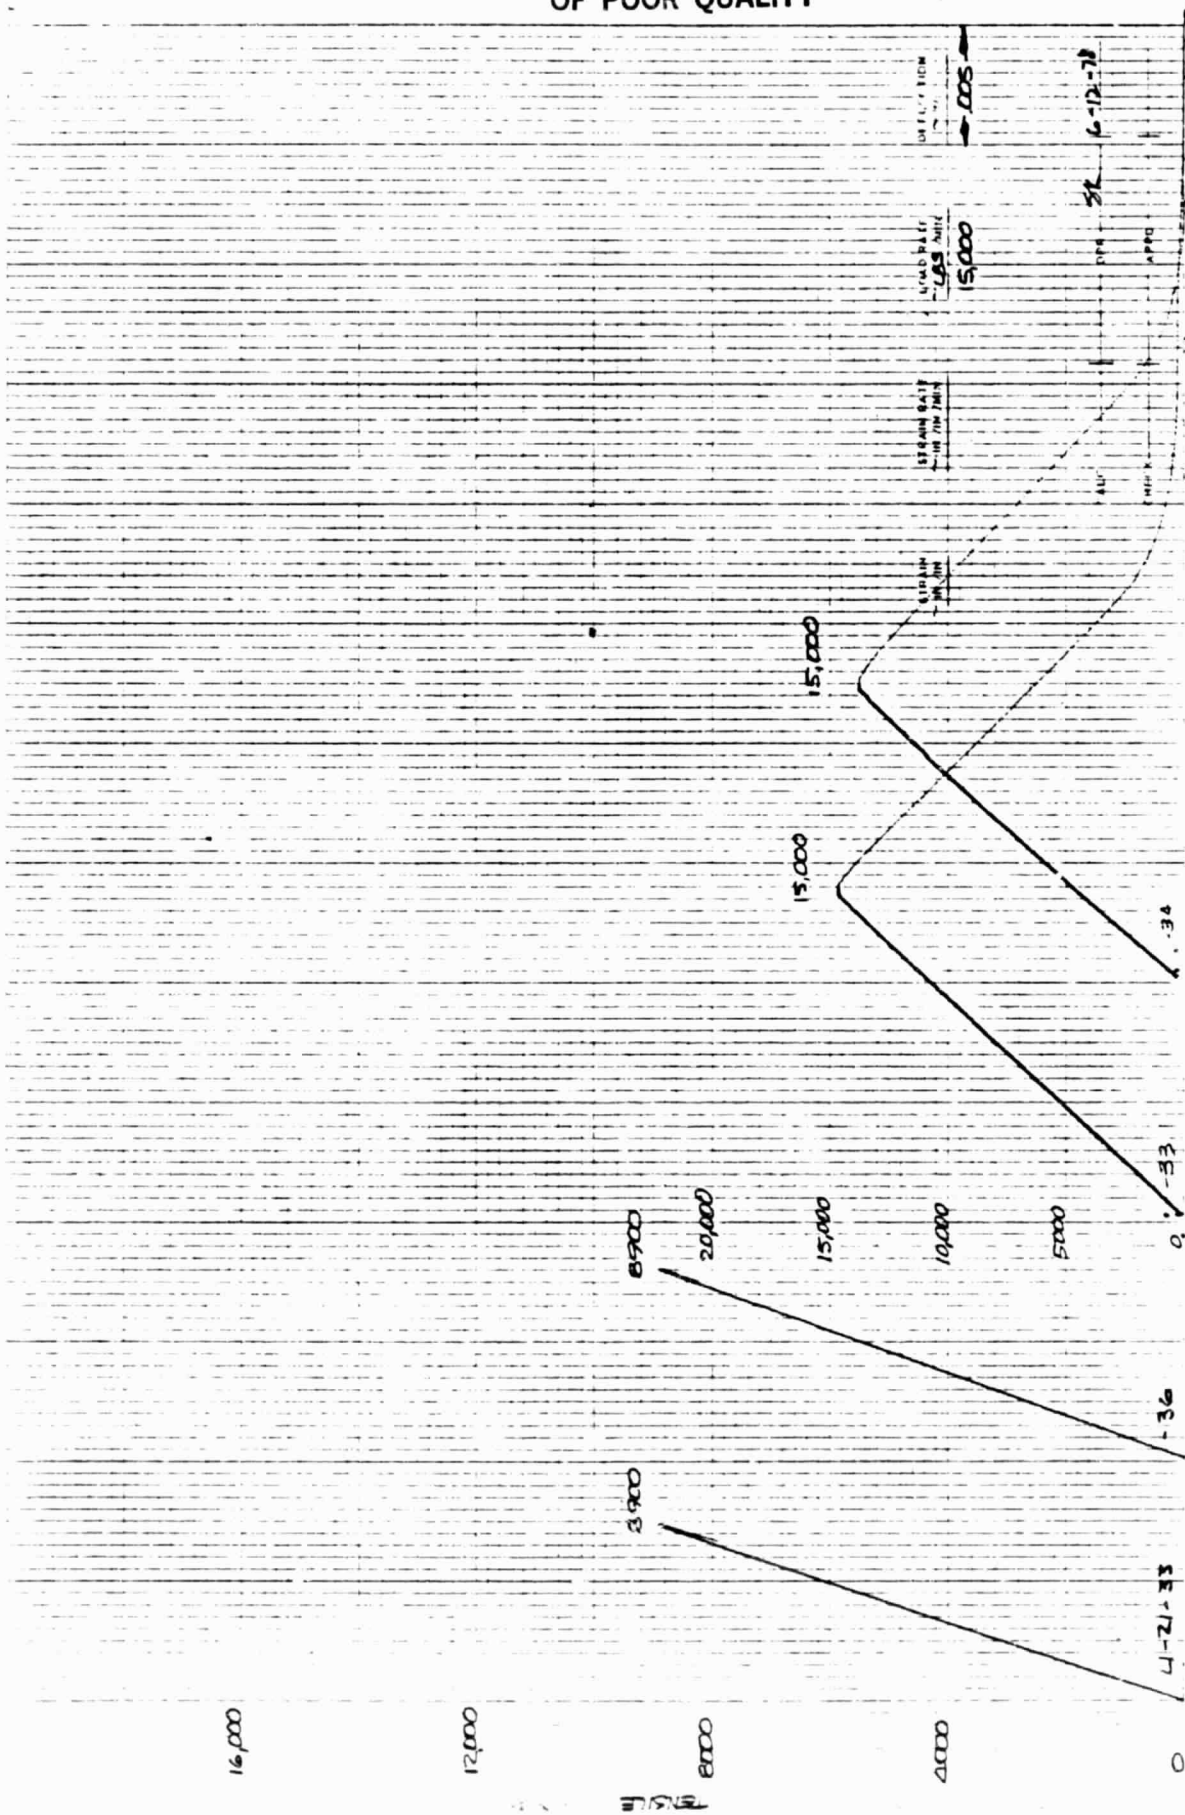

ORIGINAL PAGE IS  
OF POOR QUALITY

10-10-78

15,000

13,400

15,800

0

000/01

000/02

000/03

000/04

000/05

000/06

000/07

000/08

000/09

000/10

000/11

000/12

000/13

000/14

000/15

000/16

000/17

000/18

000/19

000/20

000/21

000/22

000/23

000/24

000/25

000/26

000/27

000/28

000/29

000/30

000/31

000/32

000/33

000/34

000/35

000/36

000/37

000/38

000/39

000/40

000/41

000/42

000/43

000/44

000/45

000/46

000/47

000/48

000/49

000/50

000/51

000/52

000/53

000/54

000/55

000/56

000/57

000/58

000/59

000/60

000/61

000/62

000/63

000/64

000/65

000/66

000/67

000/68

000/69

000/70

000/71

000/72

000/73

000/74

000/75

000/76

000/77

000/78

000/79

000/80

000/81

000/82

000/83

000/84

000/85

000/86

000/87

000/88

000/89

000/90

000/91

000/92

000/93

000/94

000/95

000/96

000/97

000/98

000/99

000/100

000/101

000/102

000/103

000/104

000/105

000/106

000/107

000/108

000/109

000/110

000/111

000/112

000/113

000/114

000/115

000/116

000/117

000/118

000/119

000/120

000/121

000/122

000/123

000/124

000/125

000/126

000/127

000/128

000/129

000/130

000/131

000/132

000/133

000/134

000/135

000/136

000/137

000/138

000/139

000/140

000/141

000/142

000/143

000/144

000/145

000/146

000/147

000/148

000/149

000/150

000/151

000/152

000/153

000/154

000/155

000/156

000/157

000/158

000/159

000/160

000/161

000/162

000/163

000/164

000/165

000/166

000/167

000/168

000/169

000/170

000/171

000/172

000/173

000/174

000/175

000/176

000/177

000/178

000/179

000/180

000/181

000/182

000/183

000/184

000/185

000/186

000/187

000/188

000/189

000/190

000/191

000/192

000/193

000/194

000/195

000/196

000/197

000/198

000/199

000/200

000/201

000/202

000/203

000/204

000/205

000/206

000/207

000/208

000/209

000/210

000/211

000/212

000/213

000/214

000/215

000/216

000/217

000/218

000/219

000/220

000/221

000/222

000/223

000/224

000/225

000/226

000/227

000/228

000/229

000/230

000/231

000/232

000/233

000/234

000/235

000/236

000/237

000/238

000/239

000/240

000/241

000/242

000/243

000/244

000/245

000/246

000/247

000/248

000/249

000/250

000/251

000/252

000/253

000/254

000/255

000/256

000/257

000/258

000/259

000/260

000/261

000/262

000/263

000/264

000/265

000/266

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
1/8 HP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-41

L1-21-42

L1-21-43

L1-21-44

INITIAL

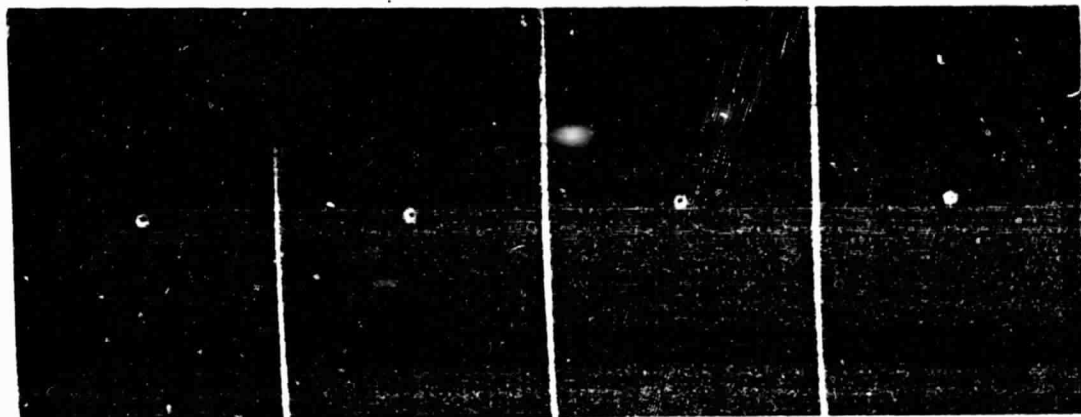



AFTER  
PRELOAD  
20.7 KIP

VISUAL DAMAGE

NONE



AFTER  
MOISTURE  
CONDITIONING

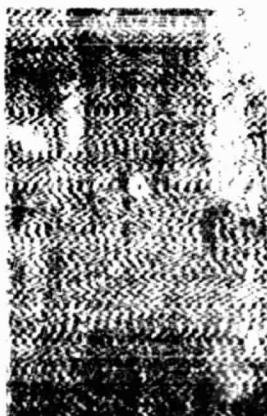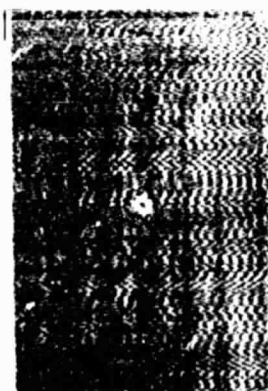


2.





ORIGINAL PAGE IS  
OF POOR QUALITY

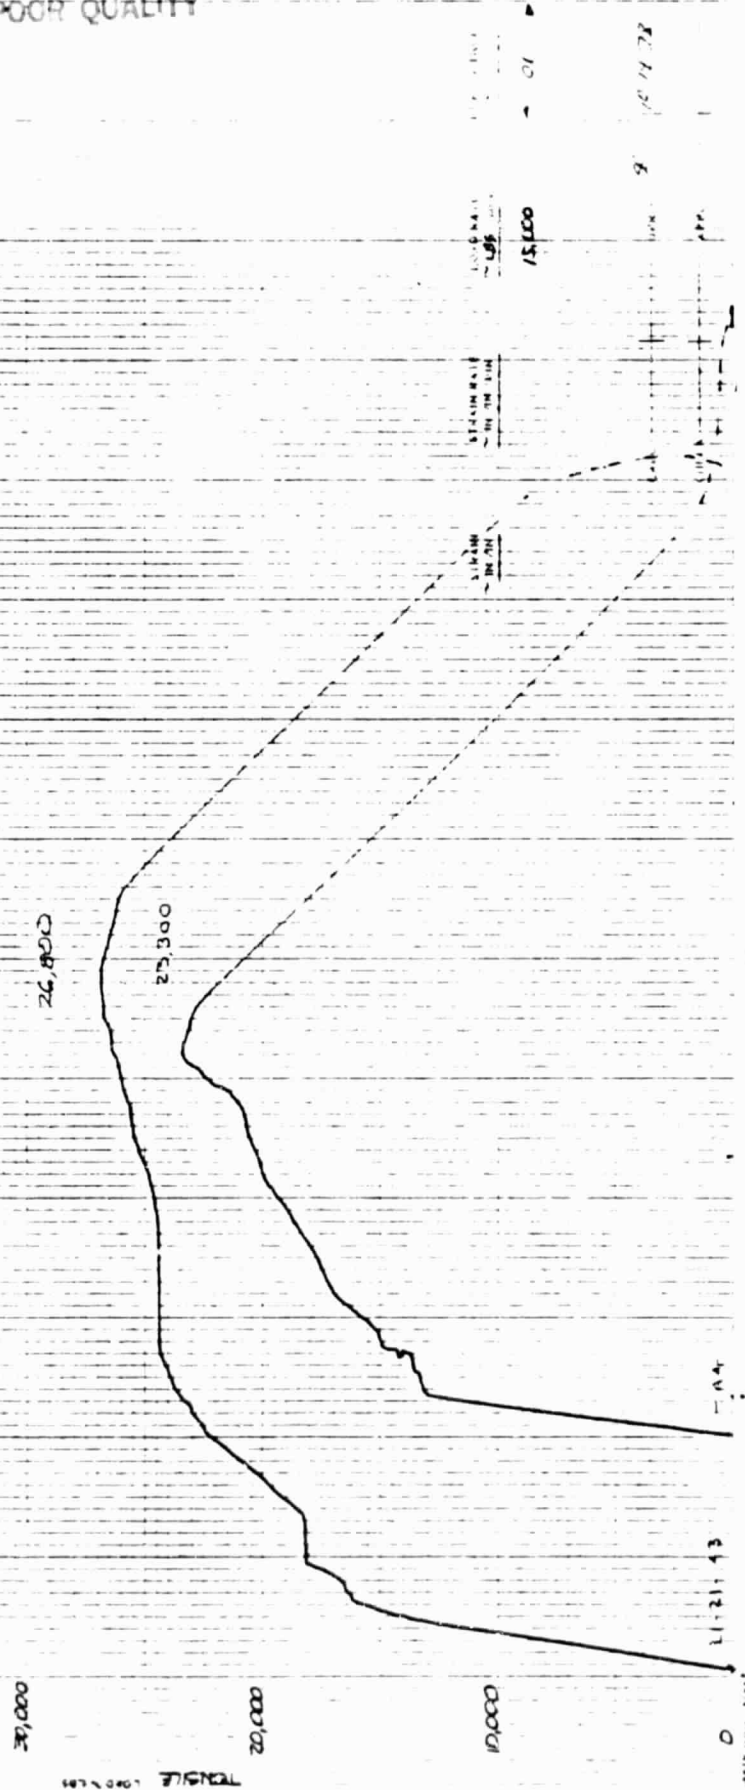

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
1/8 HP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L1-21-45

L1-21-46

L1-21-47

L1-21-48

INITIAL

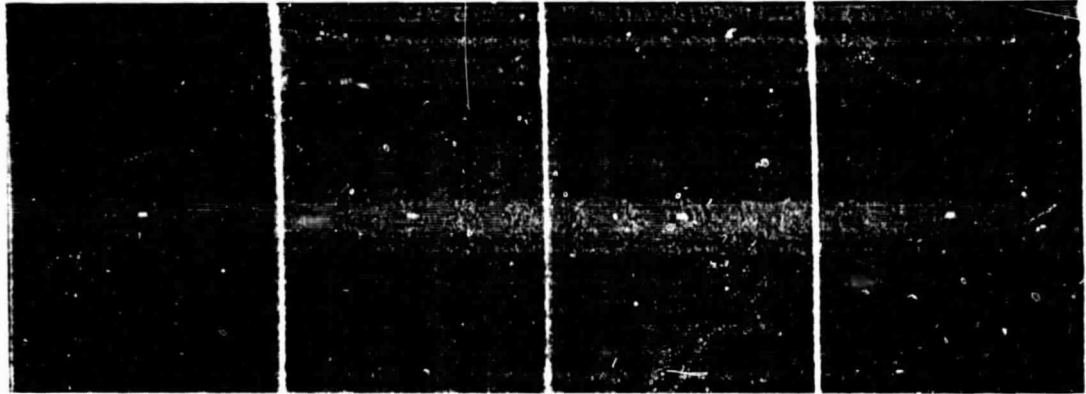


AFTER  
PRELOAD  
19.1 KIP




VISUAL DAMAGE

← NONE →

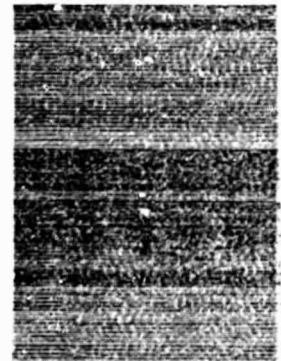


AFTER  
MOISTURE  
CONDITIONING

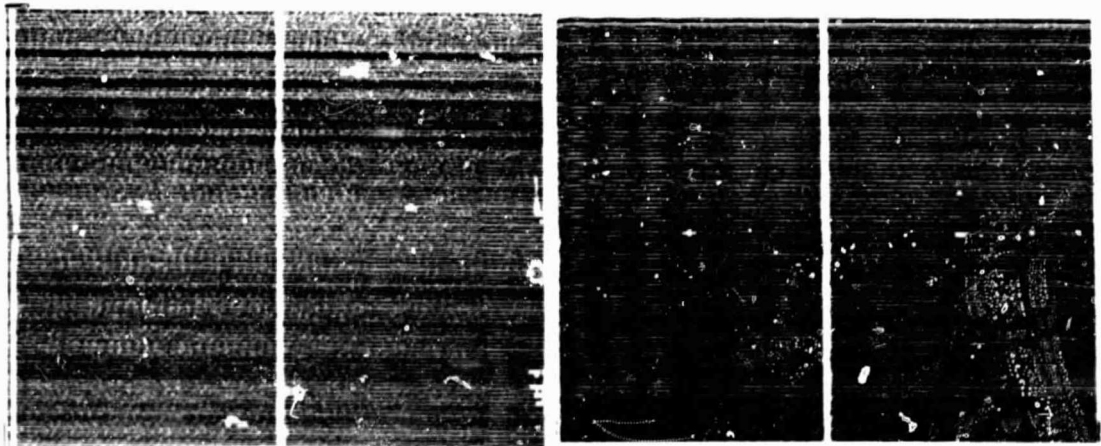




ORIGINAL PAGE IS  
OF POOR QUALITY

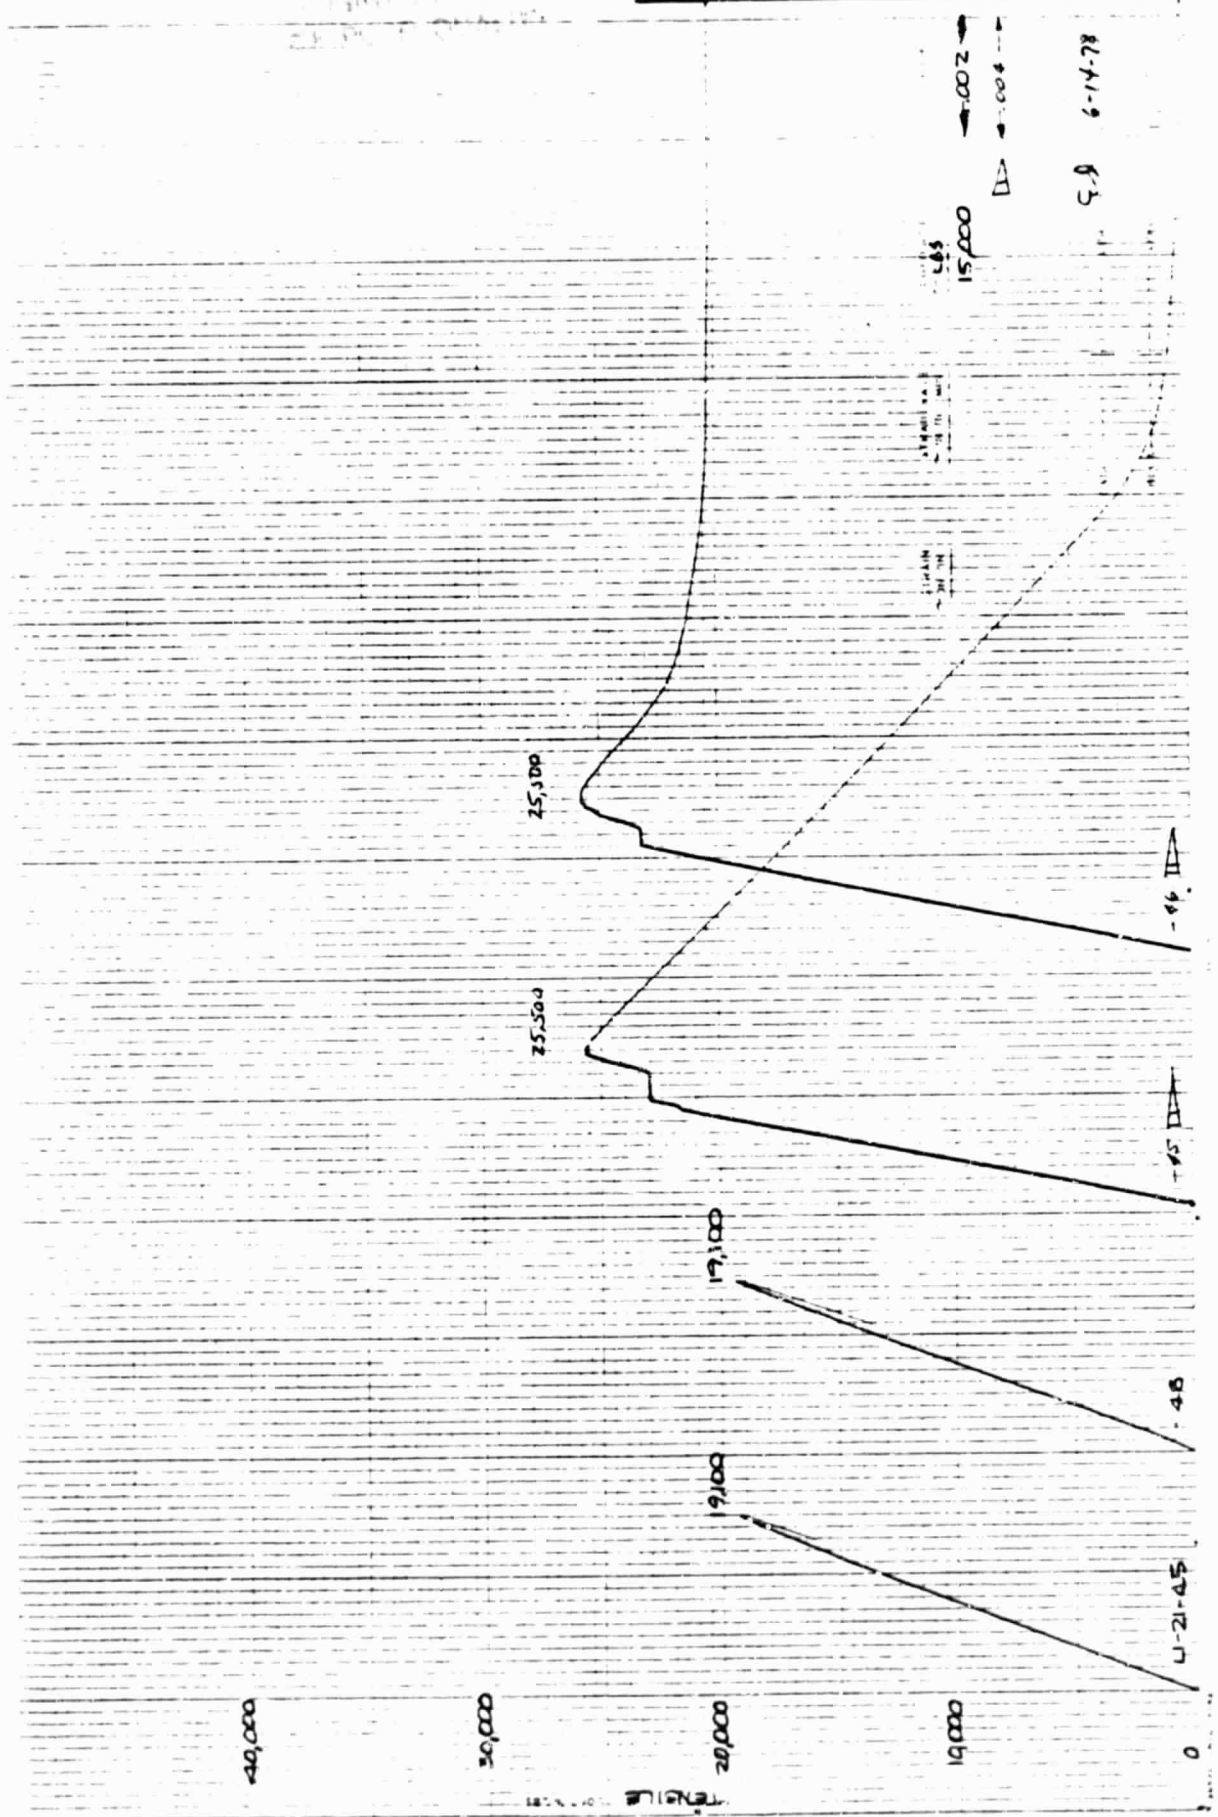

ORIGINAL PAGE IS  
OF POOR QUALITY

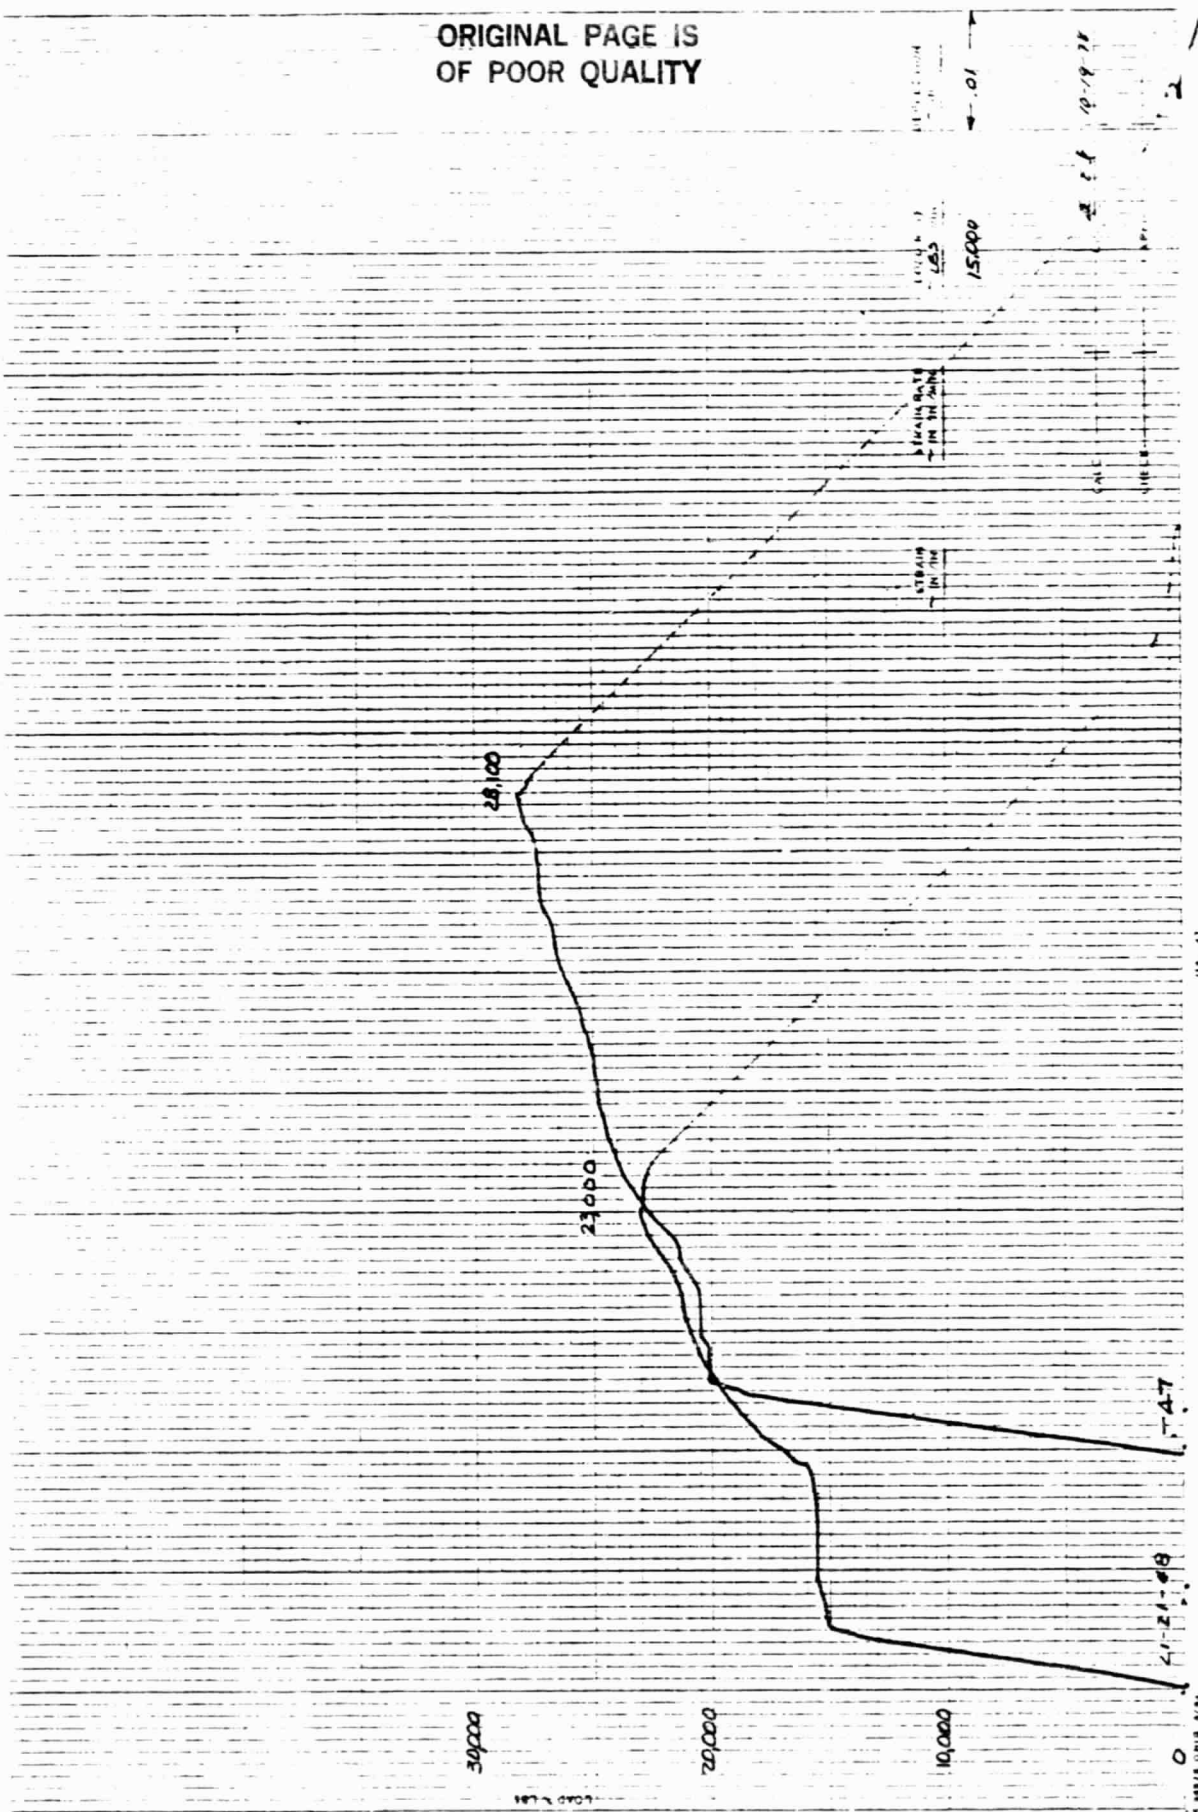

C-3

U.S. GOVERNMENT PRINTING OFFICE: 1964

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
3/8 HP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

L1-21-49

L1-21-50

L1-21-51

L1-21-52


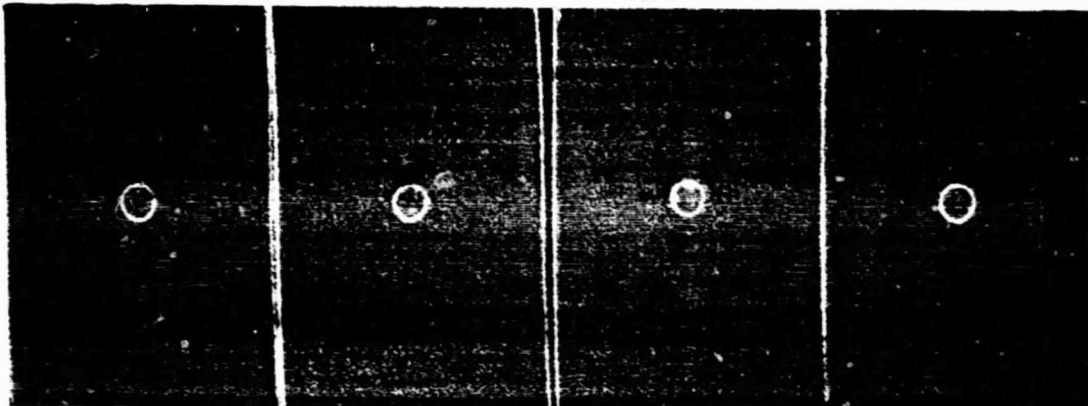


AFTER  
PRELOAD  
18.3 KIP


VISUAL DAMAGE

← FINE CRACK


NONE →

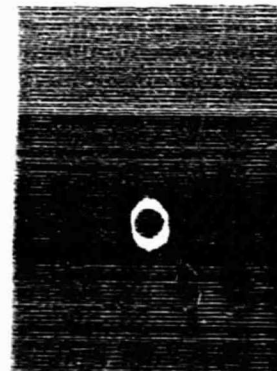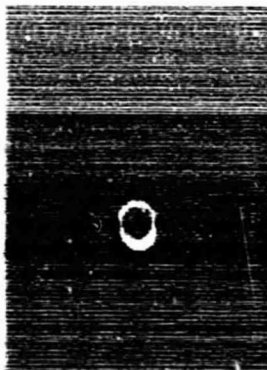


AFTER  
MOISTURE  
CONDITIONING

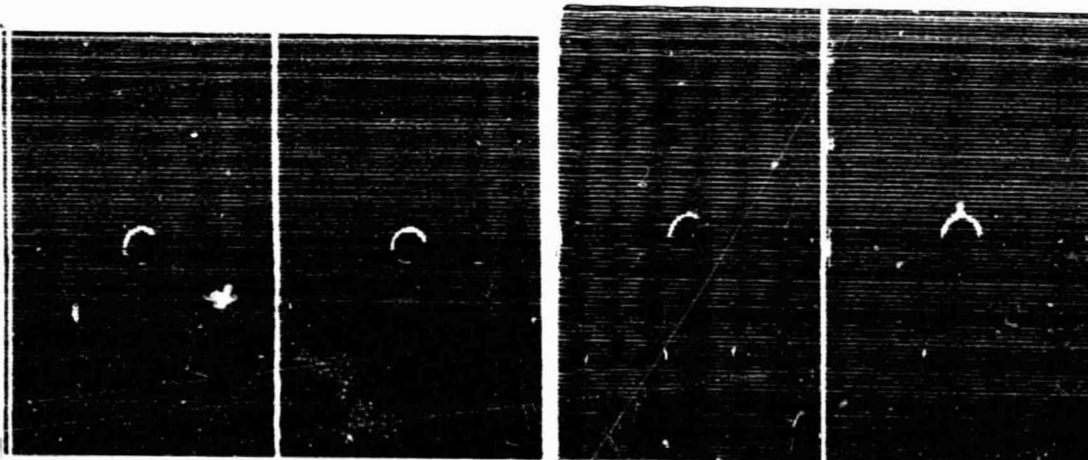

ORIGINAL PAGE IS  
OF POOR QUALITY

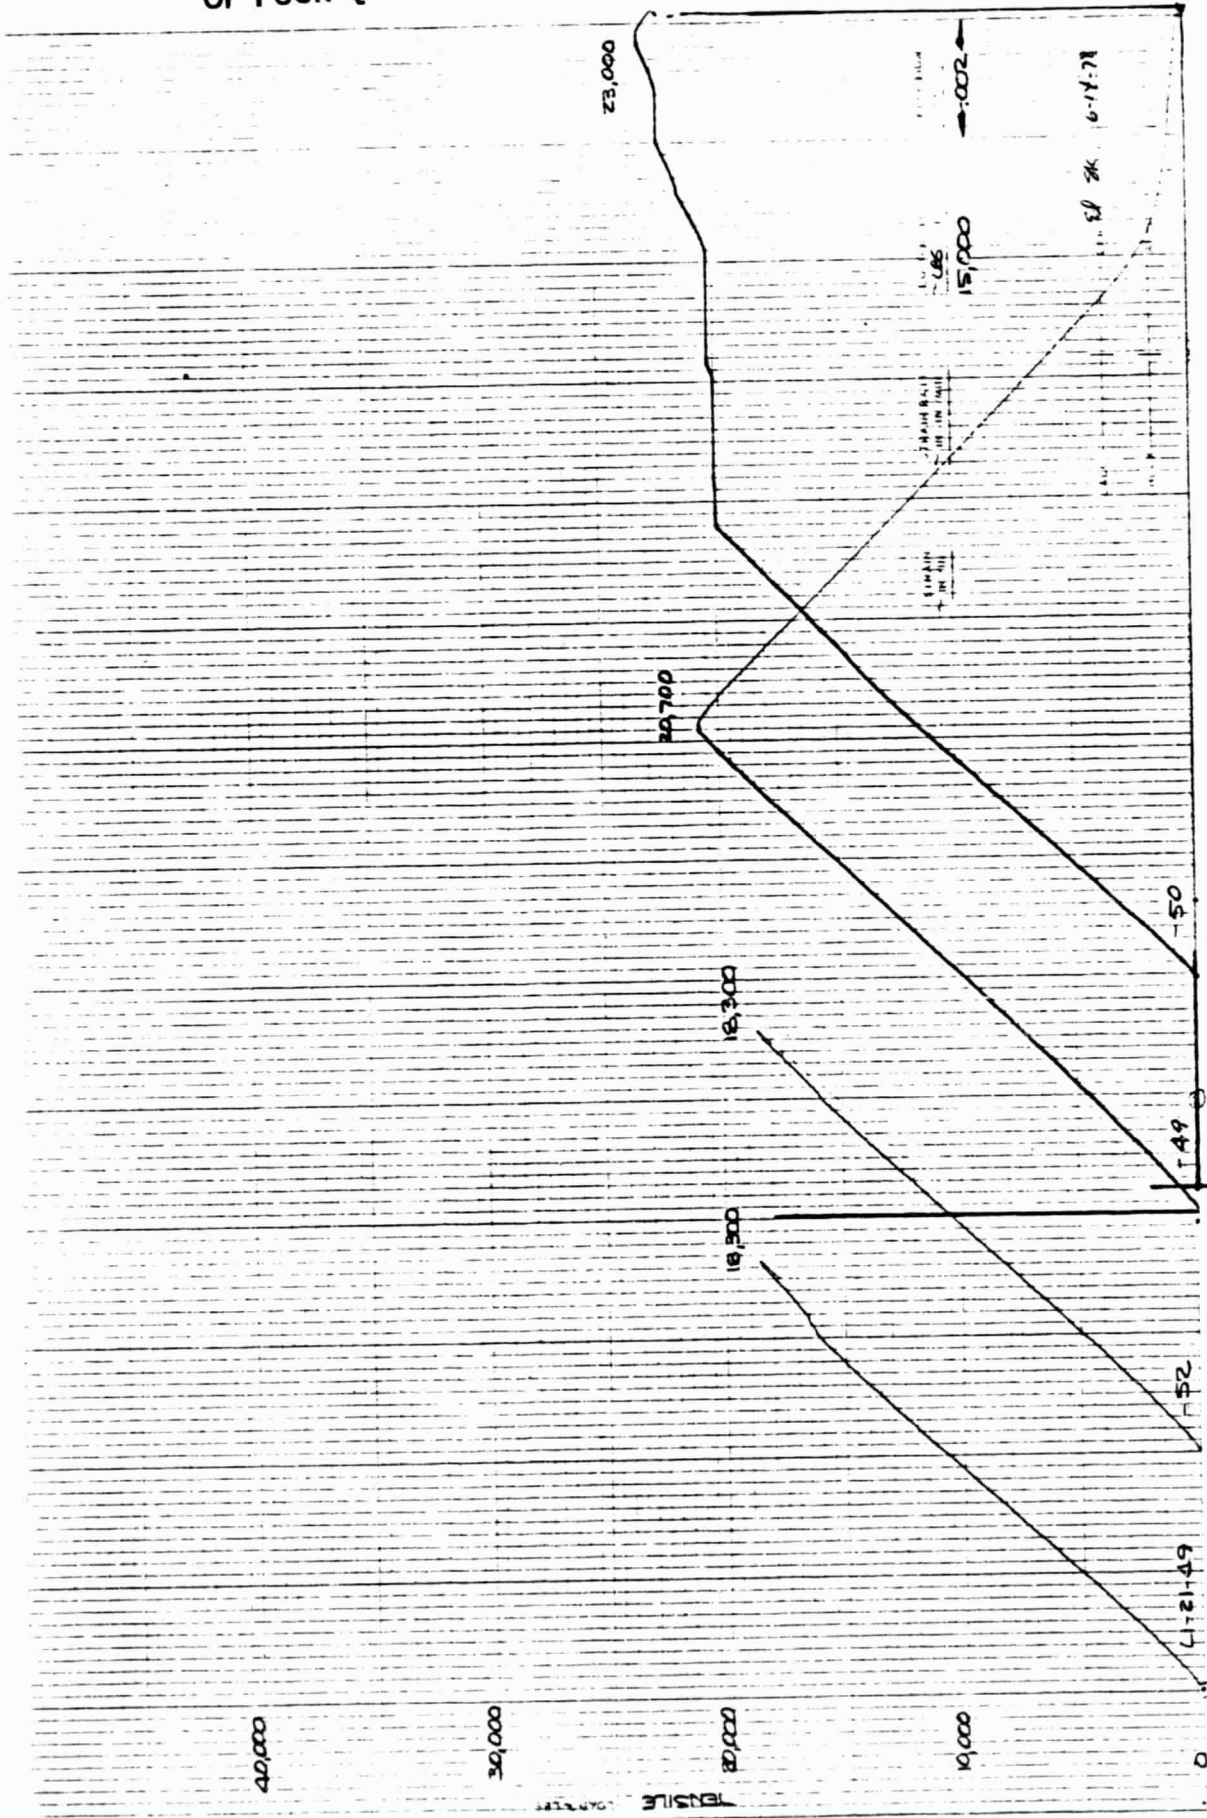

ORIGINAL PAGE IS  
OF POOR QUALITY

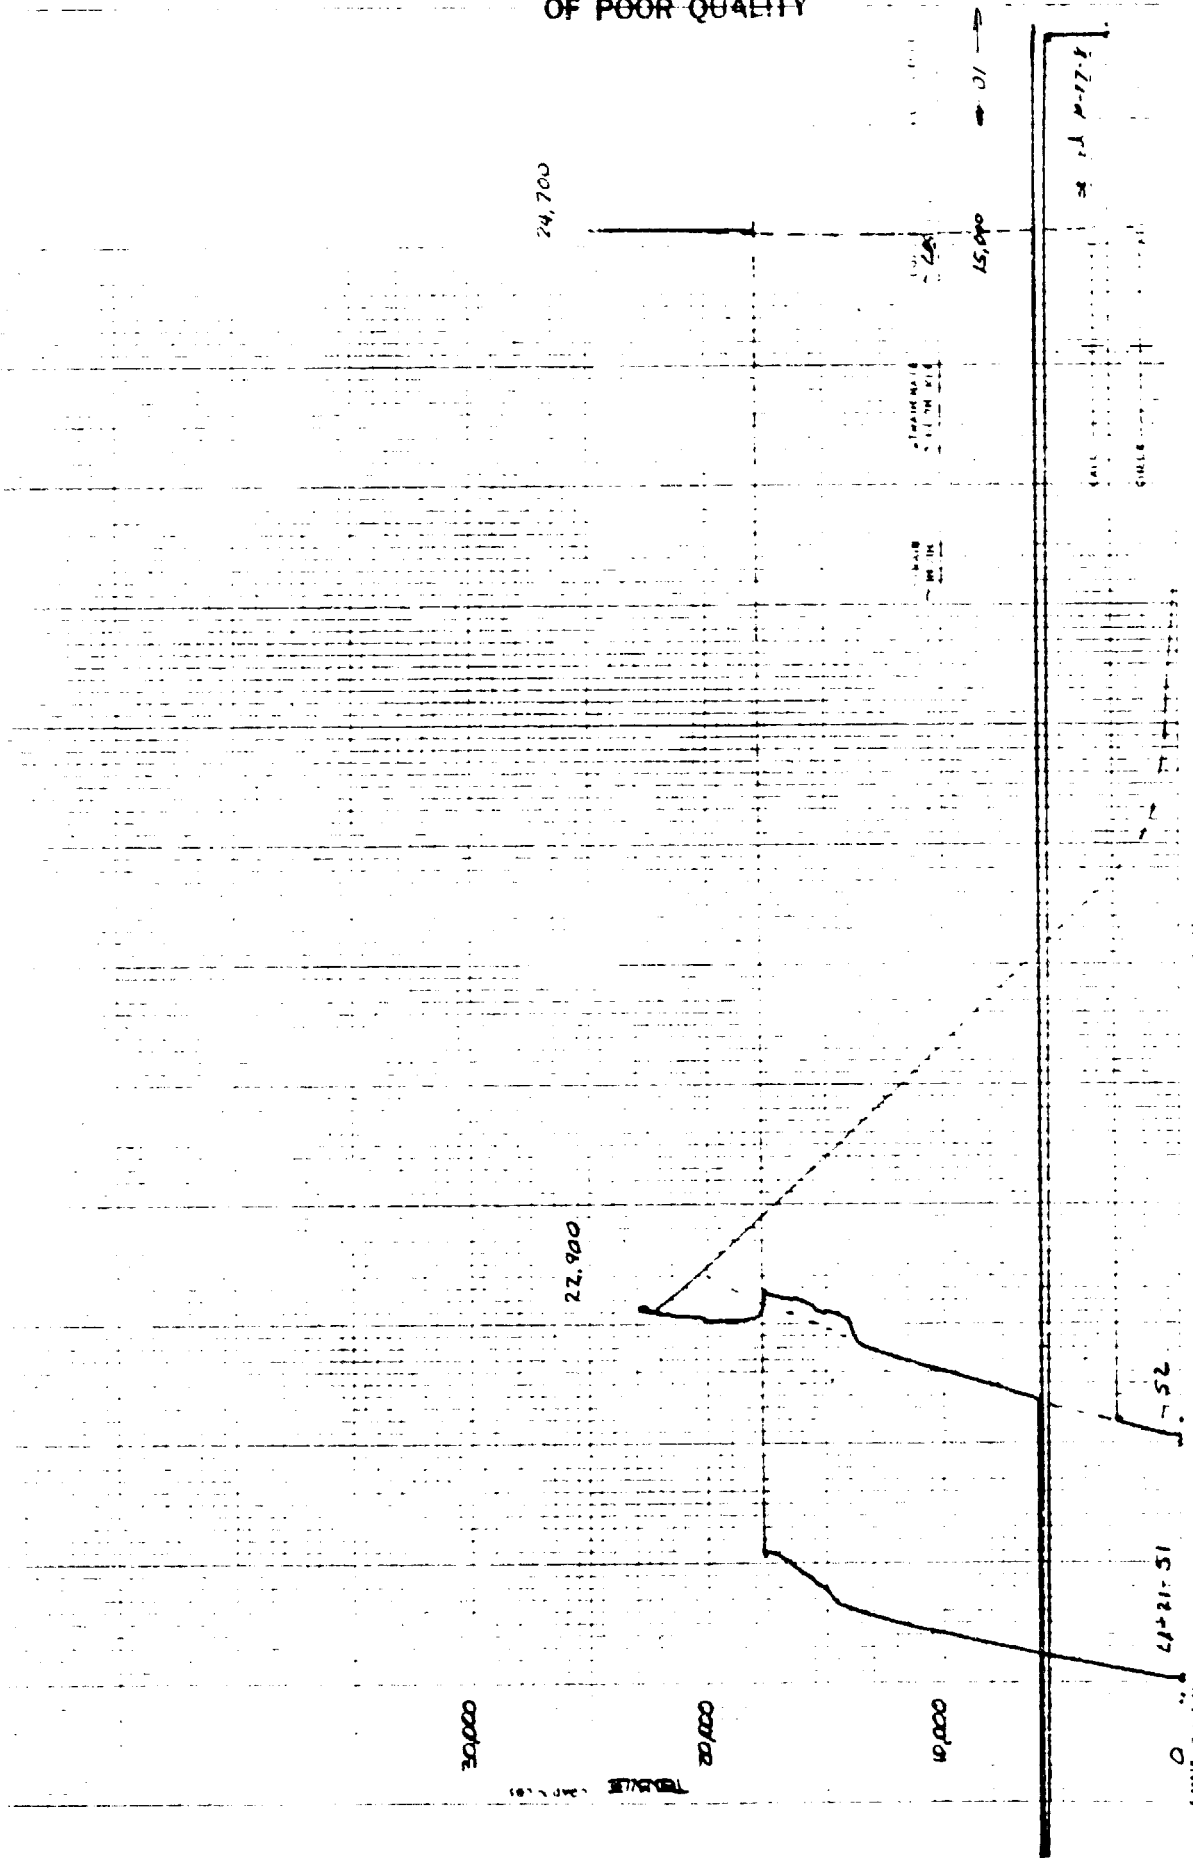

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH


LAMINATE L1  
3/8 HP SLIT

TEST SPECIMENS


ROOM TEMPERATURE

422° K (300° F)

INITIAL

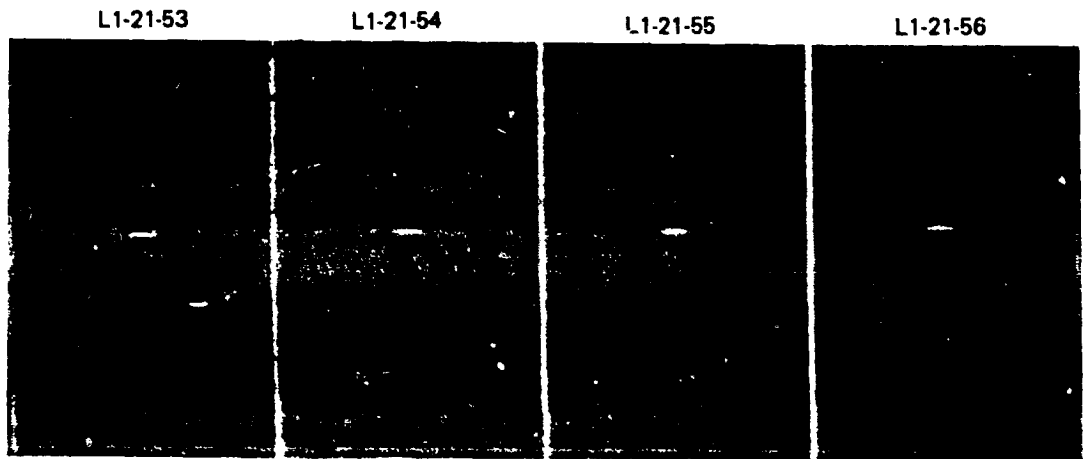


AFTER  
PRELOAD  
17.3 KIP

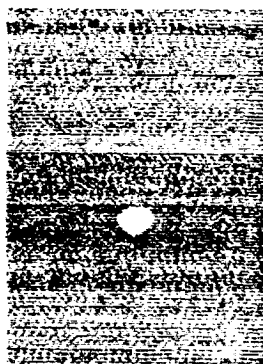


VISUAL DAMAGE


← NONE →

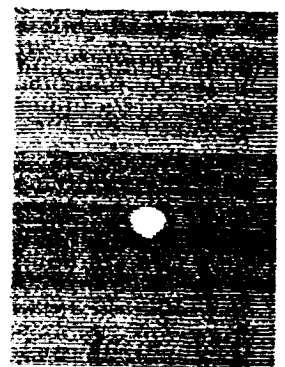


AFTER  
MOISTURE  
CONDITIONING

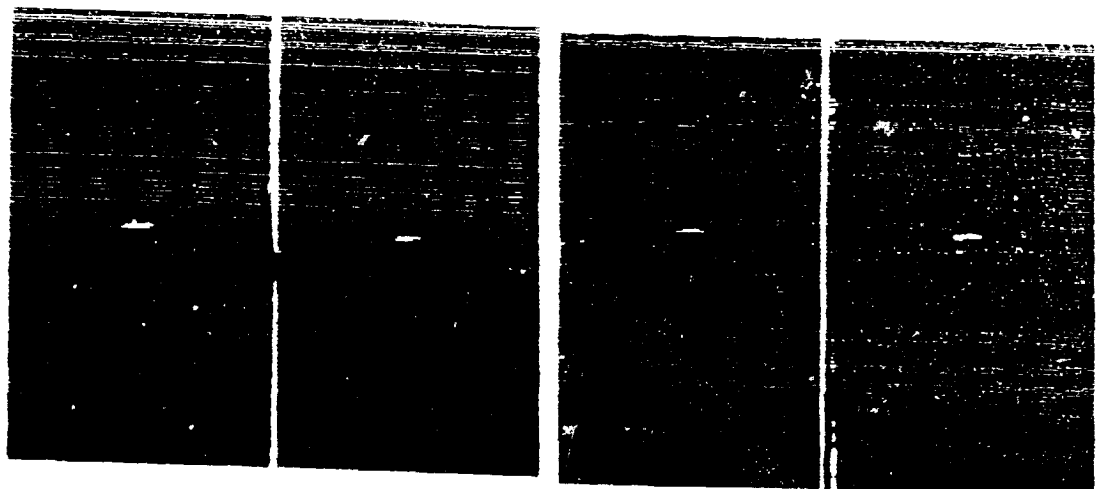

PLUR QUALITY

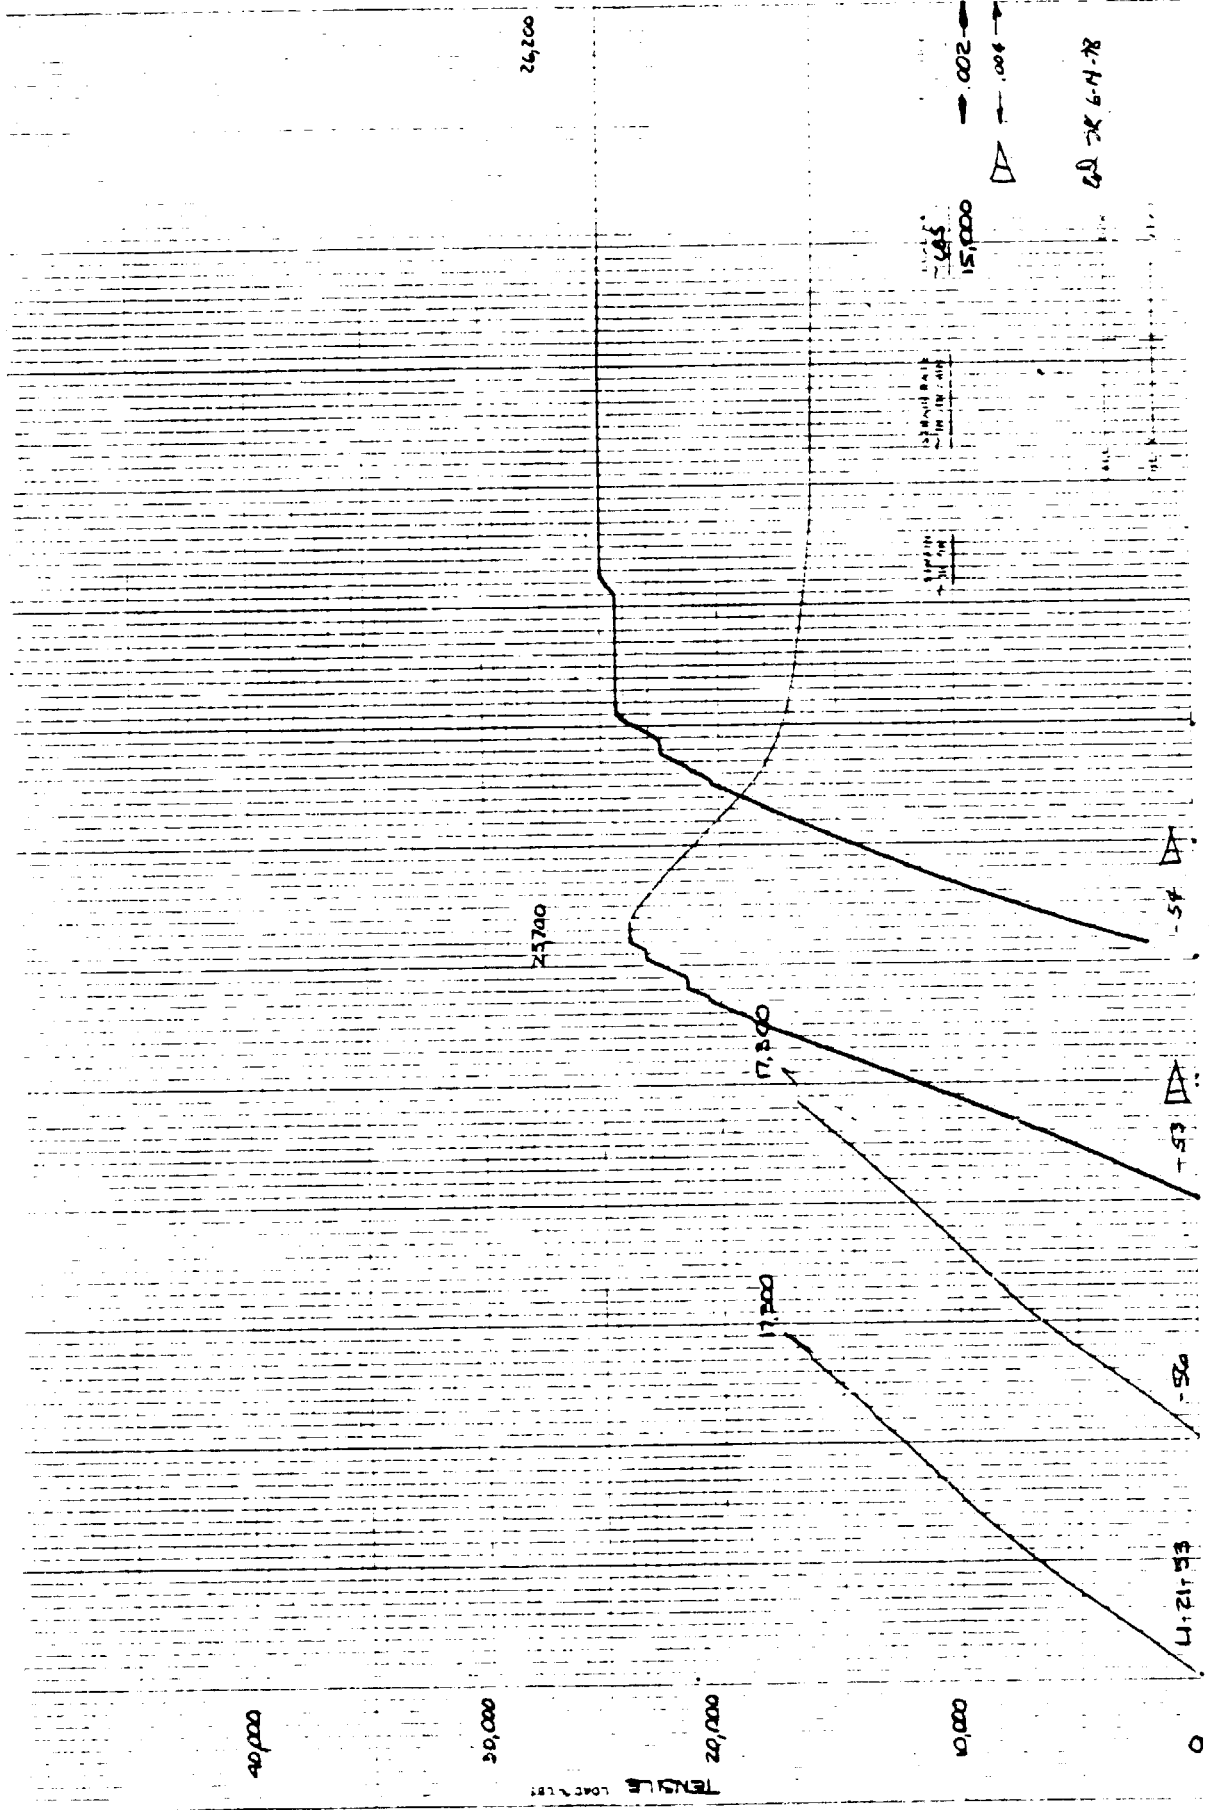

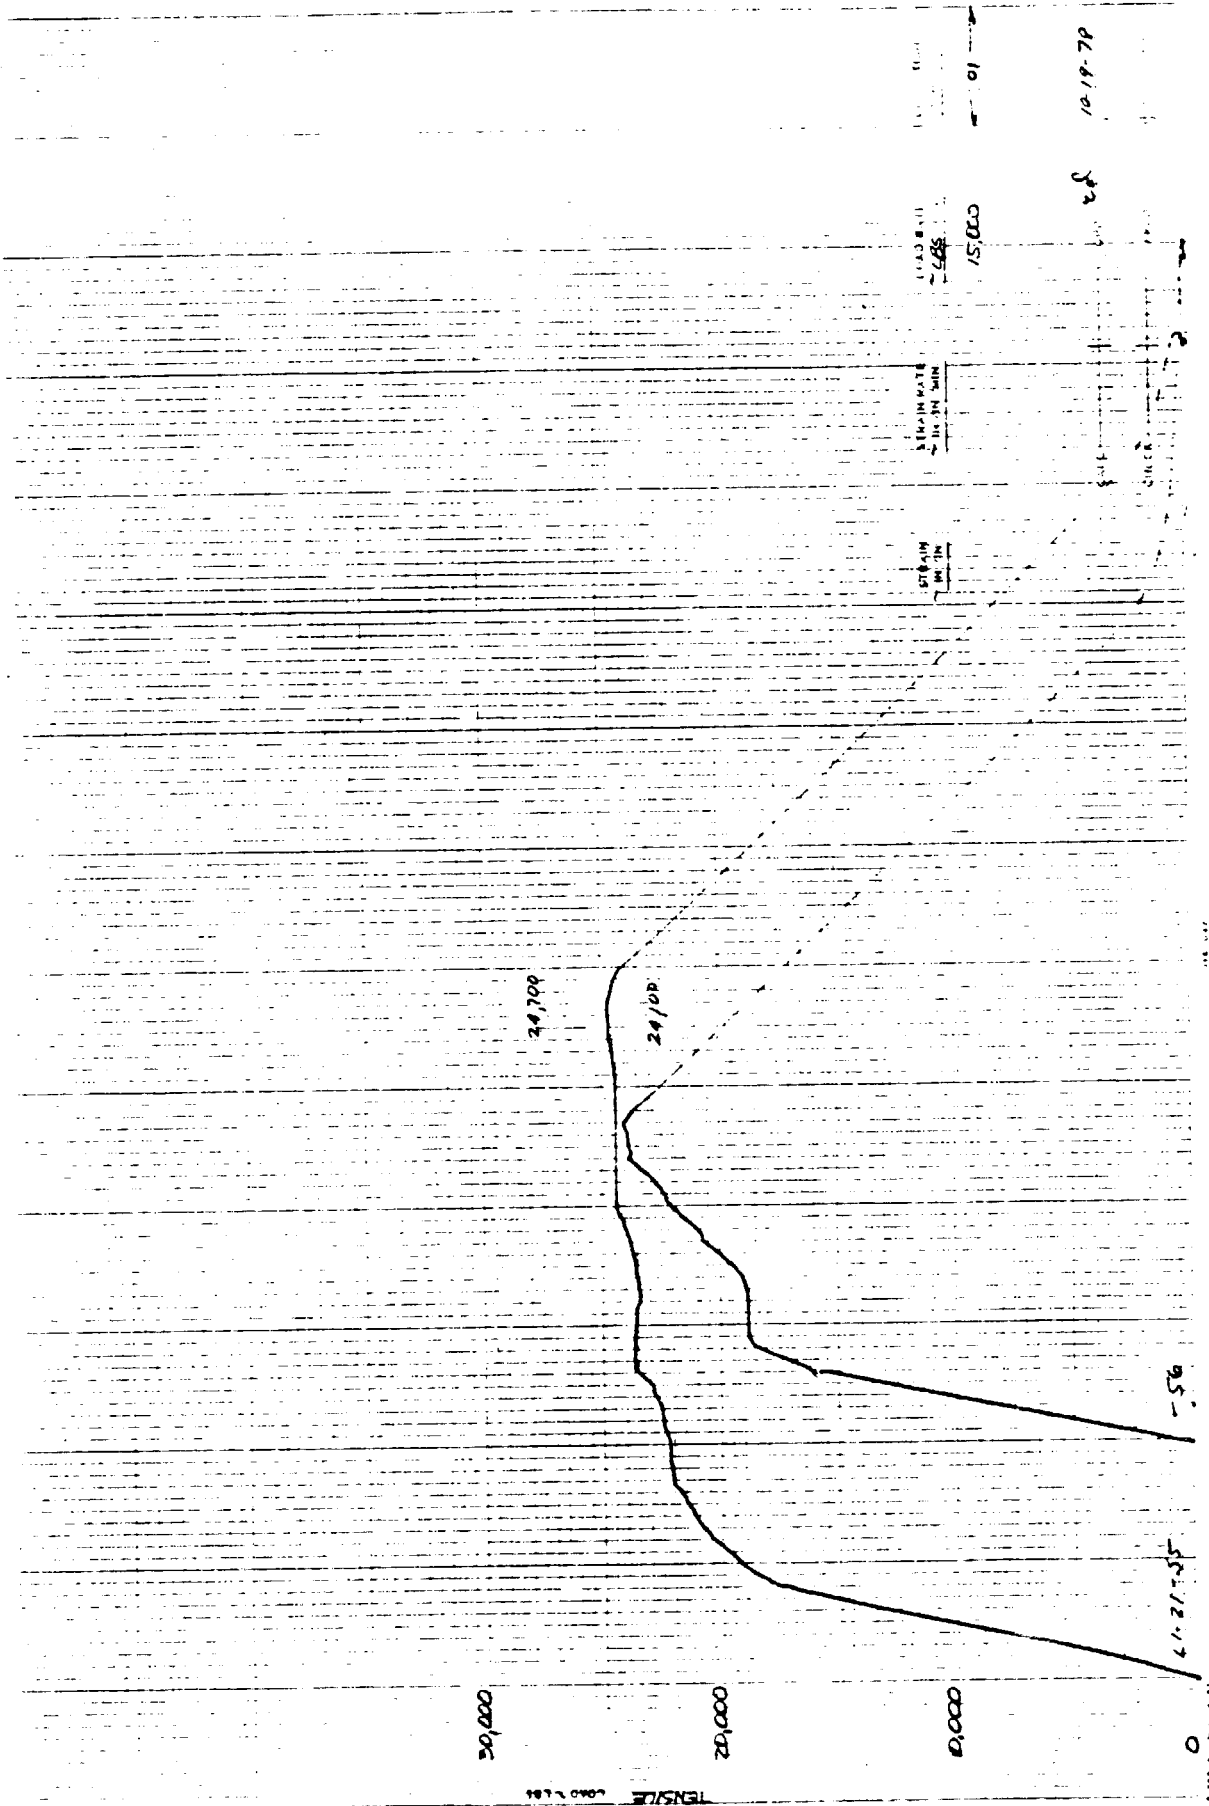






ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
5/8 HP SLIT


TEST SPECIMENS

ROOM TEMPERATURE


422° K (300° F)

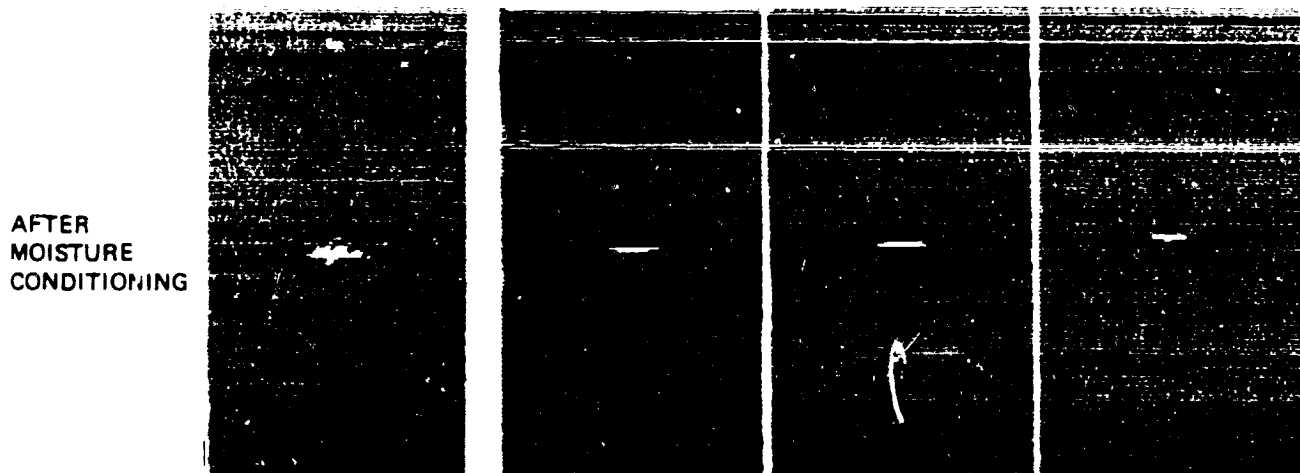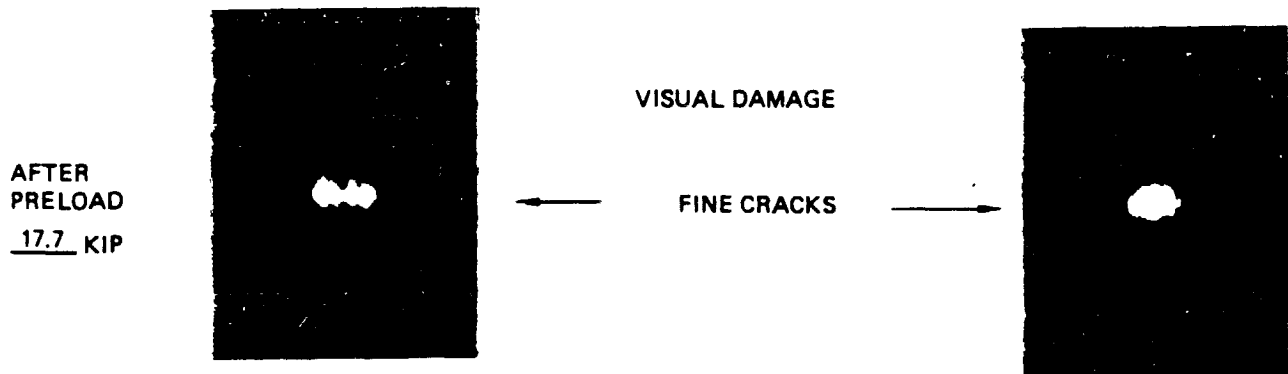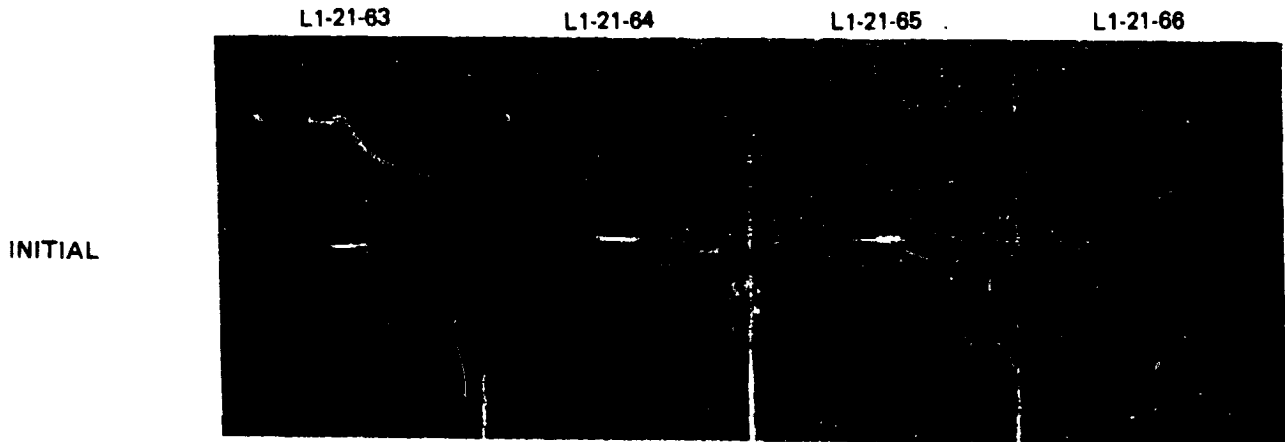

ORIGINAL PAGE IS  
OF POOR QUALITY

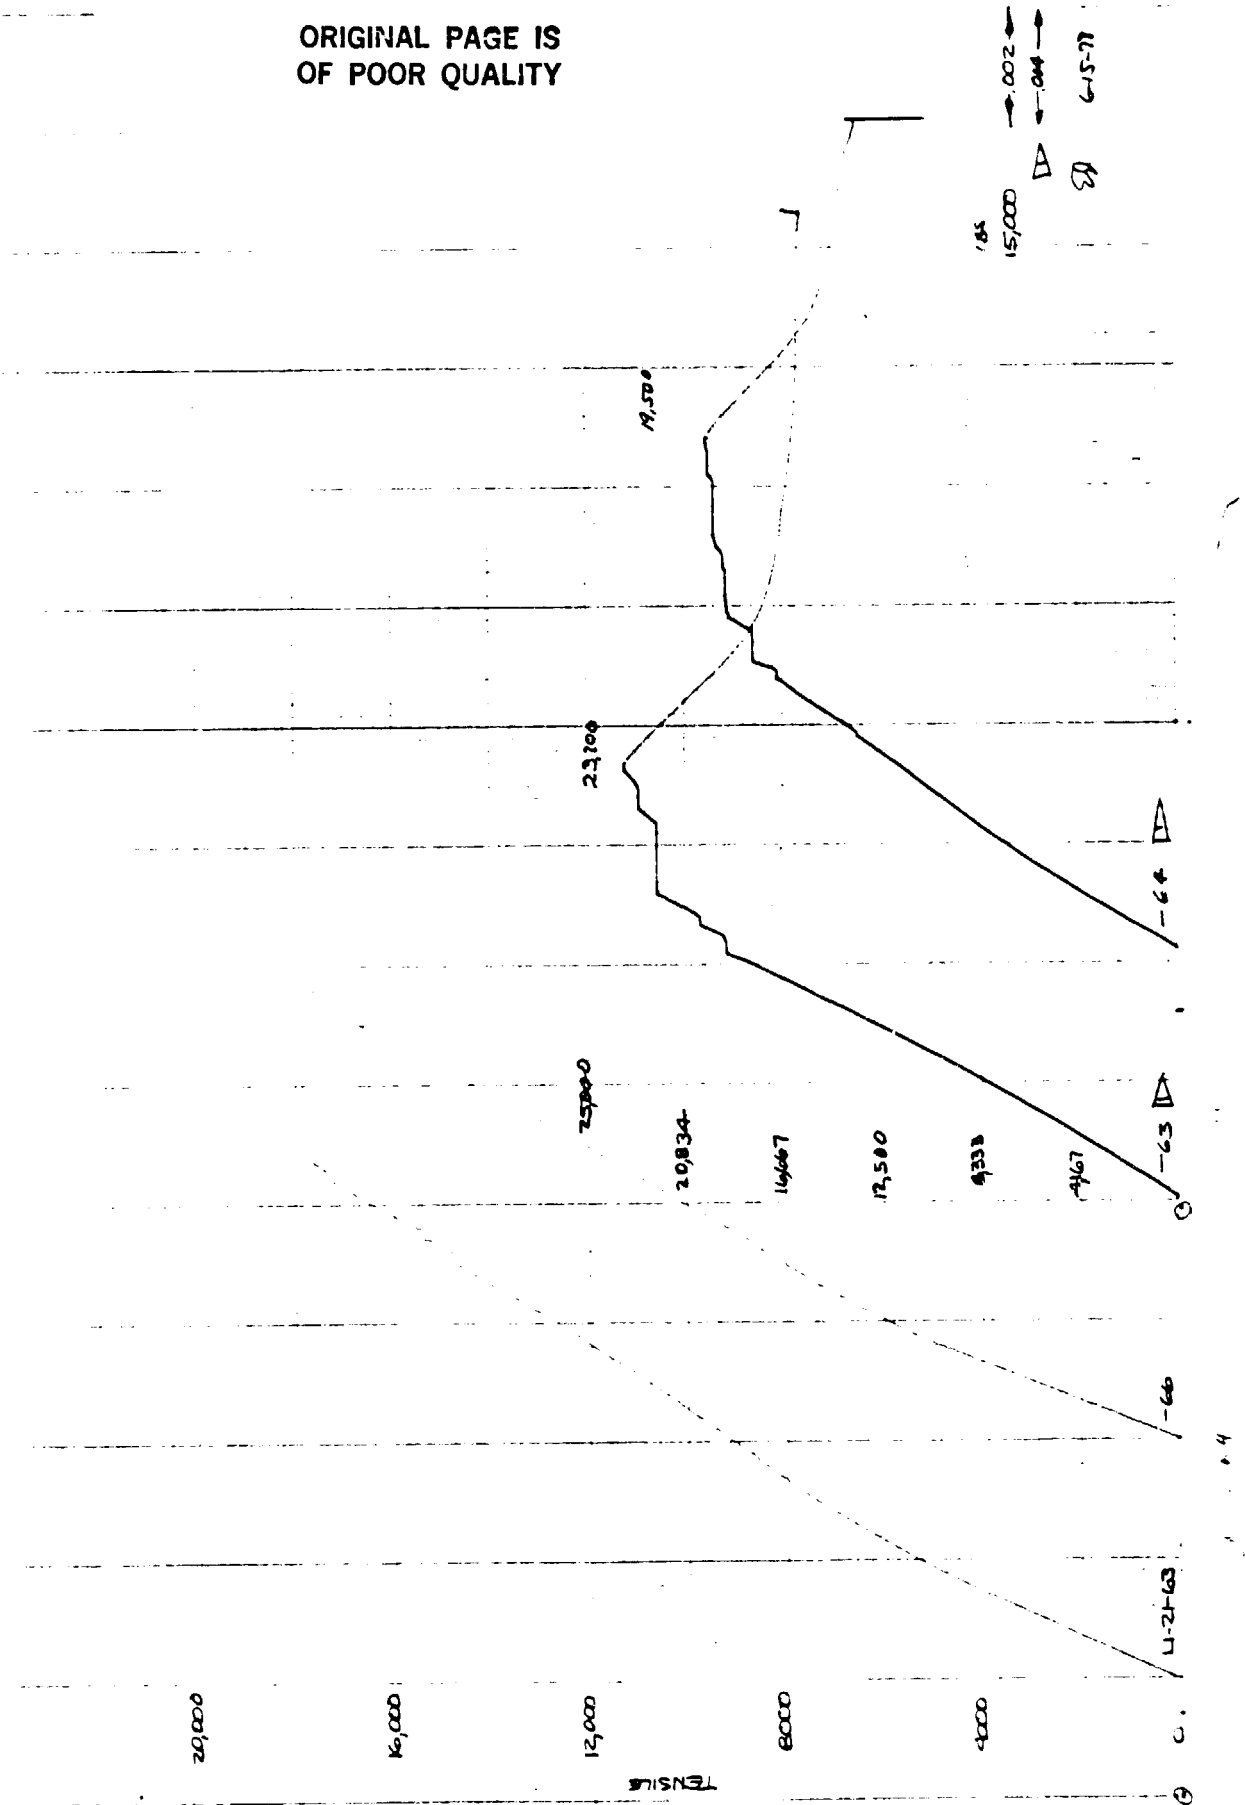

ORIGINAL PAGE IS  
OF POOR QUALITY

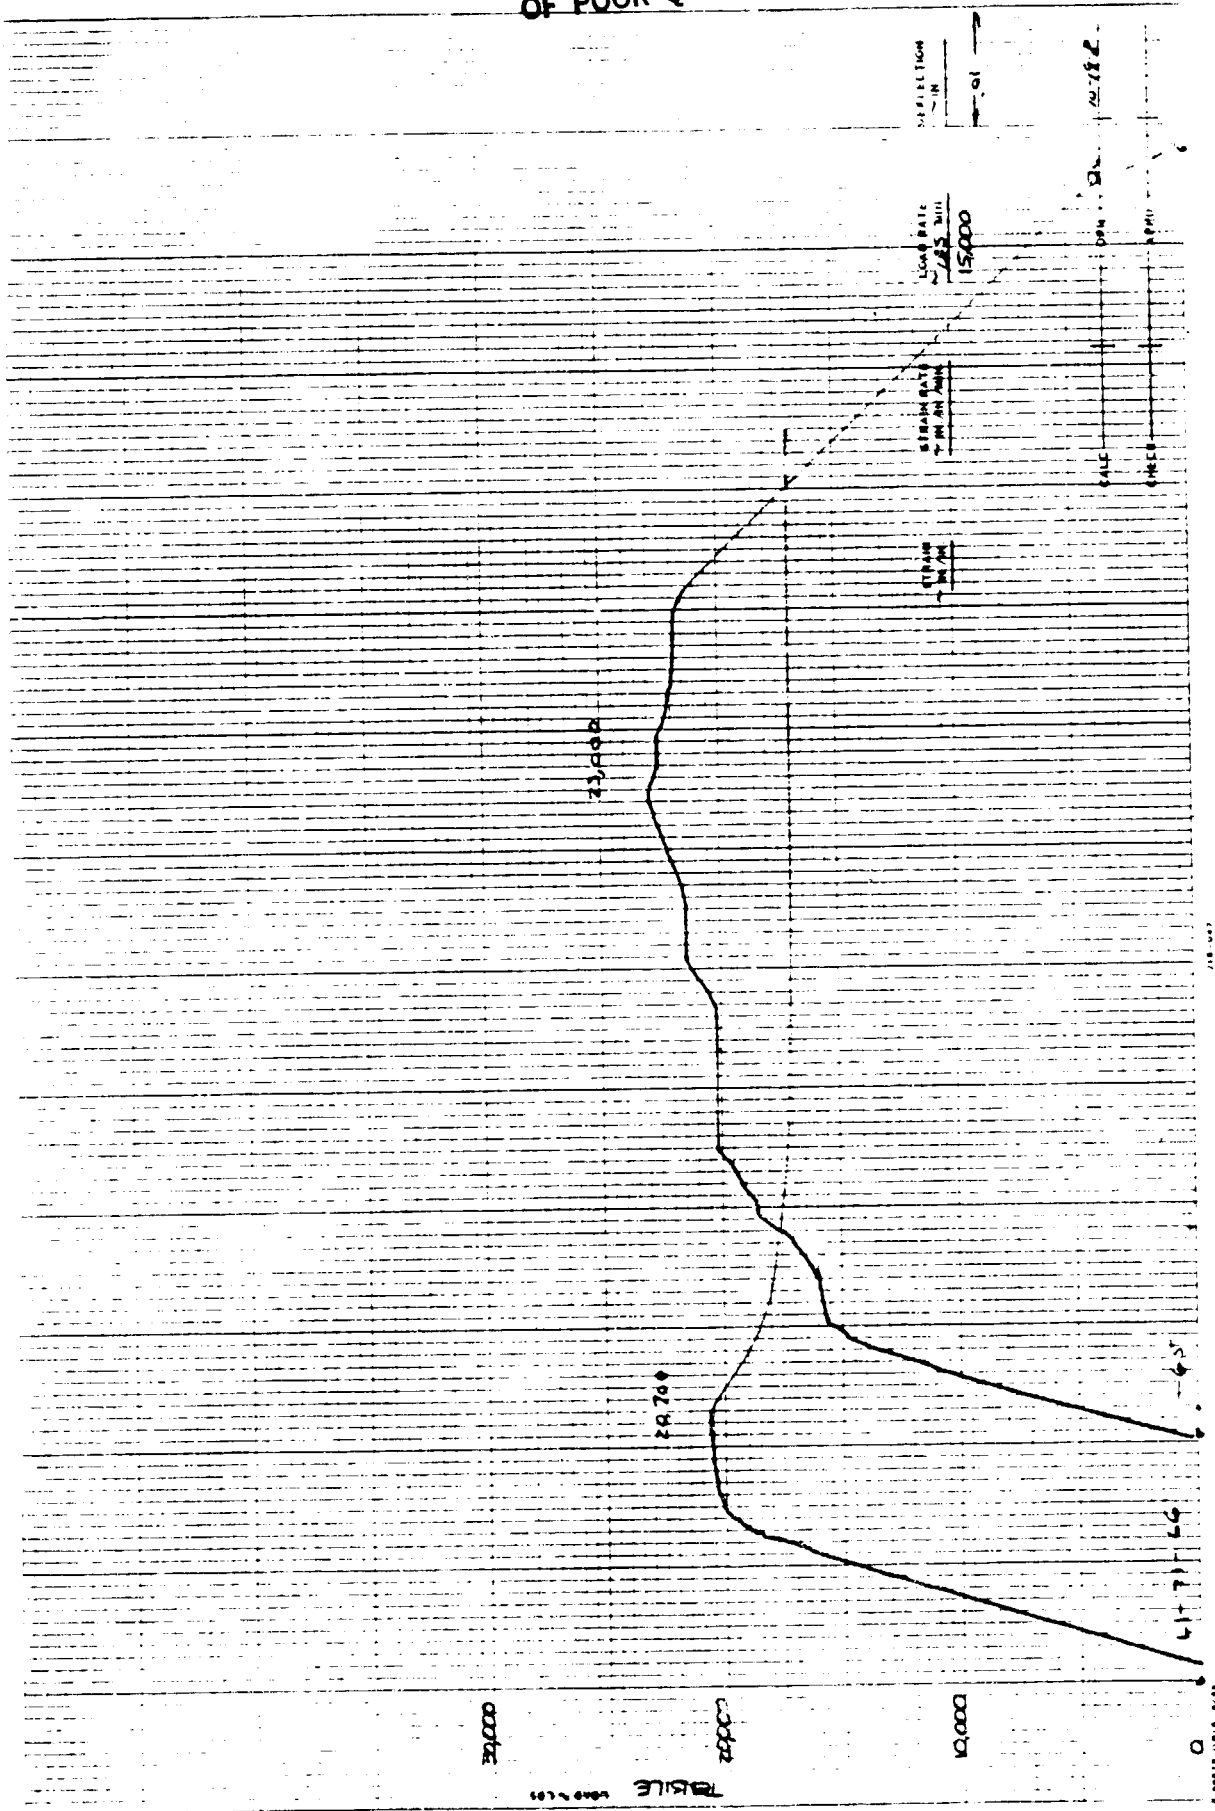

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L1  
5/8 HP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

L1-21-59

L1-21-61

L1-21-62

L1-21-67

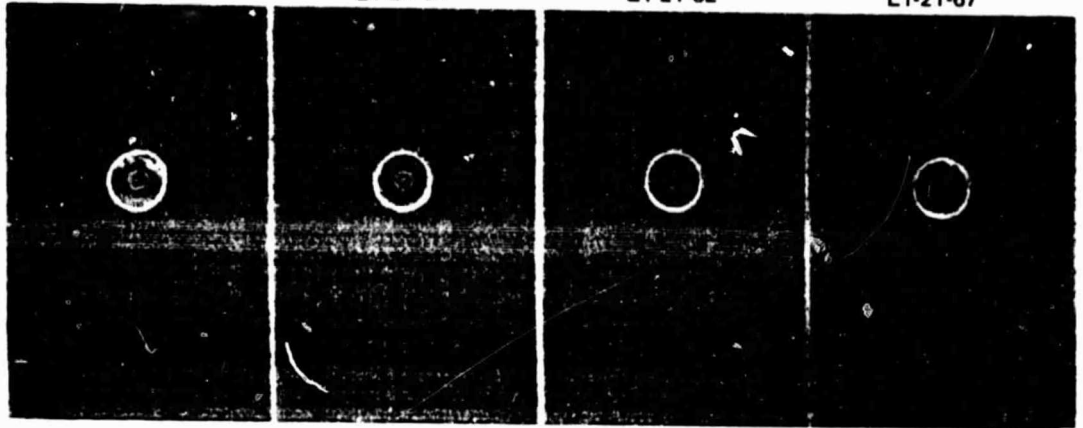


AFTER  
PRELOAD  
16.1 KIP


VISUAL DAMAGE

← NONE

FINE CRACK 0.1 inch →

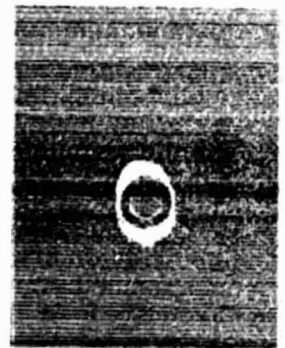

AFTER  
MOISTURE  
CONDITIONING

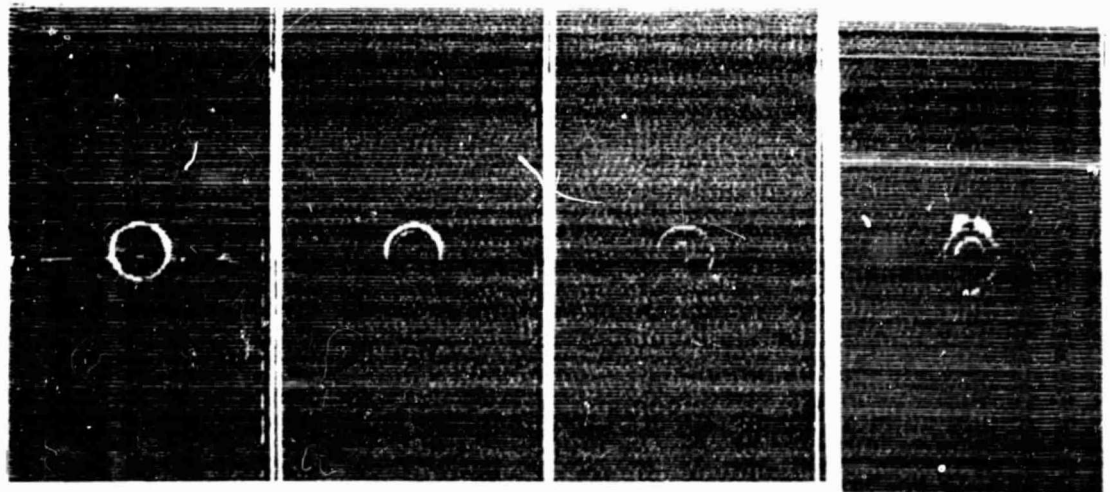




86-0191

100' - 500'

100' 51

87

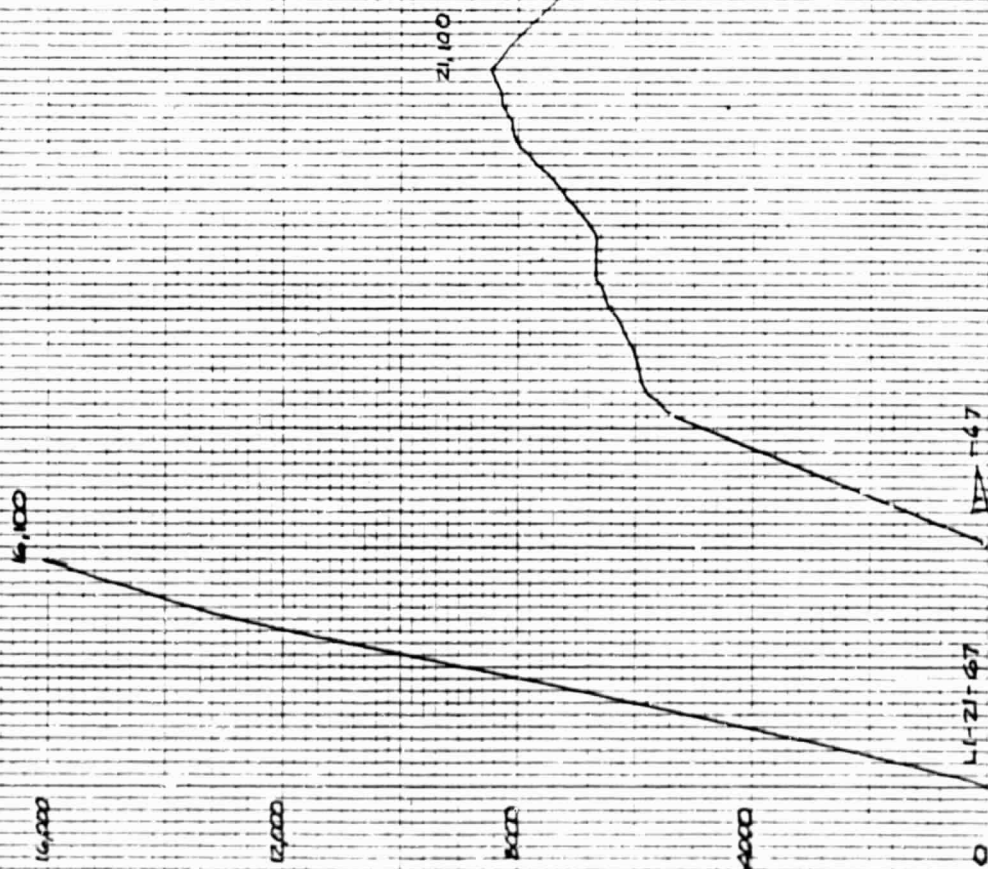

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
NO DEFECT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L2-21-1

L2-21-2


L2-21-3

L2-21-4

INITIAL

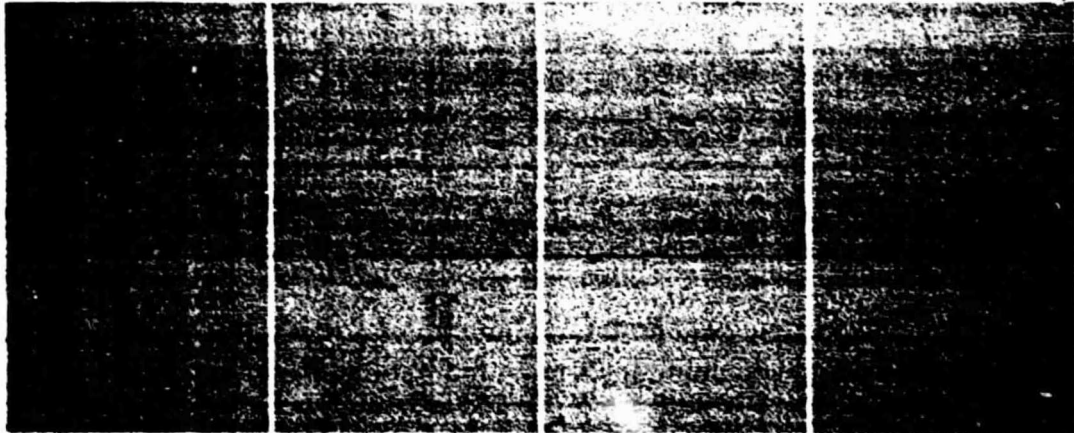

AFTER  
PRELOAD  
35.1 KIP

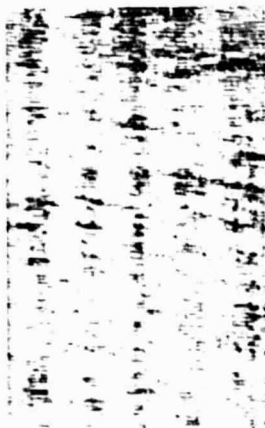


VISUAL DAMAGE


NONE



AFTER  
MOISTURE  
CONDITIONING

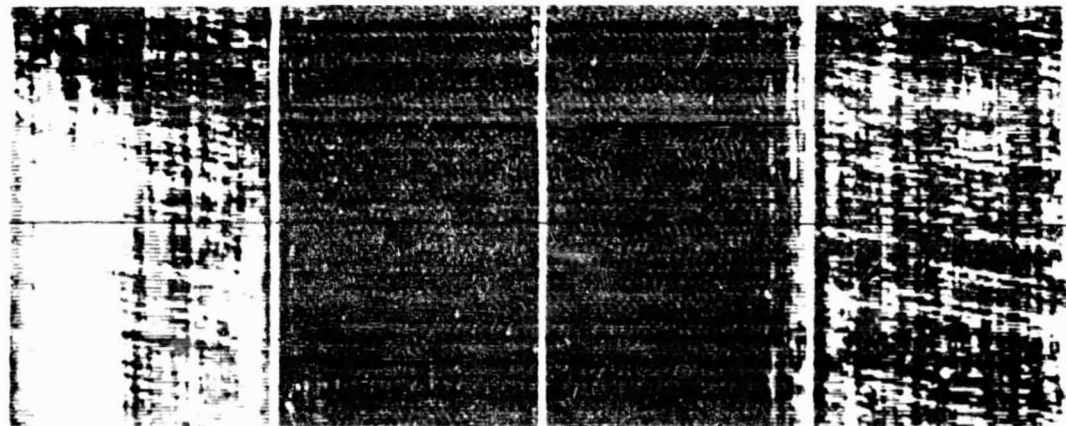

ORIGINAL PAGE IS  
OF POOR QUALITY

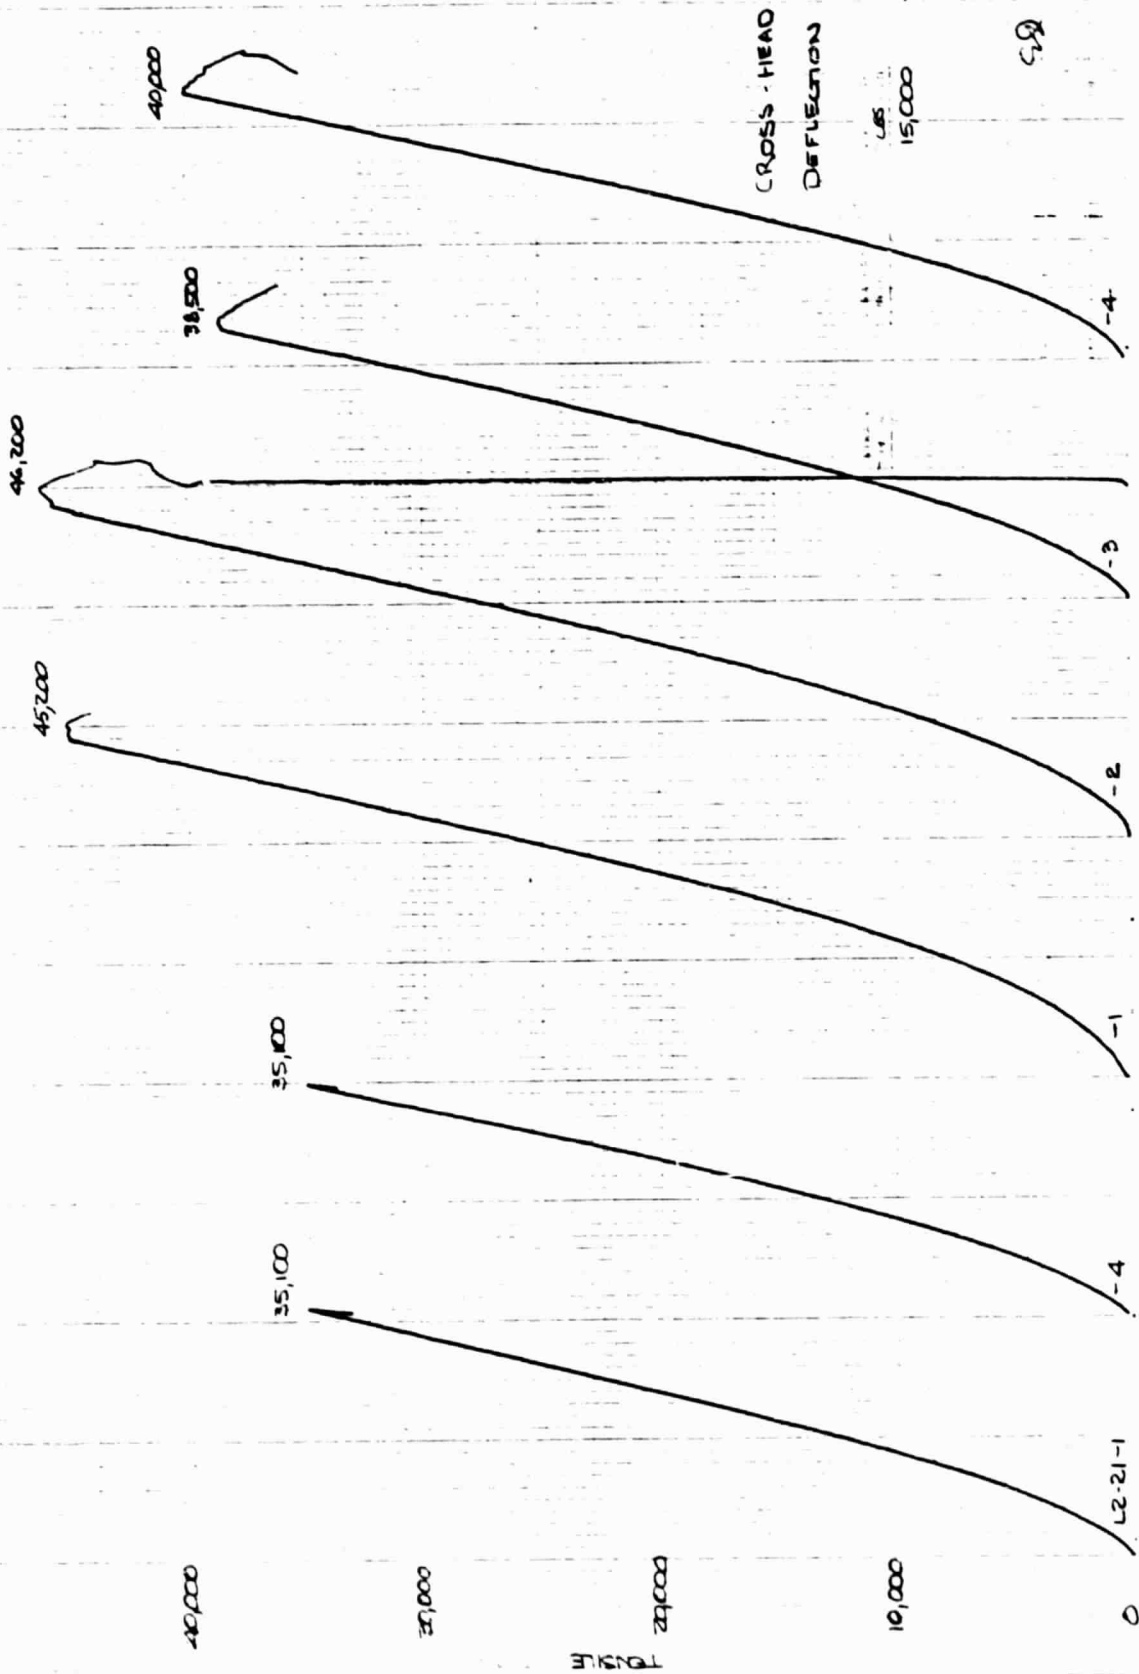



ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE L2  
1/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L2-21-5

L2-21-6

L2-21-7

L2-21-8

INITIAL

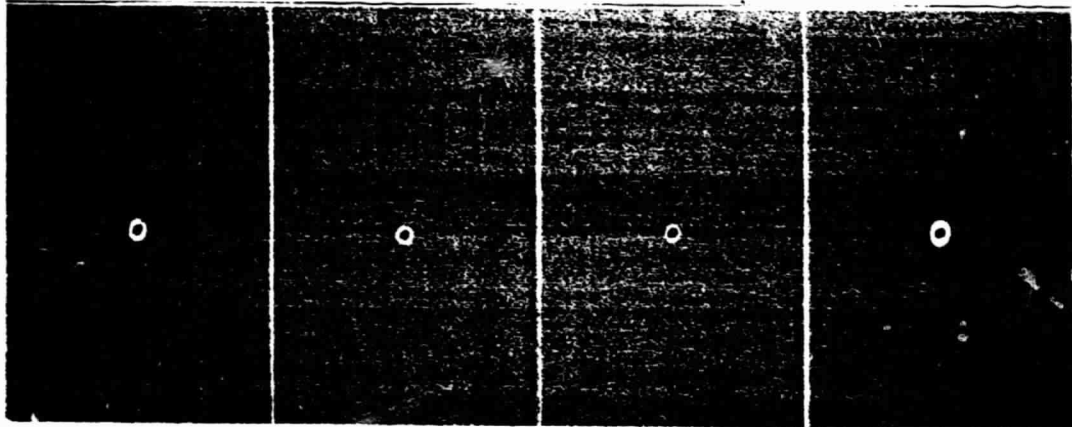

AFTER  
PRELOAD  
24.4 KIP




VISUAL DAMAGE


← 0.3 inch FINE SPLITS →




AFTER  
MOISTURE  
CONDITIONING

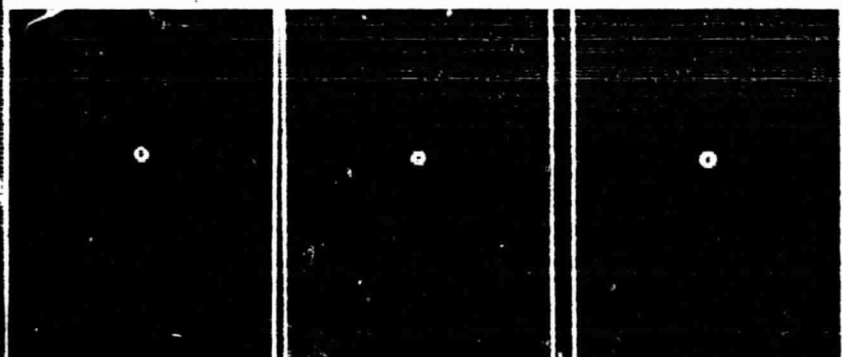

ORIGINAL PAGE IS  
OF POOR QUALITY

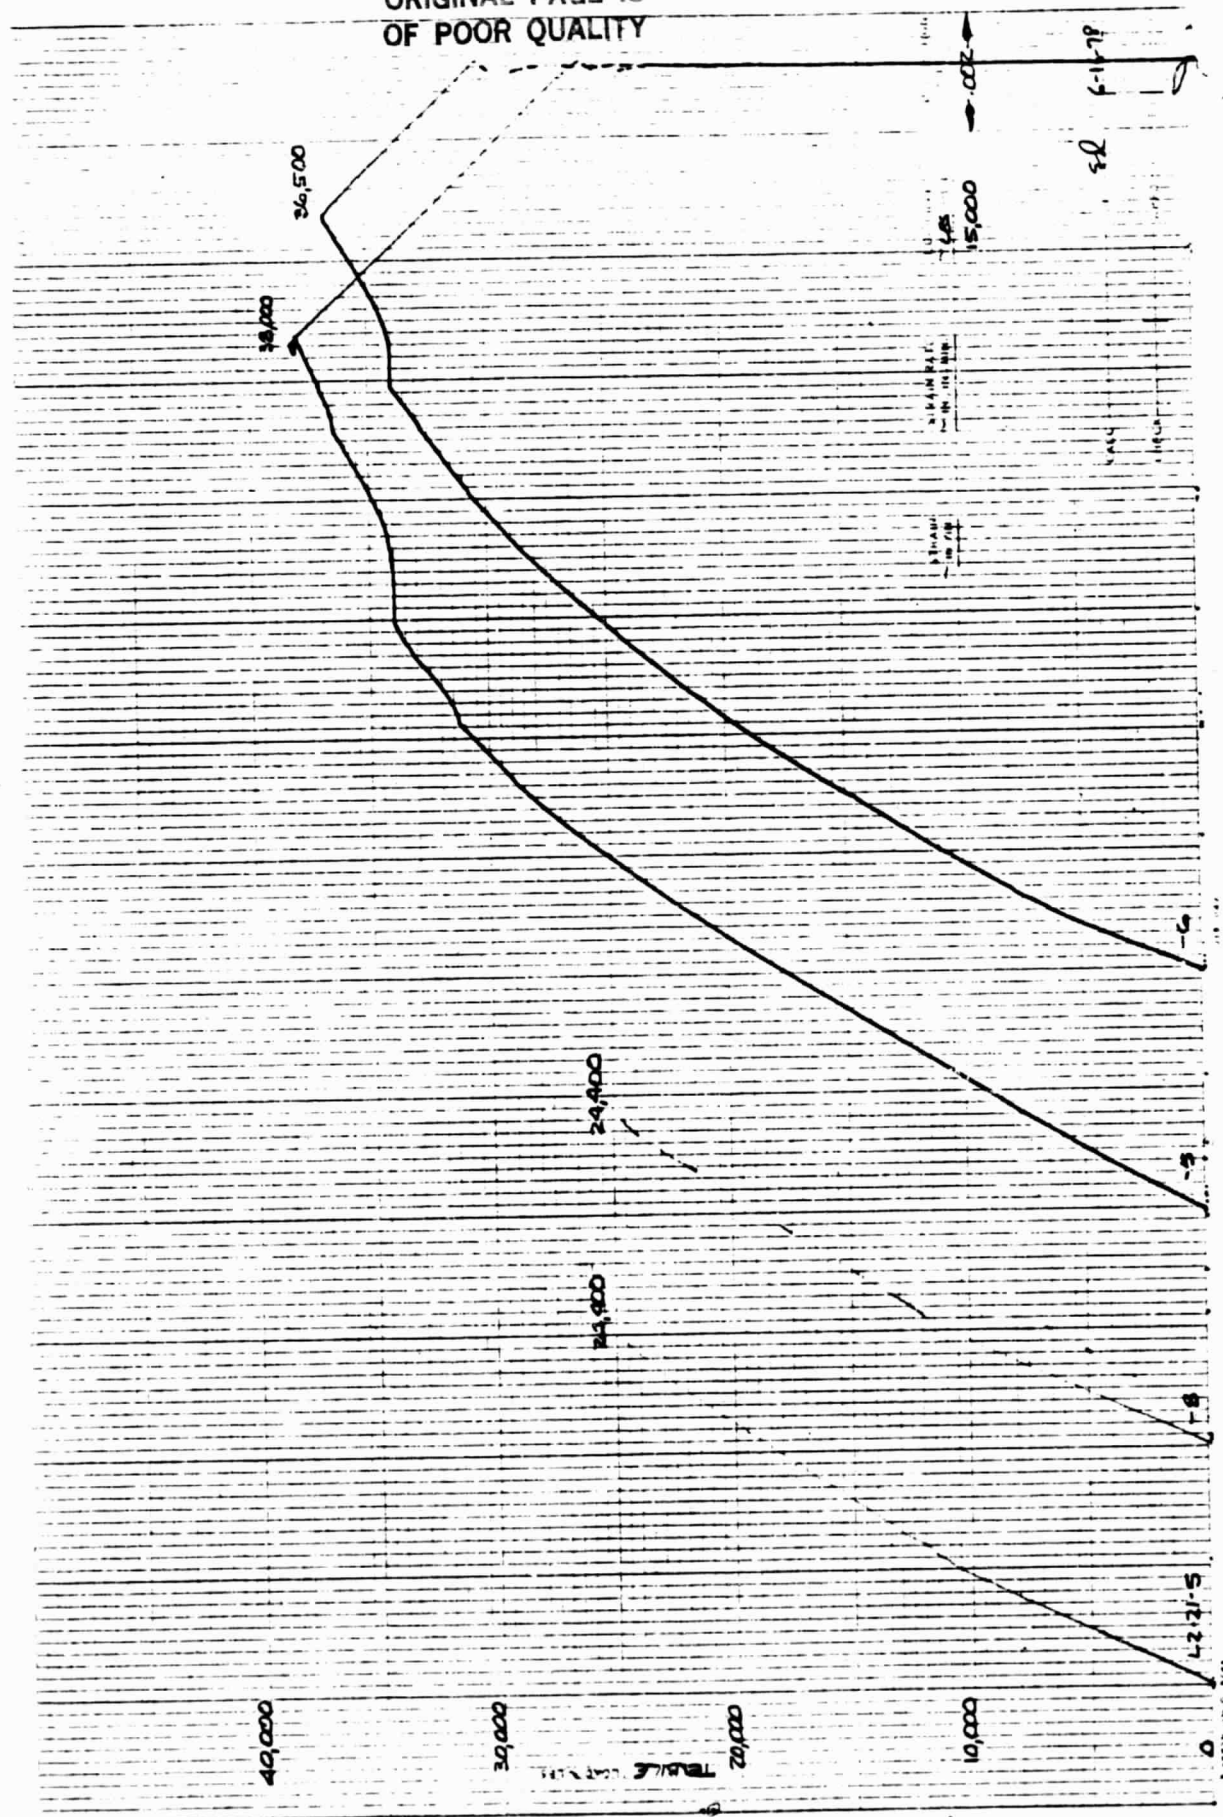

ORIGINAL PAGE IS  
OF POOR QUALITY

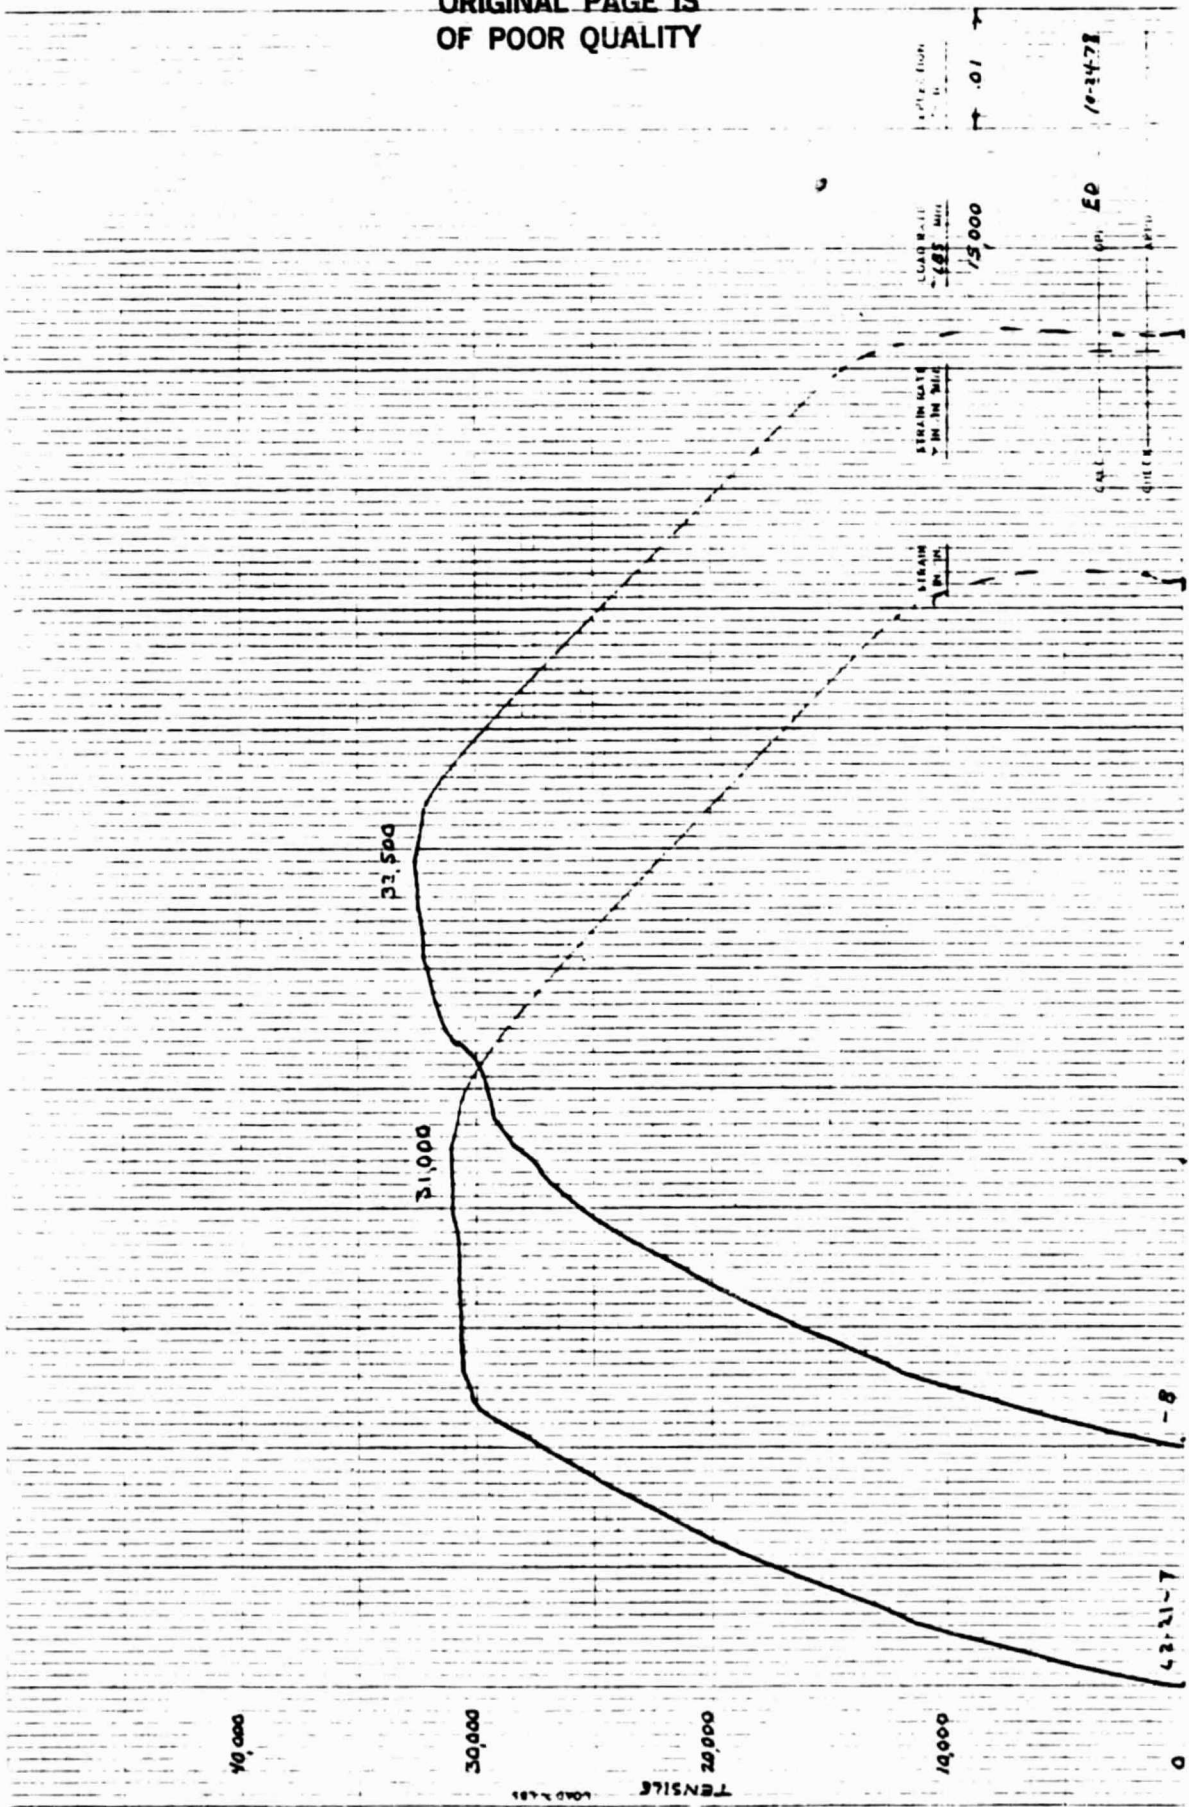

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
3/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L2-21-9

L2-21-10


L2-21-11

L2-21-12

INITIAL

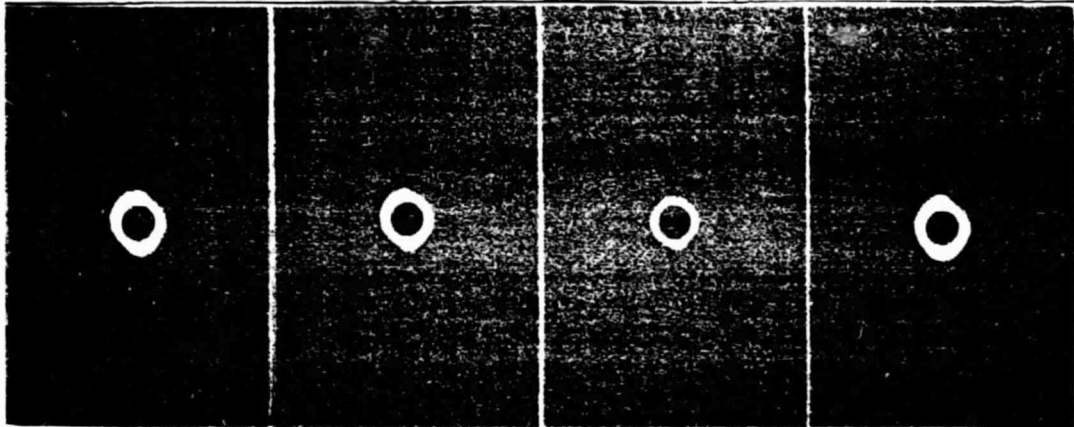


AFTER  
PRELOAD  
22.9 KIP

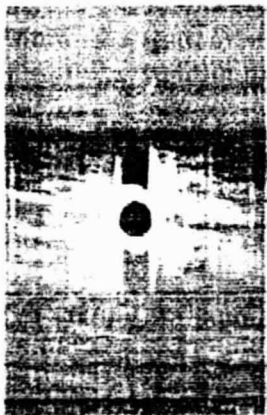


VISUAL DAMAGE

← 1.0 inch FINE SPLITS →

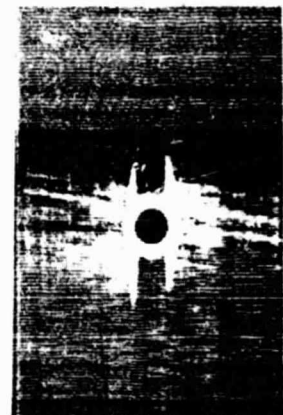

AFTER  
MOISTURE  
CONDITIONING

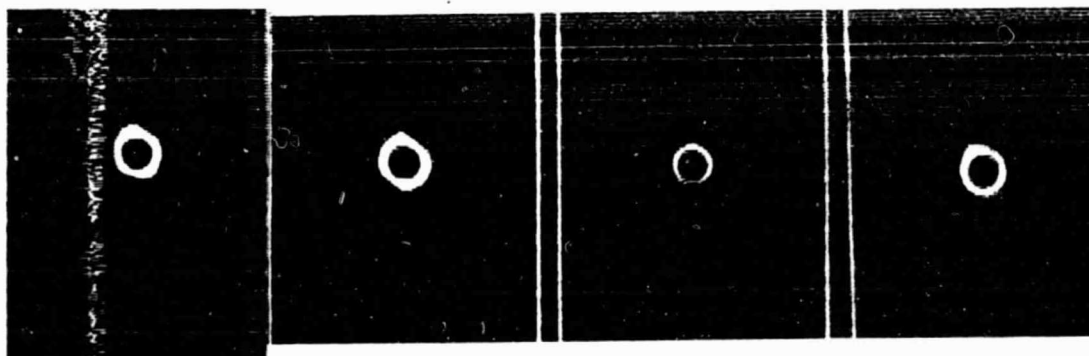


ORIGINAL PAGE IS  
OF POOR QUALITY





ORIGINAL PAGE IS  
OF POOR QUALITY

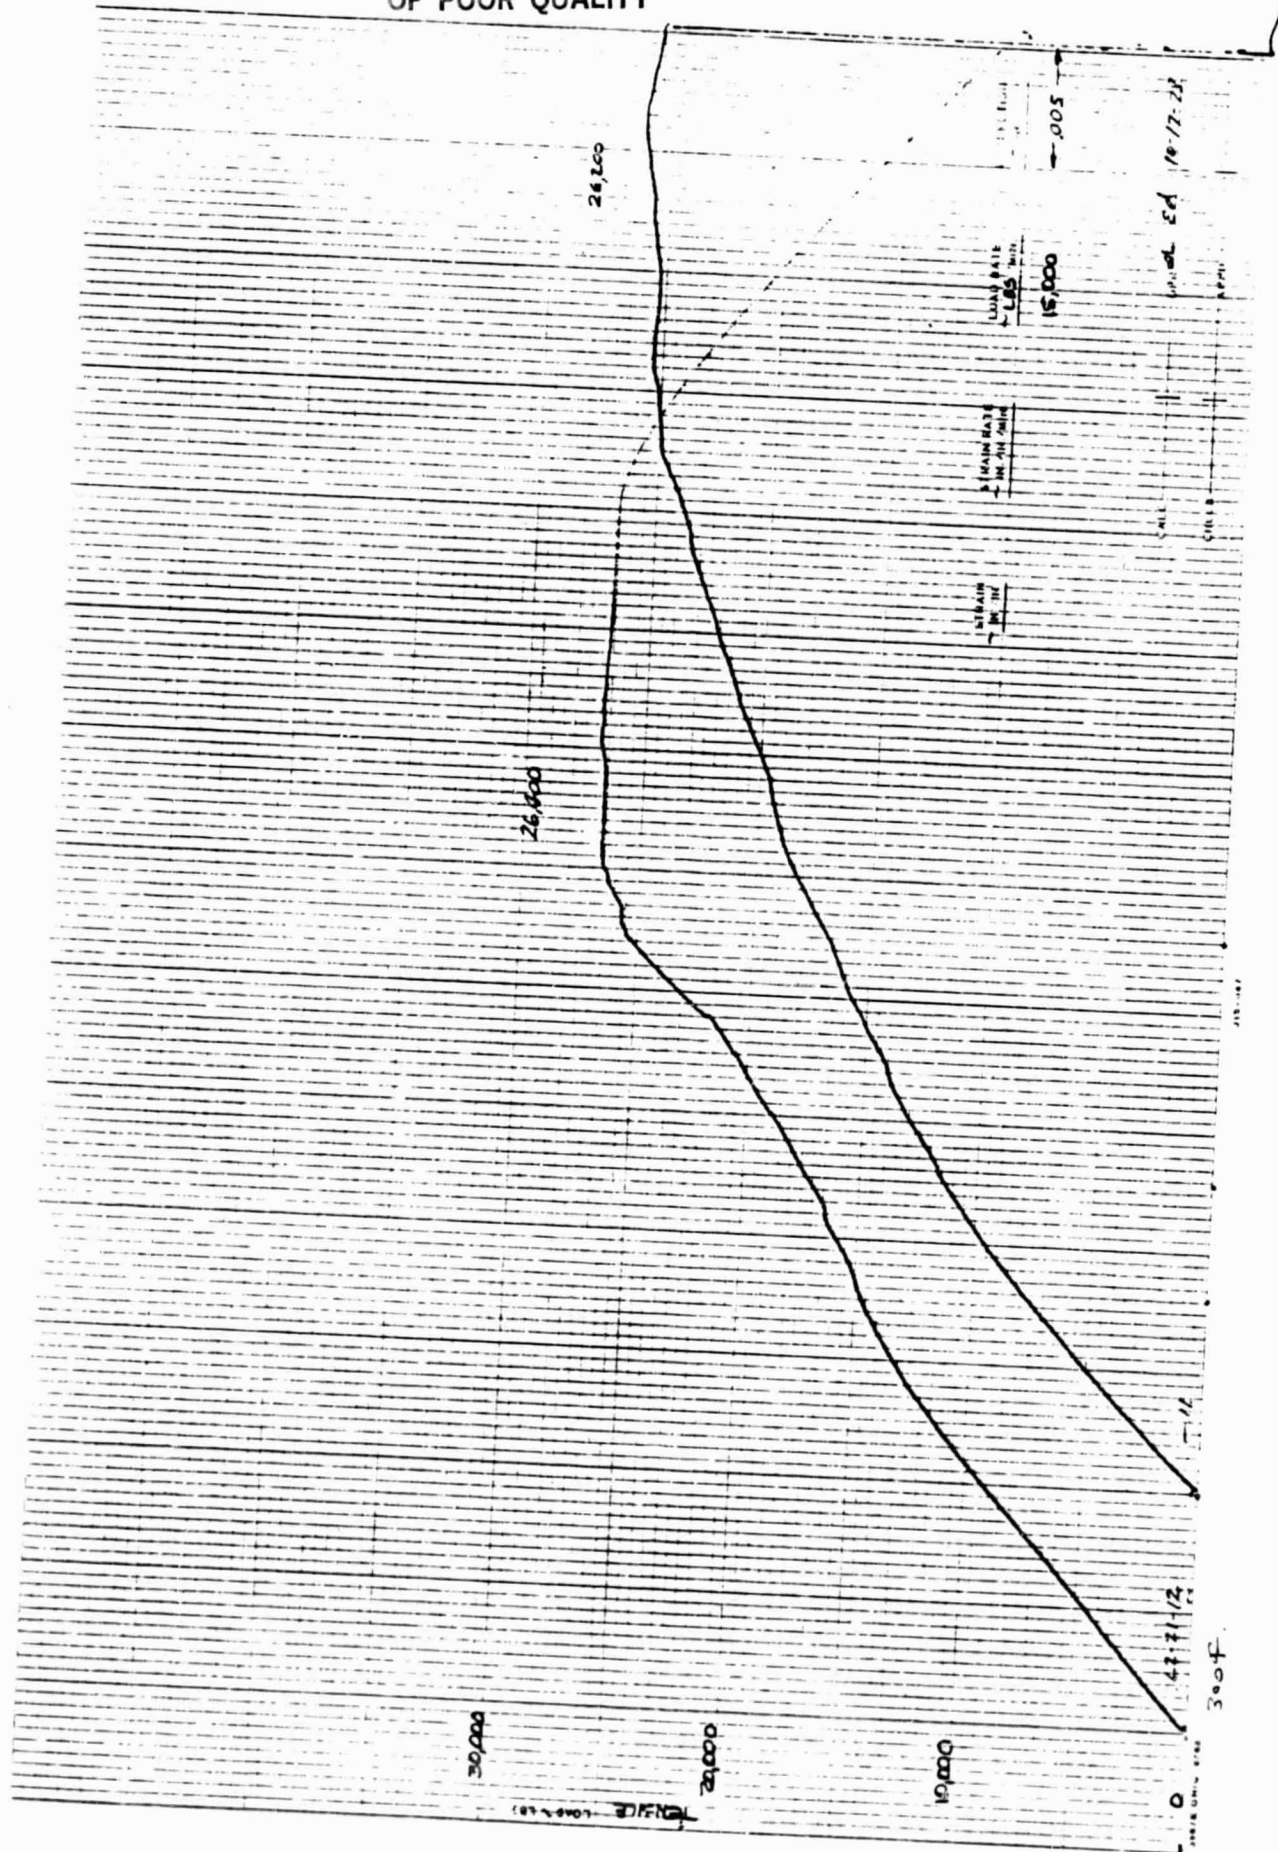




ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
5/8 FP HOLE


TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

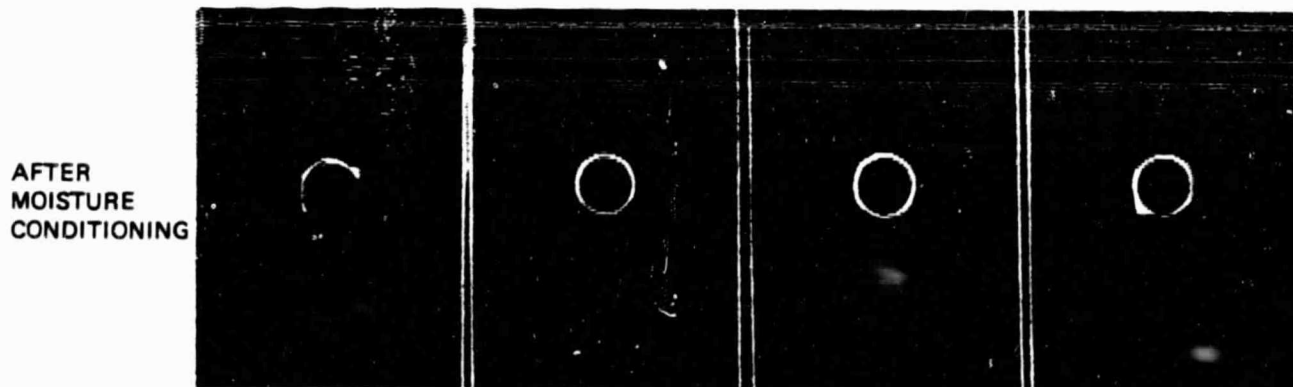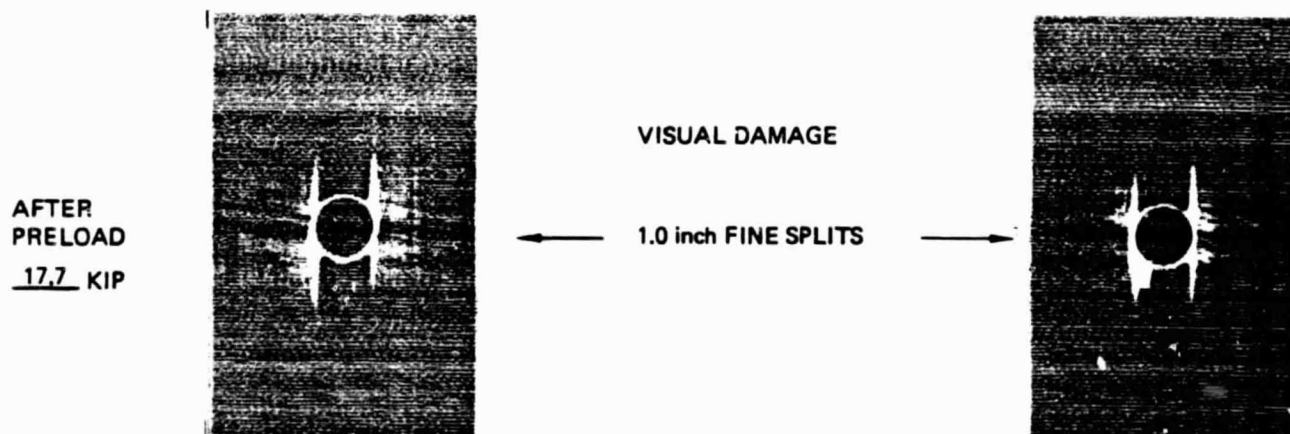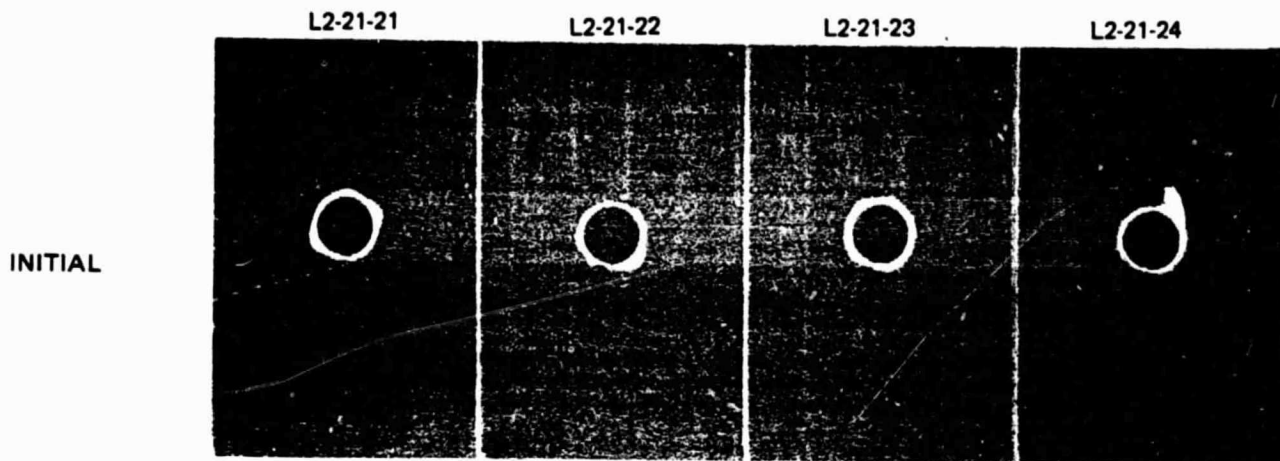


ORIGINAL PAGE IS  
OF POOR QUALITY

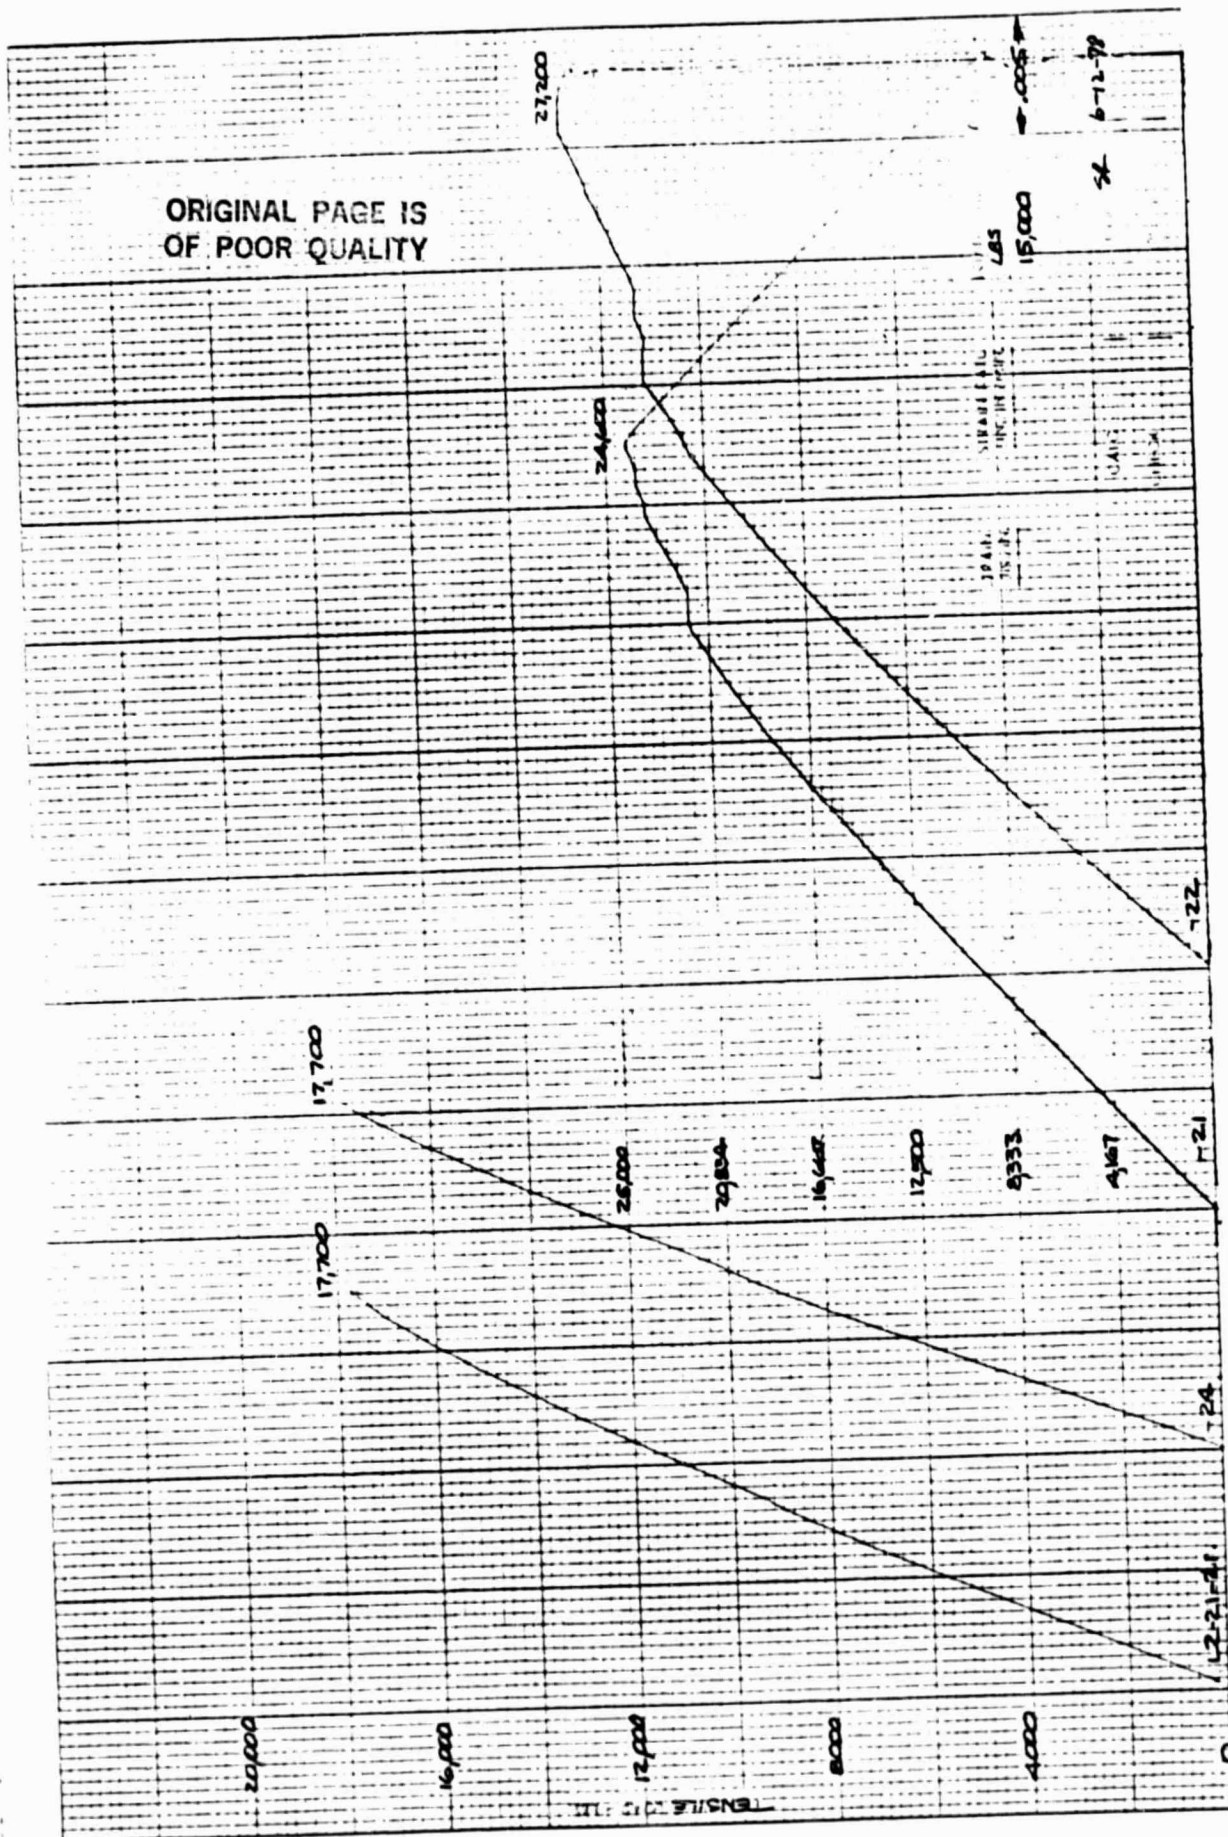



ORIGINAL PAGE IS  
OF POOR QUALITY

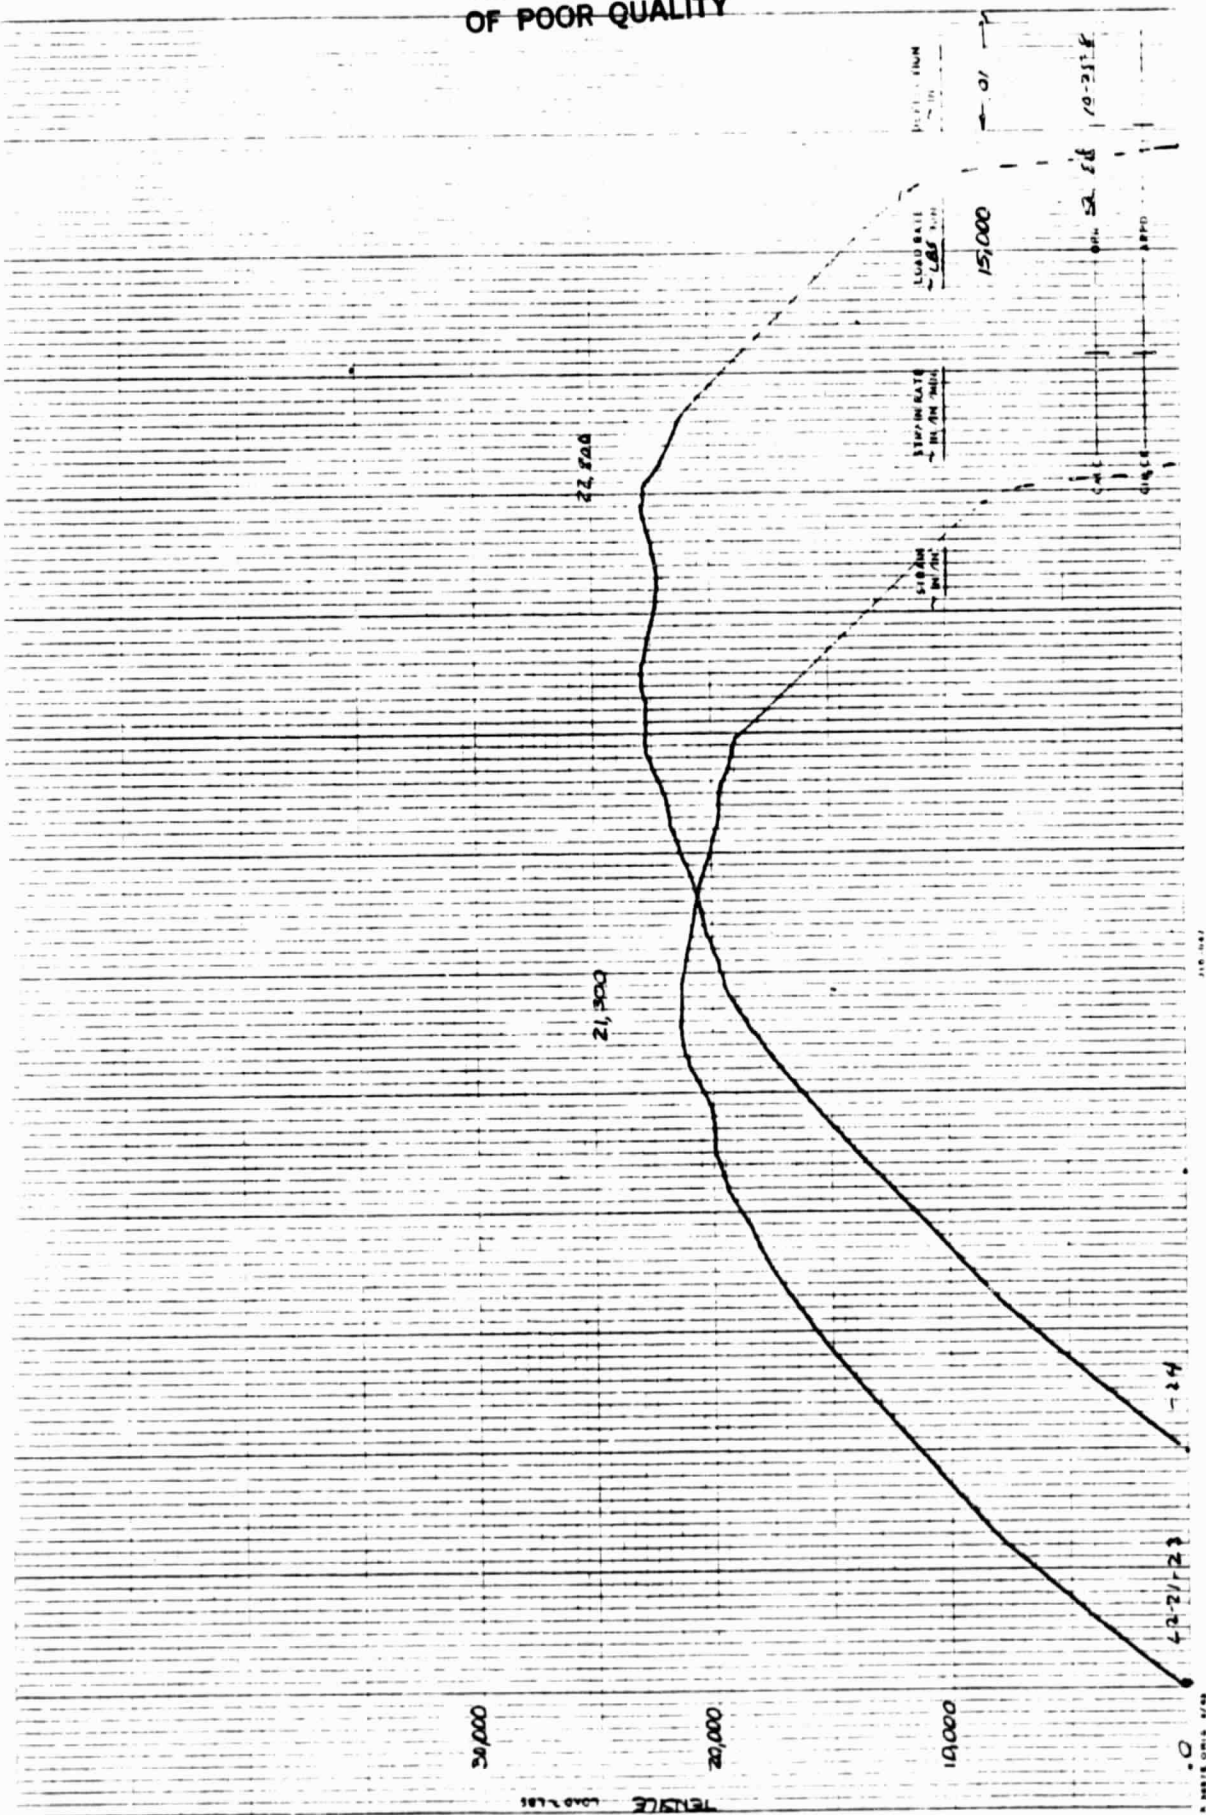

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
5/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L2-21-25

L2-21-26

L2-21-27

L2-21-28

INITIAL

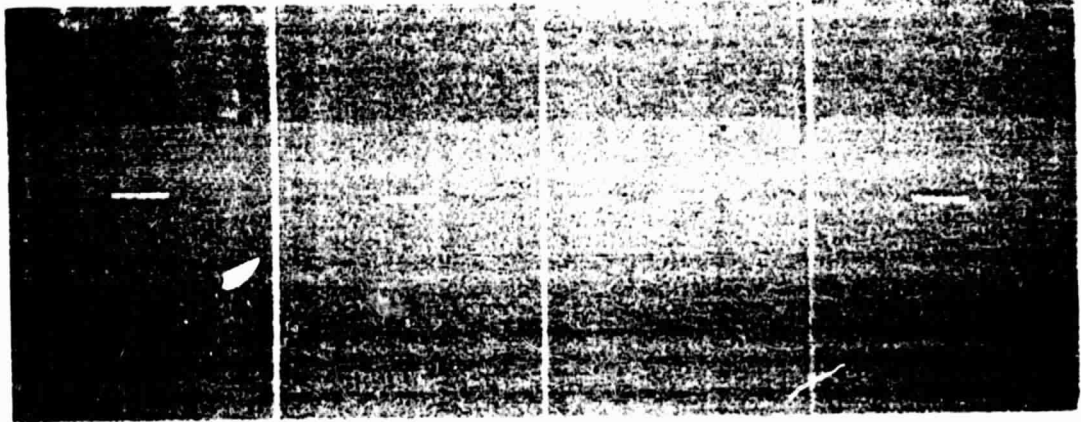

AFTER  
PRELOAD  
19.5 KIP




VISUAL DAMAGE


← 0.7–1.0 inch FINE SPLITS →



AFTER  
MOISTURE  
CONDITIONING

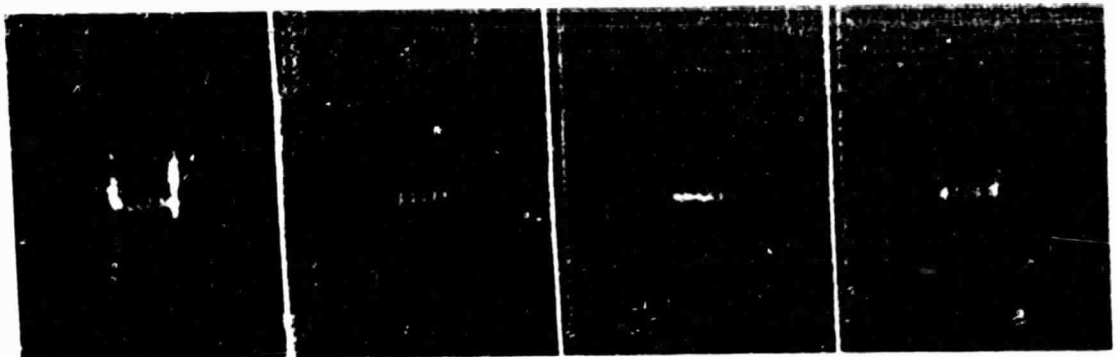

ORIGINAL PAGE IS  
OF POOR QUALITY

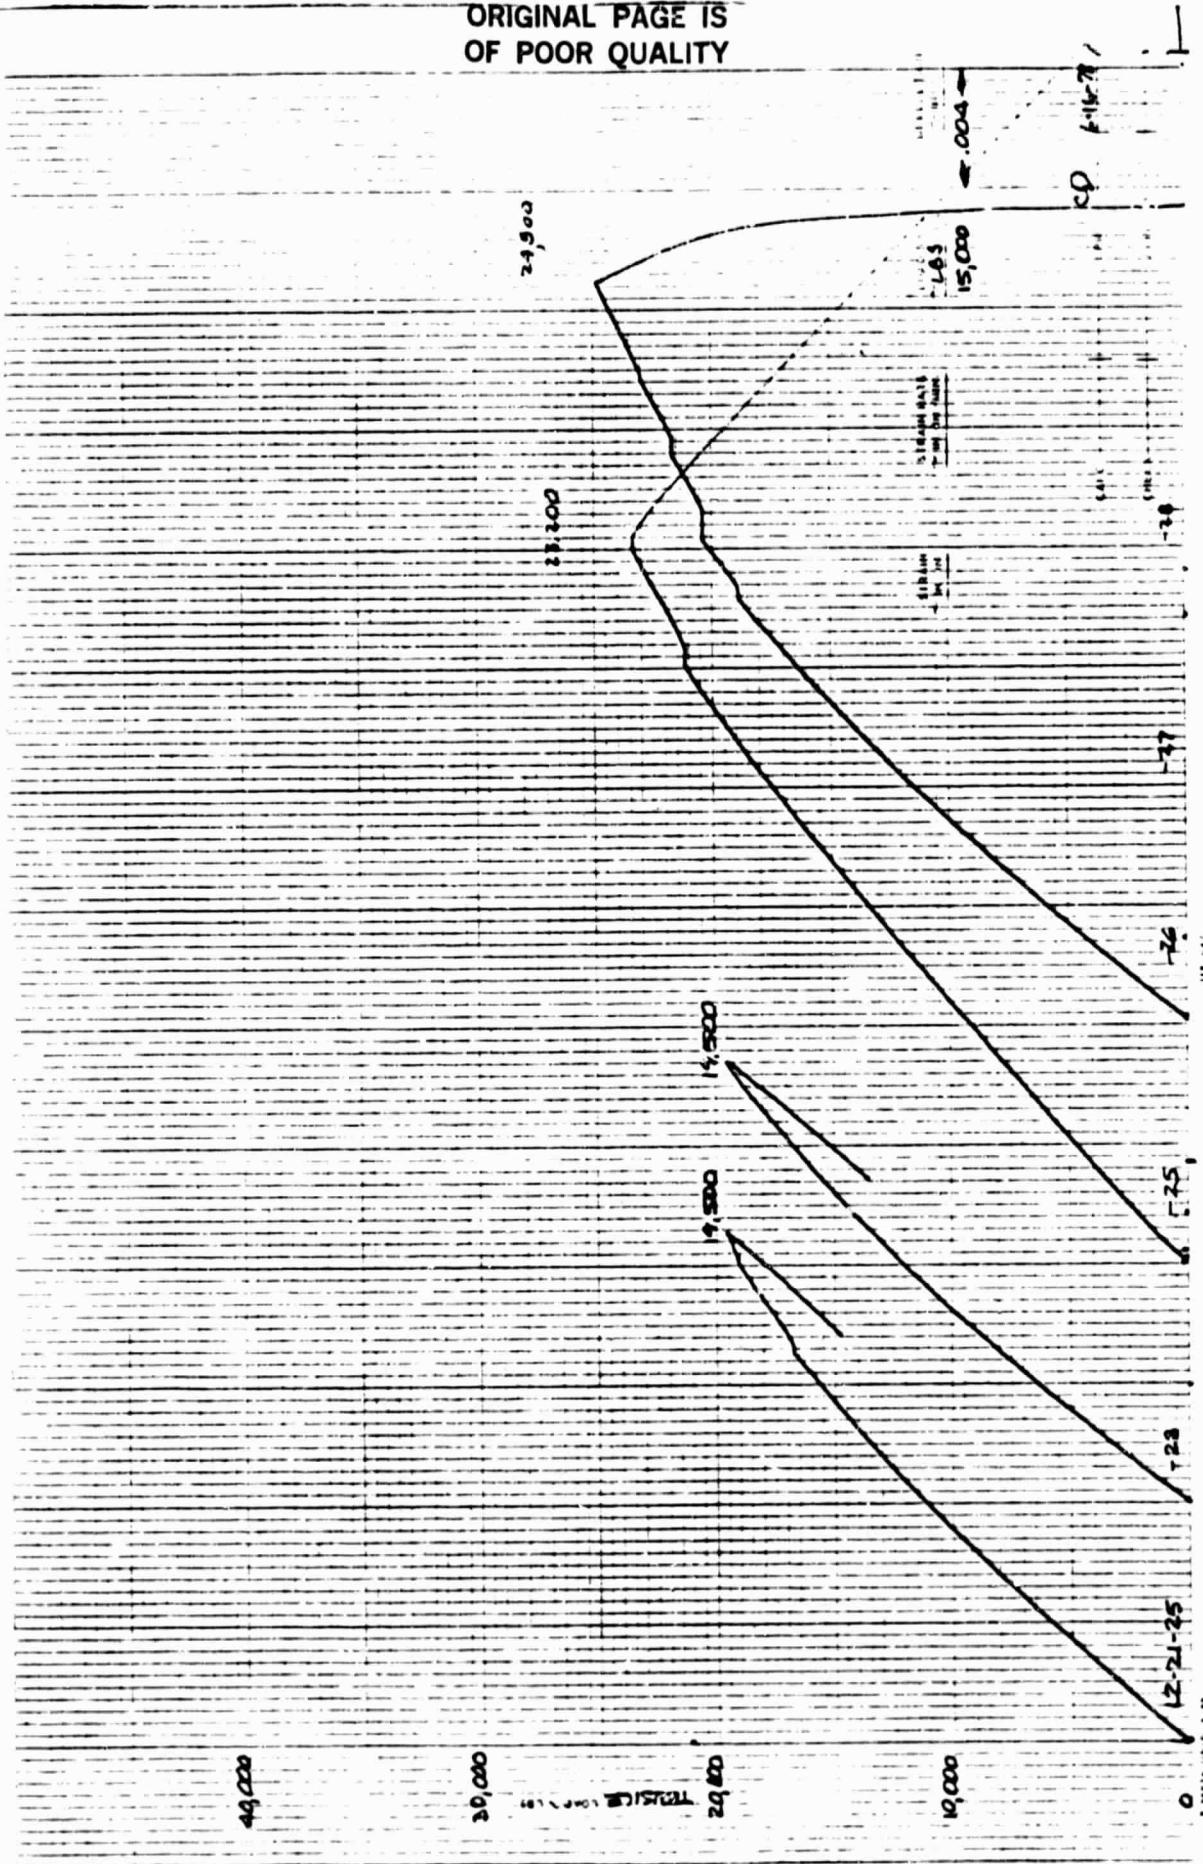

1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 2676, 2677, 2678, 2679, 2680, 26

6

10-24-78

FD

1500

100-0000

1

—

24,900

22 100

3

—

5900

00002

10,000.

1273.9587

2716N21

5

100




ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
5/8 HP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

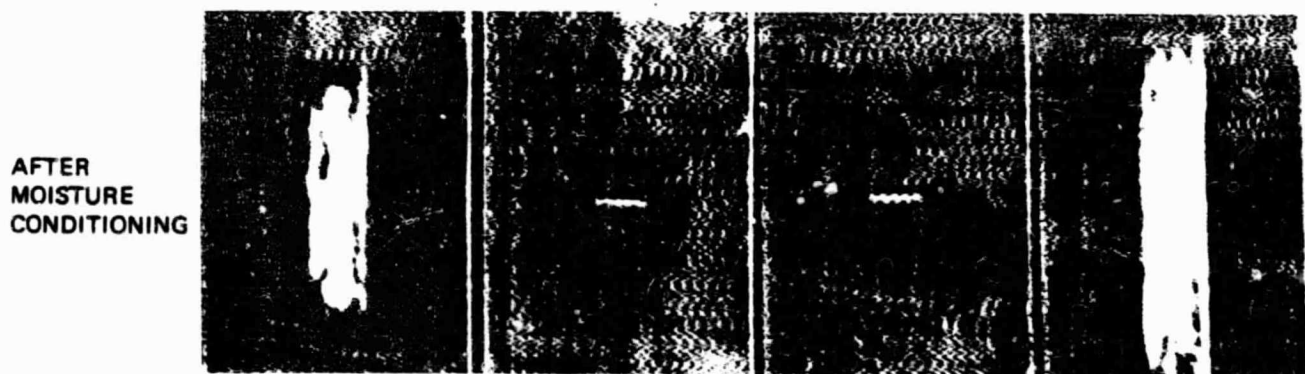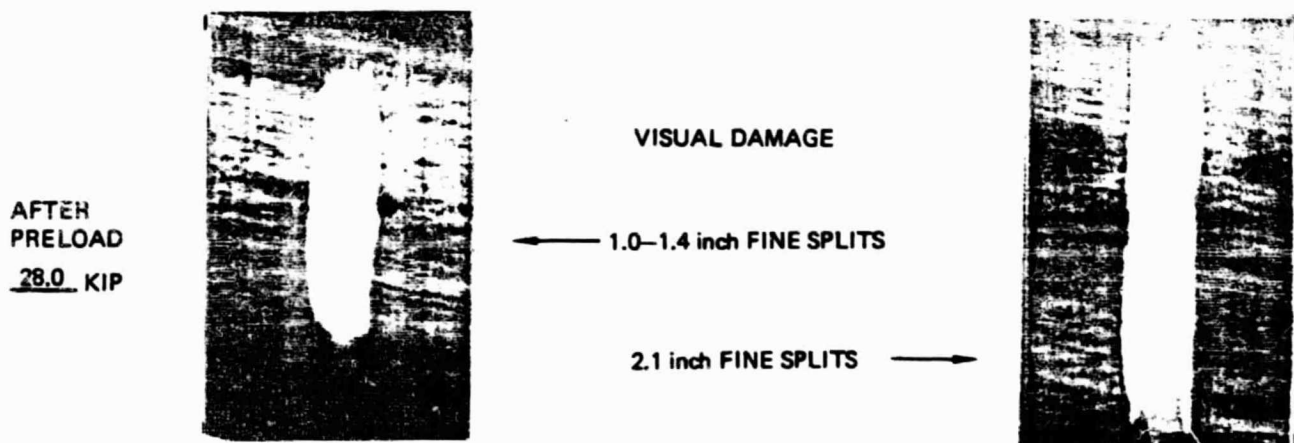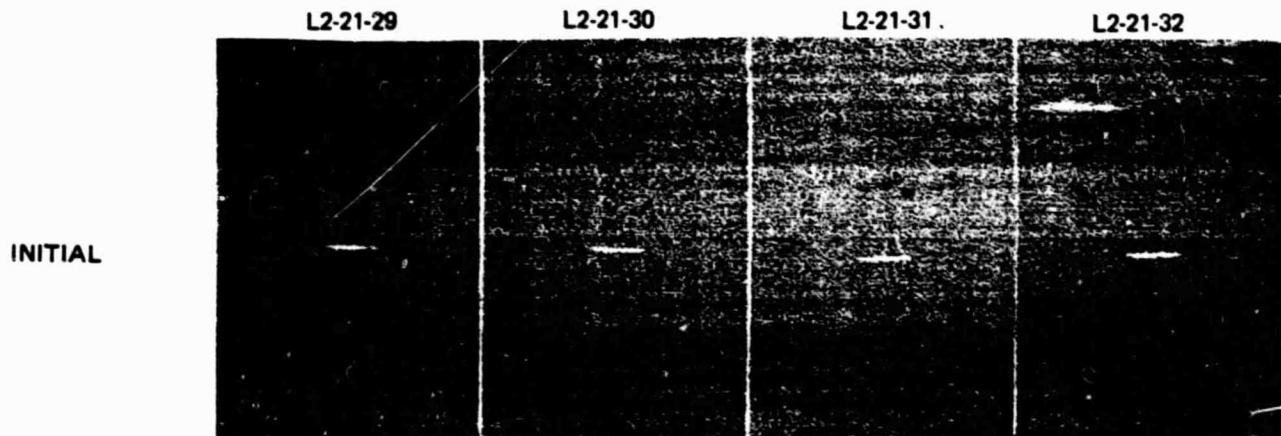




83 6-2-73



ORIGINAL PAGE IS  
OF POOR QUALITY

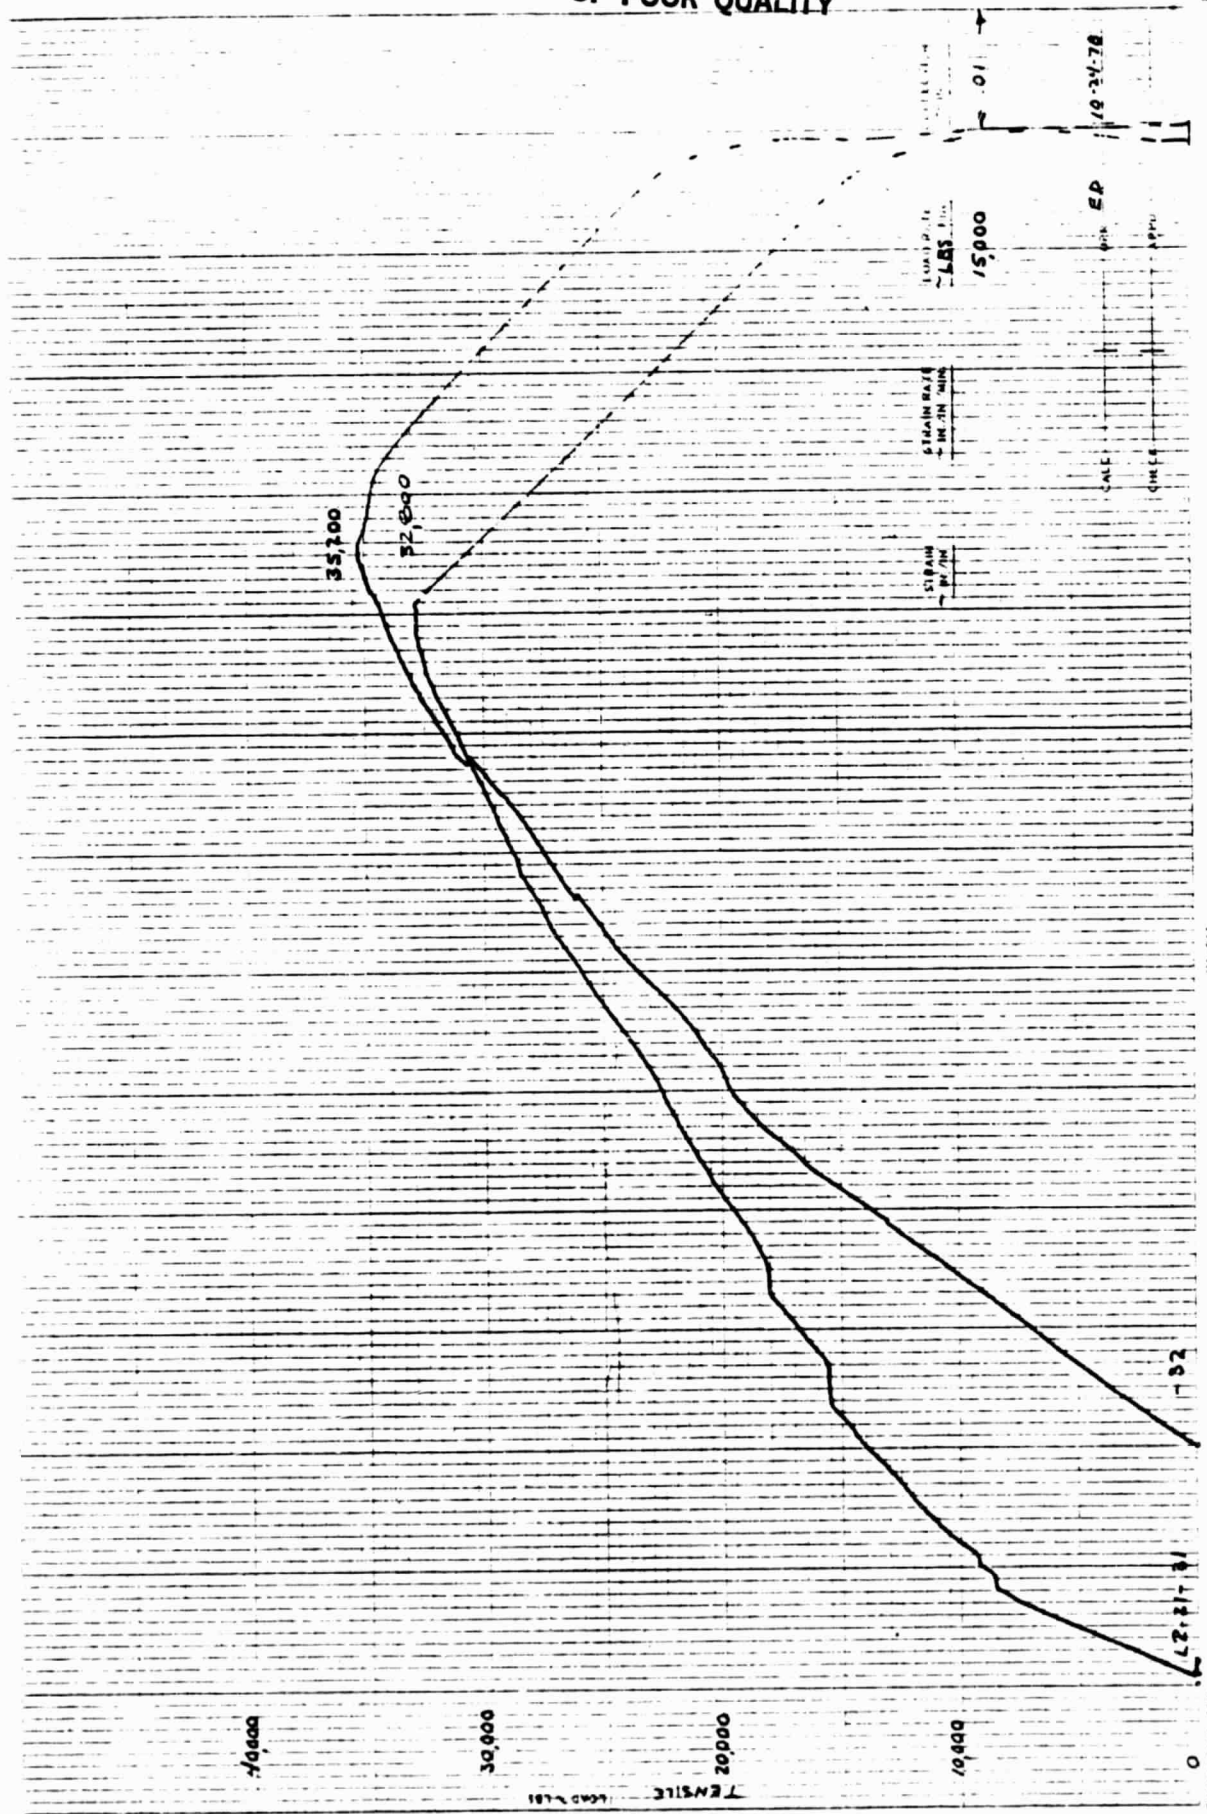

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
3/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

L2-21-41

L2-21-42

L2-21-43

L2-21-44

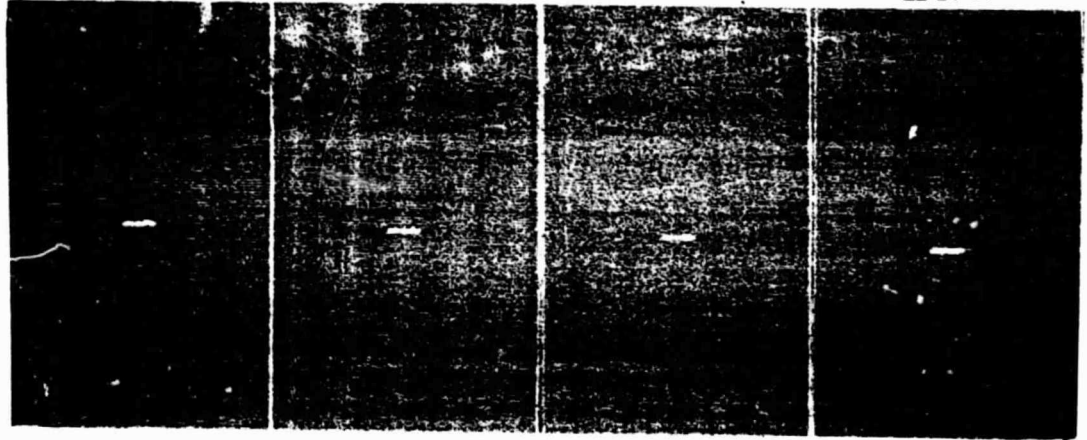

AFTER  
PRELOAD  
23.8 KIP




VISUAL DAMAGE

← 0.6–0.8 inch FINE SPLITS

0.8–1.0 inch FINE SPLITS →





AFTER  
MOISTURE  
CONDITIONING

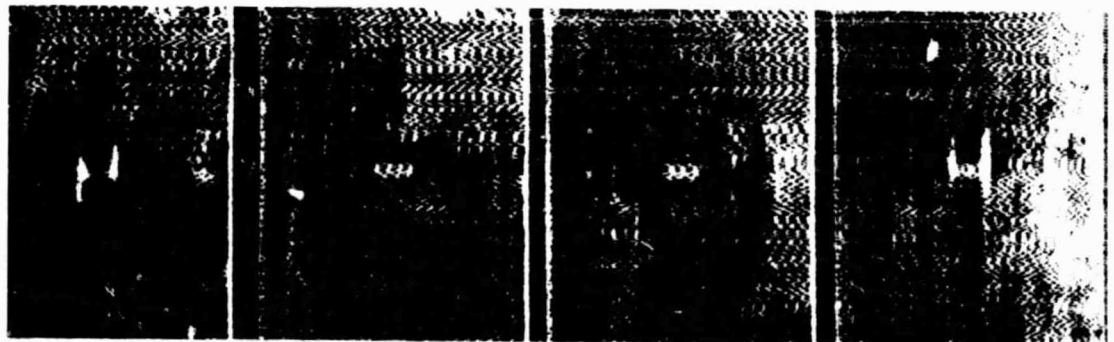



ORIGINAL PAGE IS  
OF POOR QUALITY

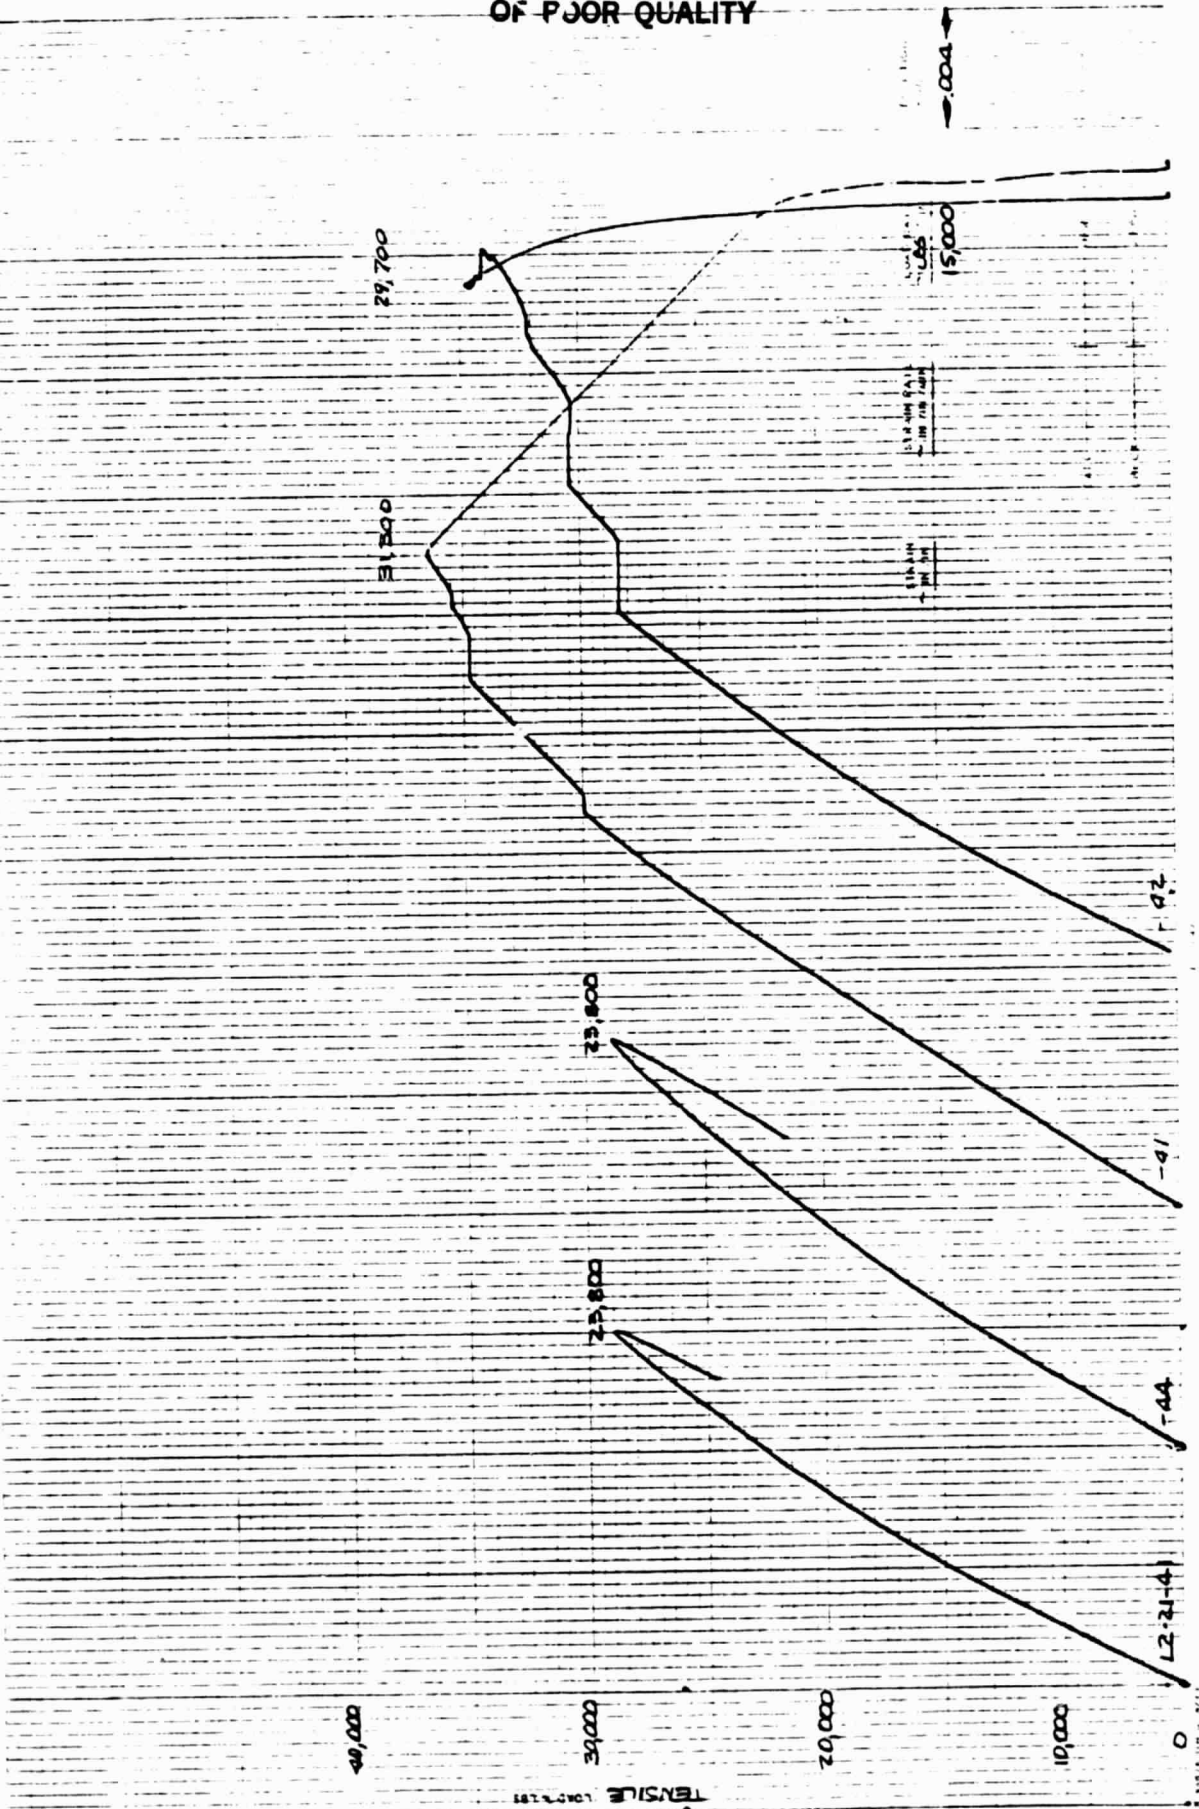

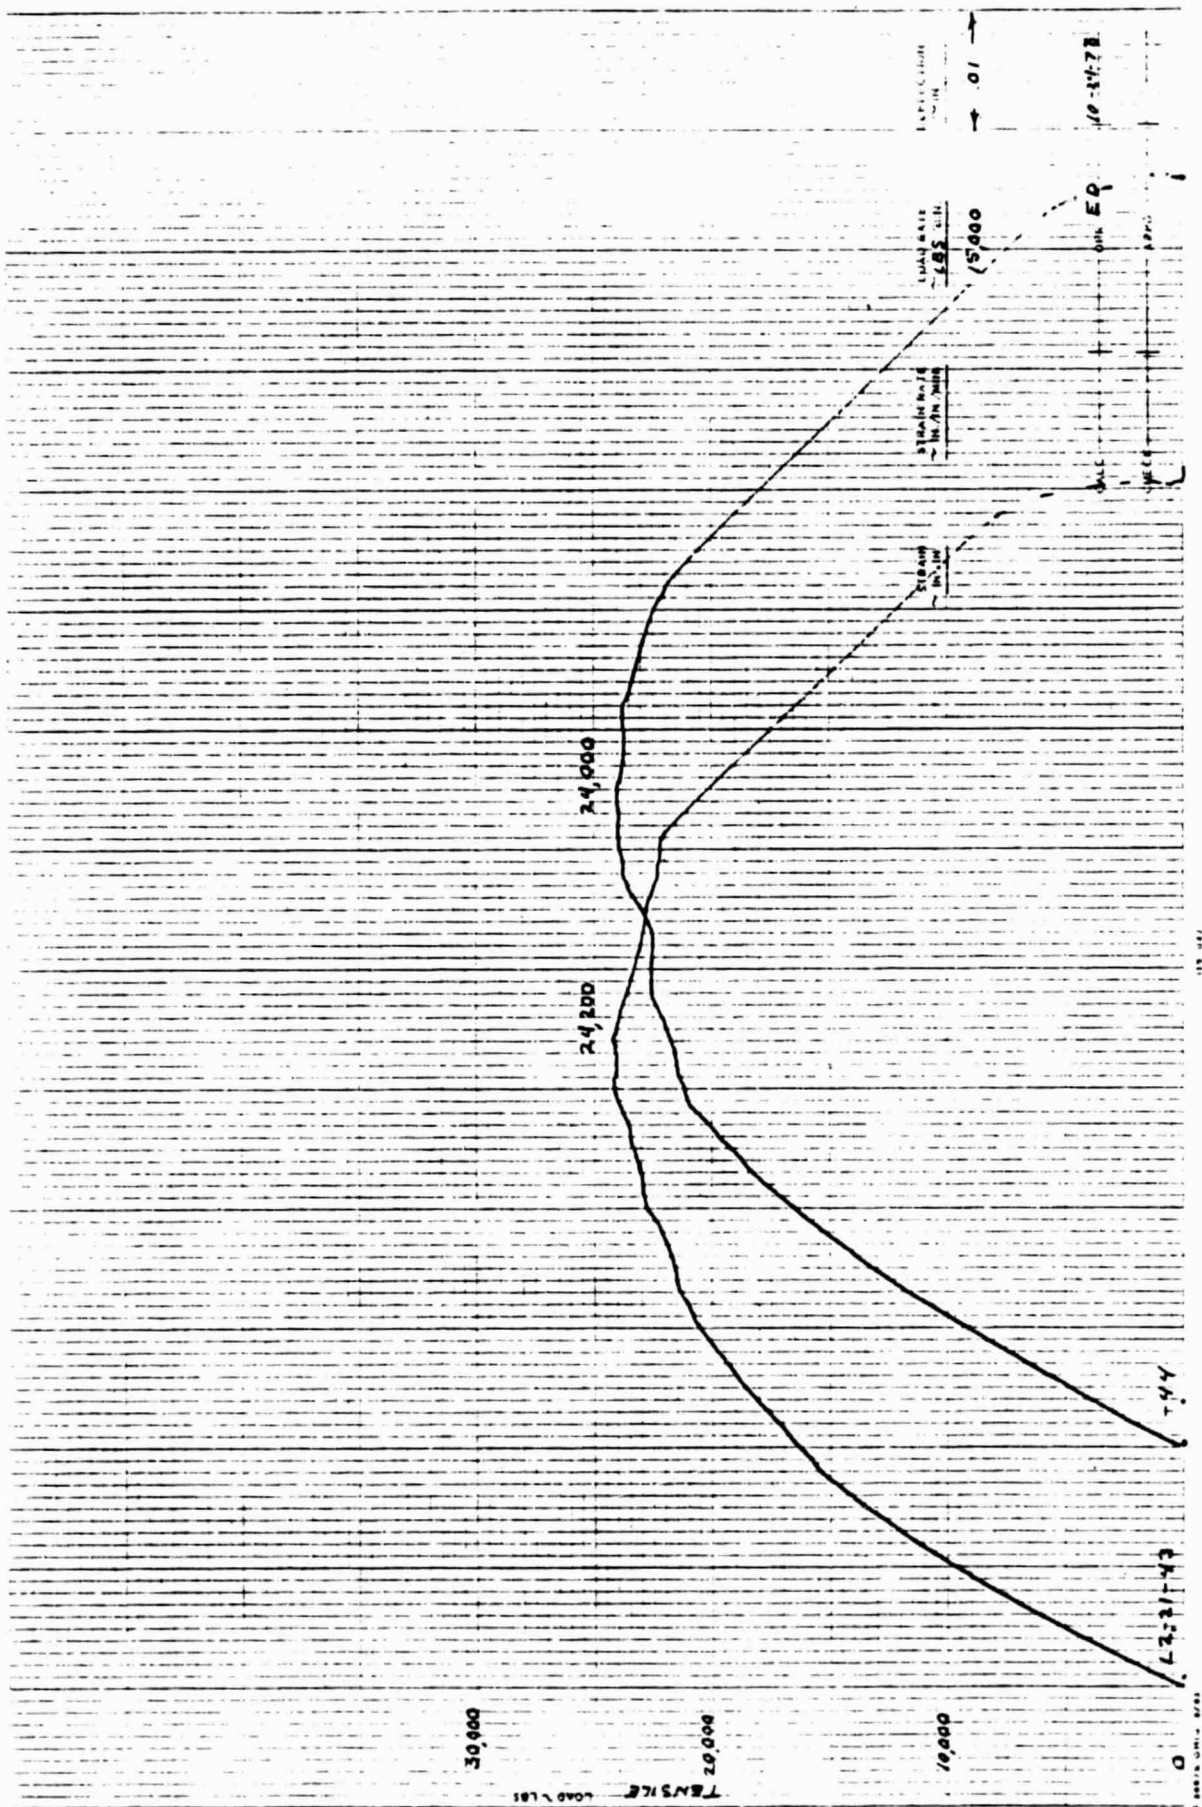

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
3/8 HP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L2-21-45

L2-21-46

L2-21-47

L2-21-48


INITIAL

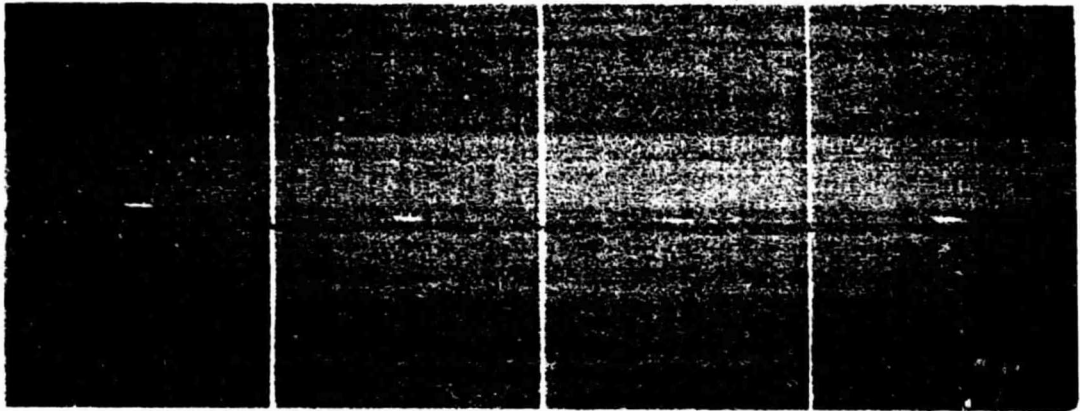


AFTER  
PRELOAD  
32.2 KIP

VISUAL DAMAGE


← 2.0-2.5 inch FINE SPLITS →

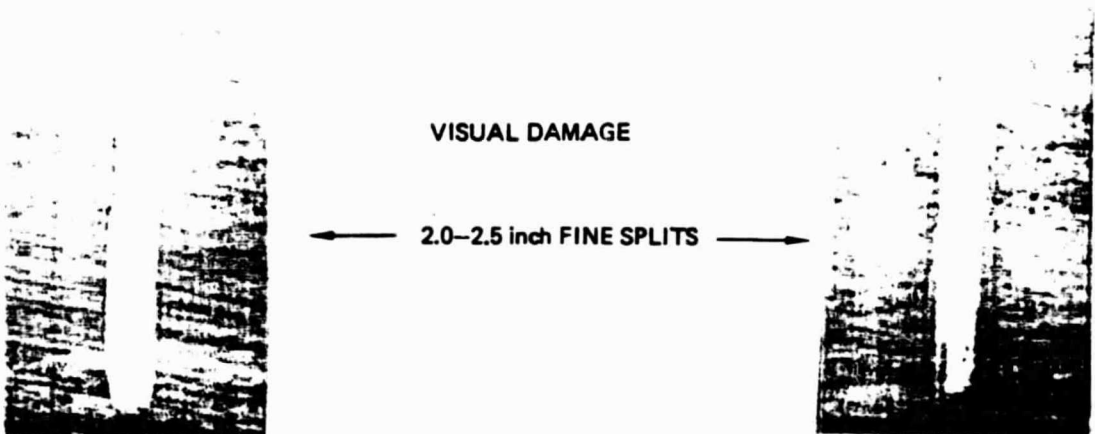


AFTER  
MOISTURE  
CONDITIONING

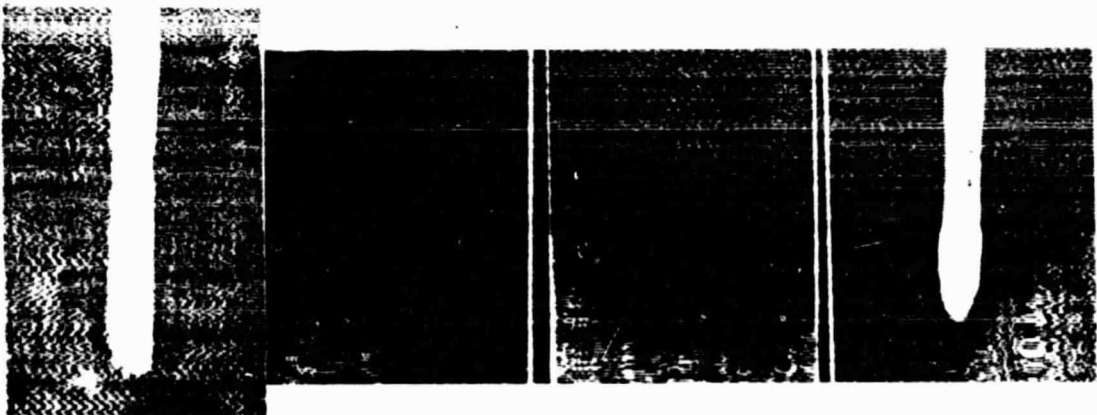

80°  
 60°  
 40°  
 20°  
 0°  
 -20°  
 -40°  
 -60°  
 -80°  
 -100°  
 -120°  
 -140°  
 -160°  
 -180°



ORIGINAL PAGE IS  
OF POOR QUALITY

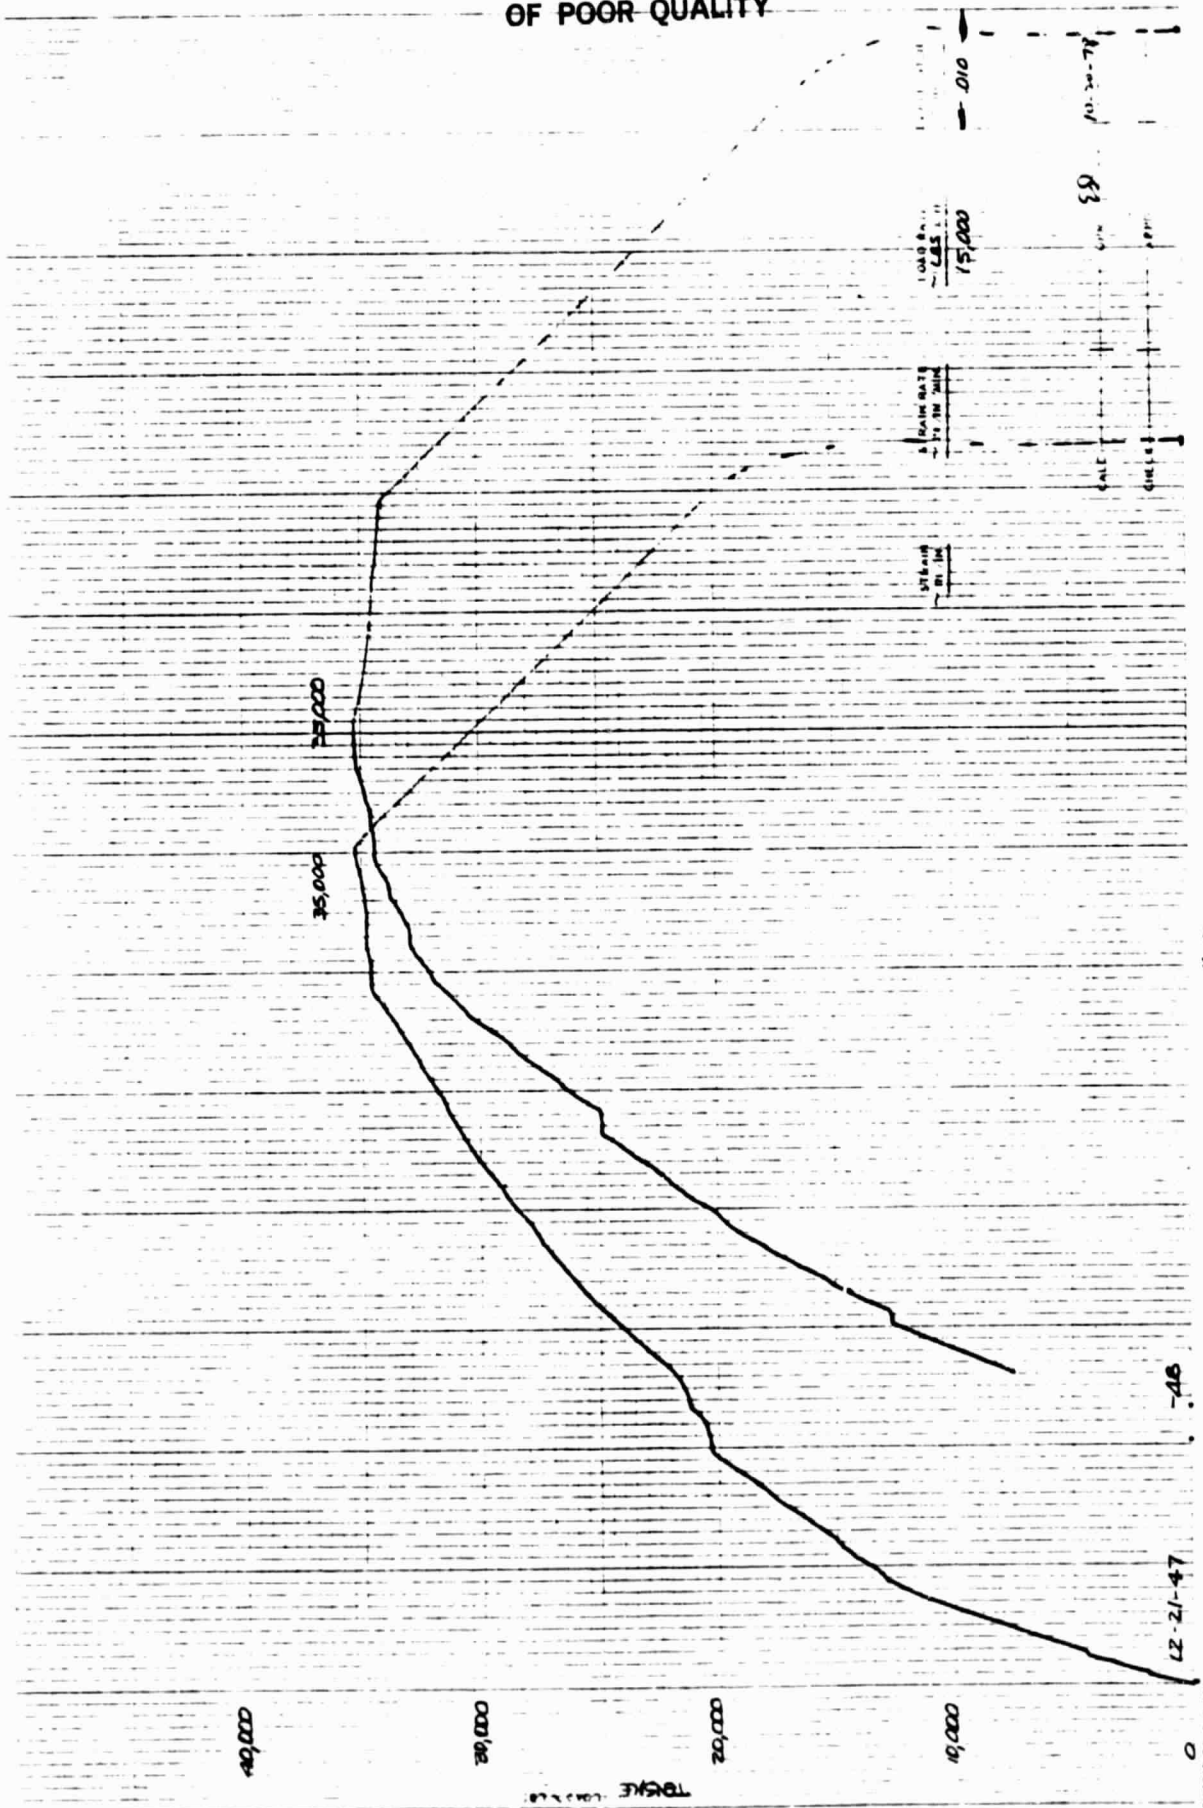



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
1/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

INITIAL

L2-21-49

L2-21-50

L2-21-51

L2-21-52



AFTER  
PRELOAD  
24.9 KIP

VISUAL DAMAGE


← 0.3–0.4 inch FINE SPLITS →




AFTER  
MOISTURE  
CONDITIONING



ORIGINAL PAGE IS  
OF POOR QUALITY

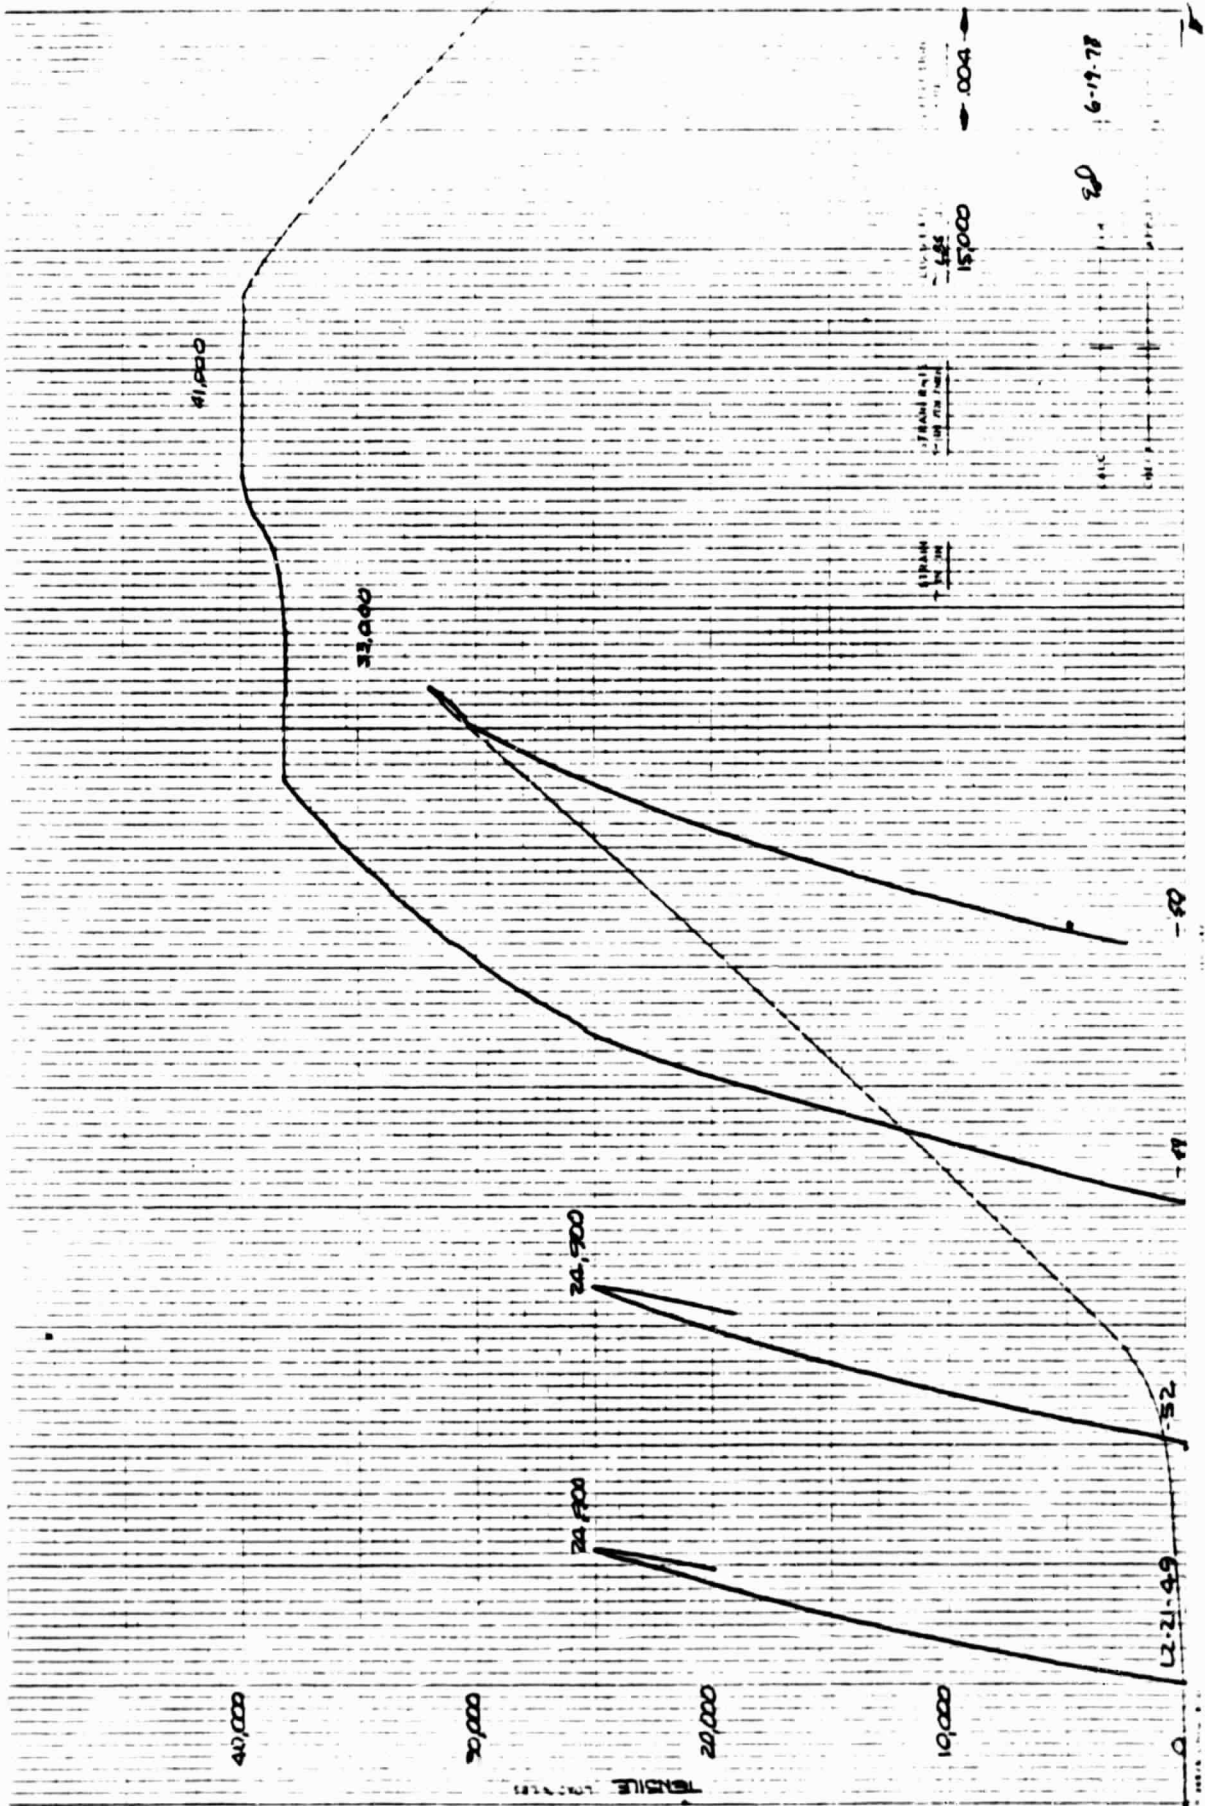

ORIGINAL PAGE IS  
OF POOR QUALITY

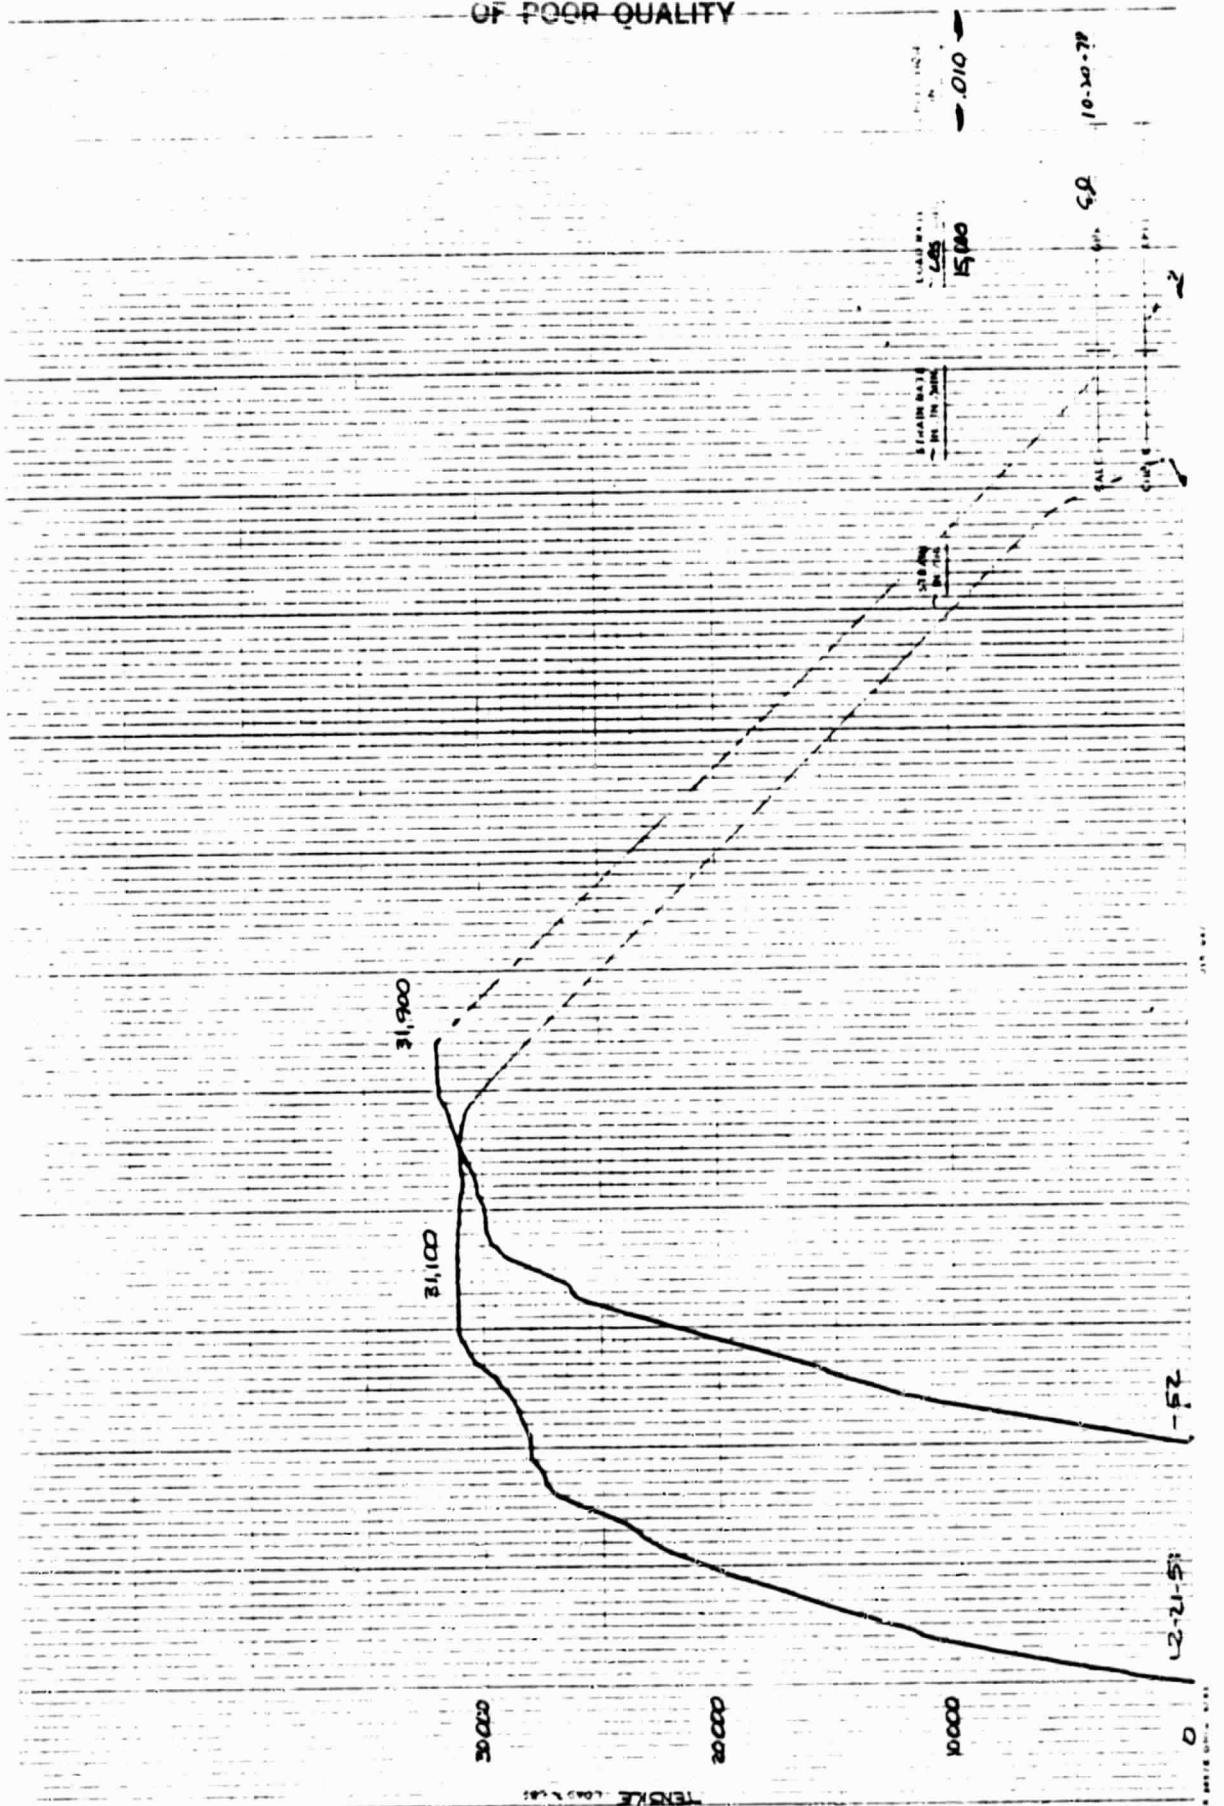



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
1/8 HP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L2-21-61

L2-21-62

L2-21-63

L2-21-64

INITIAL

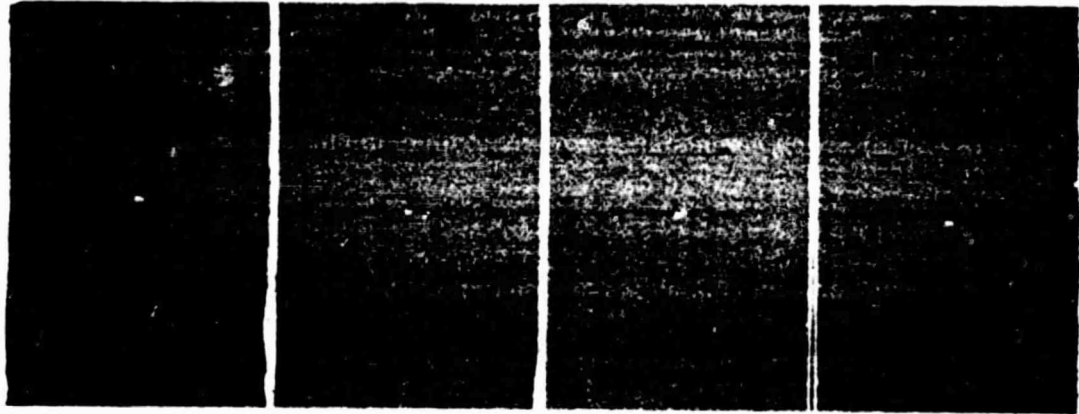


AFTER  
PRELOAD  
26.9 KIP


VISUAL DAMAGE

← 0.1–0.2 inch FINE SPLITS

0.2–0.3 inch FINE SPLITS →

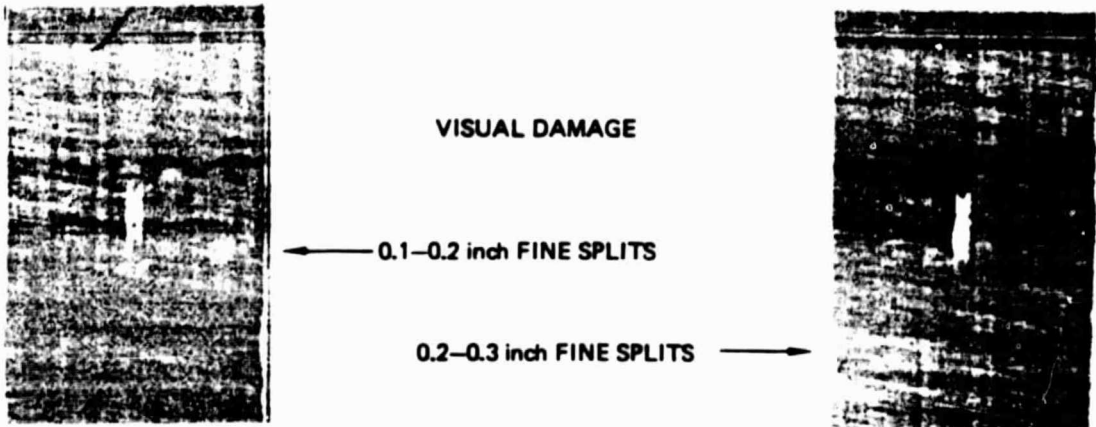

AFTER  
MOISTURE  
CONDITIONING

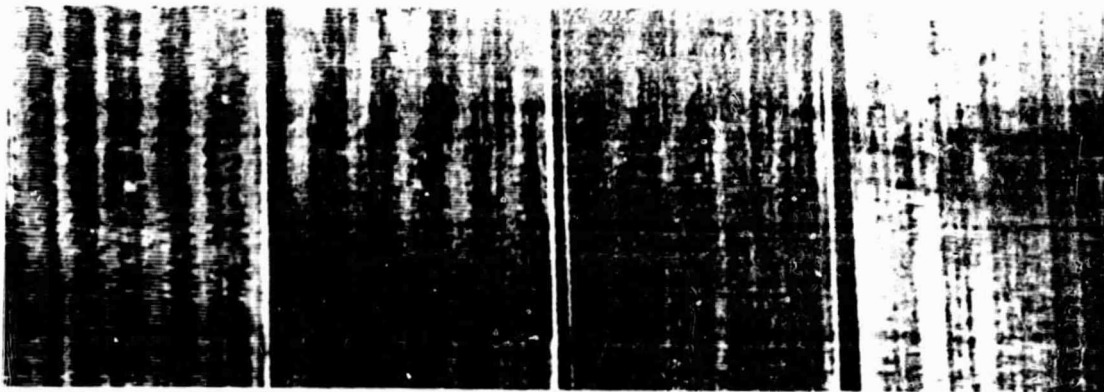

6-19-78

1. The first step is to identify the problem or question that needs to be answered.

100

-62-

19-1

$$12.21 + 6A$$

12-21-61

—d

26,000.

26,900

40900

000 DE


29,000

5000

TRANSMIT

000 70 6 000 00

ORIGINAL PAGE IS  
OF POOR QUALITY

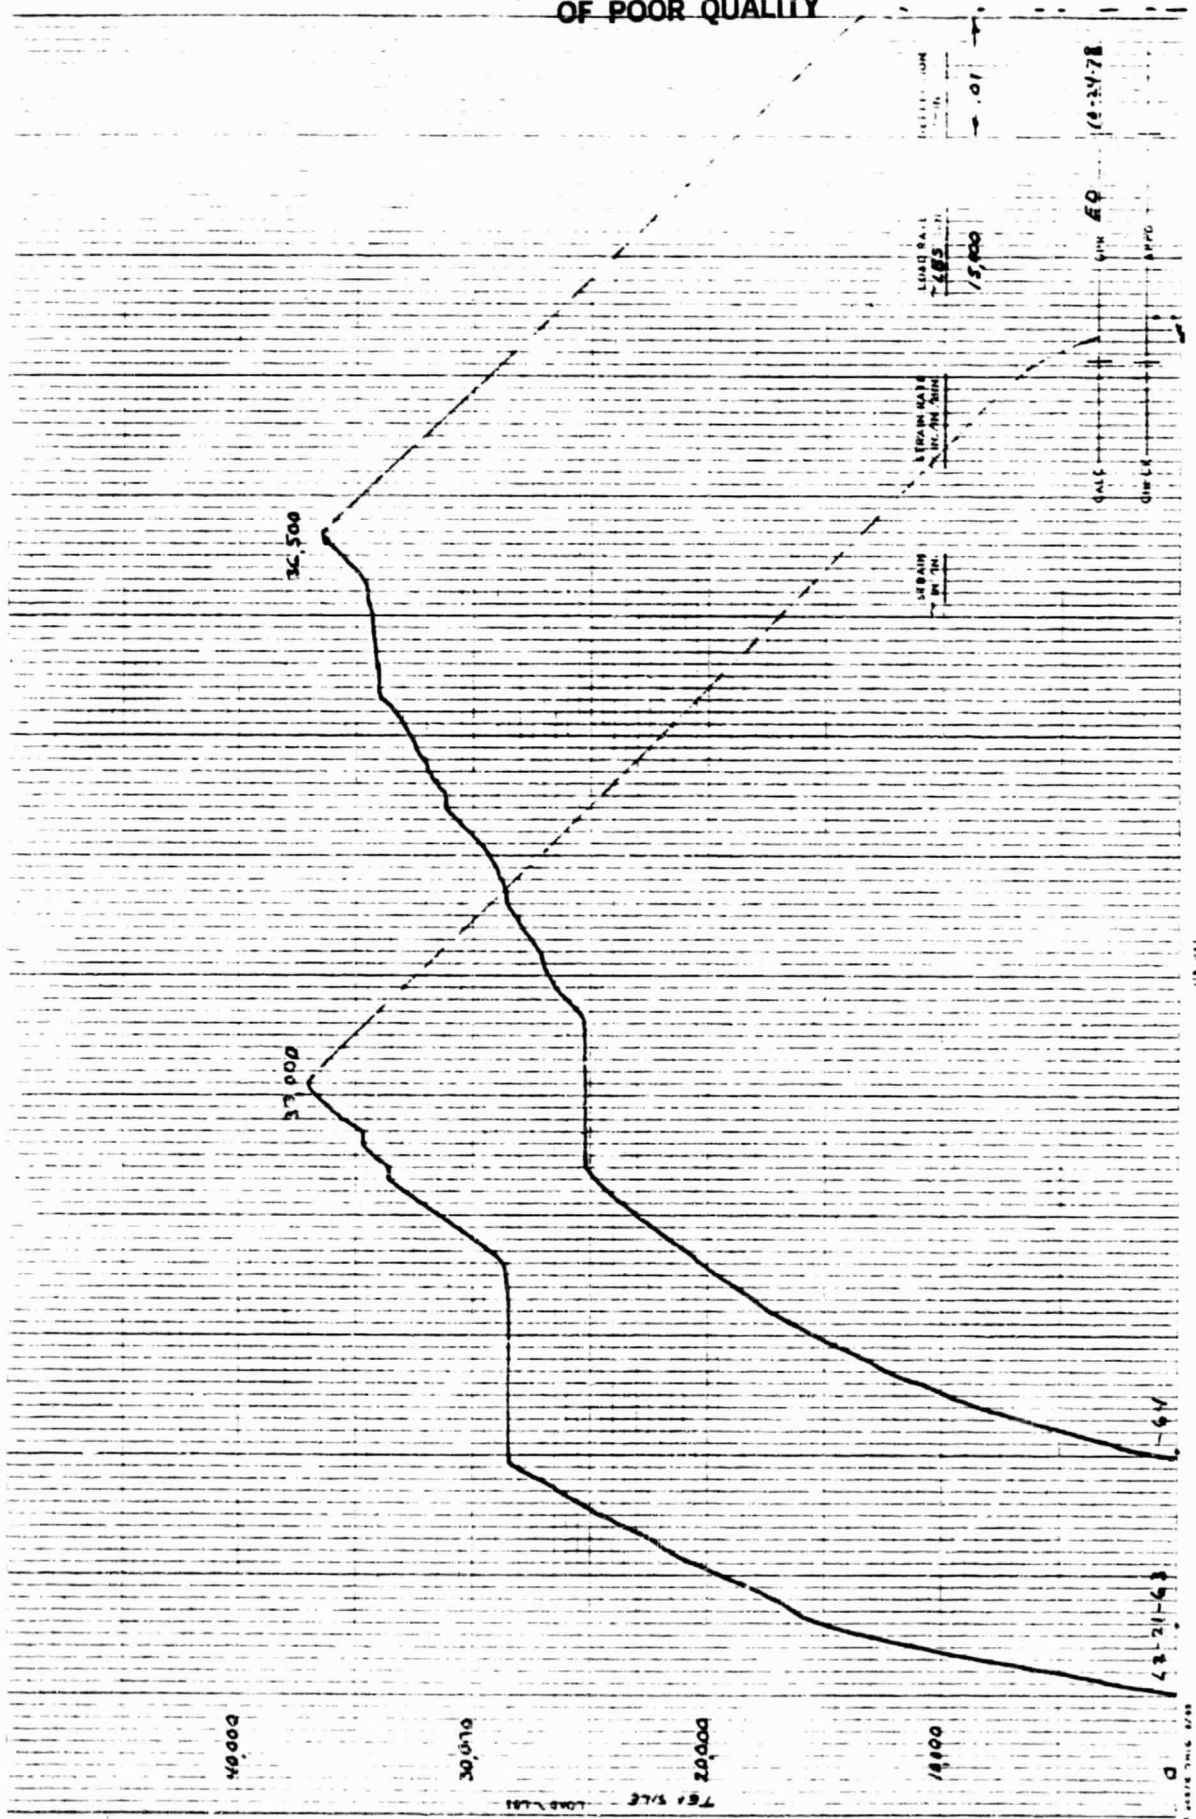




ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
5/8 FP HOLE  
50 psi CURE

TEST SPECIMENS

ROOM TEMPERATURE


422° K (300° F)

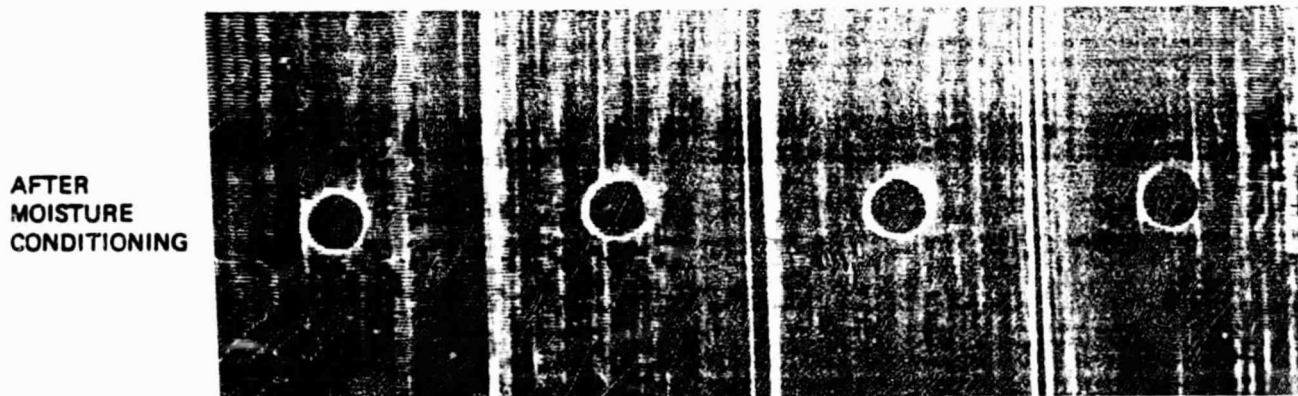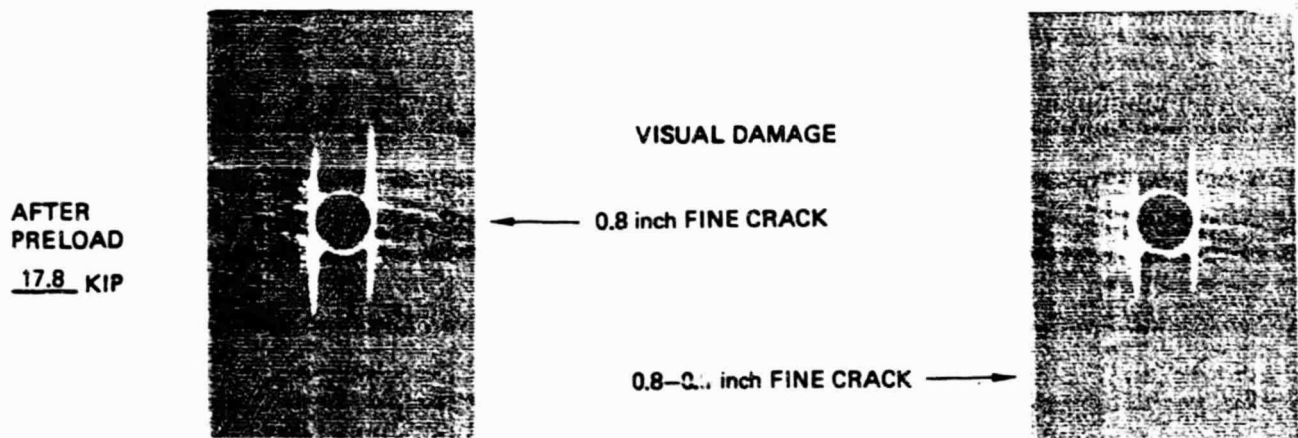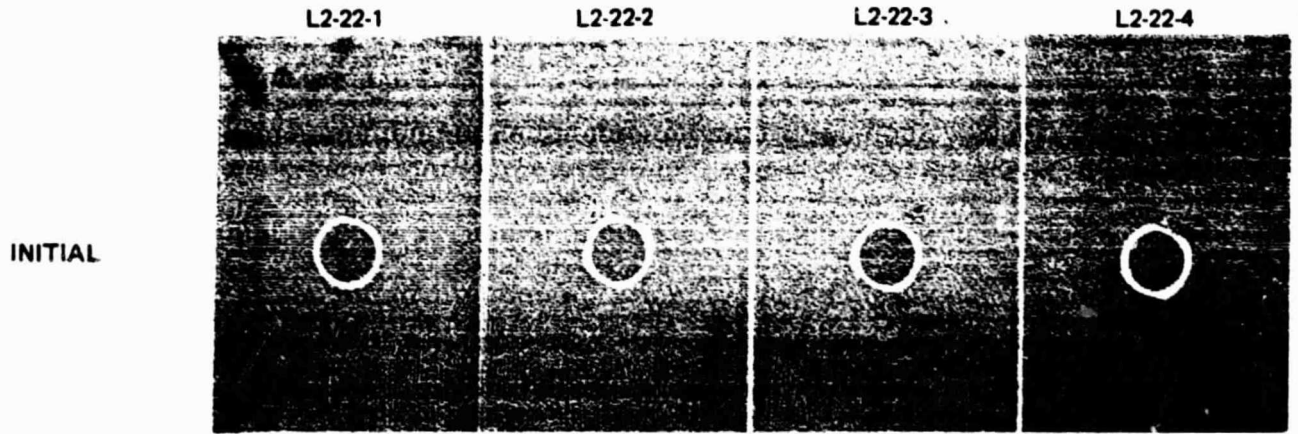





ORIGINAL PAGE IS  
OF POOR QUALITY

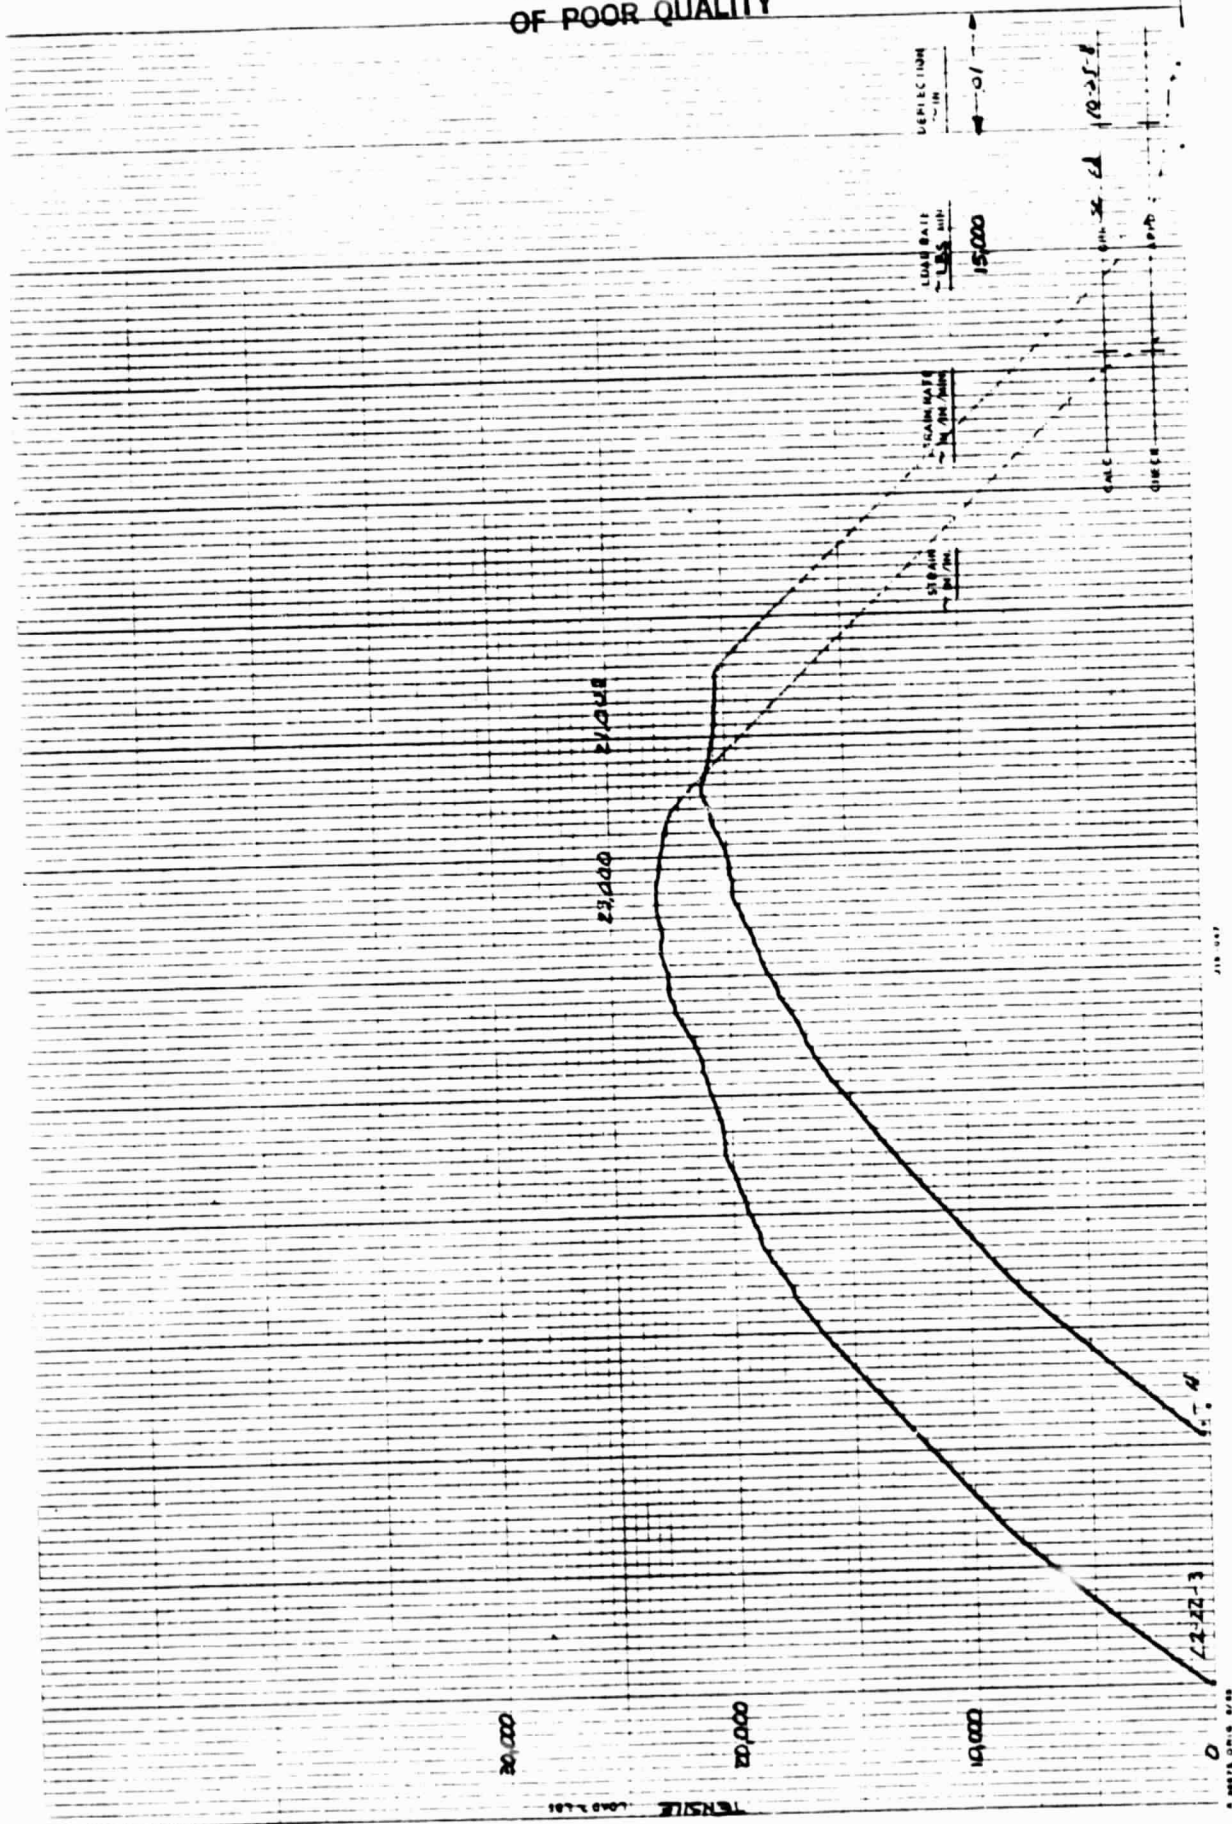

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
5/8 FP HOLE  
25 psi CURE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L2-23-1

L2-23-2

L2-23-3

L2-23-4

INITIAL

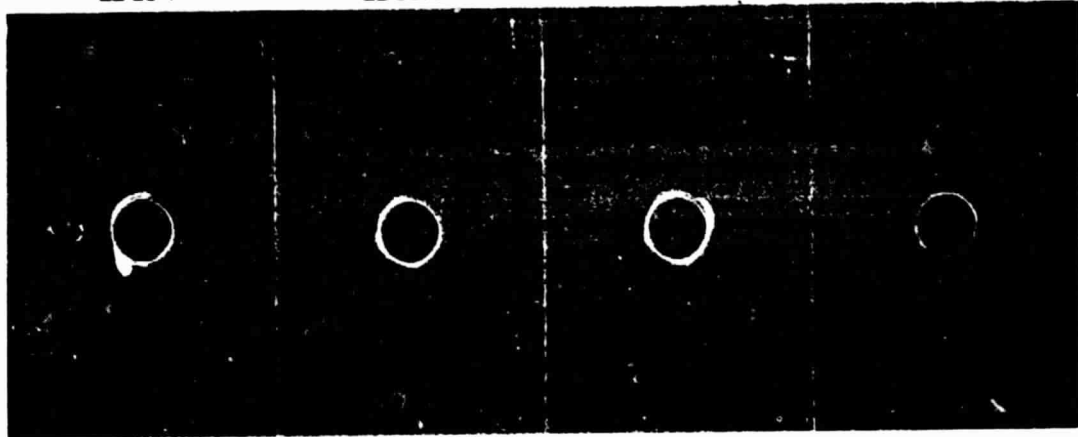


AFTER  
PRELOAD  
18.2 KIP


VISUAL DAMAGE

← 0.8–0.9 inch FINE CRACKS


~ 0.8 inch FINE CRACKS →

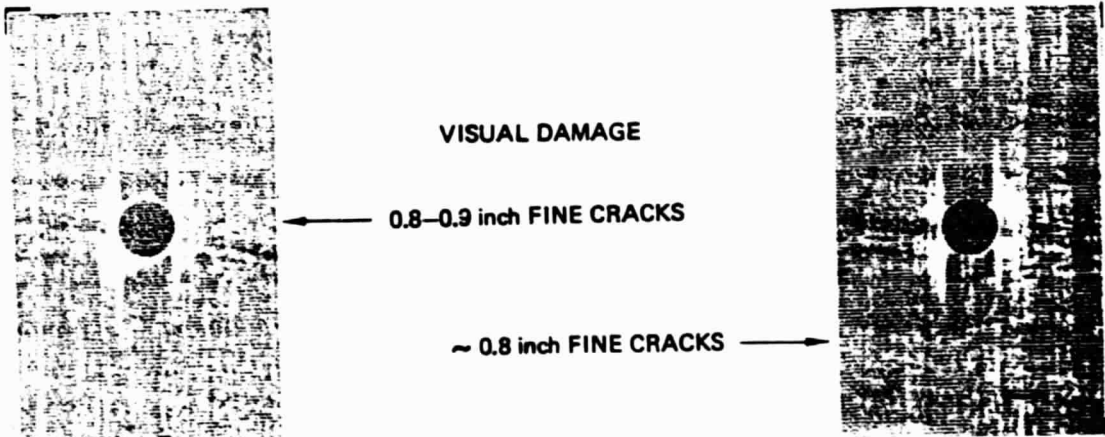

AFTER  
MOISTURE  
CONDITIONING

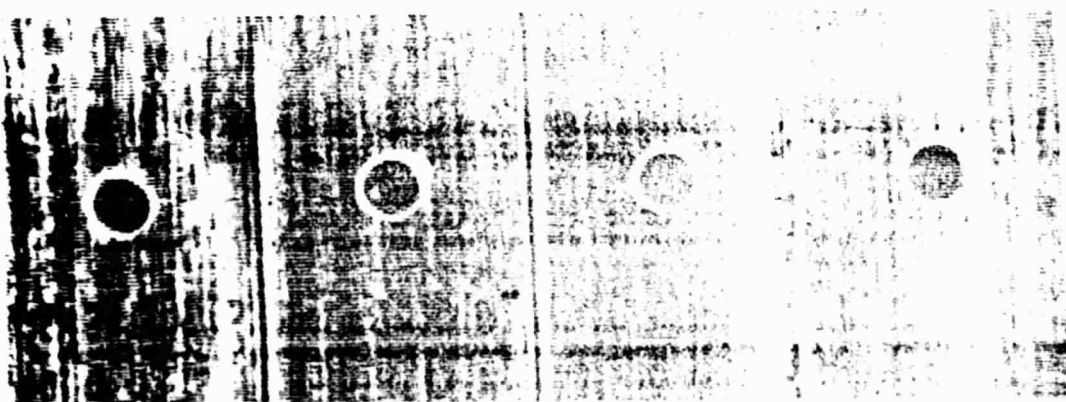


ORIGINAL PAGE IS  
OF POOR QUALITY

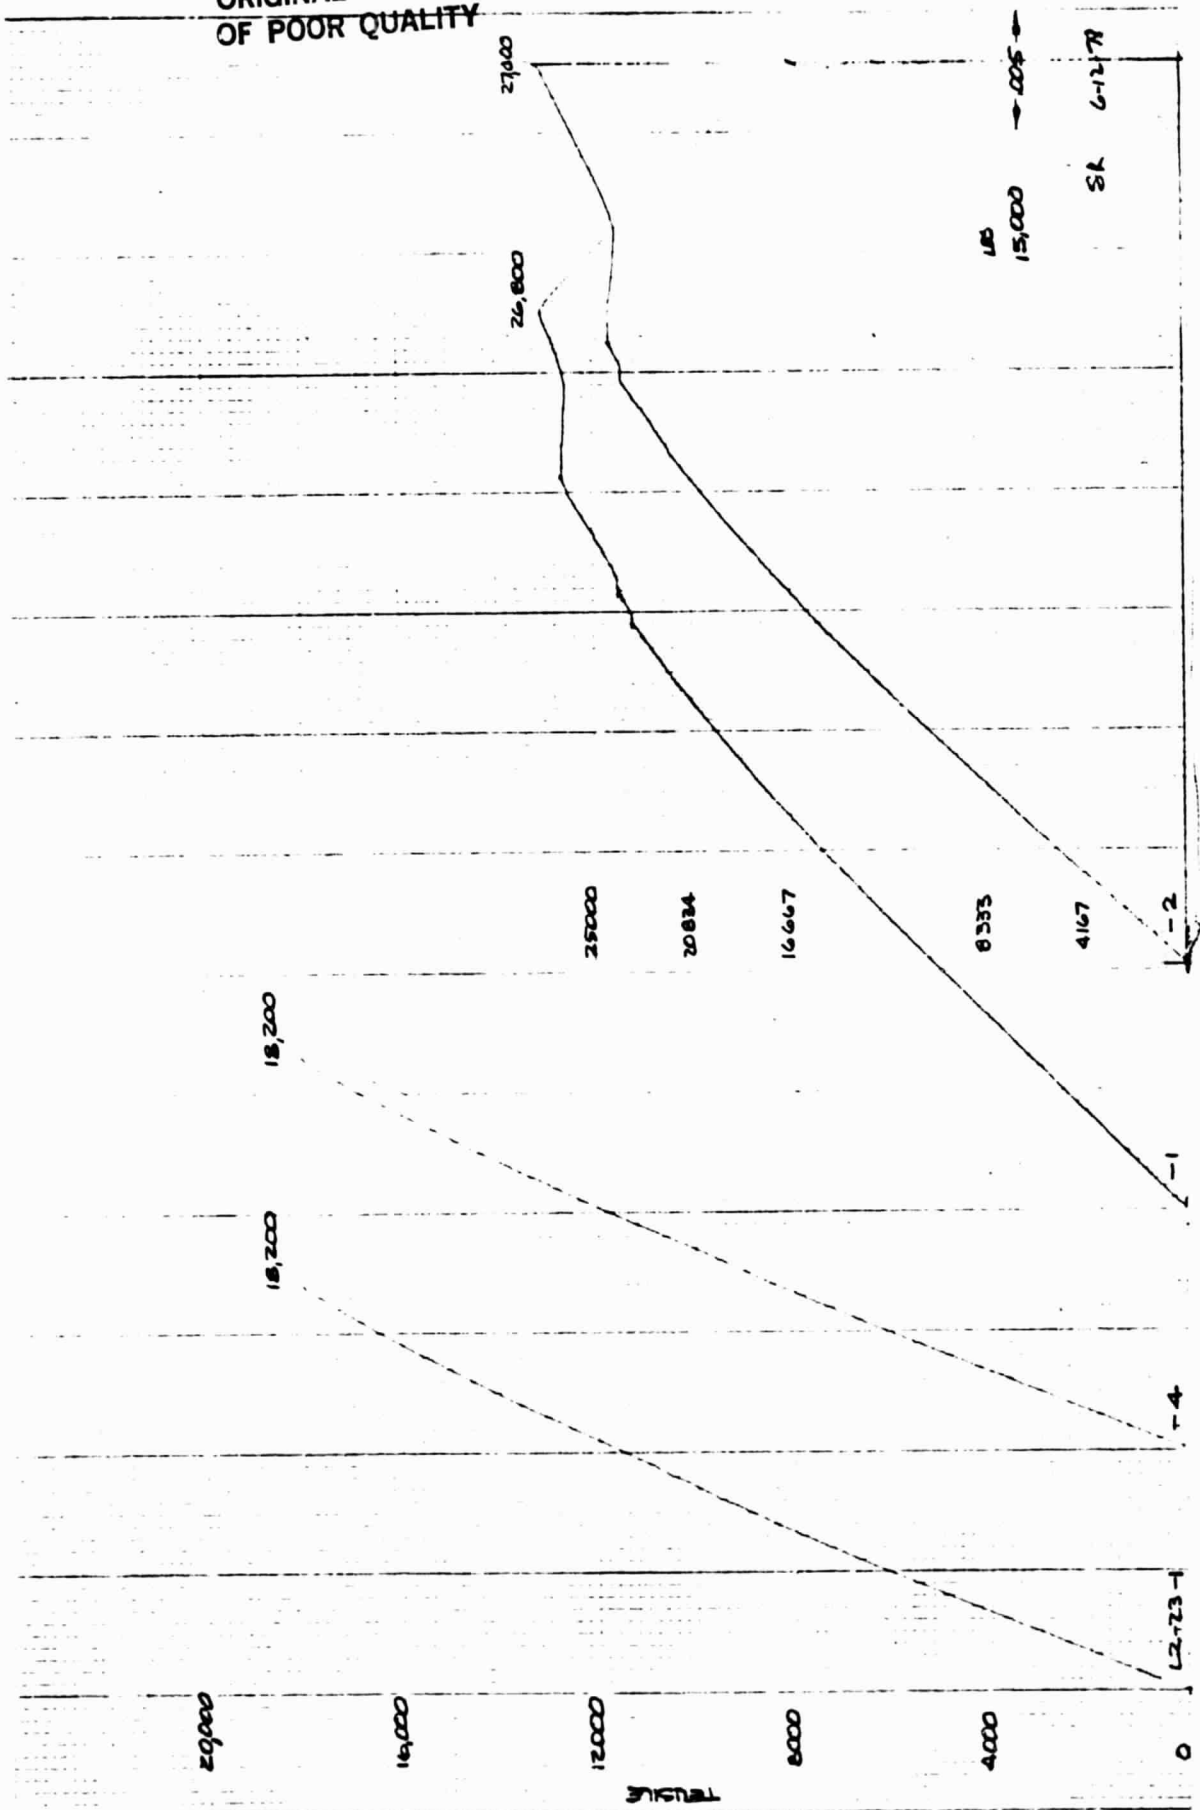



ORIGINAL PAGE IS  
OF POOR QUALITY

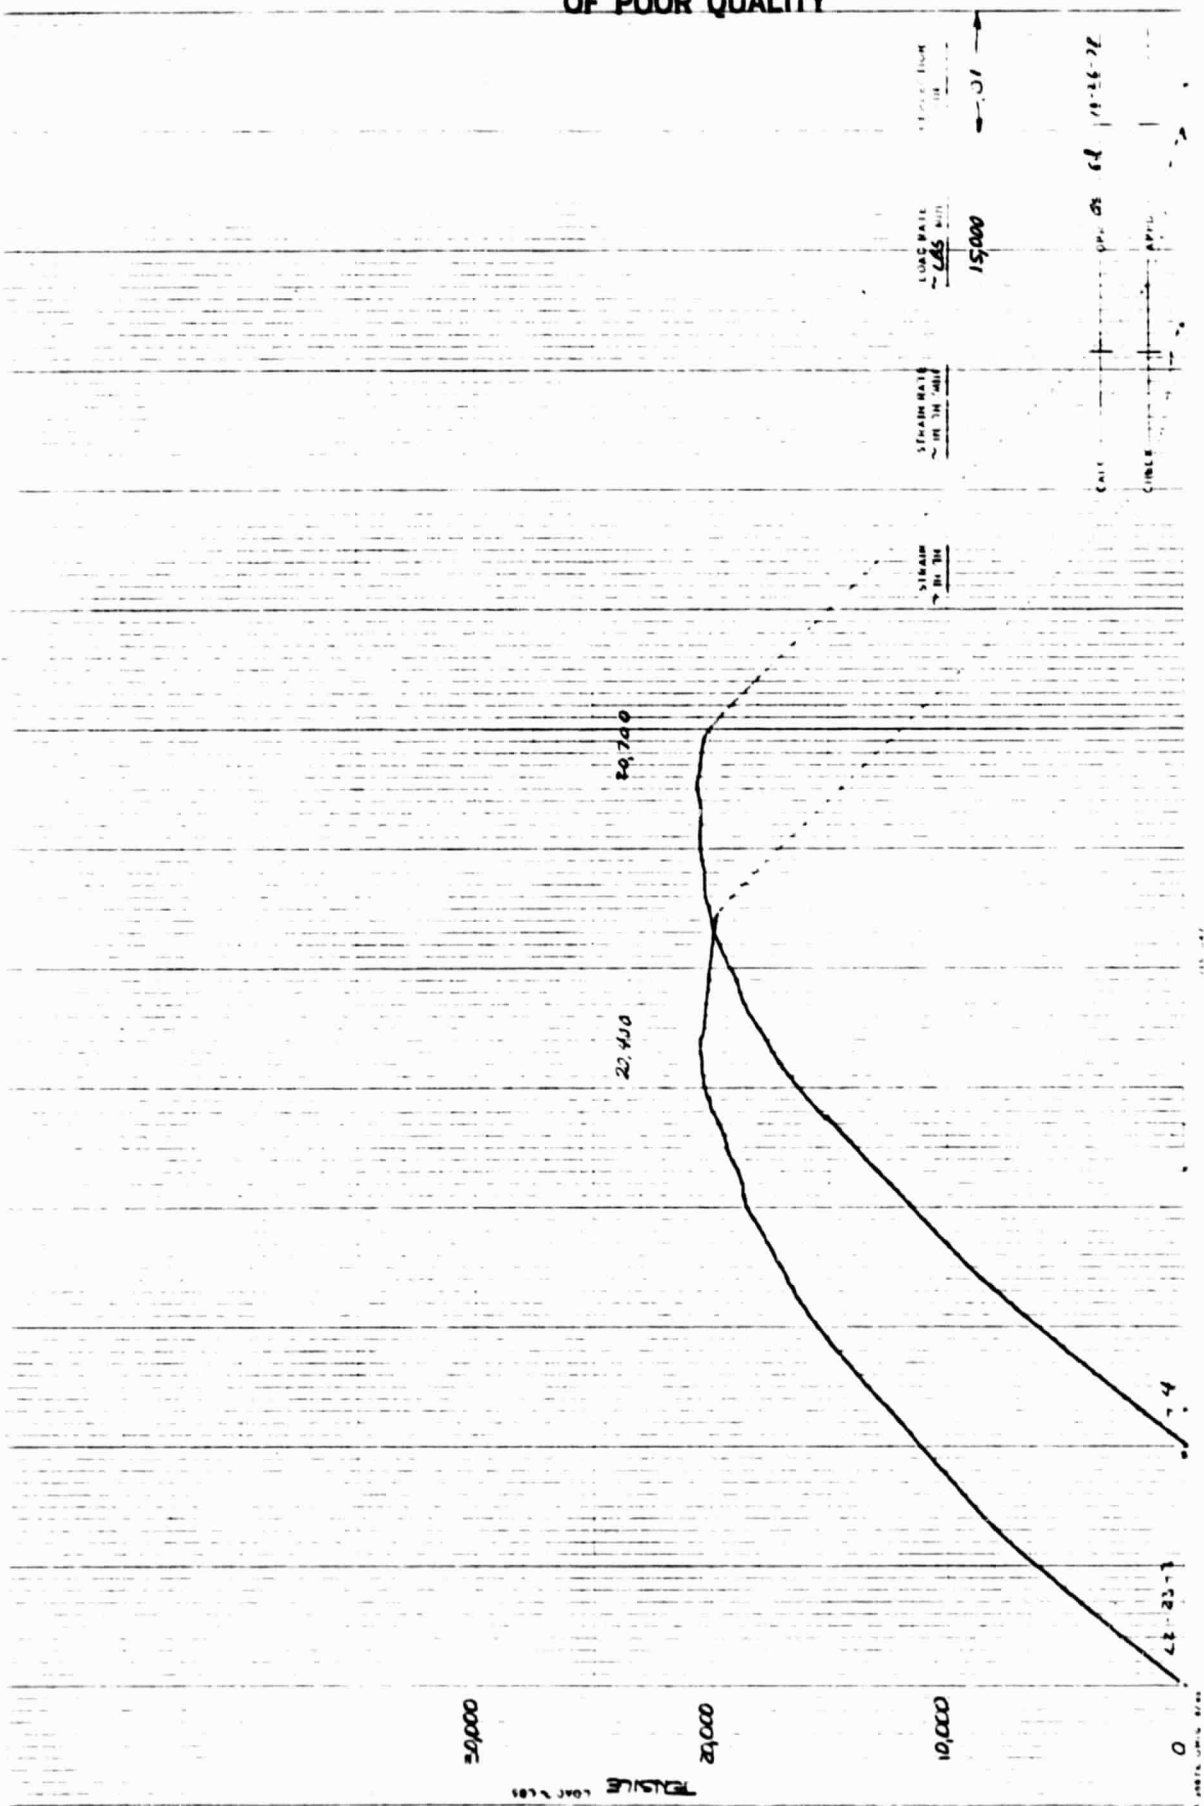




ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L2  
5/8 FP HOLE  
12.5 psi CURE


TEST SPECIMENS

ROOM TEMPERATURE


422° K (300° F)

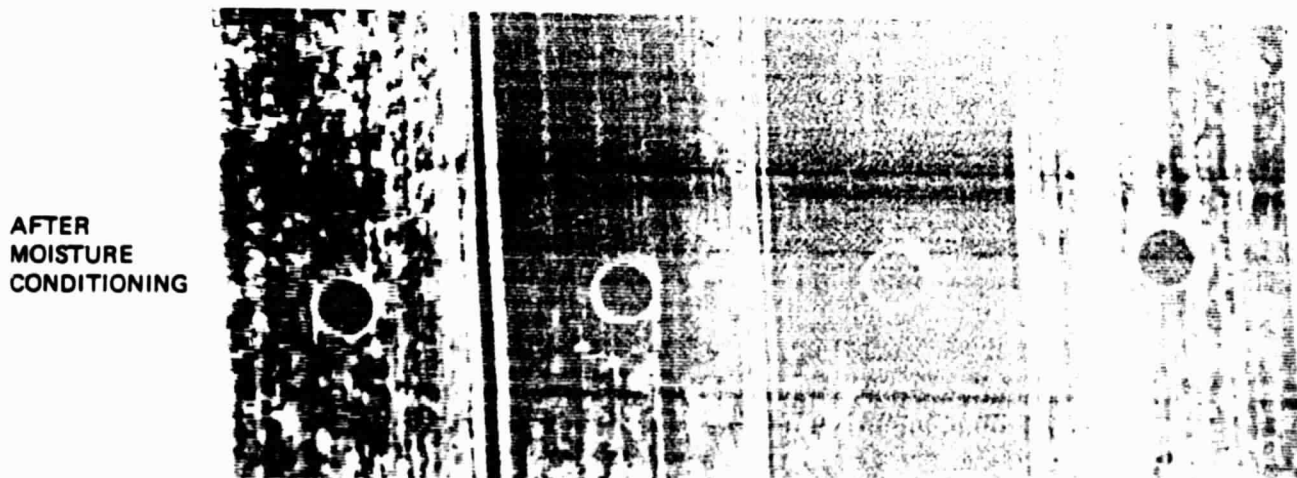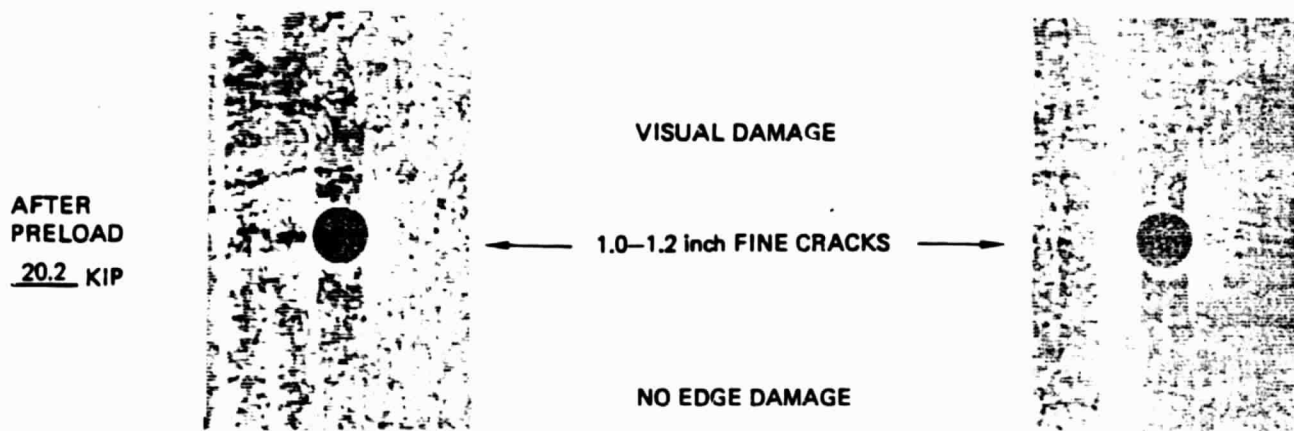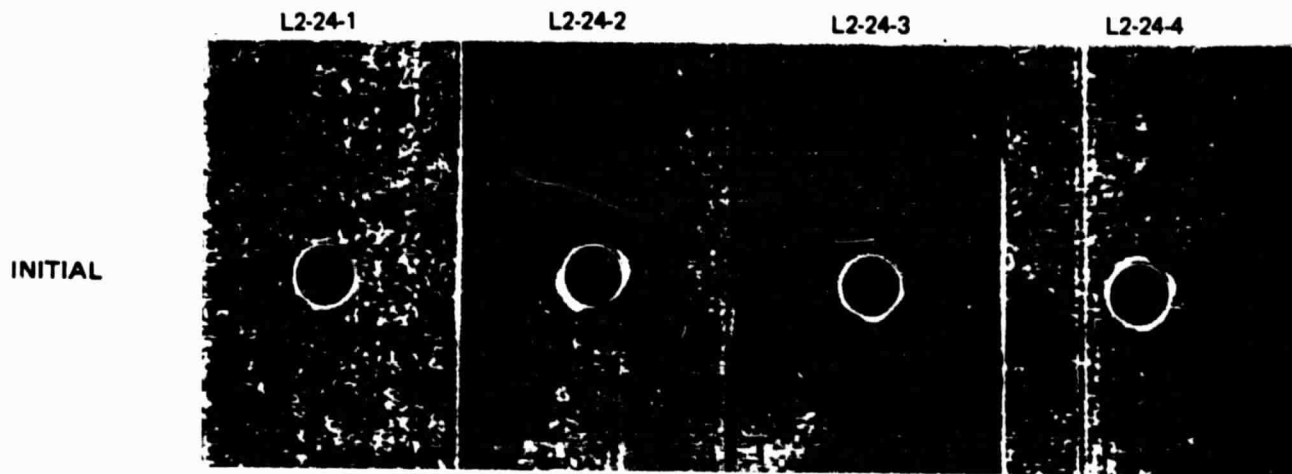

ORIGINAL PAGE IS  
OF POOR QUALITY

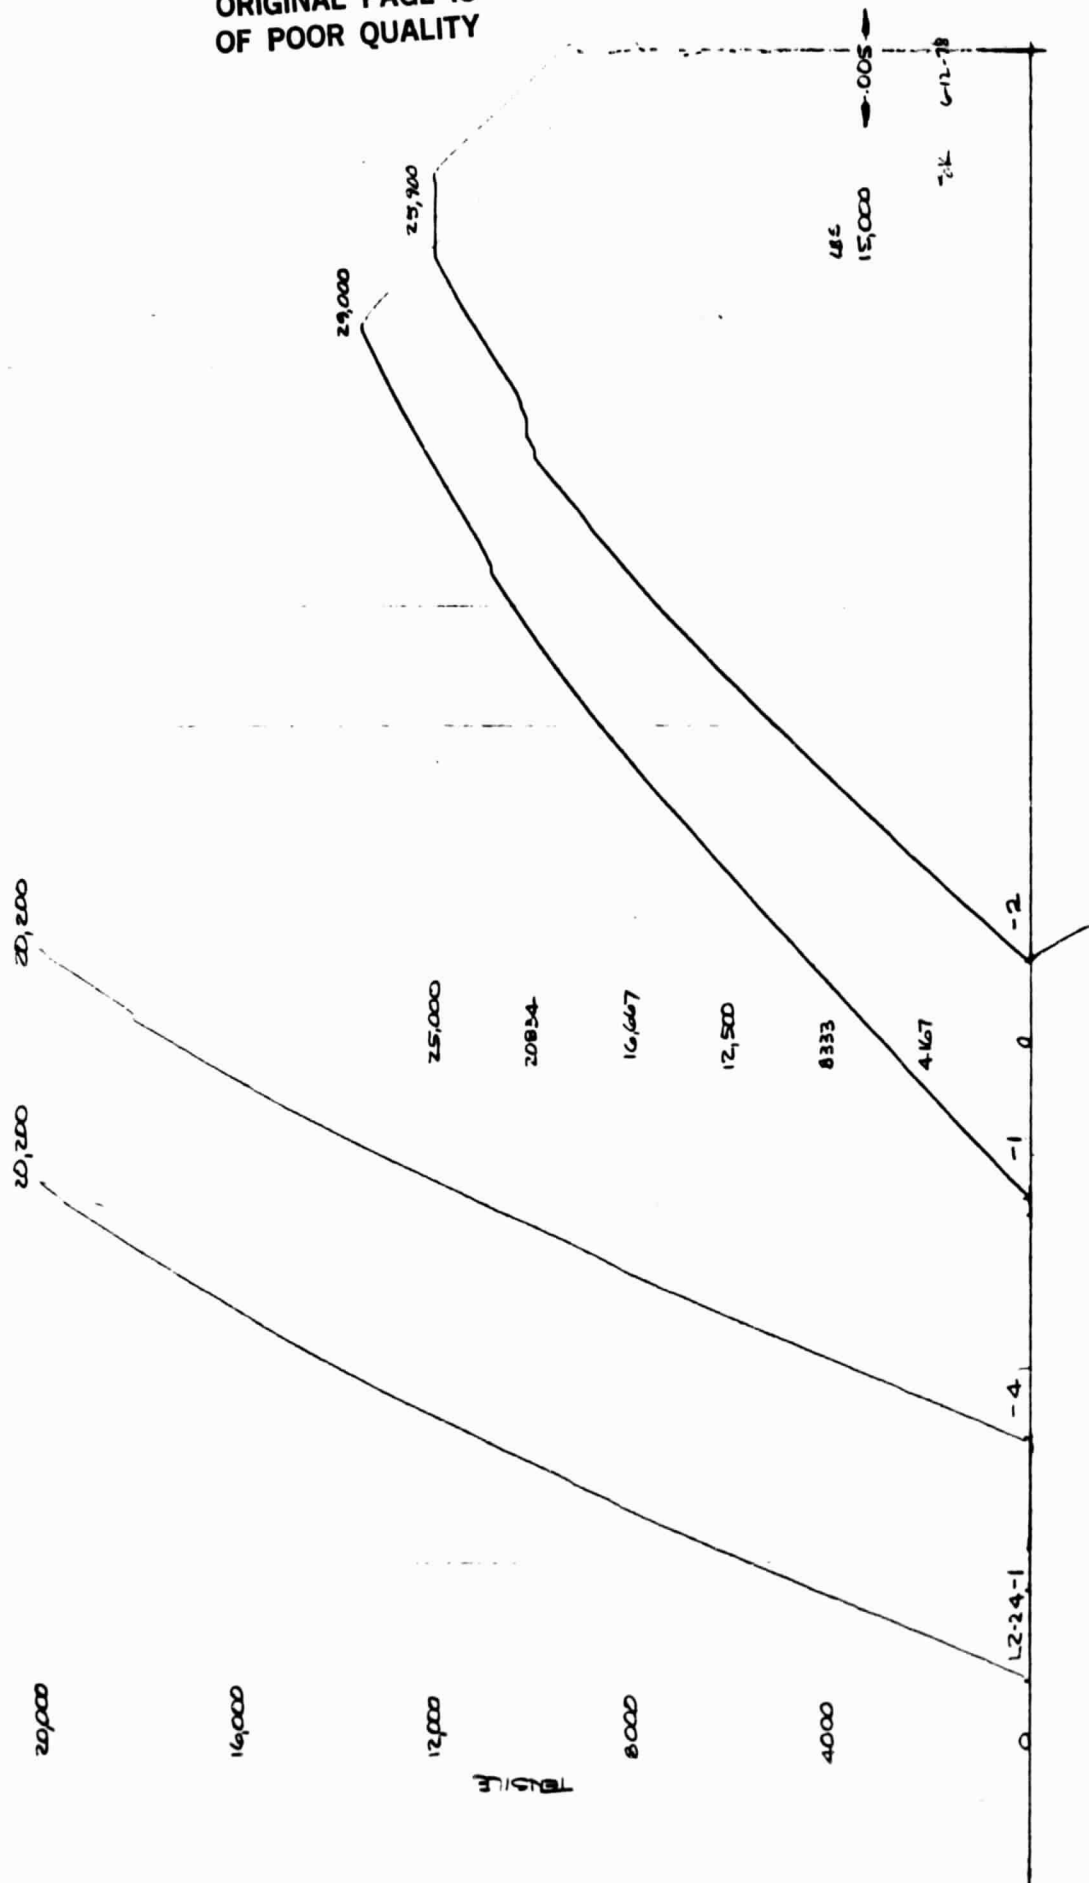

ORIGINAL PAGE IS  
OF POOR QUALITY

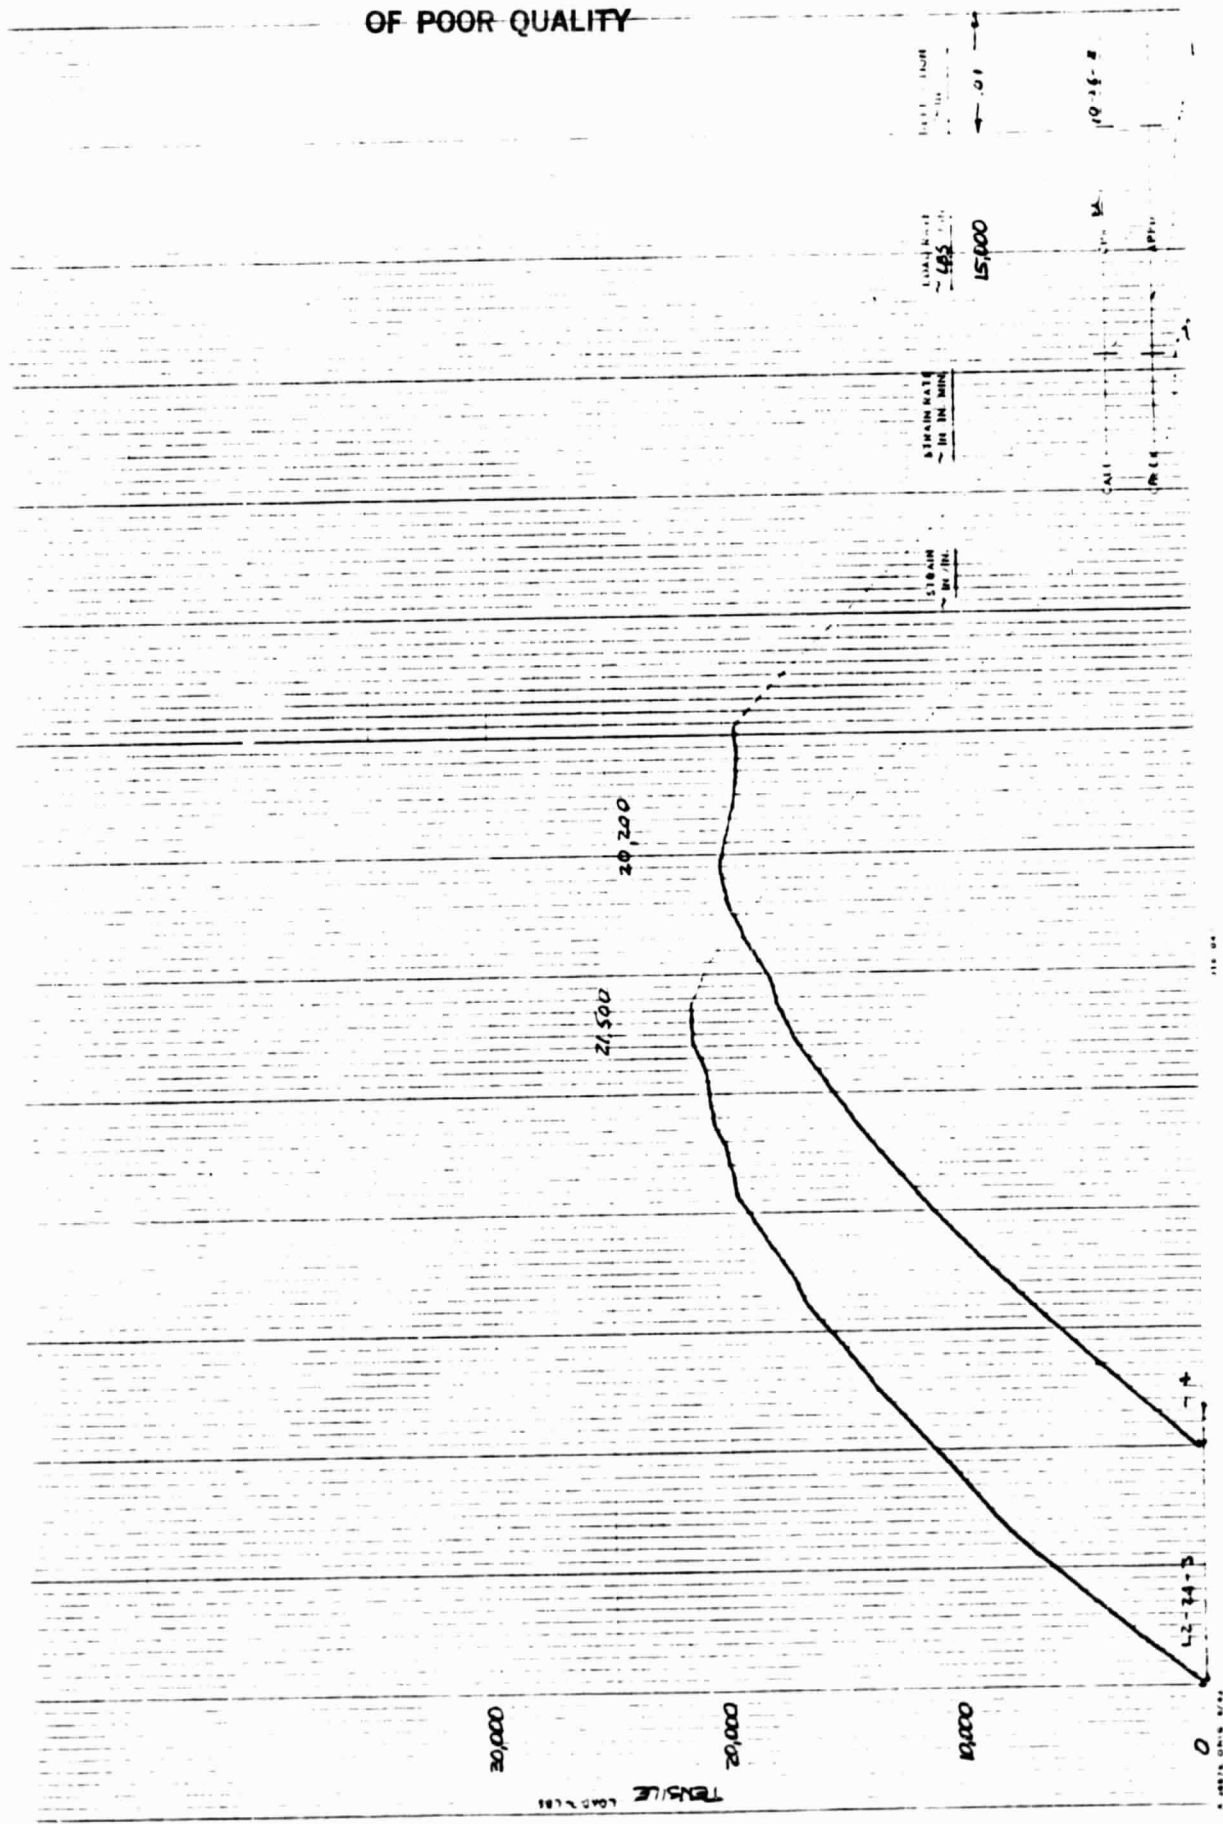

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
NO DEFECT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

INITIAL

L3-21-61

L3-21-62

L3-21-63


L3-21-64




AFTER  
PRELOAD  
38.3 KIP

VISUAL DAMAGE


NONE

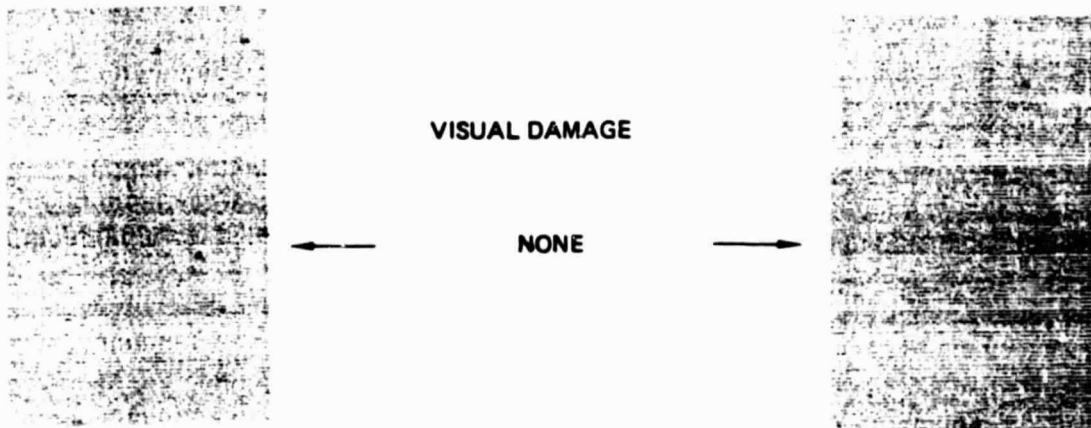

AFTER  
MOISTURE  
CONDITIONING

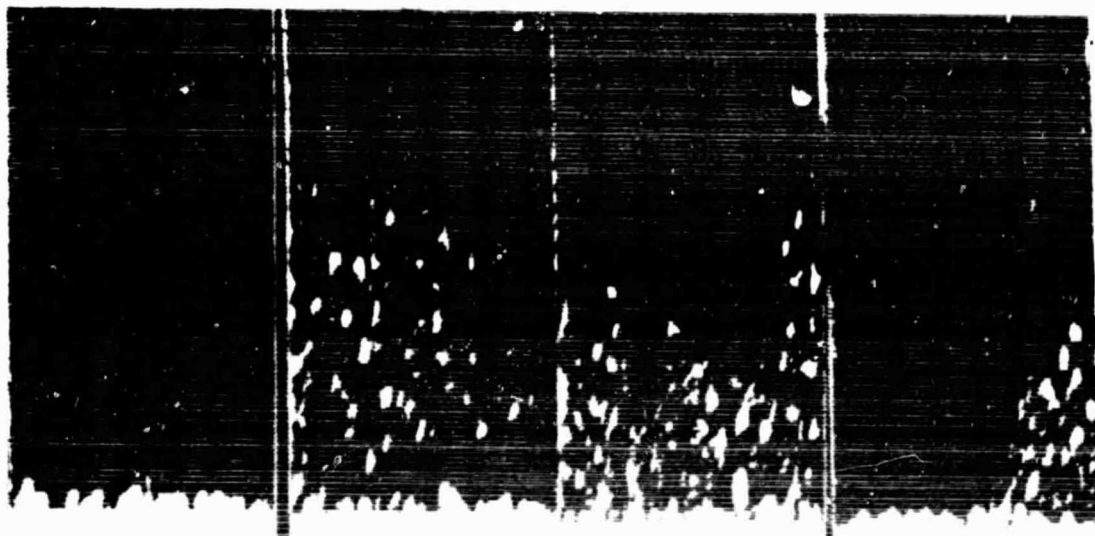

ORIGINAL PAGE IS  
OF POOR QUALITY

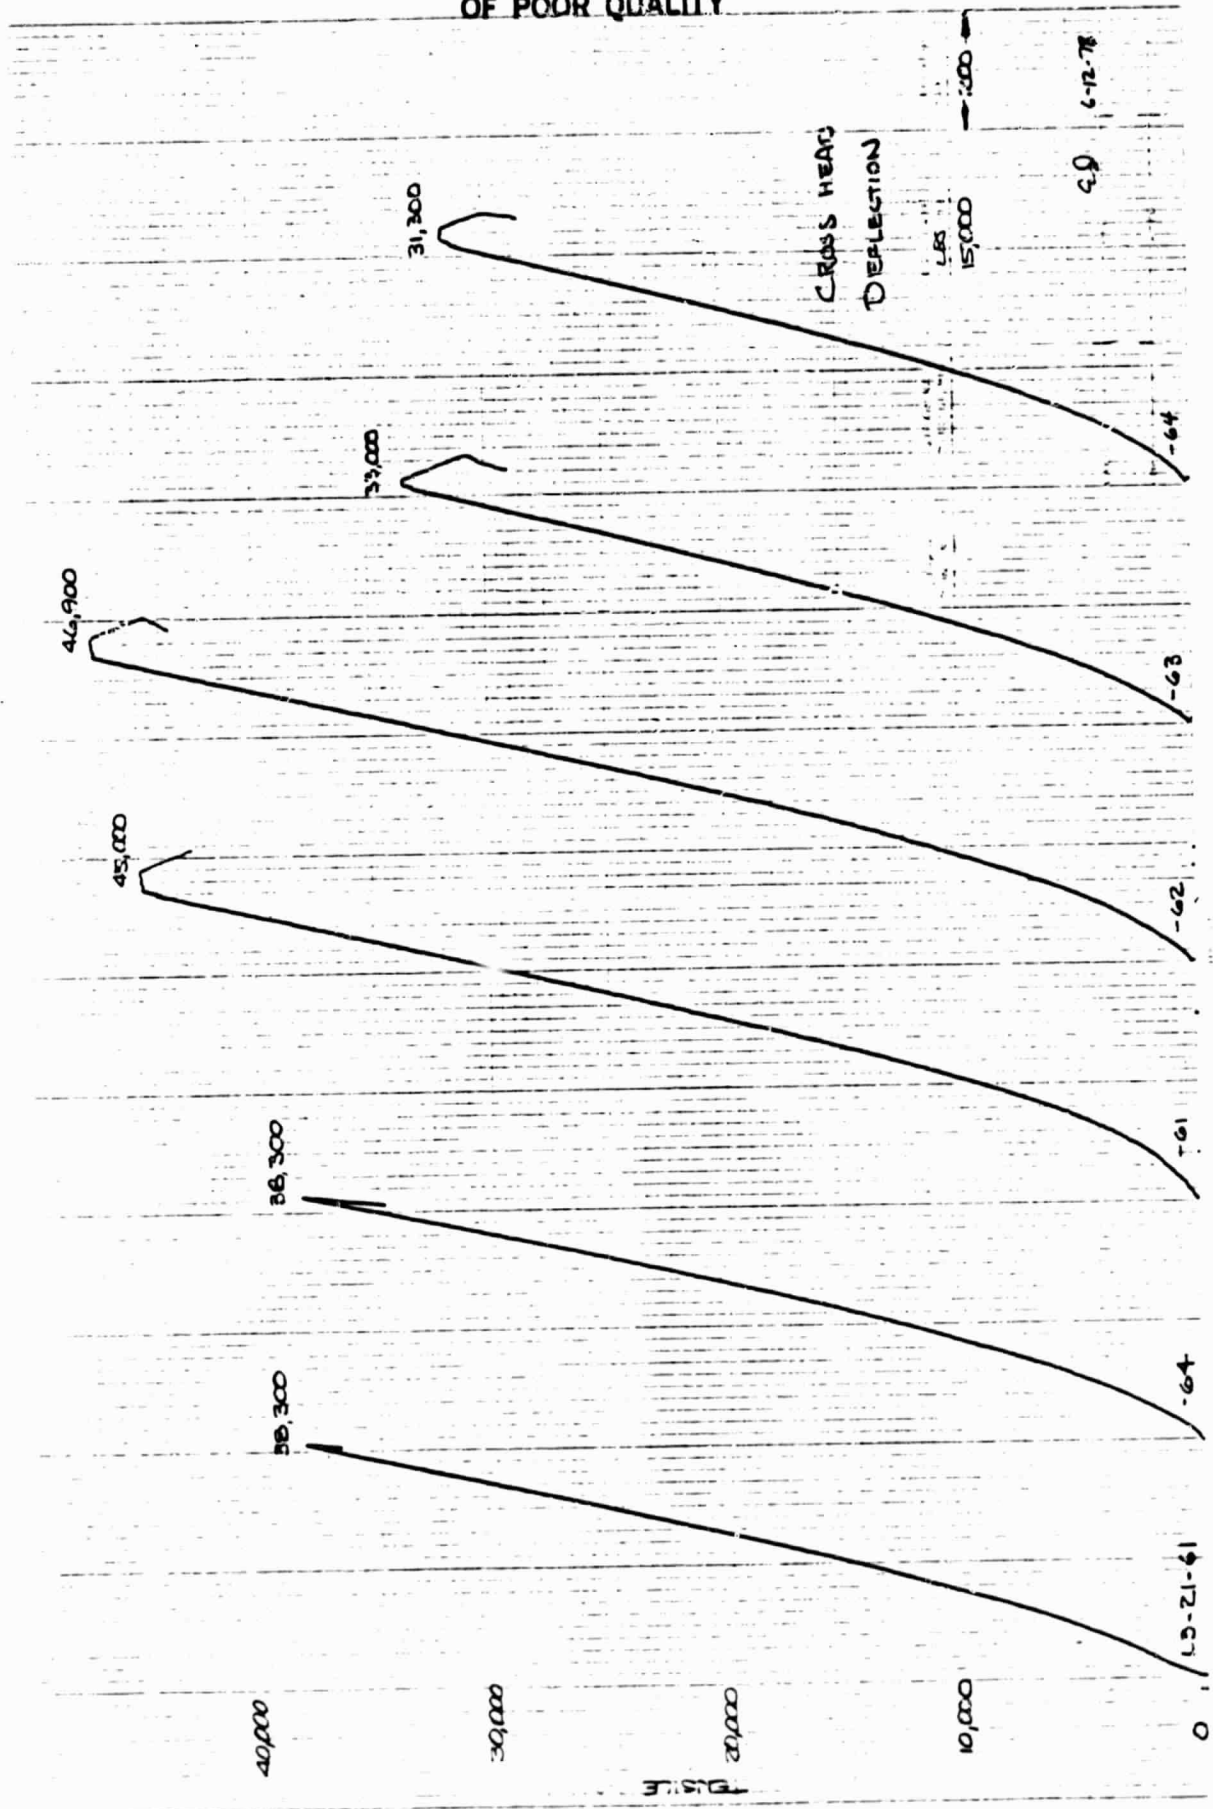

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
1/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L3-21-1

L3-21-2

L3-21-3

L3-21-4


INITIAL

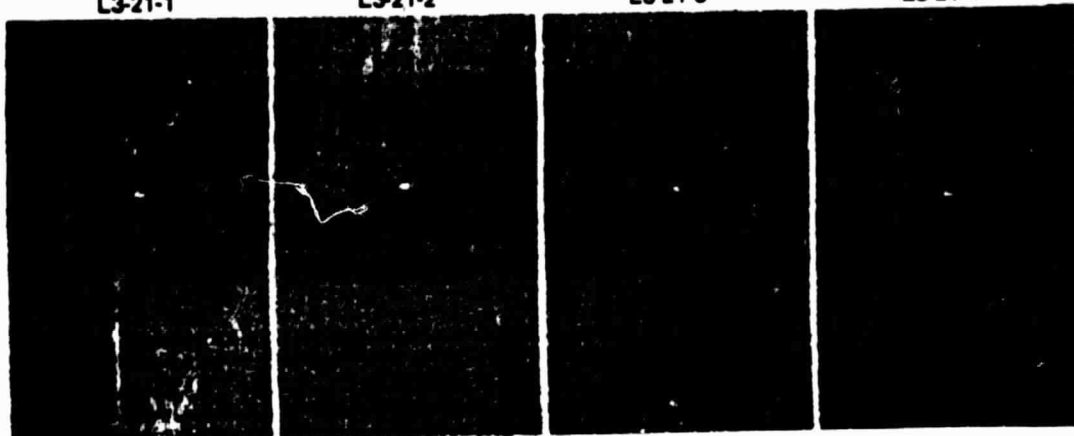

AFTER  
PRELOAD  
23.6 KIP

VISUAL DAMAGE


NONE

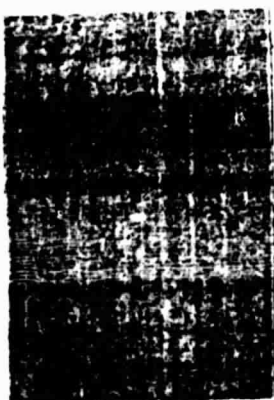

AFTER  
MOISTURE  
CONDITIONING



ORIGINAL PAGE IS  
OF POOR QUALITY

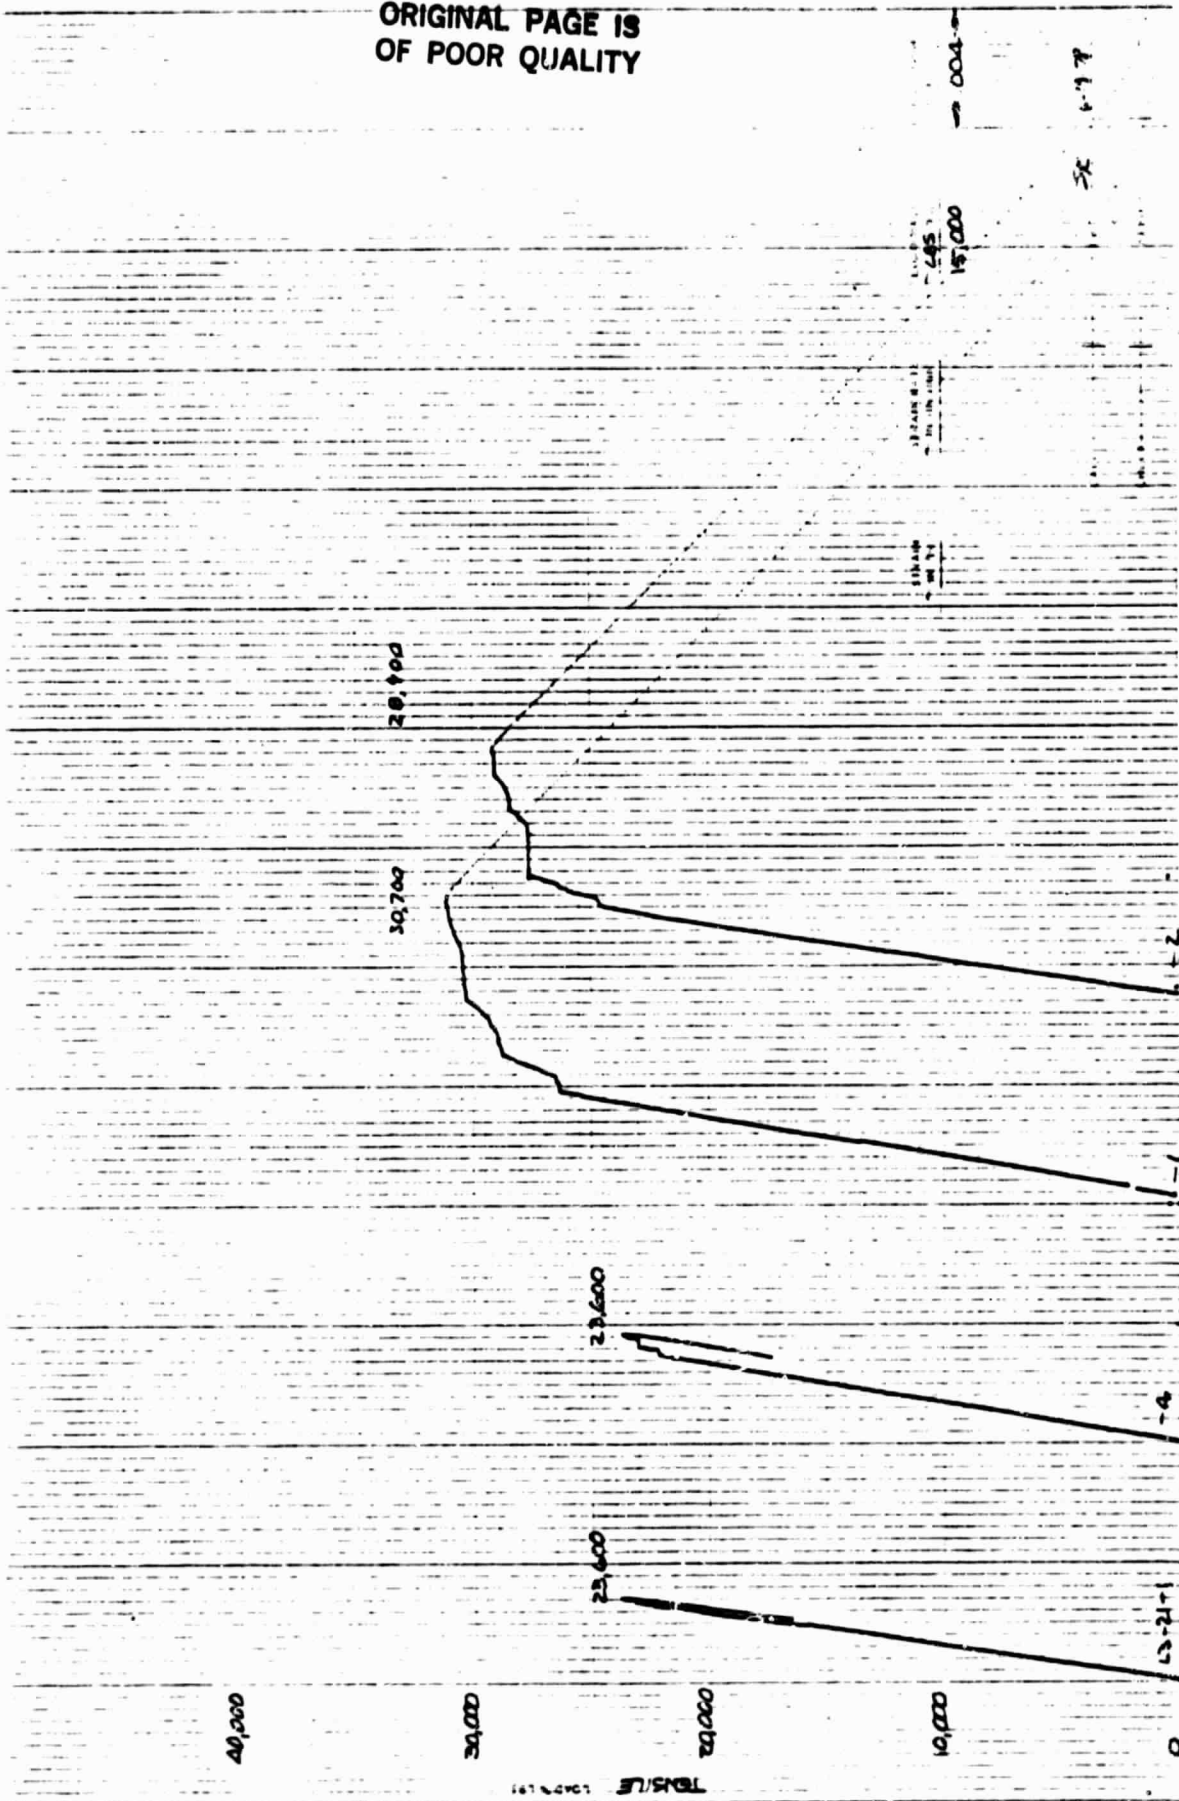

15,000

20,000

23,600

20,000

30,700

20,000

23,600

23,600

23,600


23,600

23,600

23,600



ORIGINAL PAGE IS  
OF POOR QUALITY

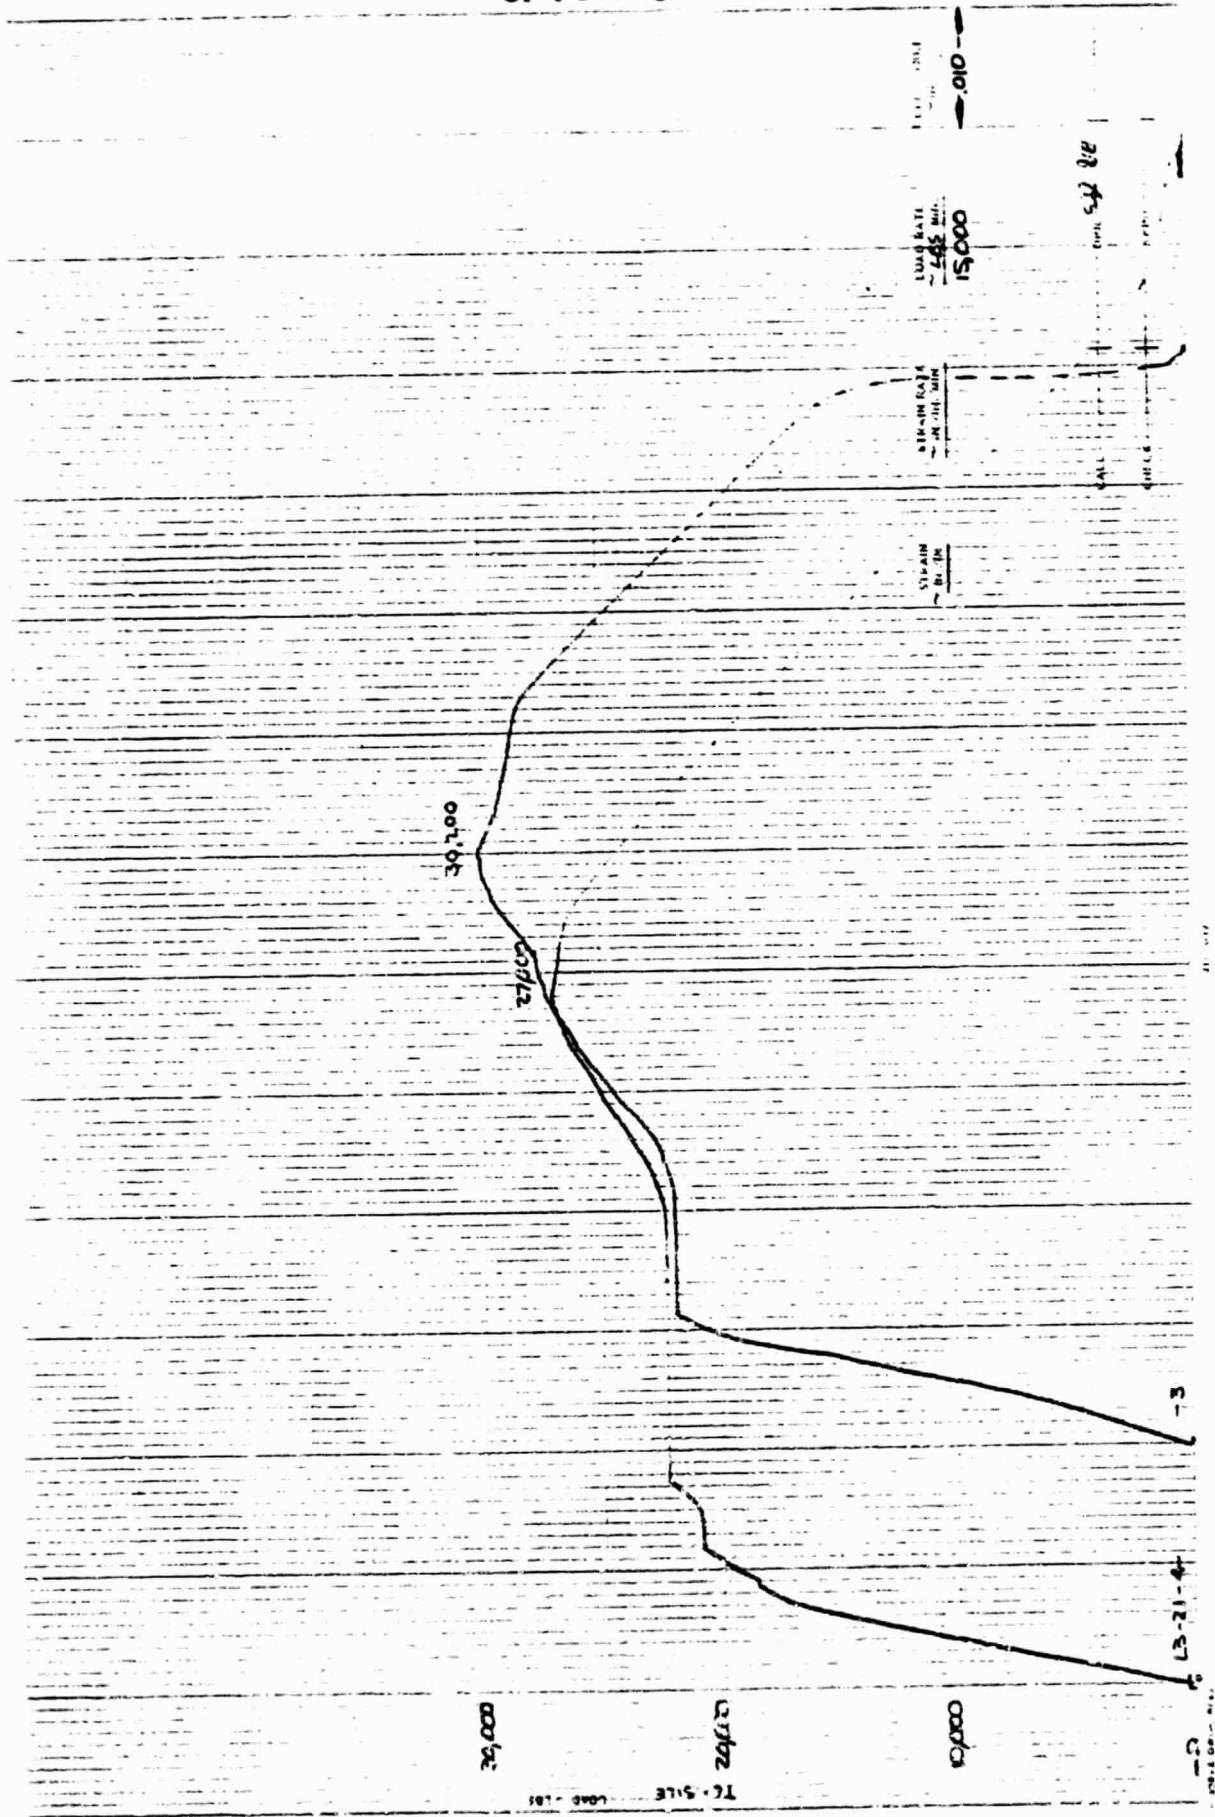

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
3/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

L3-21-5

L3-21-6

L3-21-7

L3-21-8

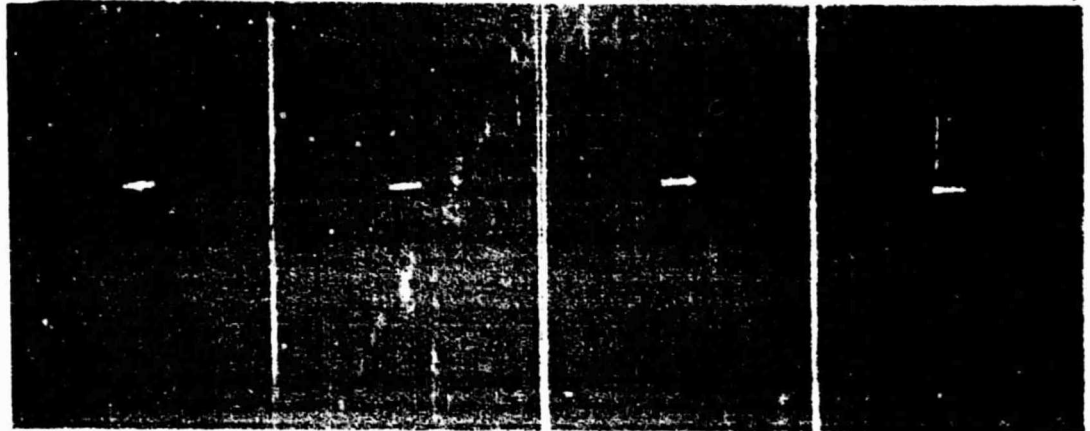


AFTER  
PRELOAD  
18.3 KIP

VISUAL DAMAGE

NONE




AFTER  
MOISTURE  
CONDITIONING

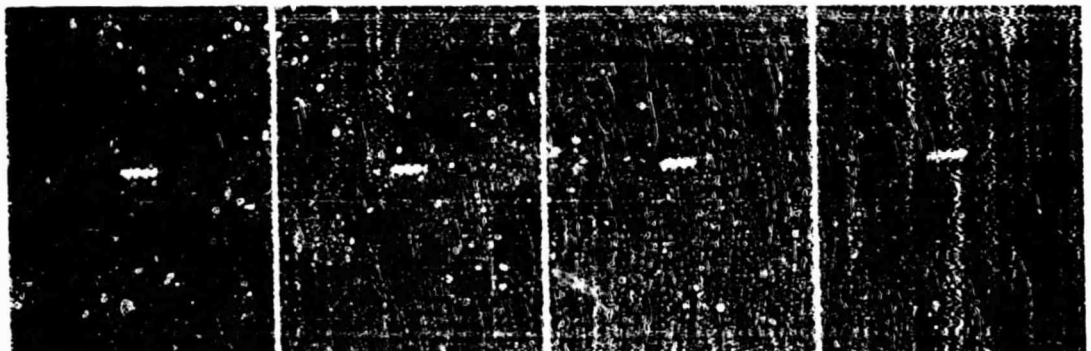

LAG 15,000 15,004 15,008 15,012 15,016 15,020 15,024 15,028 15,032 15,036 15,040 15,044 15,048 15,052 15,056 15,060 15,064 15,068 15,072 15,076 15,080 15,084 15,088 15,092 15,096 15,100 15,104 15,108 15,112 15,116 15,120 15,124 15,128 15,132 15,136 15,140 15,144 15,148 15,152 15,156 15,160 15,164 15,168 15,172 15,176 15,180 15,184 15,188 15,192 15,196 15,200 15,204 15,208 15,212 15,216 15,220 15,224 15,228 15,232 15,236 15,240 15,244 15,248 15,252 15,256 15,260 15,264 15,268 15,272 15,276 15,280 15,284 15,288 15,292 15,296 15,300 15,304 15,308 15,312 15,316 15,320 15,324 15,328 15,332 15,336 15,340 15,344 15,348 15,352 15,356 15,360 15,364 15,368 15,372 15,376 15,380 15,384 15,388 15,392 15,396 15,400 15,404 15,408 15,412 15,416 15,420 15,424 15,428 15,432 15,436 15,440 15,444 15,448 15,452 15,456 15,460 15,464 15,468 15,472 15,476 15,480 15,484 15,488 15,492 15,496 15,500 15,504 15,508 15,512 15,516 15,520 15,524 15,528 15,532 15,536 15,540 15,544 15,548 15,552 15,556 15,560 15,564 15,568 15,572 15,576 15,580 15,584 15,588 15,592 15,596 15,600 15,604 15,608 15,612 15,616 15,620 15,624 15,628 15,632 15,636 15,640 15,644 15,648 15,652 15,656 15,660 15,664 15,668 15,672 15,676 15,680 15,684 15,688 15,692 15,696 15,700 15,704 15,708 15,712 15,716 15,720 15,724 15,728 15,732 15,736 15,740 15,744 15,748 15,752 15,756 15,760 15,764 15,768 15,772 15,776 15,780 15,784 15,788 15,792 15,796 15,800 15,804 15,808 15,812 15,816 15,820 15,824 15,828 15,832 15,836 15,840 15,844 15,848 15,852 15,856 15,860 15,864 15,868 15,872 15,876 15,880 15,884 15,888 15,892 15,896 15,900 15,904 15,908 15,912 15,916 15,920 15,924 15,928 15,932 15,936 15,940 15,944 15,948 15,952 15,956 15,960 15,964 15,968 15,972 15,976 15,980 15,984 15,988 15,992 15,996 16,000 16,004 16,008 16,012 16,016 16,020 16,024 16,028 16,032 16,036 16,040 16,044 16,048 16,052 16,056 16,060 16,064 16,068 16,072 16,076 16,080 16,084 16,088 16,092 16,096 16,100 16,104 16,108 16,112 16,116 16,120 16,124 16,128 16,132 16,136 16,140 16,144 16,148 16,152 16,156 16,160 16,164 16,168 16,172 16,176 16,180 16,184 16,188 16,192 16,196 16,200 16,204 16,208 16,212 16,216 16,220 16,224 16,228 16,232 16,236 16,240 16,244 16,248 16,252 16,256 16,260 16,264 16,268 16,272 16,276 16,280 16,284 16,288 16,292 16,296 16,300 16,304 16,308 16,312 16,316 16,320 16,324 16,328 16,332 16,336 16,340 16,344 16,348 16,352 16,356 16,360 16,364 16,368 16,372 16,376 16,380 16,384 16,388 16,392 16,396 16,400 16,404 16,408 16,412 16,416 16,420 16,424 16,428 16,432 16,436 16,440 16,444 16,448 16,452 16,456 16,460 16,464 16,468 16,472 16,476 16,480 16,484 16,488 16,492 16,496 16,500 16,504 16,508 16,512 16,516 16,520 16,524 16,528 16,532 16,536 16,540 16,544 16,548 16,552 16,556 16,560 16,564 16,568 16,572 16,576 16,580 16,584 16,588 16,592 16,596 16,600 16,604 16,608 16,612 16,616 16,620 16,624 16,628 16,632 16,636 16,640 16,644 16,648 16,652 16,656 16,660 16,664 16,668 16,672 16,676 16,680 16,684 16,688 16,692 16,696 16,700 16,704 16,708 16,712 16,716 16,720 16,724 16,728 16,732 16,736 16,740 16,744 16,748 16,752 16,756 16,760 16,764 16,768 16,772 16,776 16,780 16,784 16,788 16,792 16,796 16,800 16,804 16,808 16,812 16,816 16,820 16,824 16,828 16,832 16,836 16,840 16,844 16,848 16,852 16,856 16,860 16,864 16,868 16,872 16,876 16,880 16,884 16,888 16,892 16,896 16,900 16,904 16,908 16,912 16,916 16,920 16,924 16,928 16,932 16,936 16,940 16,944 16,948 16,952 16,956 16,960 16,964 16,968 16,972 16,976 16,980 16,984 16,988 16,992 16,996 17,000 17,004 17,008 17,012 17,016 17,020 17,024 17,028 17,032 17,036 17,040 17,044 17,048 17,052 17,056 17,060 17,064 17,068 17,072 17,076 17,080 17,084 17,088 17,092 17,096 17,100 17,104 17,108 17,112 17,116 17,120 17,124 17,128 17,132 17,136 17,140 17,144 17,148 17,152 17,156 17,160 17,164 17,168 17,172 17,176 17,180 17,184 17,188 17,192 17,196 17,200 17,204 17,208 17,212 17,216 17,220 17,224 17,228 17,232 17,236 17,240 17,244 17,248 17,252 17,256 17,260 17,264 17,268 17,272 17,276 17,280 17,284 17,288 17,292 17,296 17,300 17,304 17,308 17,312 17,316 17,320 17,324 17,328 17,332 17,3



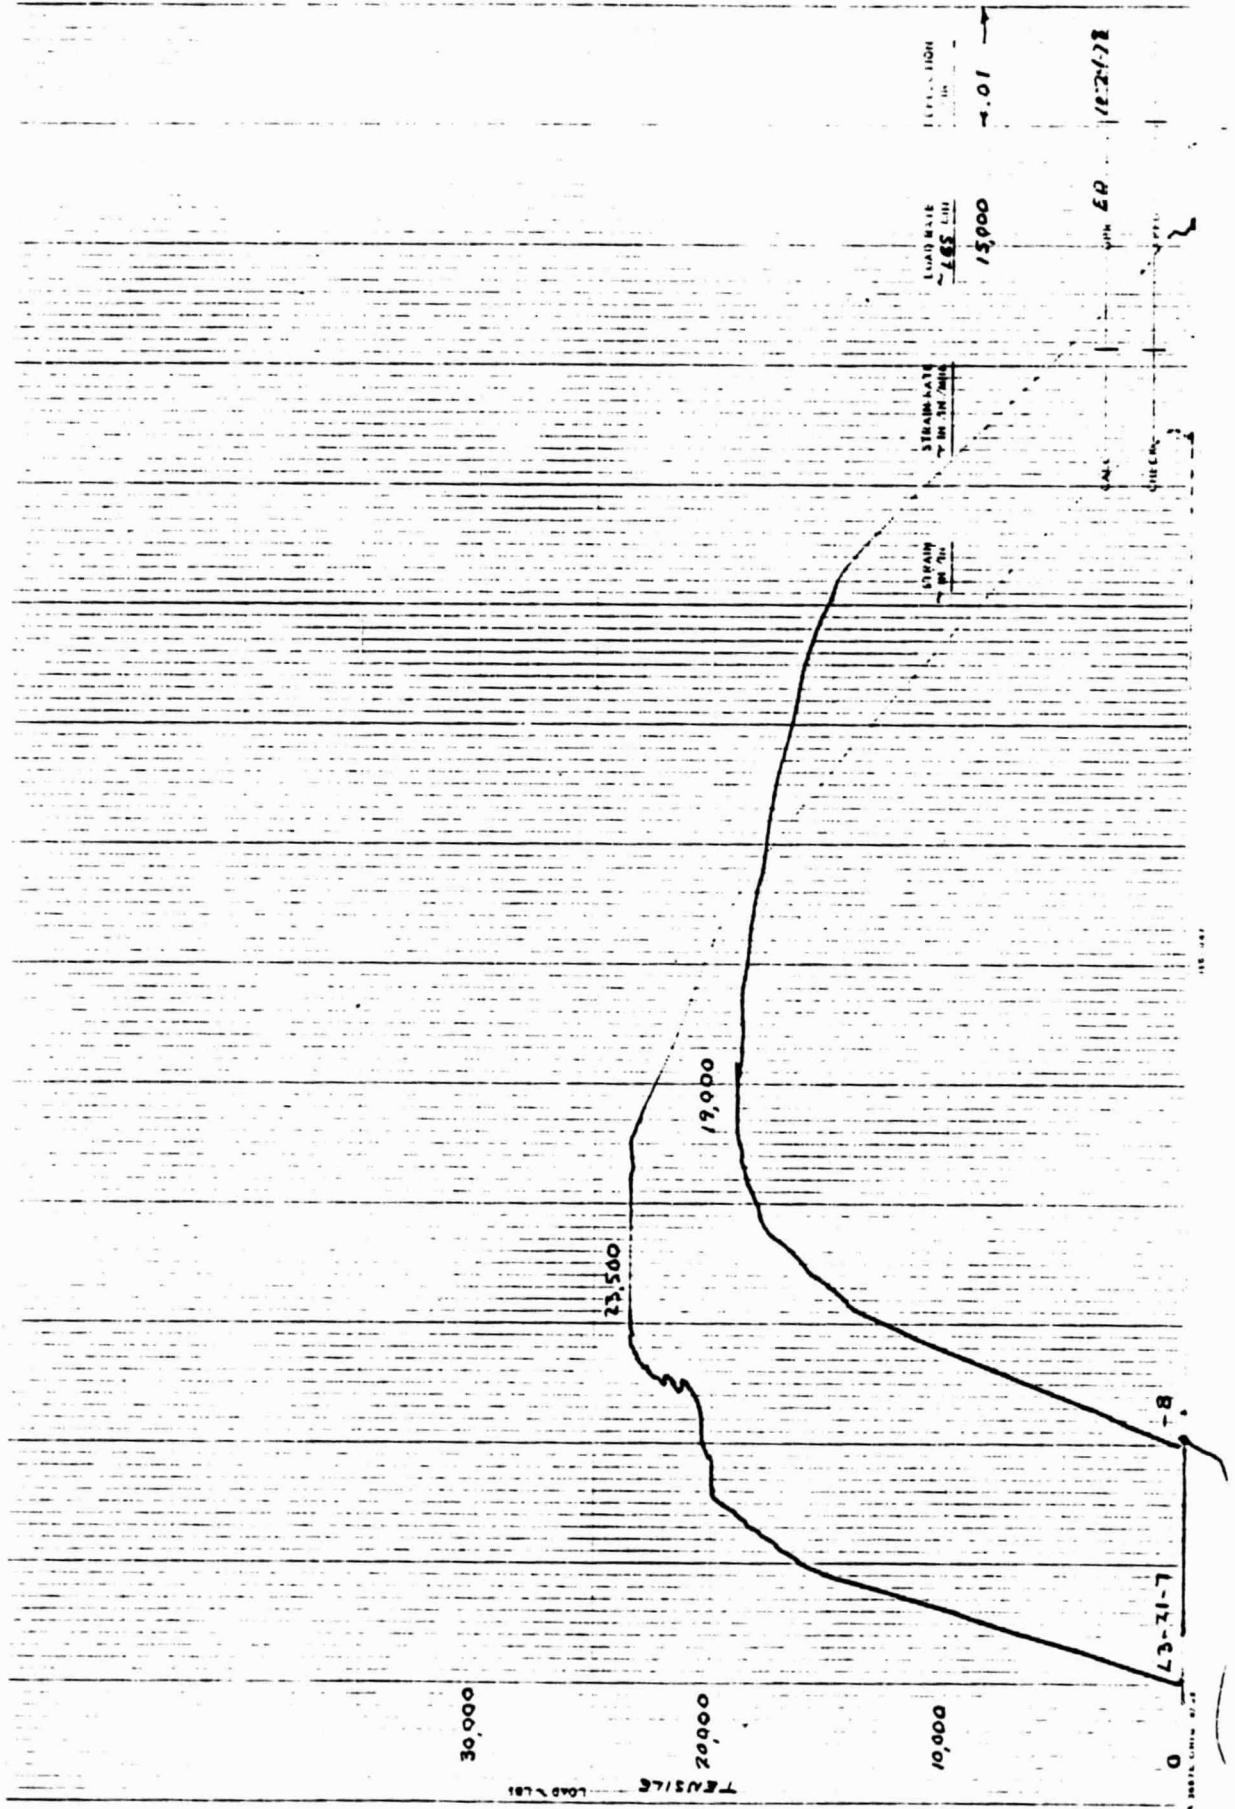

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
5/8 FP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L3-21-9

L3-21-10

L3-21-11

L3-21-12

INITIAL

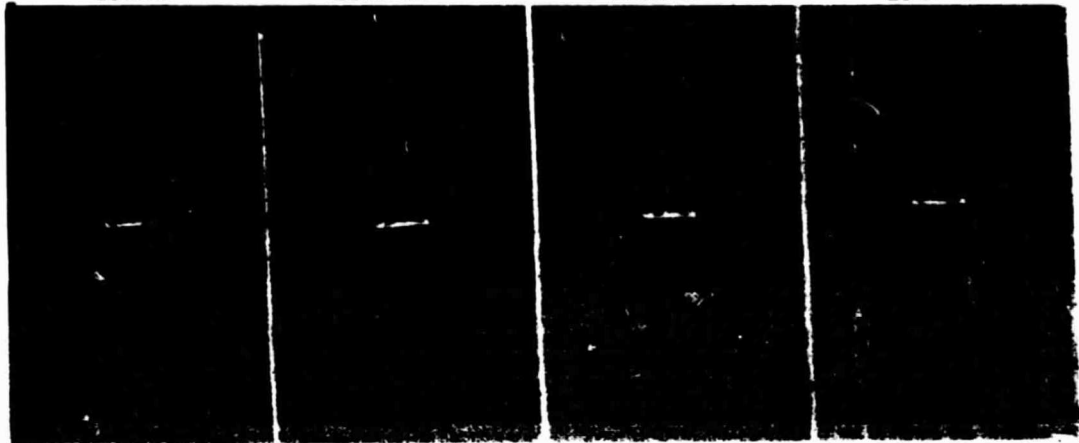

AFTER  
PRELOAD  
15.7 KIP




VISUAL DAMAGE


← 0.05 inch FINE CRACK

NONE →




AFTER  
MOISTURE  
CONDITIONING

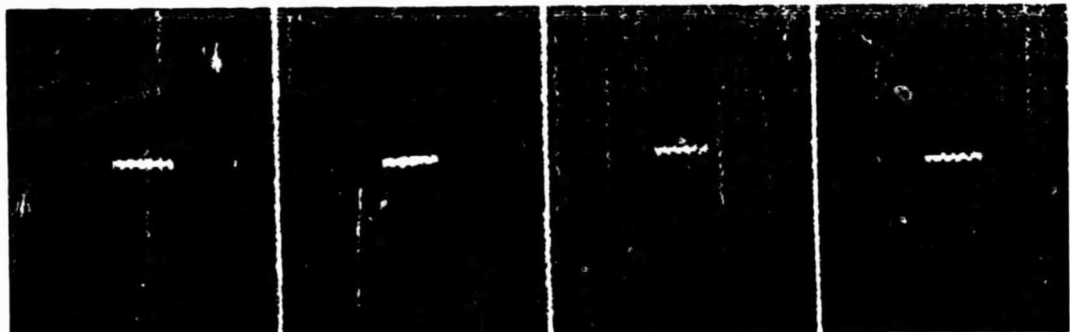

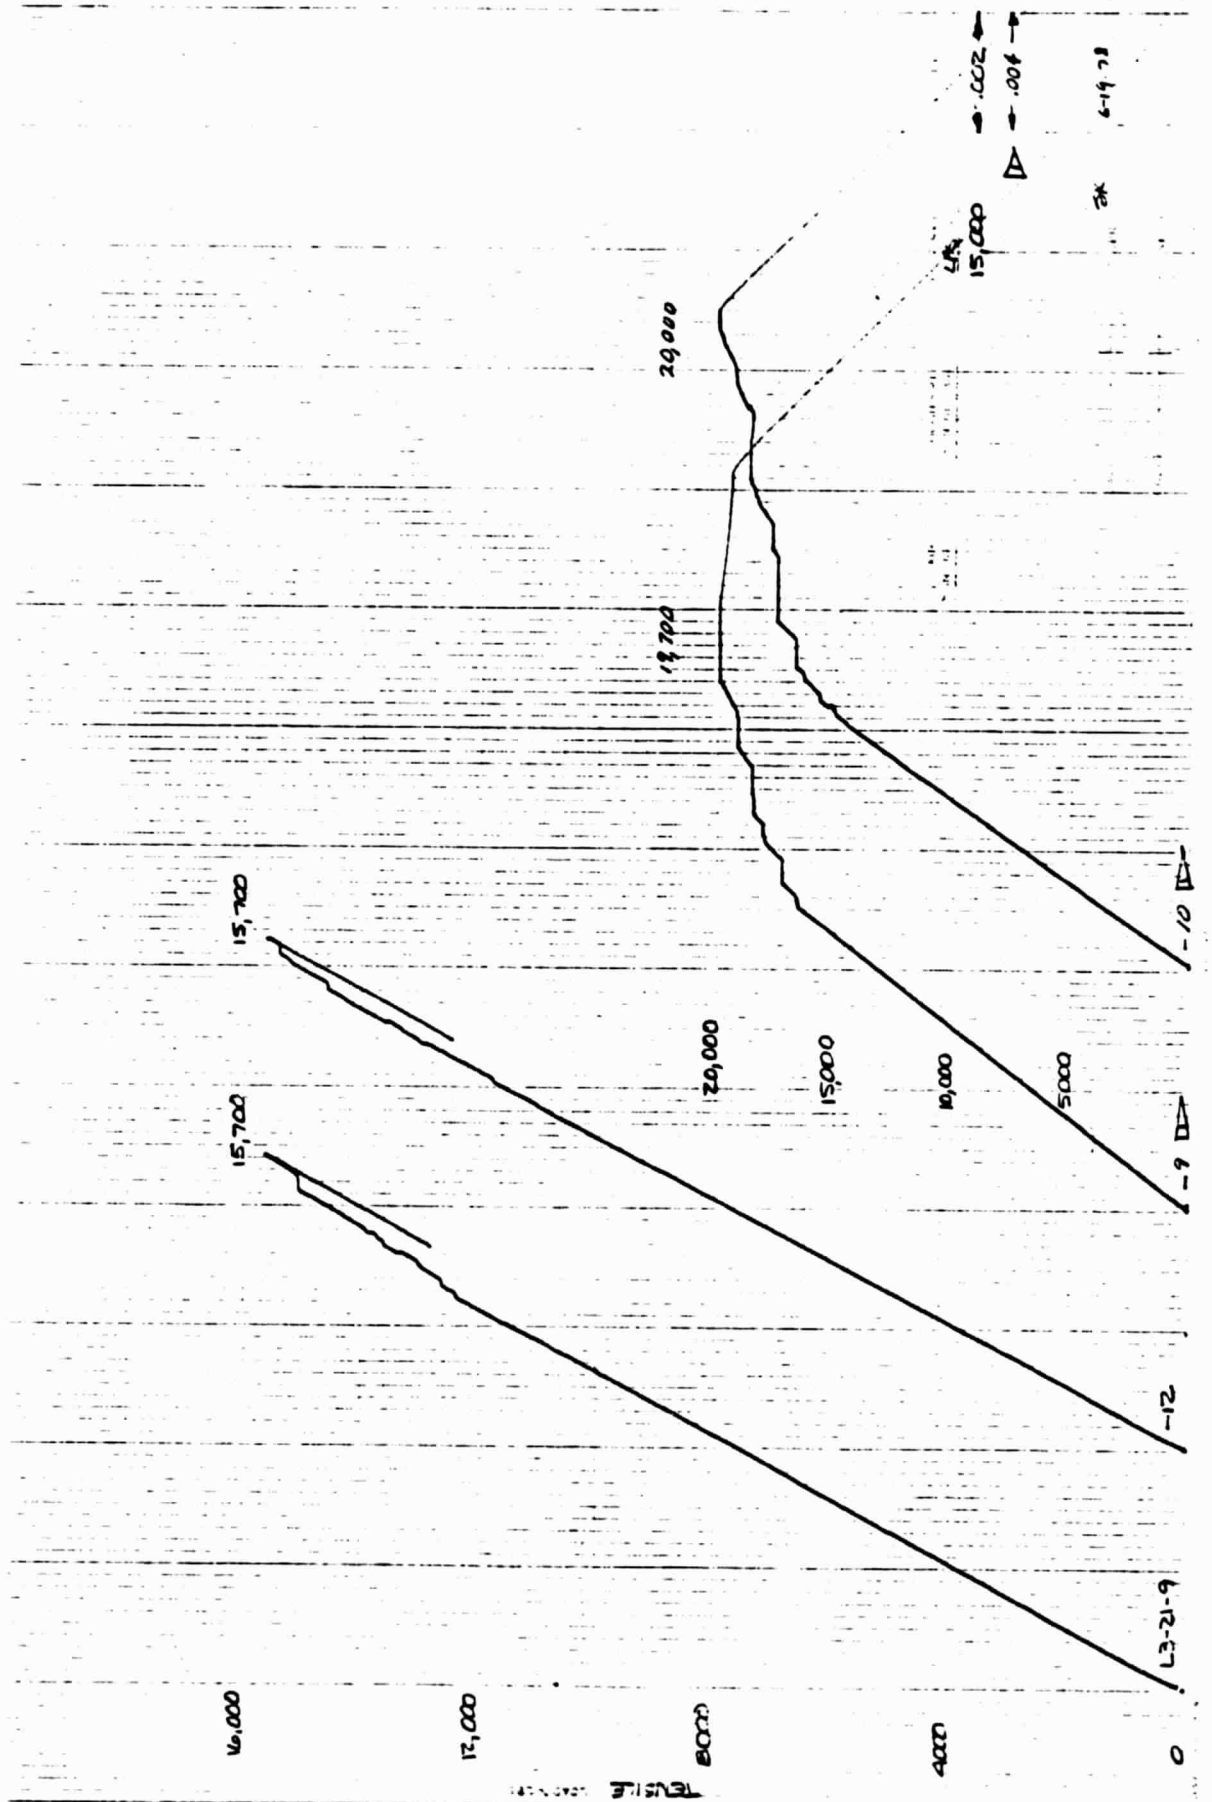

ORIGINAL PAGE IS  
OF POOR QUALITY

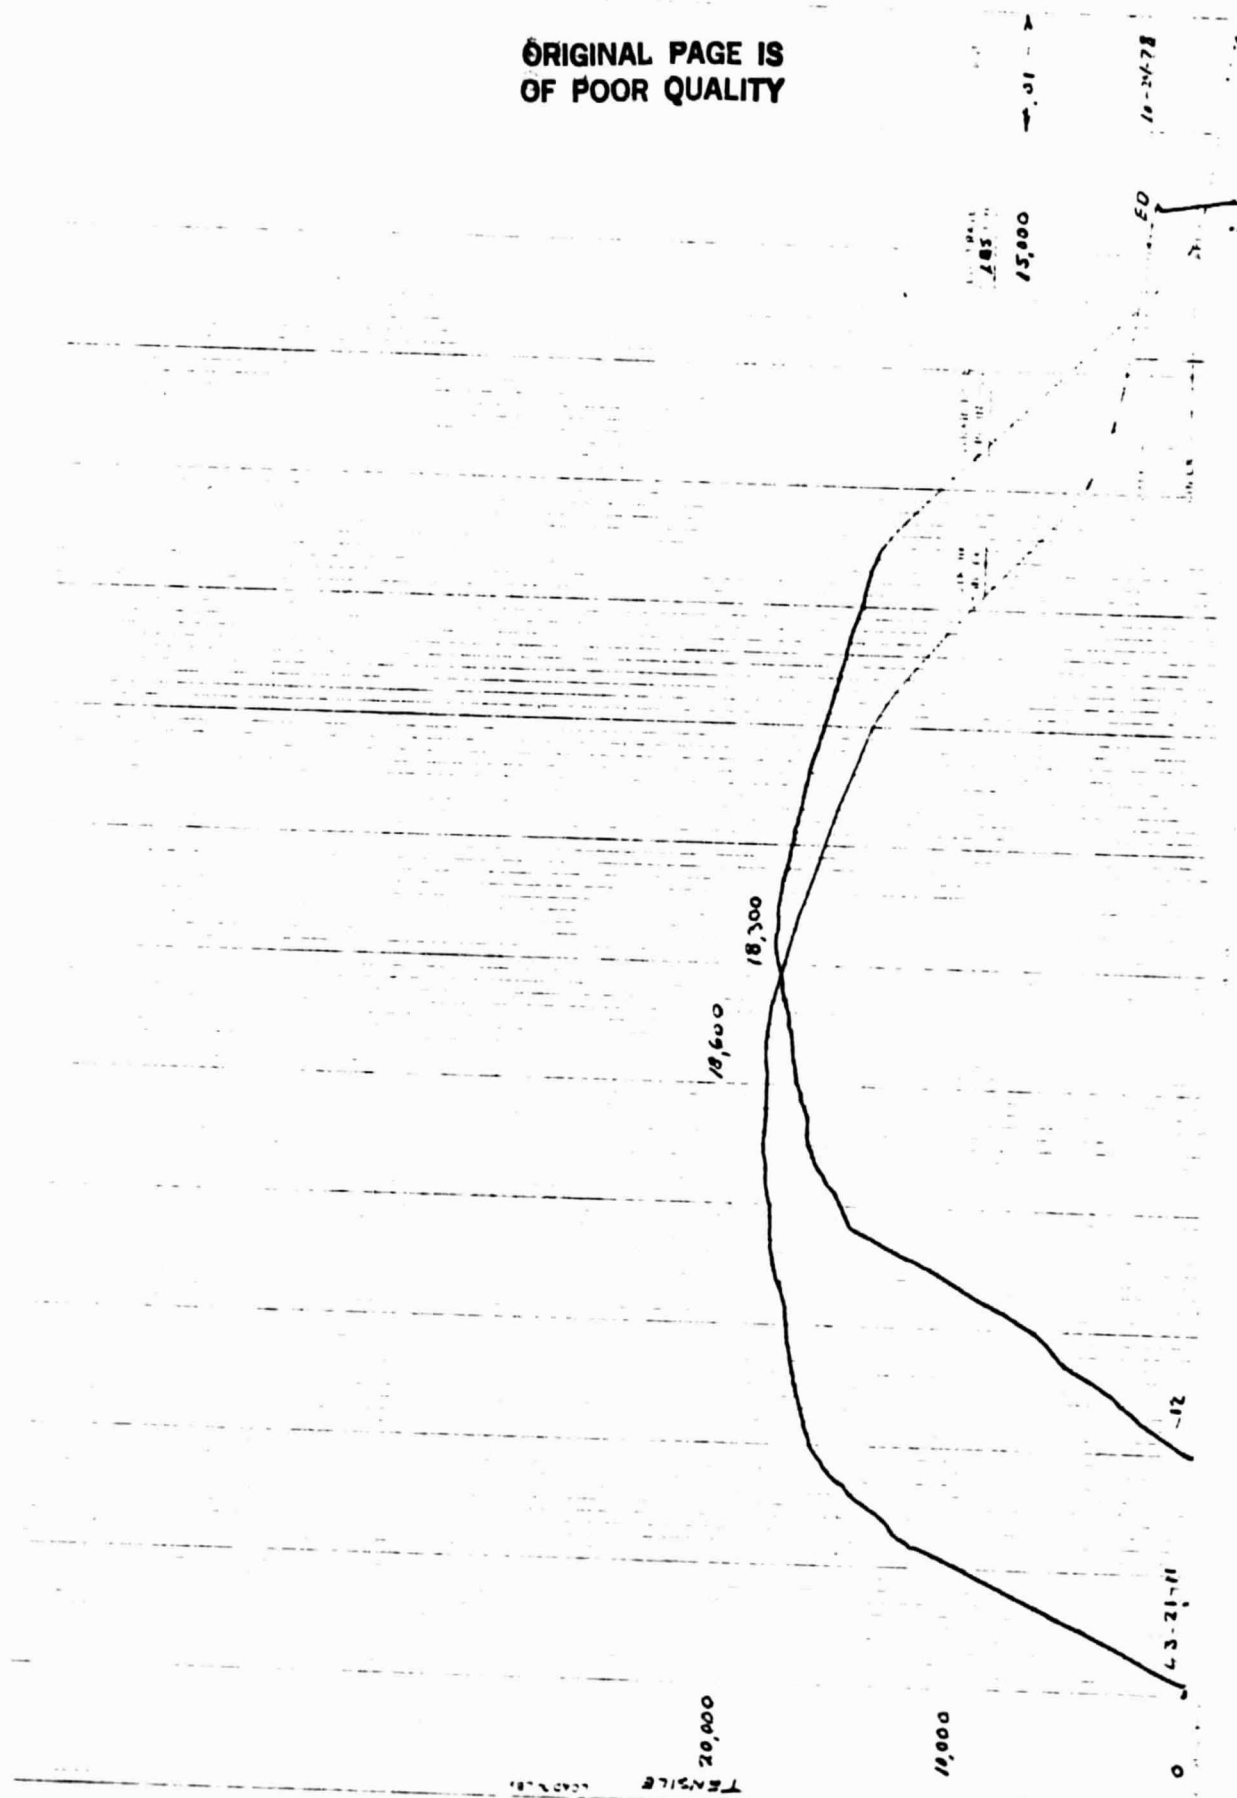

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
1/8 HP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

L3-21-21

L3-21-22

L3-21-23

L3-21-24

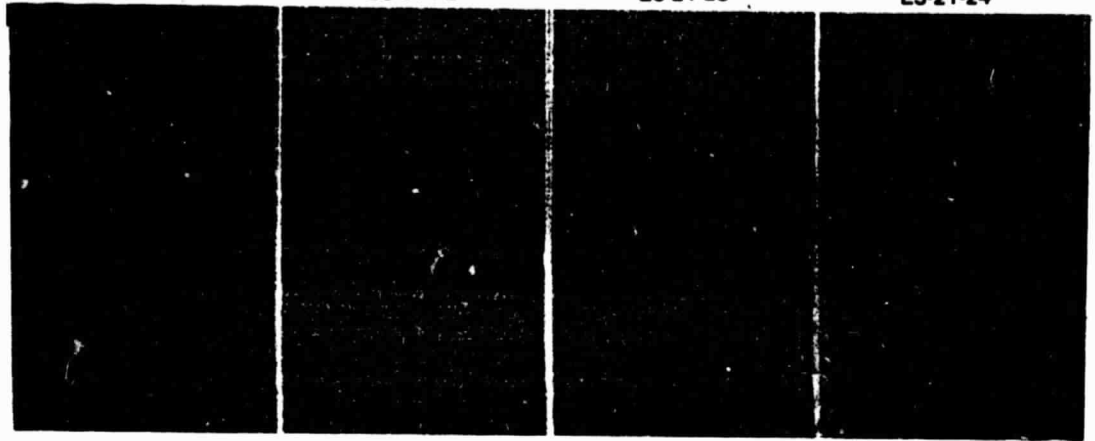


AFTER  
PRELOAD  
30.3 KIP

VISUAL DAMAGE

NONE



AFTER  
MOISTURE  
CONDITIONING

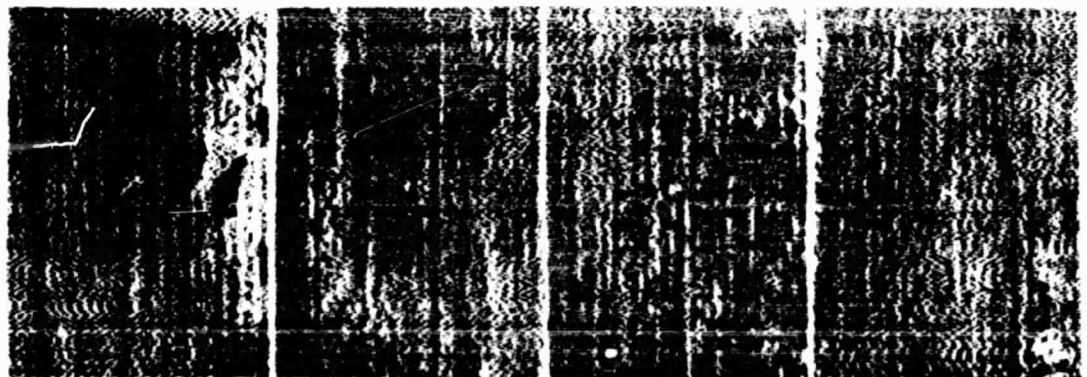




ORIGINAL PAGE IS  
OF POOR QUALITY



258

ORIGINAL PAGE IS  
OF POOR QUALITY

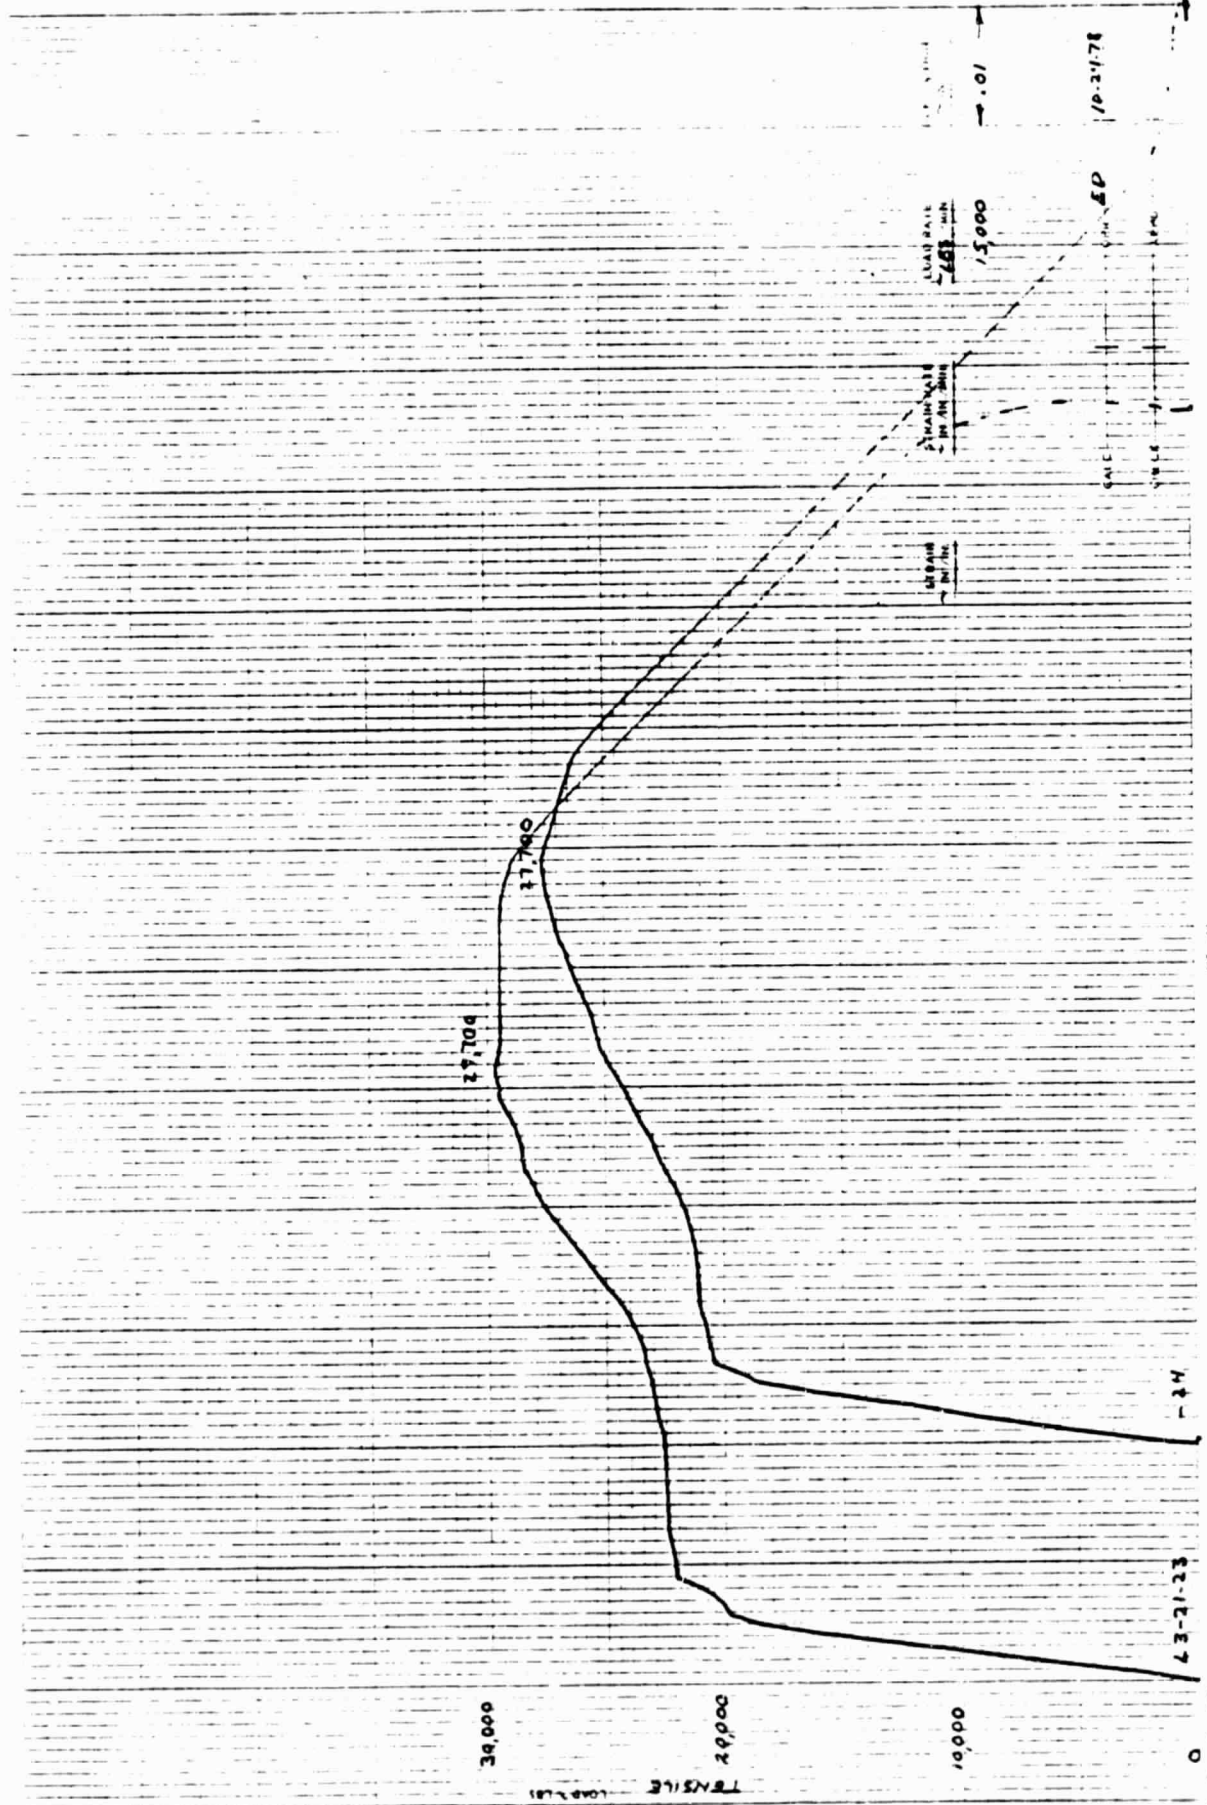

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
3/8 HP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

L3-21-25

L3-21-26

L3-21-27

L3-21-28


INITIAL



VISUAL DAMAGE

AFTER  
PRELOAD  
28.8 KIP

← 0.05—0.1 inch FINE CRACKS →

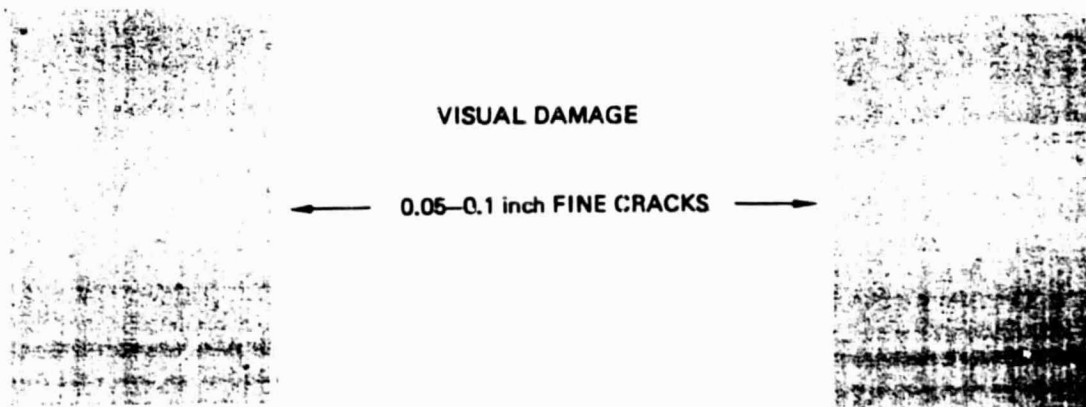


AFTER  
MOISTURE  
CONDITIONING



187-3407 7/15/77



ORIGINAL PAGE IS  
OF POOR QUALITY

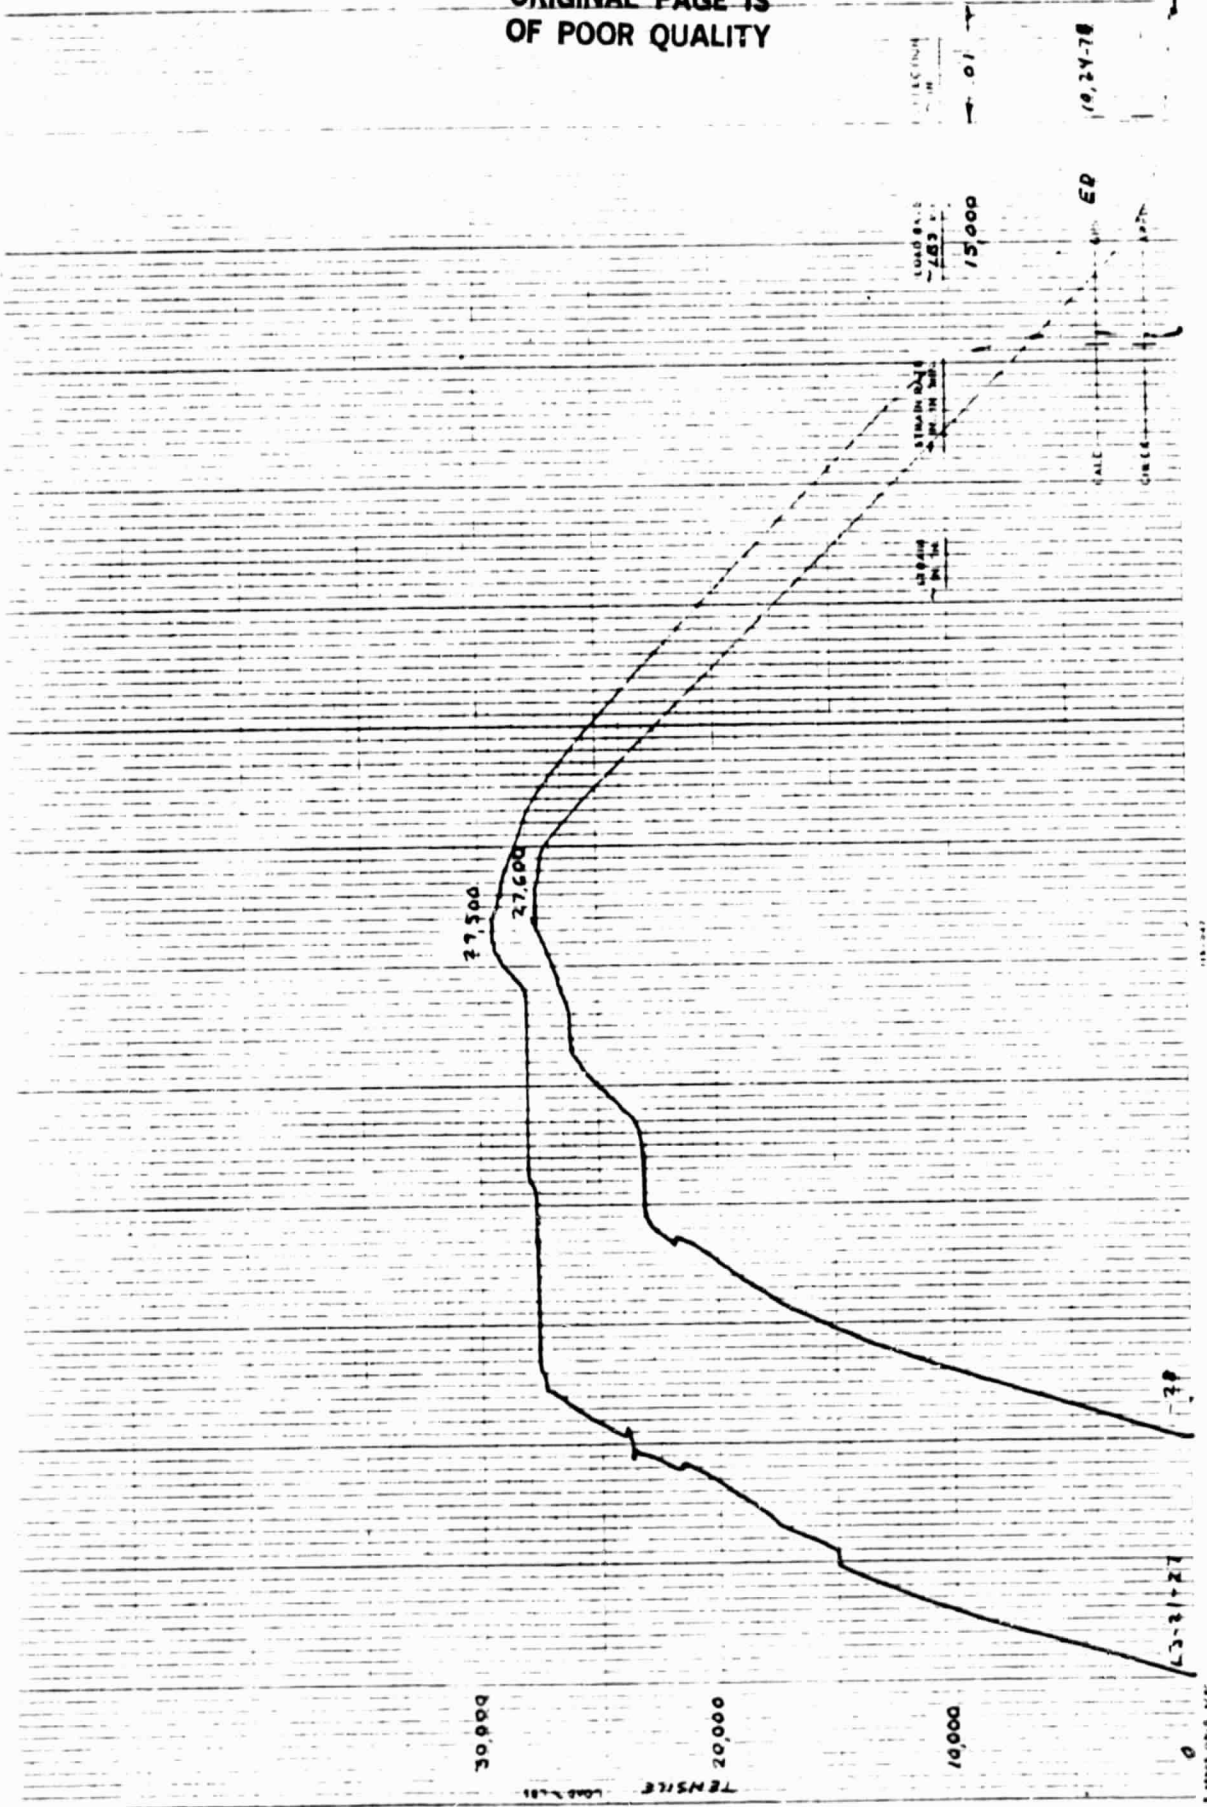

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH


LAMINATE L3  
5/8 HP SLIT

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

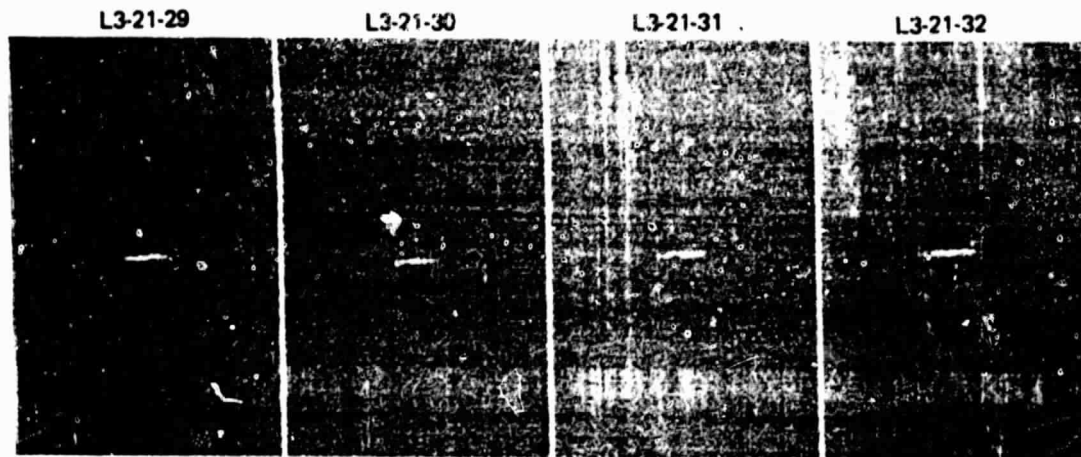


AFTER  
PRELOAD  
27.5 KIP



VISUAL DAMAGE

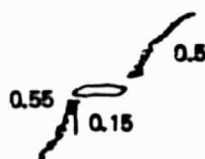


AFTER  
MOISTURE  
CONDITIONING

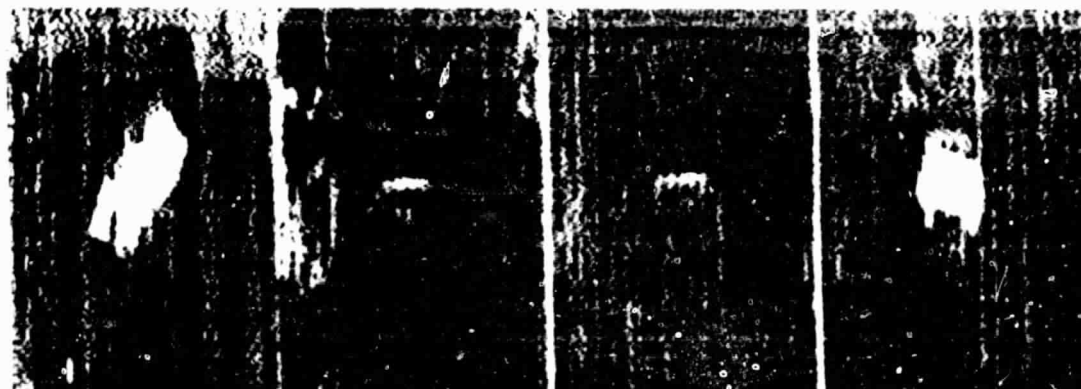




ORIGINAL PAGE IS  
OF POOR QUALITY

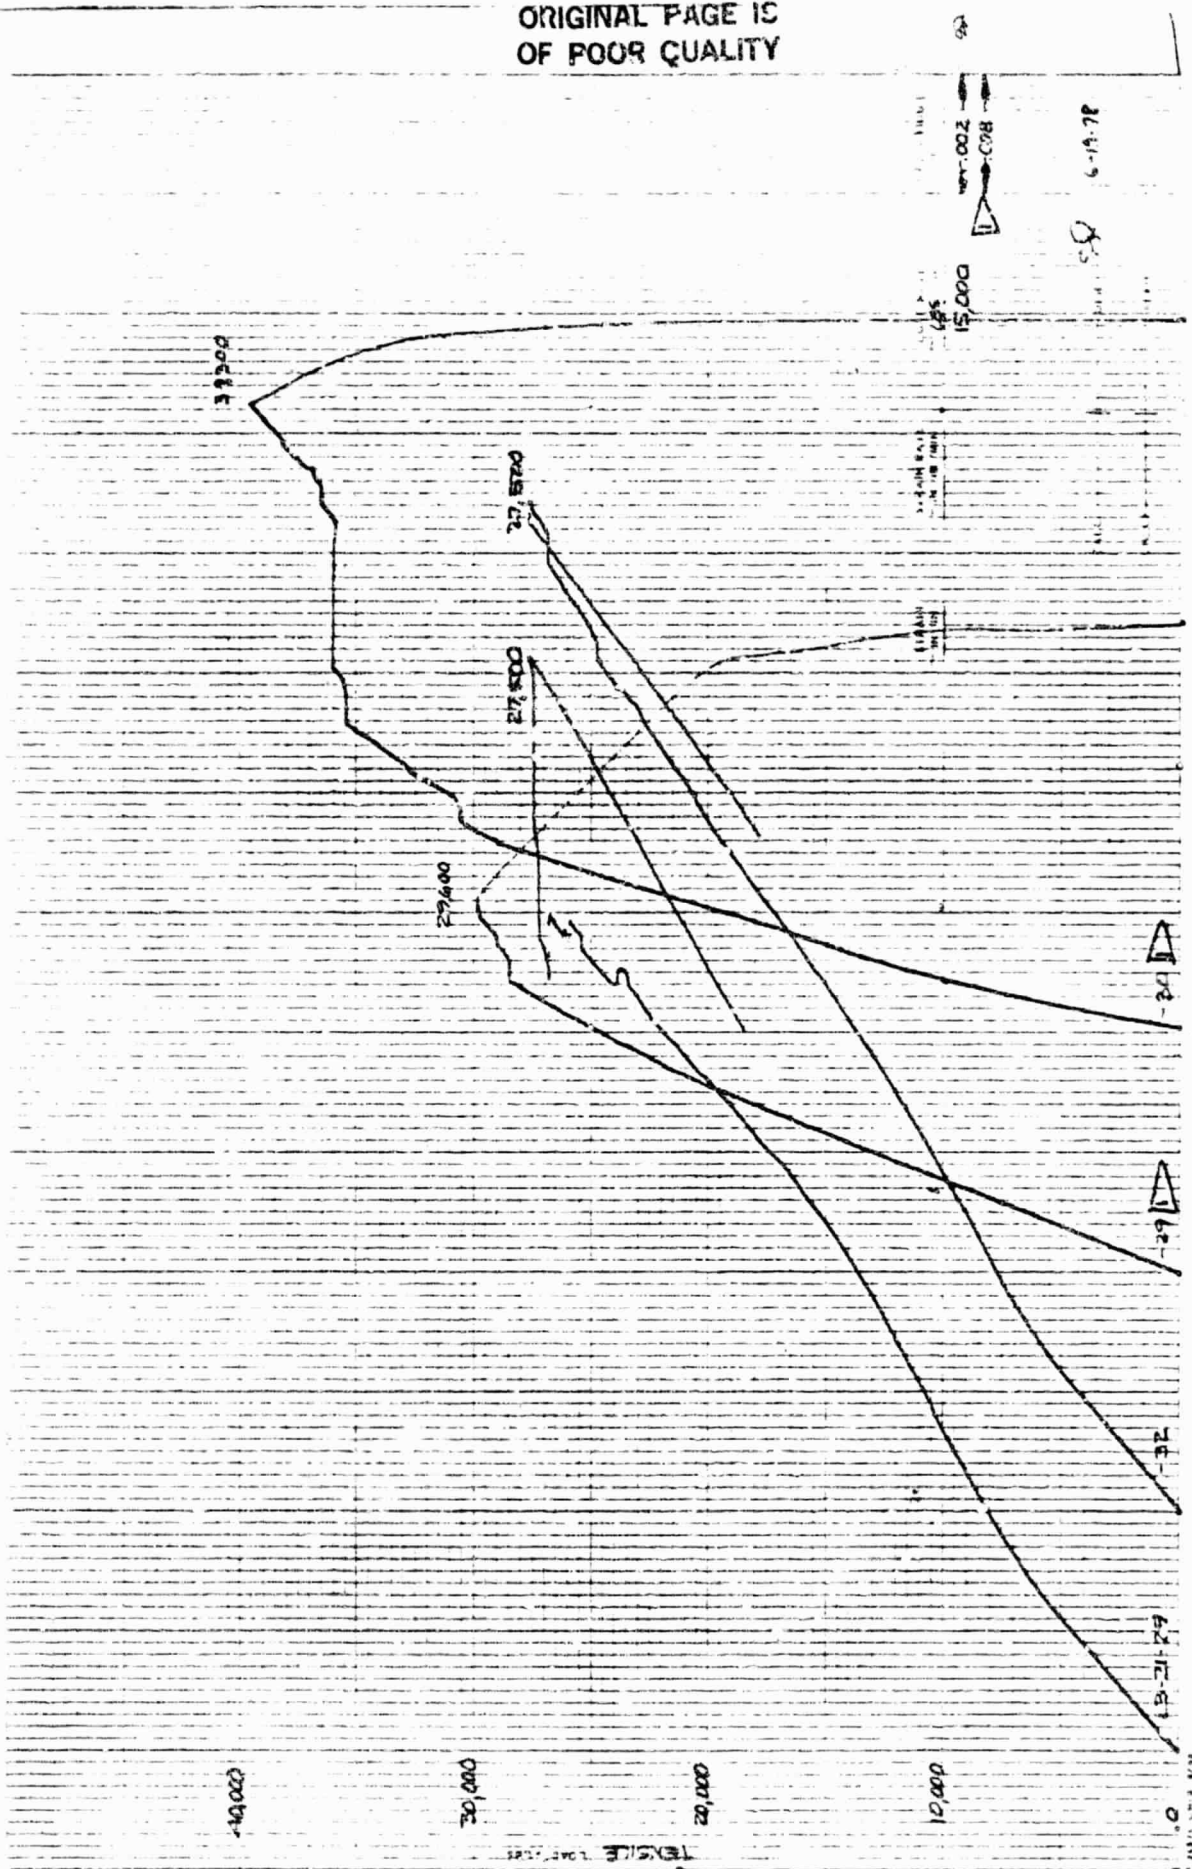

ORIGINAL PAGE IS  
OF POOR QUALITY

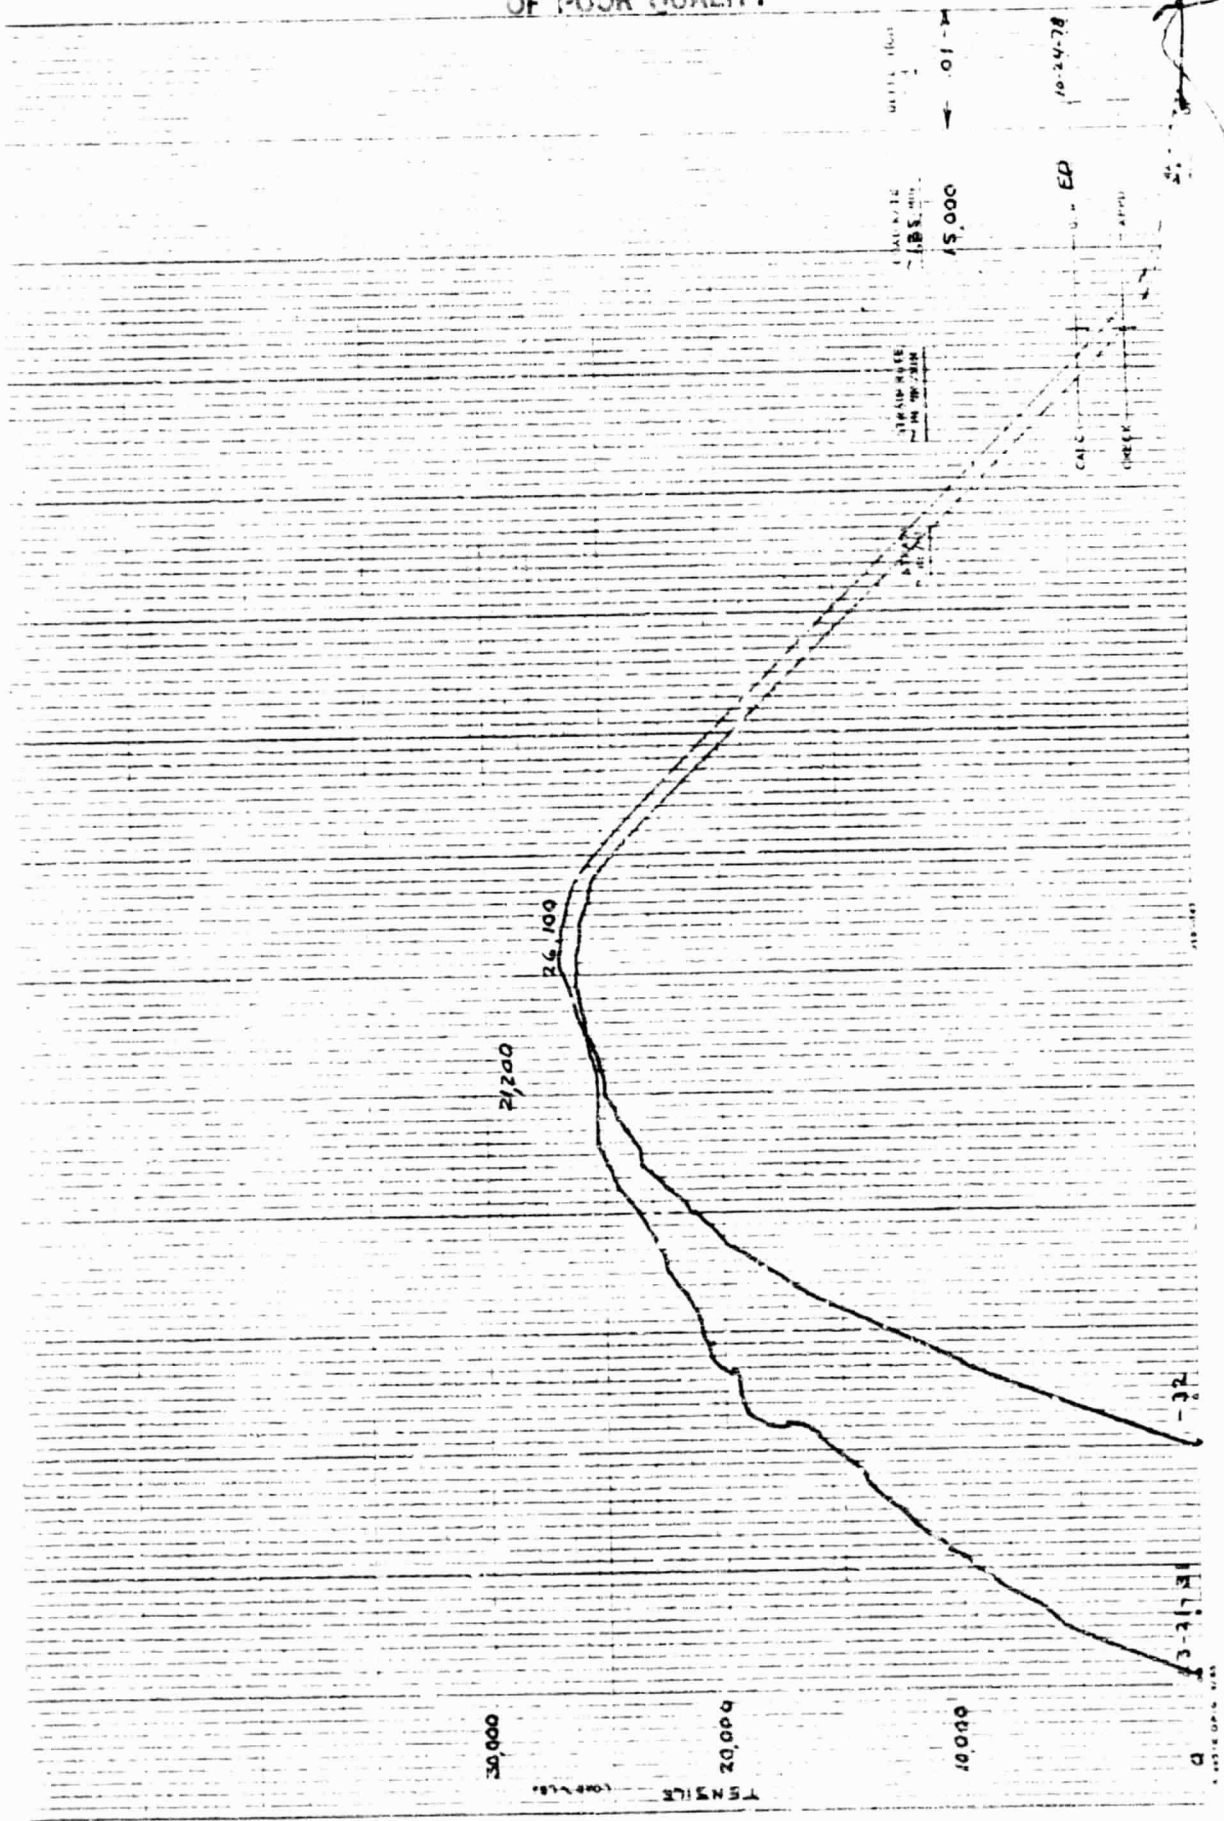



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
1/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)

L3-21-41

L3 21-42

L3-21-43

L3-21-44


INITIAL




AFTER  
PRELOAD  
24.0 KIP

VISUAL DAMAGE

NONE

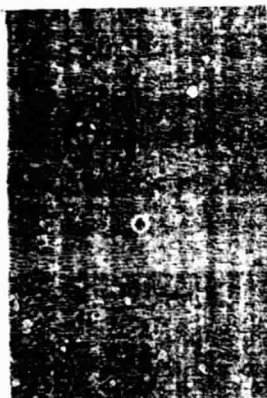

AFTER  
MOISTURE  
CONDITIONING

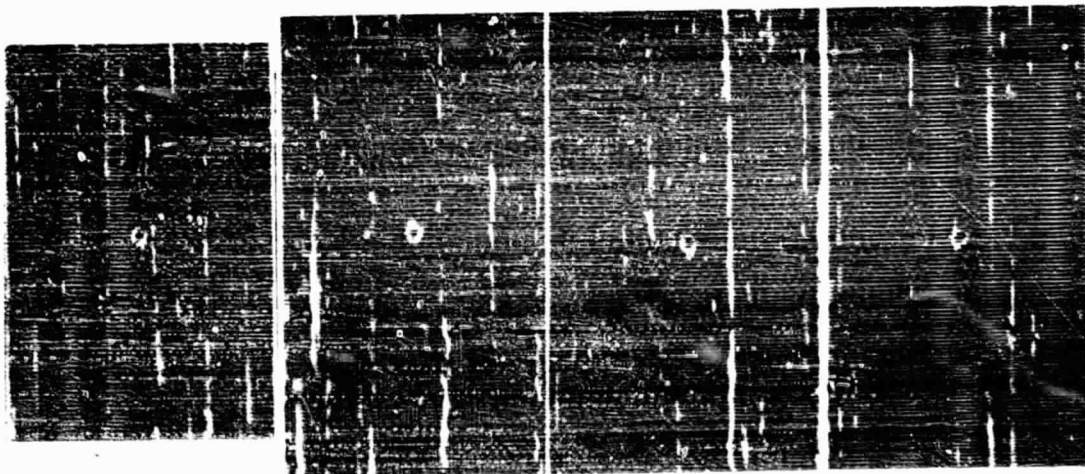

82.61.9  
815

— 496 —

5,000


202

004

△



ORIGINAL PAGE IS  
OF POOR QUALITY

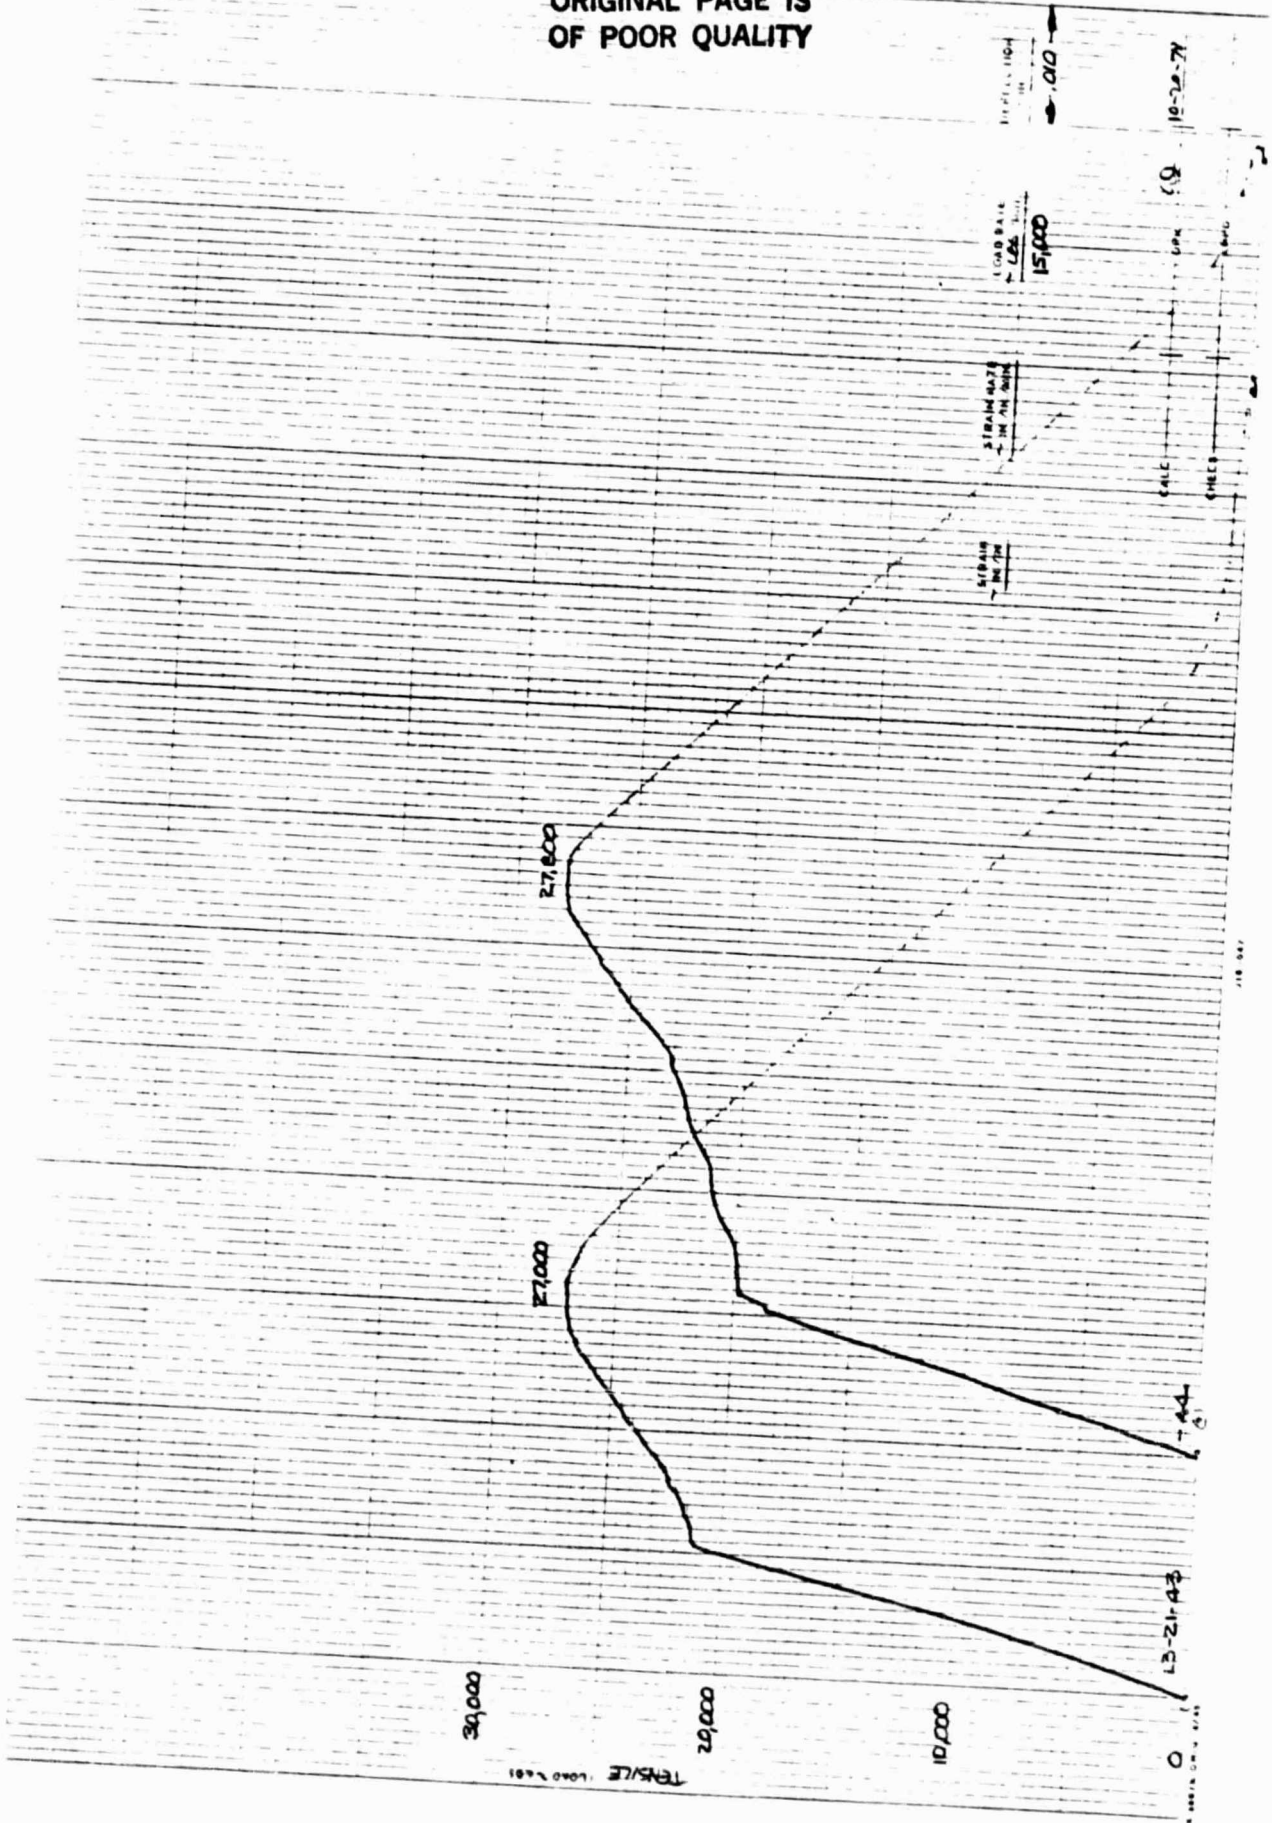

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH


LAMINATE L3  
3/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

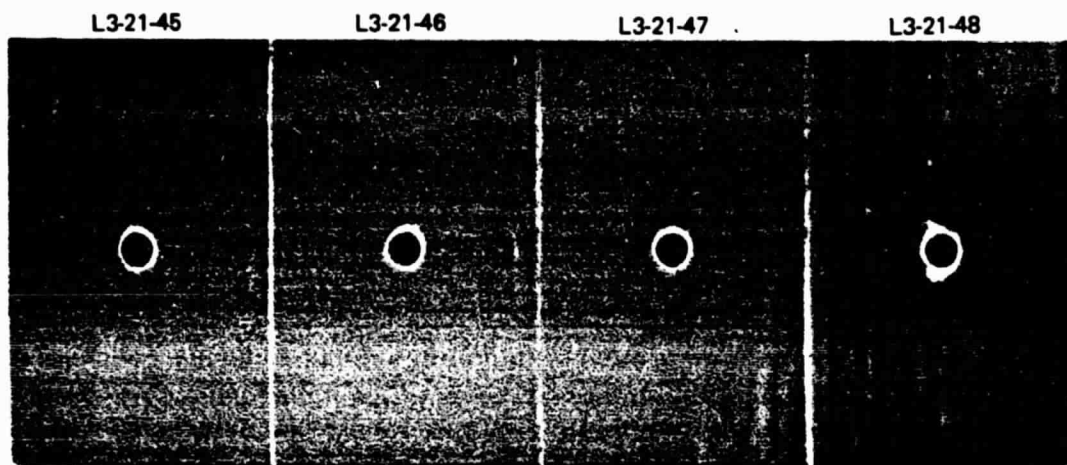


AFTER  
PRELOAD  
18.1 KIP

VISUAL DAMAGE


NONE

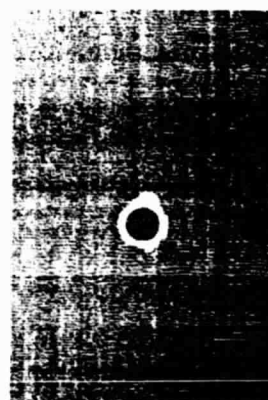


AFTER  
MOISTURE  
CONDITIONING

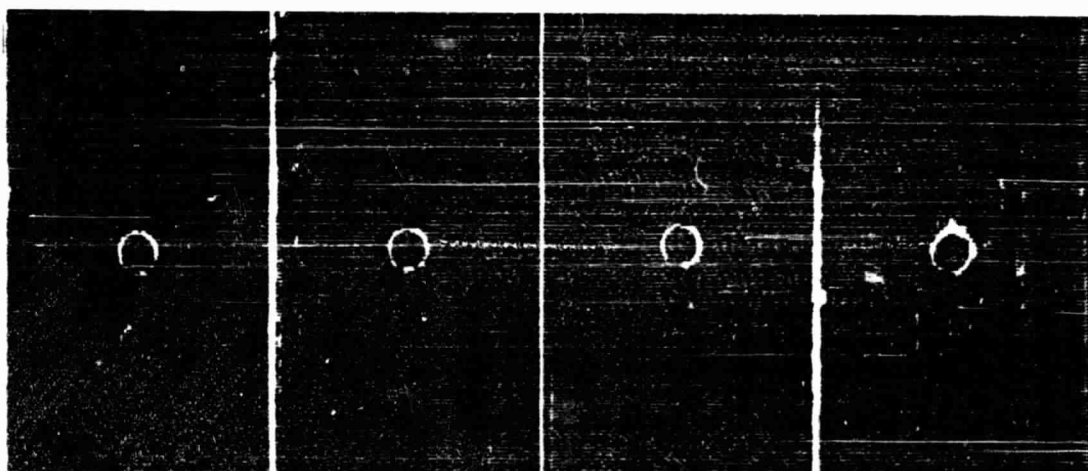

ORIGINAL PAGE IS  
OF POOR QUALITY

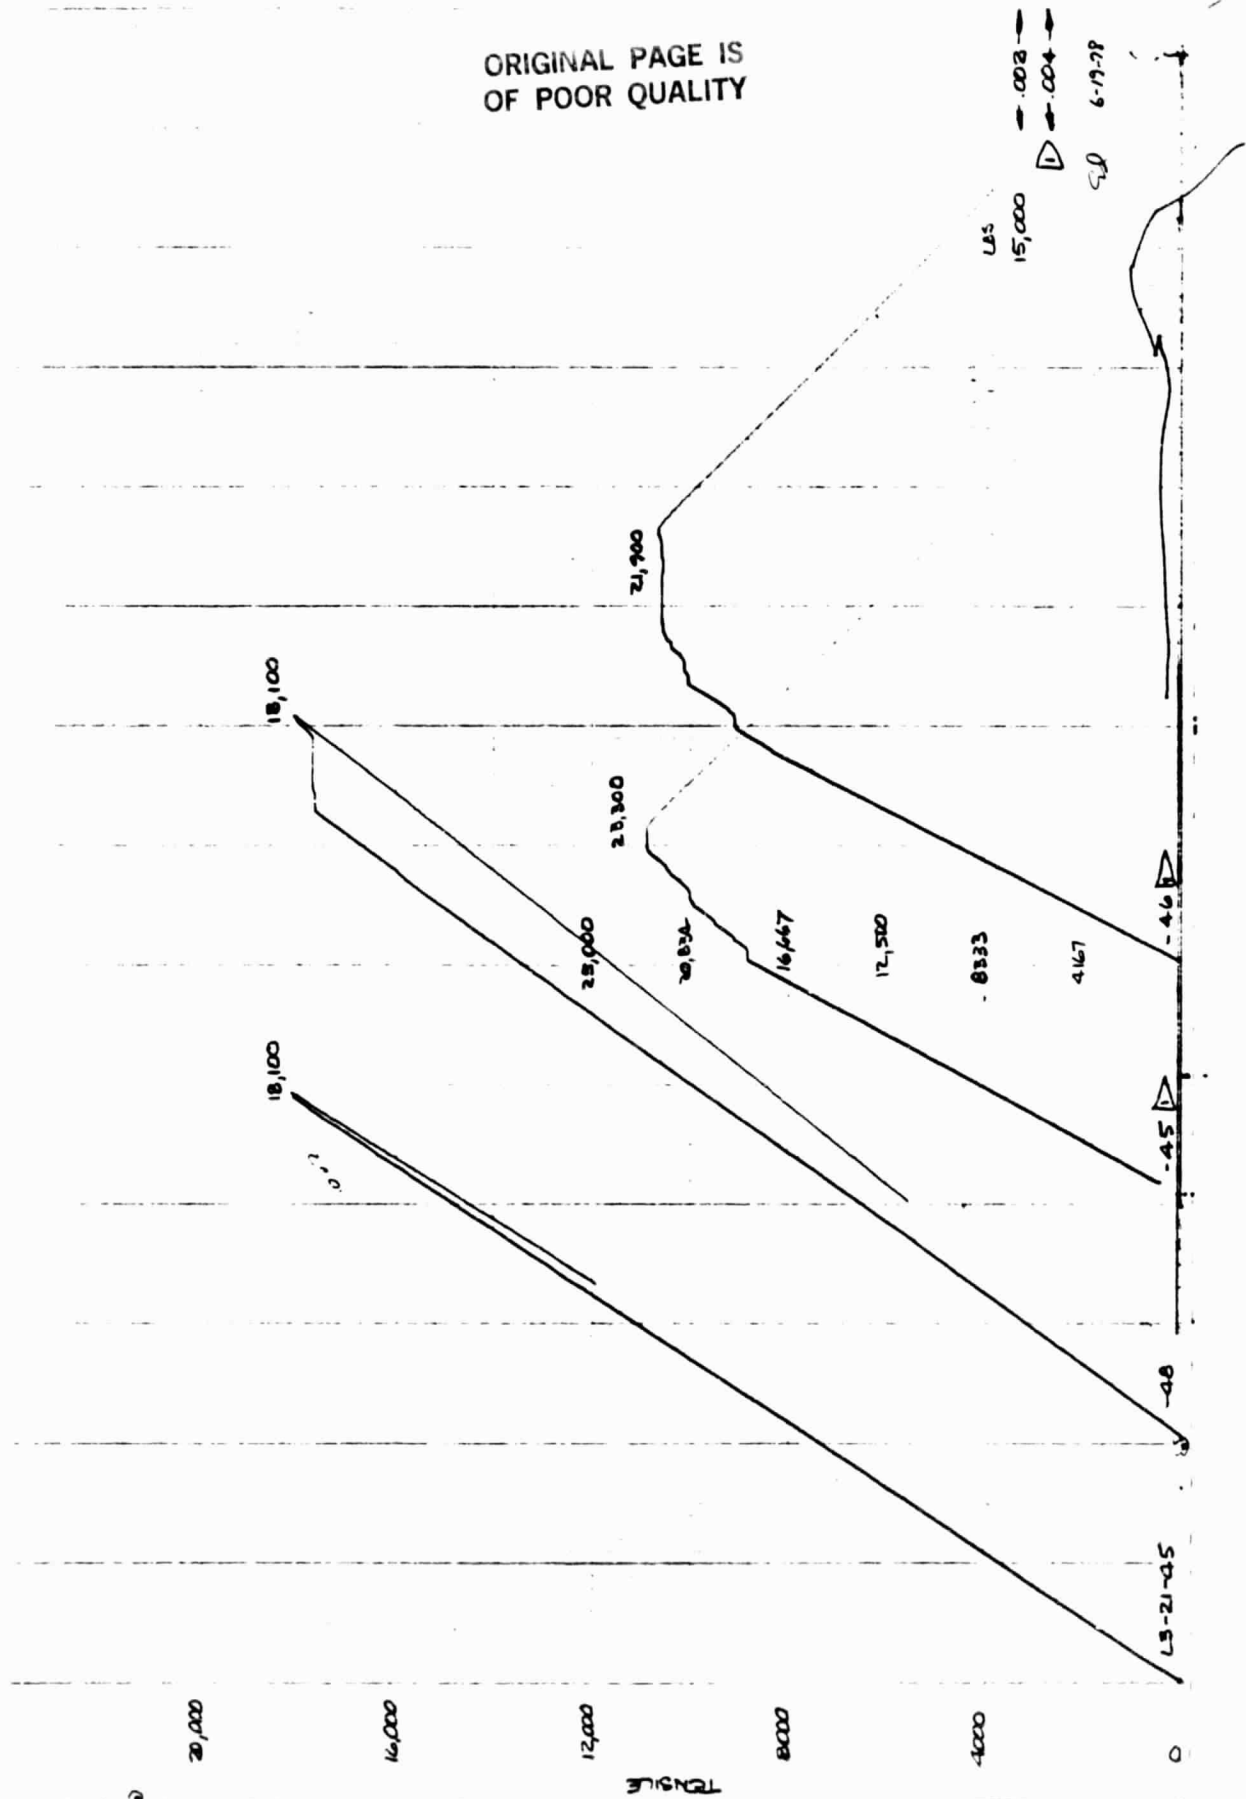



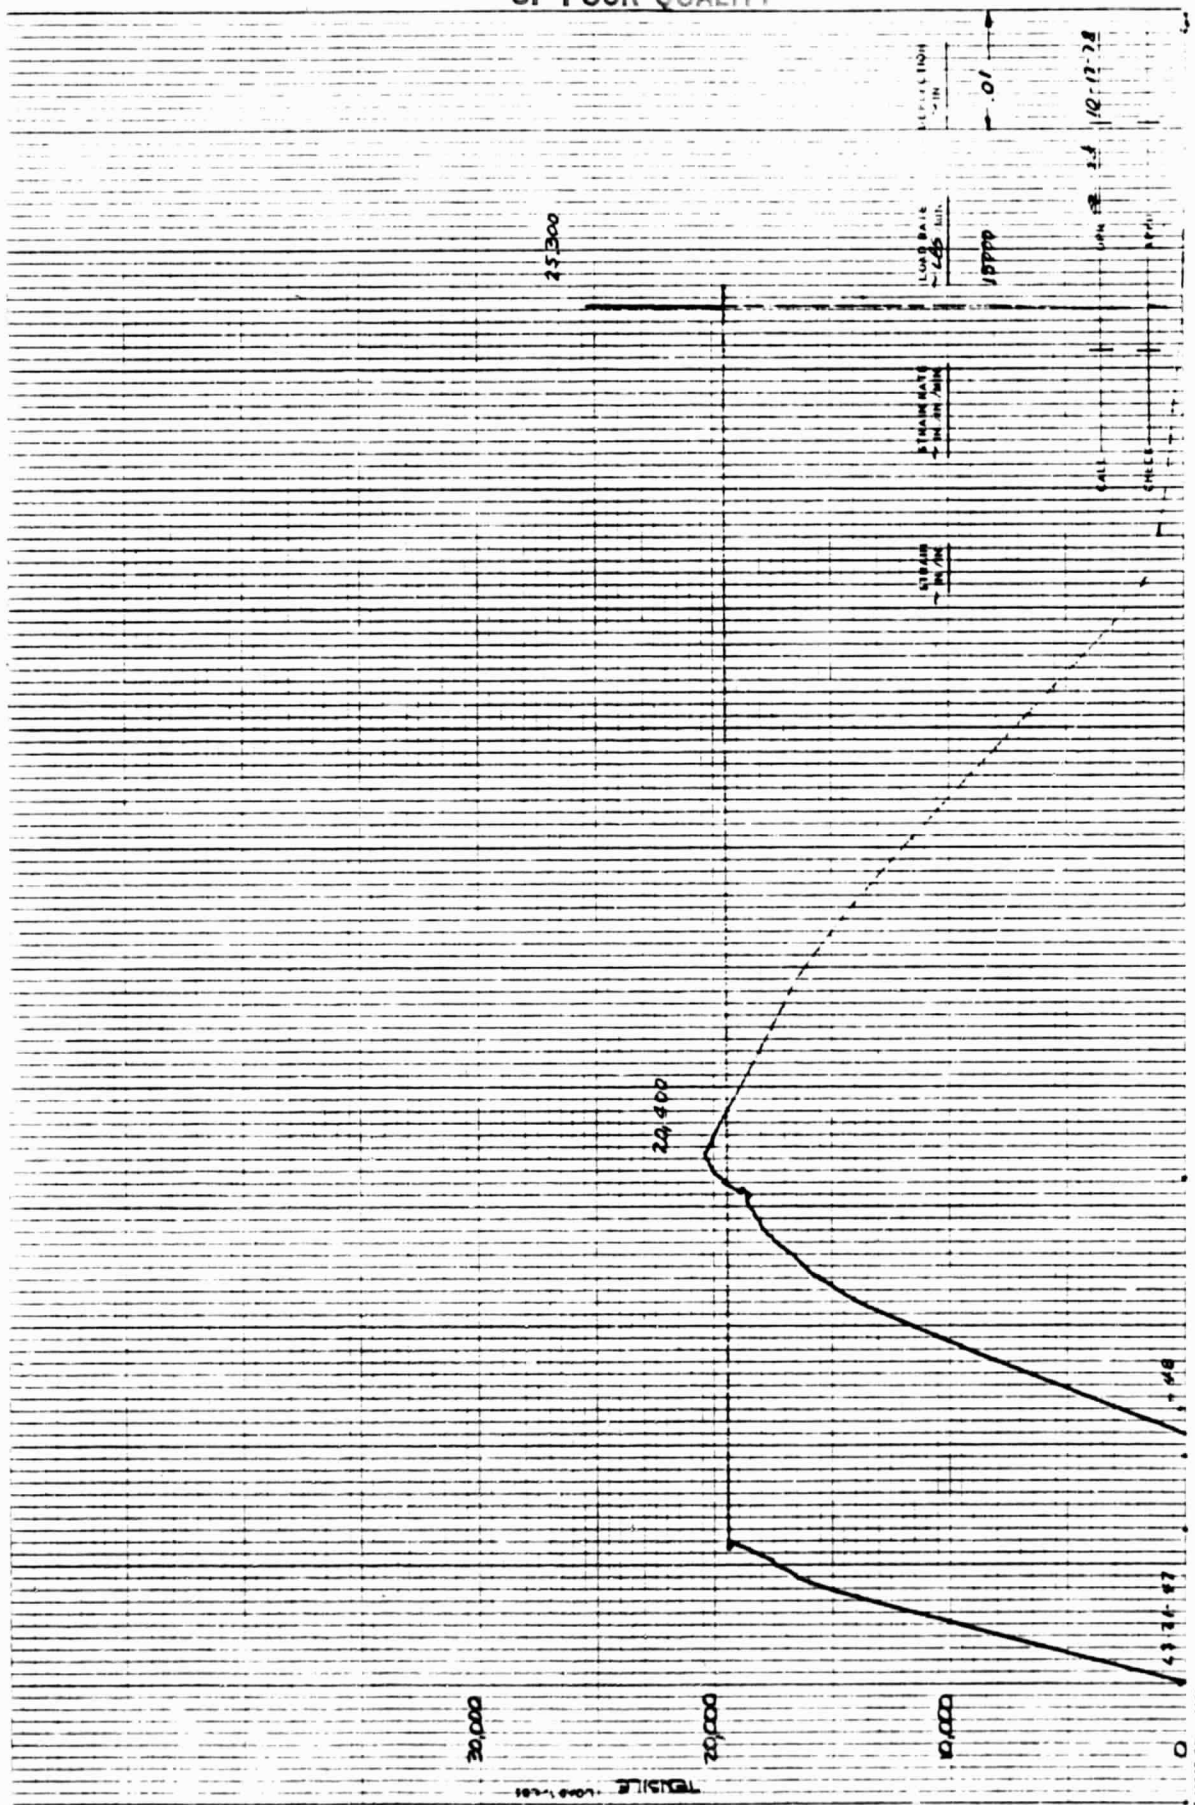

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
5/8 FP HOLE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

L3-21-49

L3-21-50

L3-21-51


L3-21-52

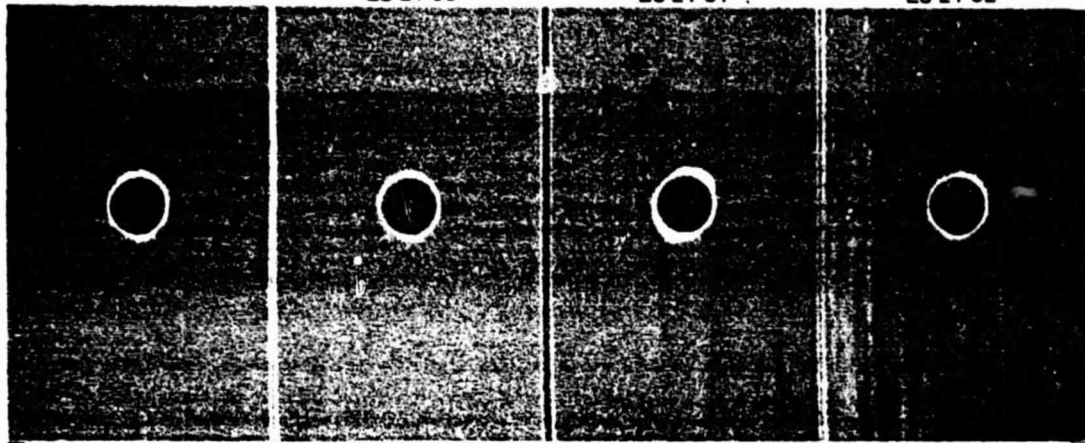


AFTER  
PRELOAD  
15.1 KIP

VISUAL DAMAGE


NONE

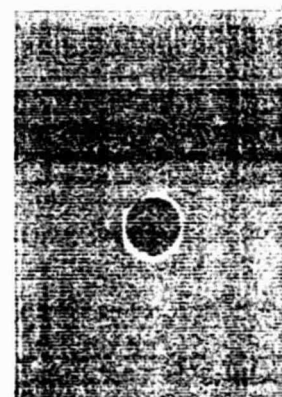

AFTER  
MOISTURE  
CONDITIONING

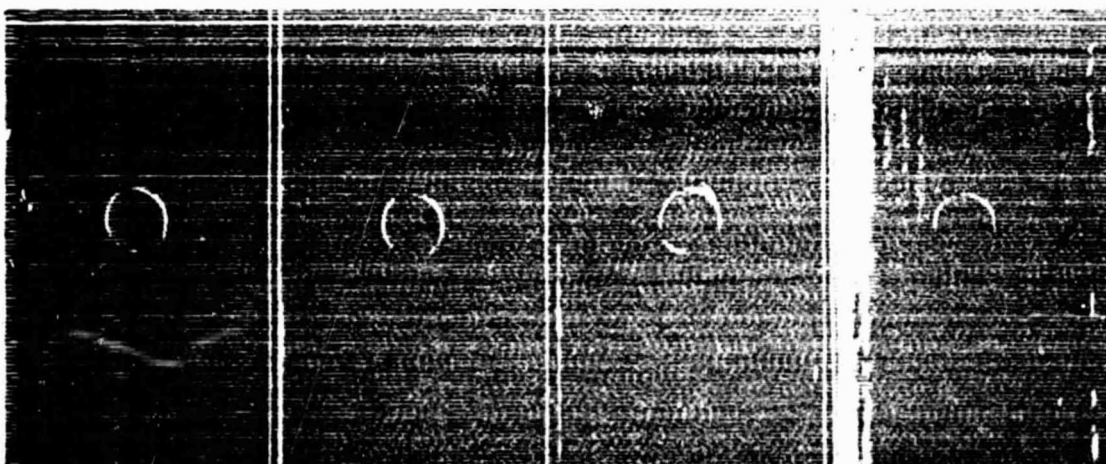


ORIGINAL PAGE IS  
OF POOR QUALITY

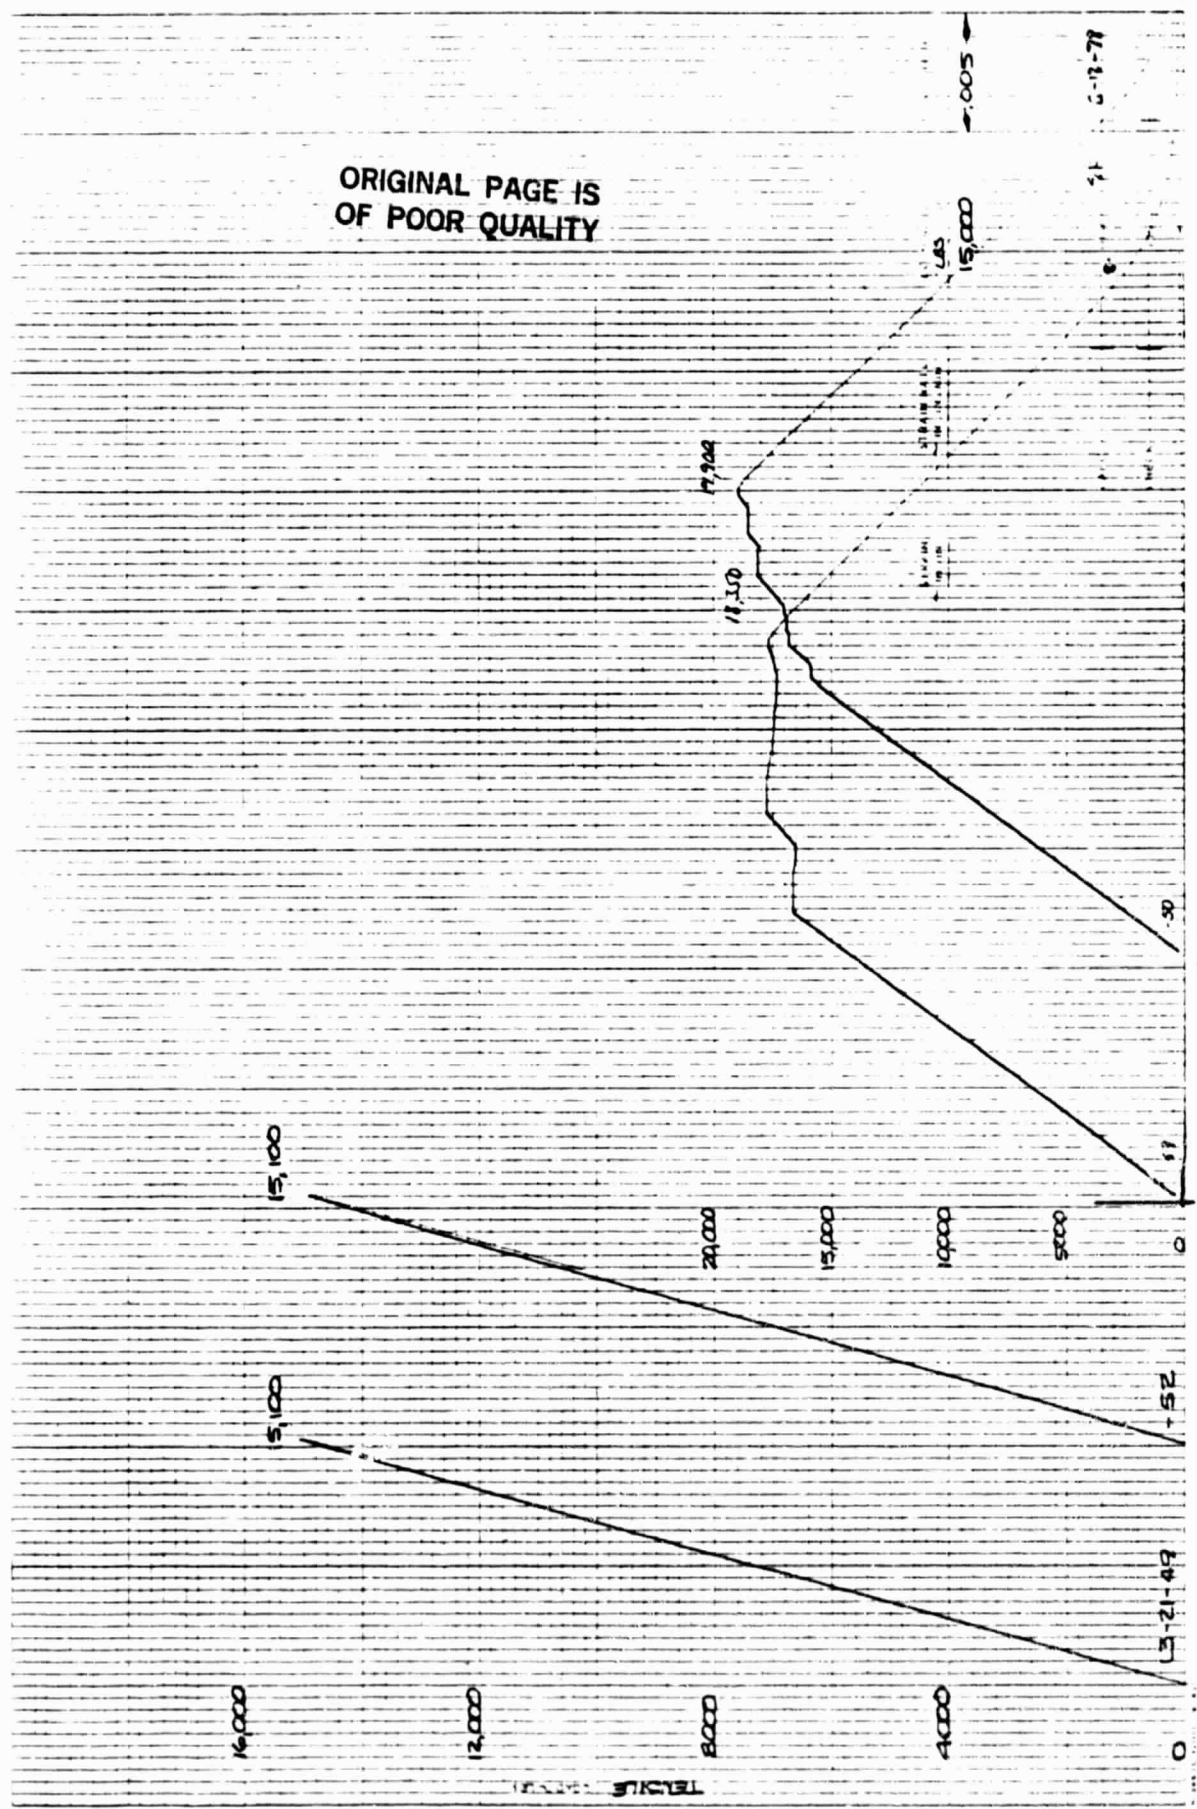



ORIGINAL PAGE IS  
OF POOR QUALITY

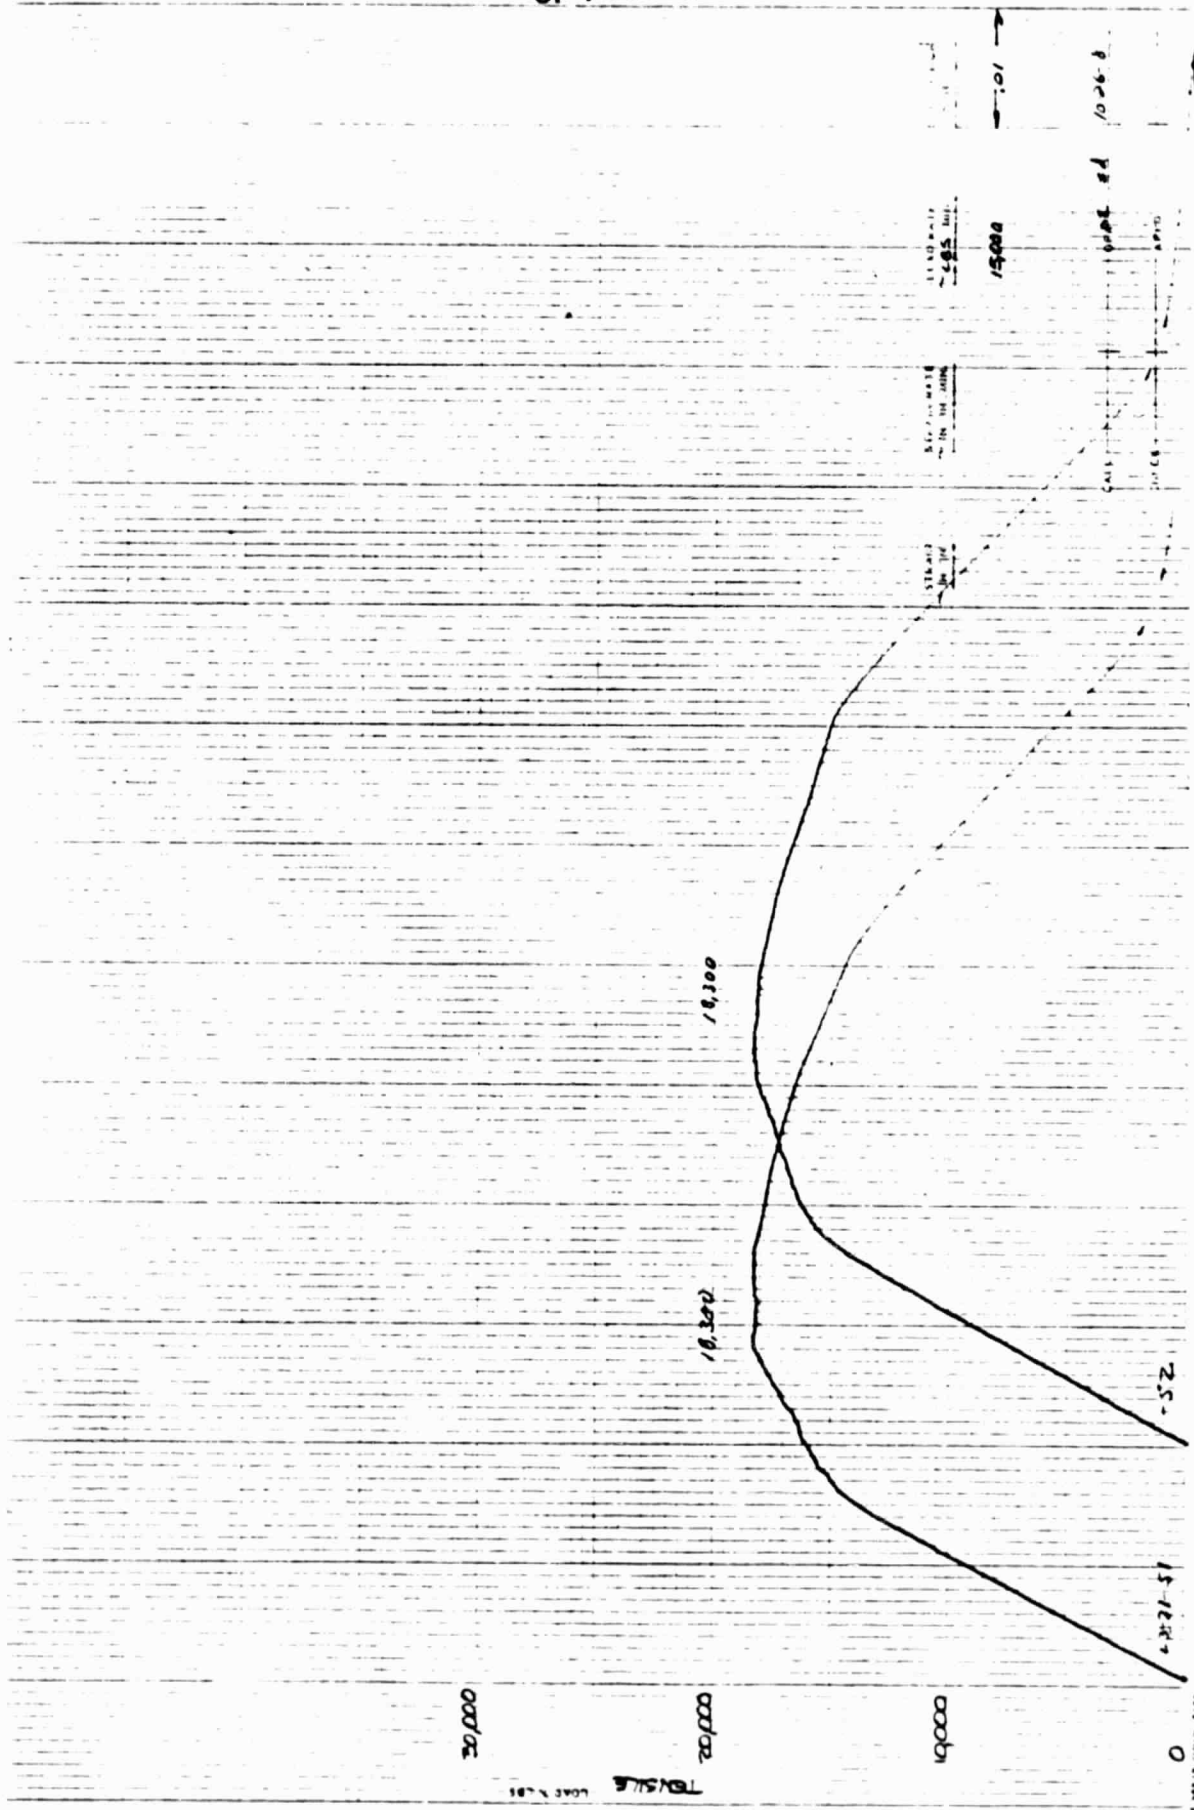

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
ALL GRAPHITE  
NO DEFECT

TEST SPECIMENS

ROOM TEMPERATURE

L3-22-9



INITIAL



AFTER  
MOISTURE  
CONDITIONING

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3  
5/8 HP SLIT  
ALL GRAPHITE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


L3-22-1

L3-22-2

L3-22-3

L3-22-4

INITIAL

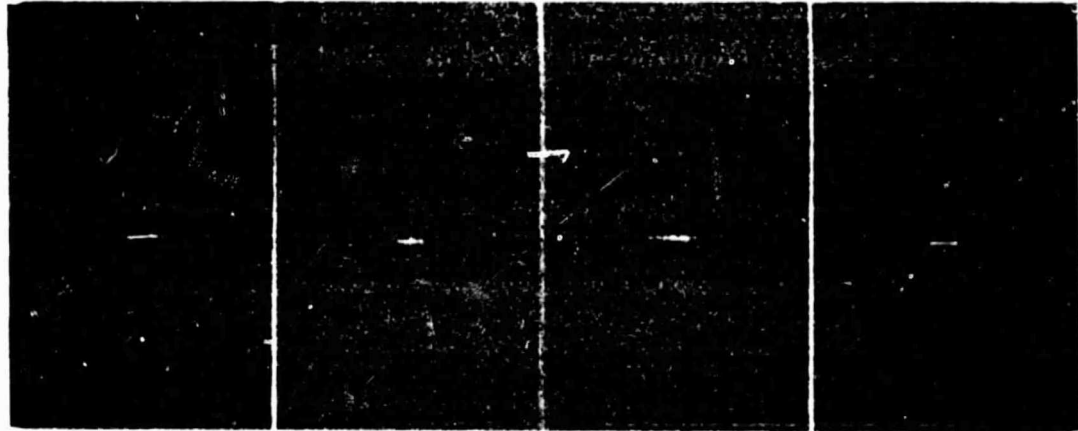


AFTER  
PRELOAD  
21.7 KIP


VISUAL DAMAGE

NONE




AFTER  
MOISTURE  
CONDITIONING

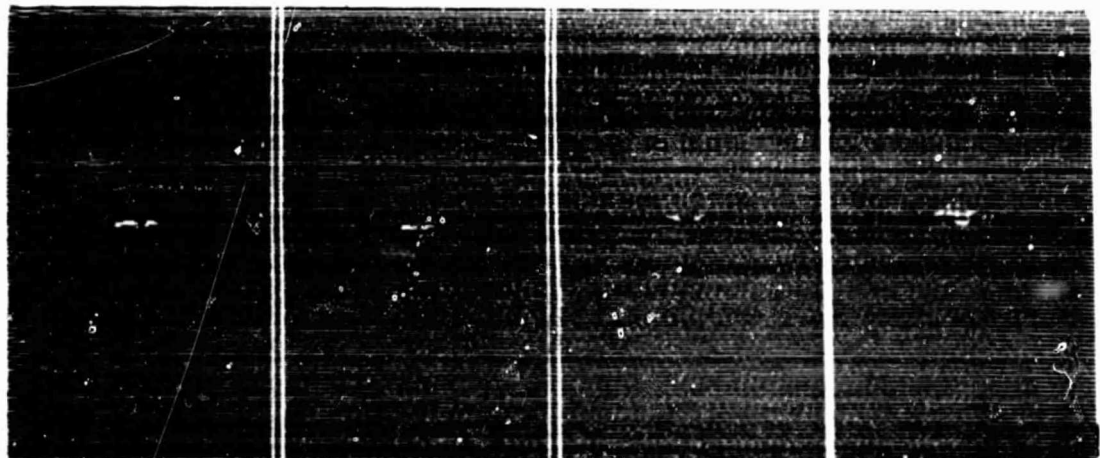

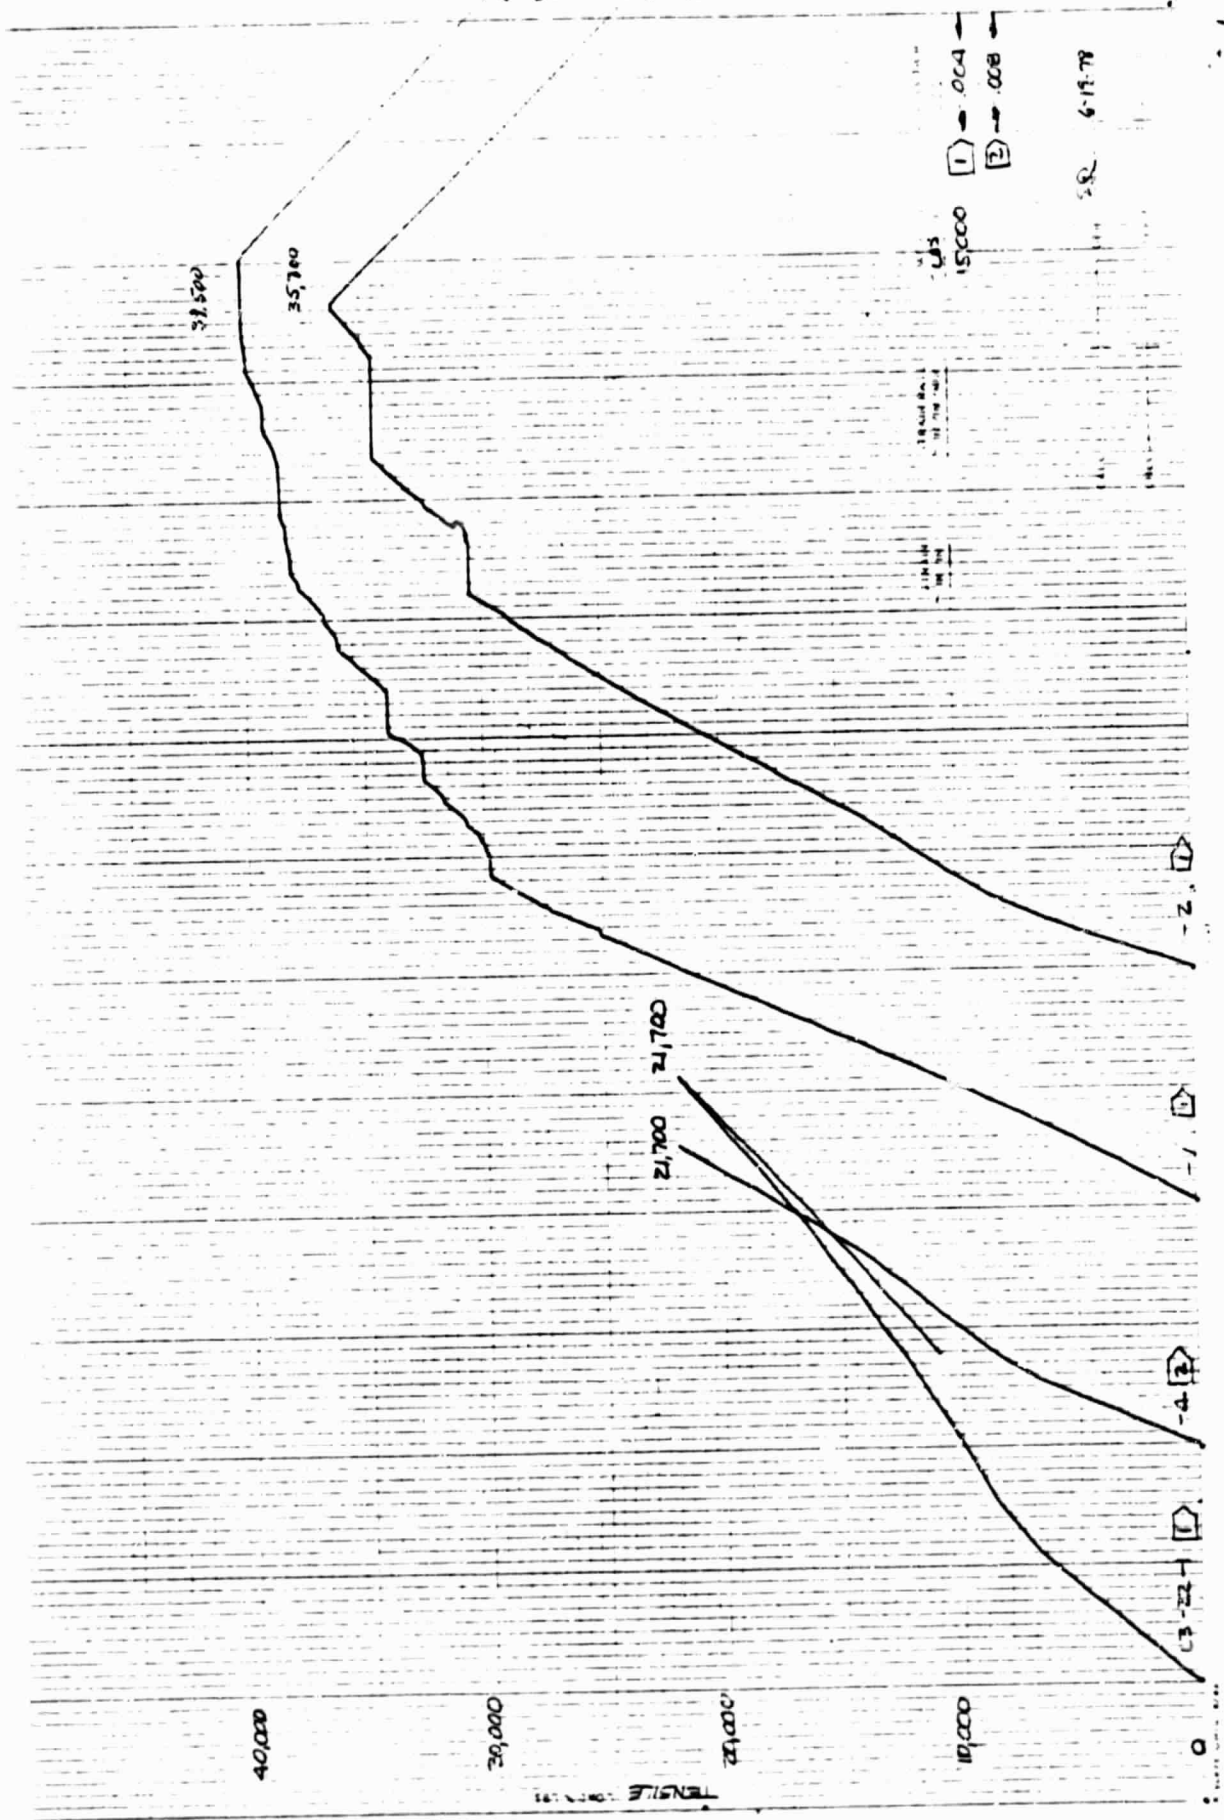

RE-61-01



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

LAMINATE L3

5/8 HP SLIT

ALL GRAPHITE

TEST SPECIMENS

ROOM TEMPERATURE

422° K (300° F)


INITIAL

L3-22-5

L3-22-6

L3-22-7


L3-22-8

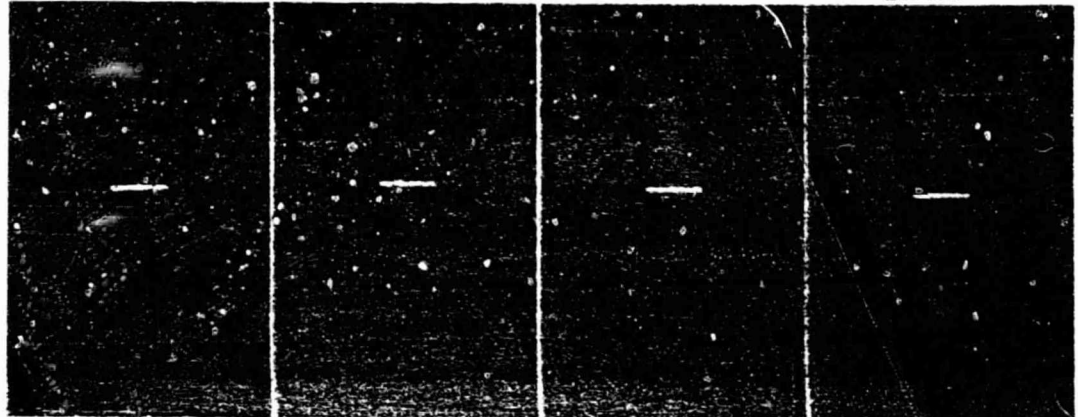

AFTER  
PRELOAD  
12.2 KIP

VISUAL DAMAGE

NONE

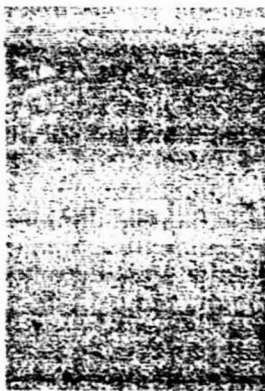


AFTER  
MOISTURE  
CONDITIONING







ORIGINAL PAGE IS  
OF POOR QUALITY

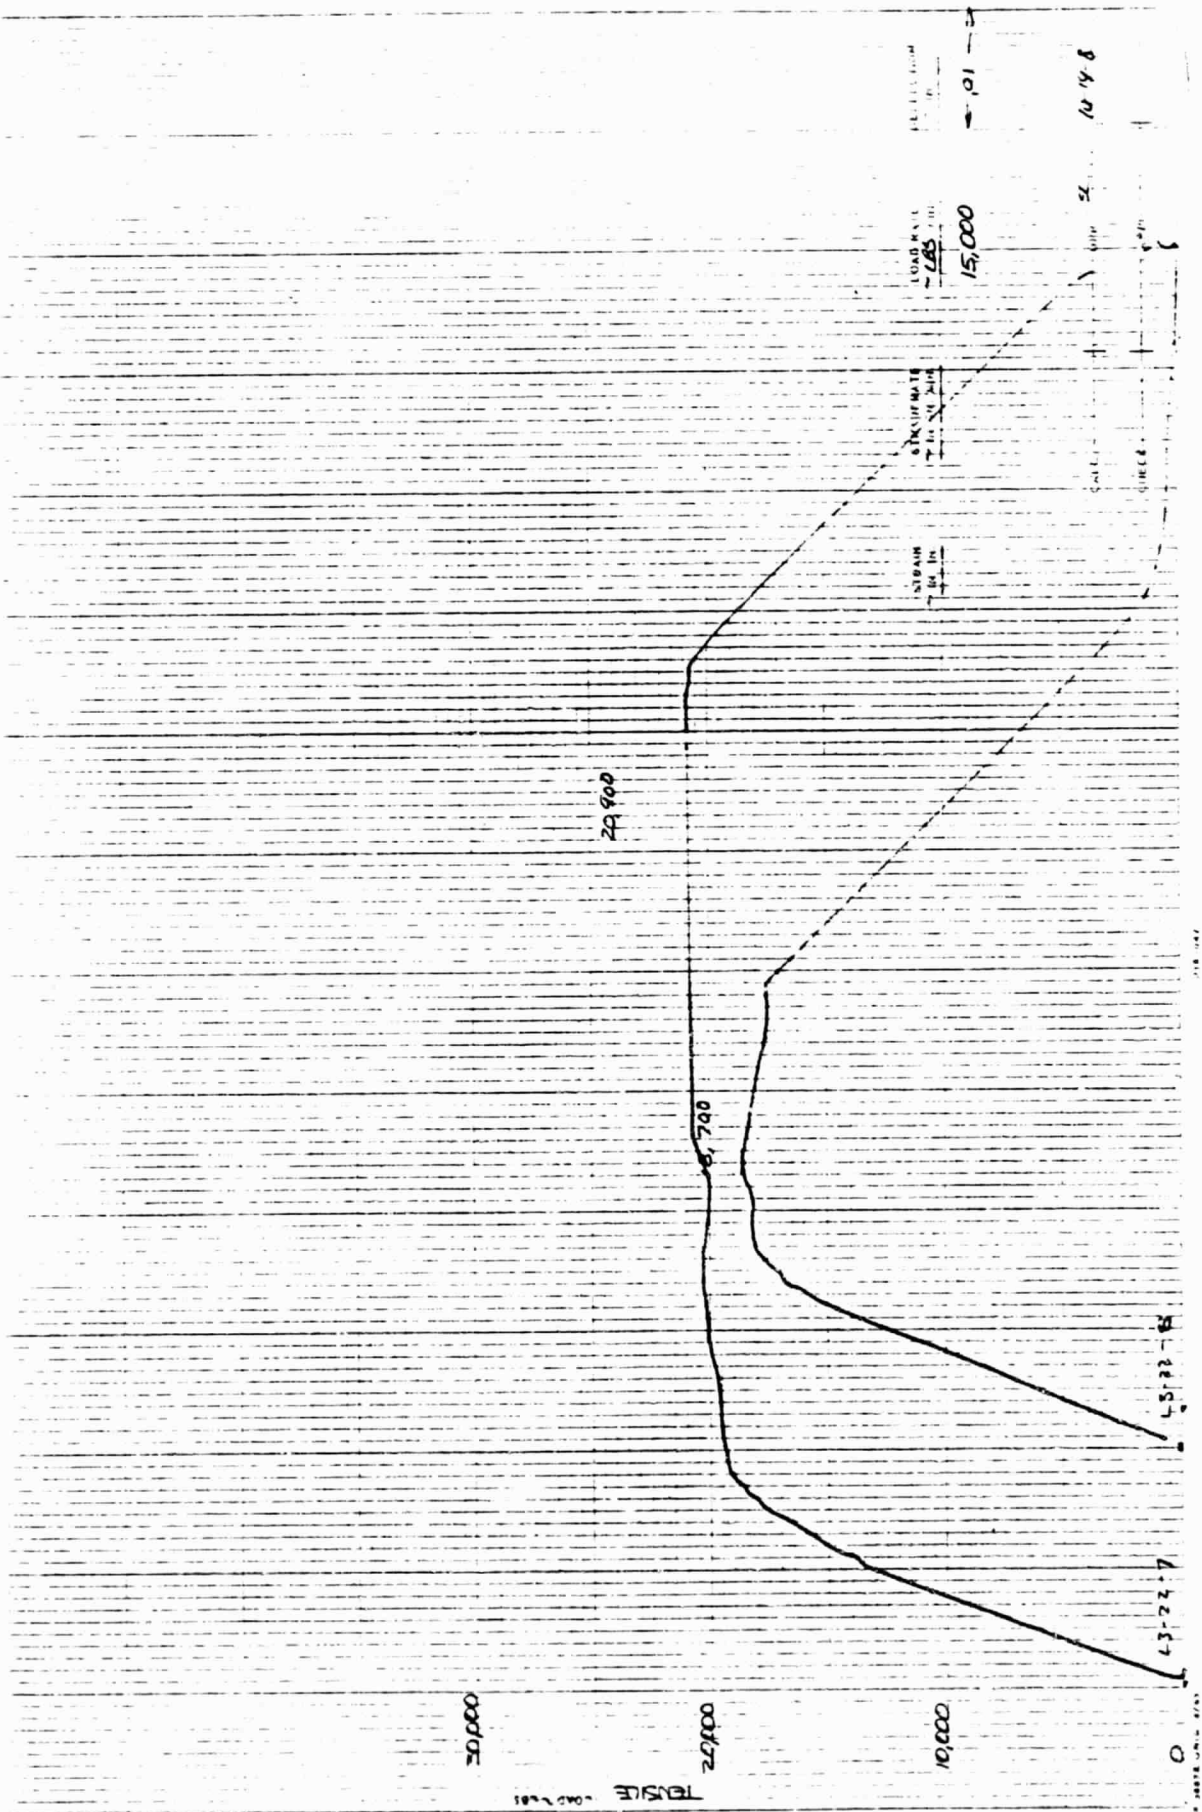



ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH


LAMINATE L3  
5/8 FP SLIT  
ALL GRAPHITE

TEST SPECIMENS


ROOM TEMPERATURE

422° K (300° F)


INITIAL

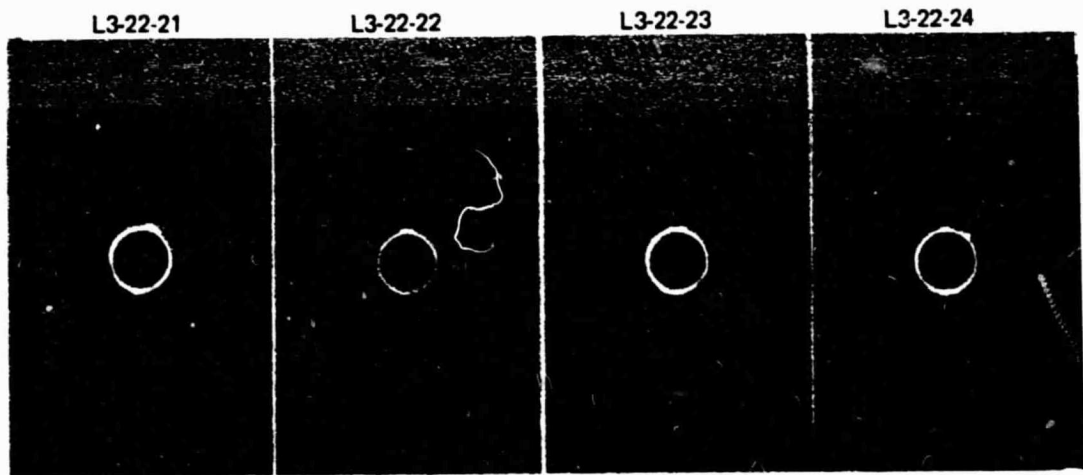



AFTER  
PRELOAD  
12.2 KIP

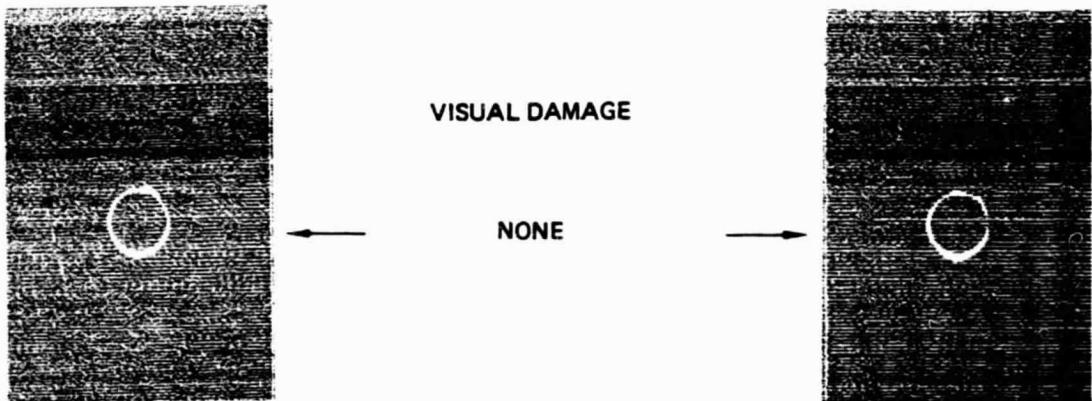

AFTER  
MOISTURE  
CONDITIONING

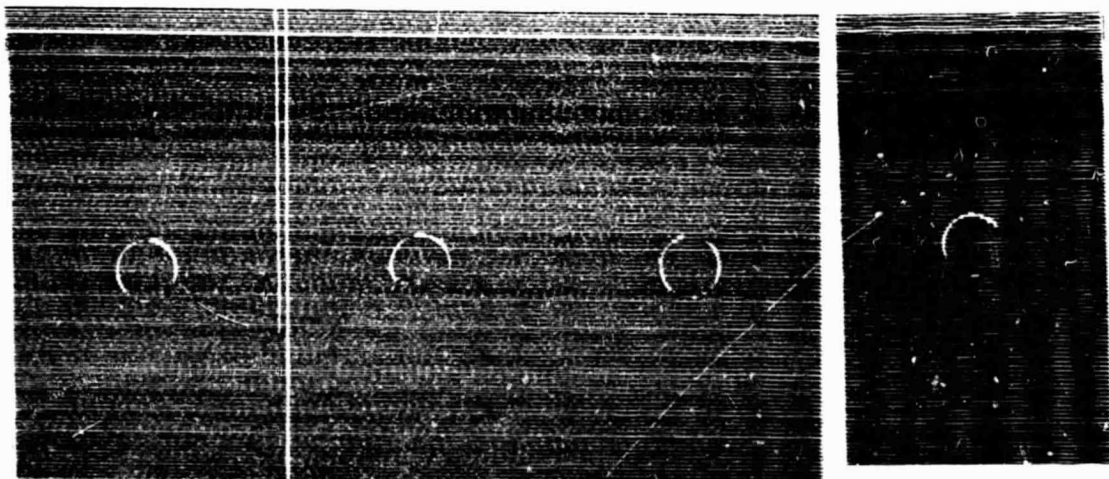

6-12-77  
54

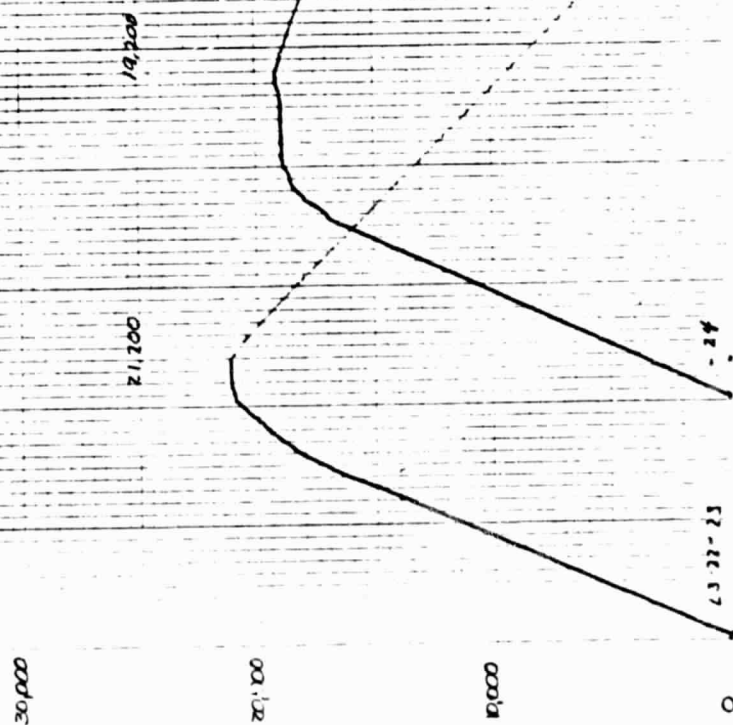[illegible]

**APPENDIX D**  
**CYCLIC TEST DAMAGE GROWTH DATA**


This appendix contains the ultrasonic C-scan examinations and the crack opening displacement COD records made of the cyclic test specimens. The ultrasonic examinations were made several times during the course of the testing, giving a progressive record of the damage development in these specimens.

PRECEDING PAGE BLANK NOT FILMED






ORIGINAL PAGE IS  
OF POOR QUALITY

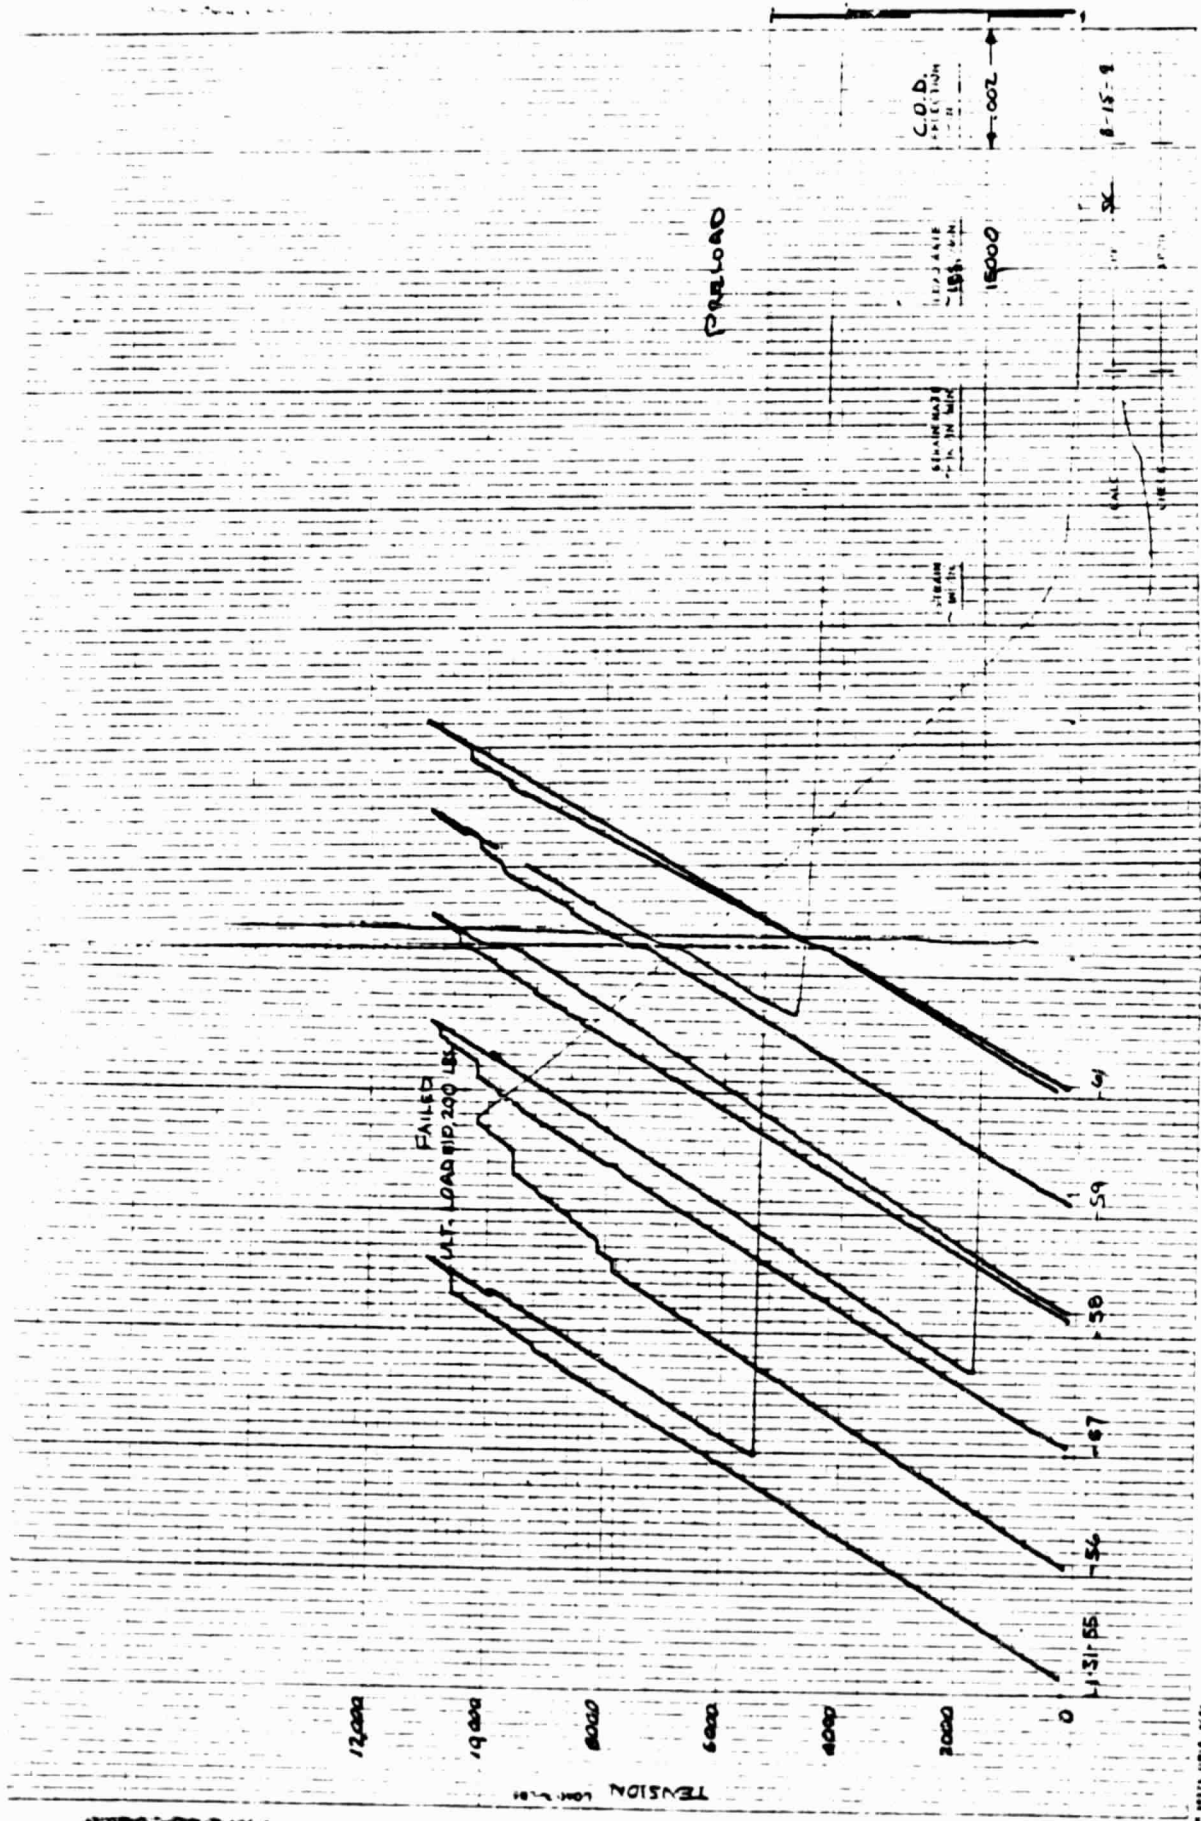

ORIGINAL PAGE IS  
OF POOR QUALITY

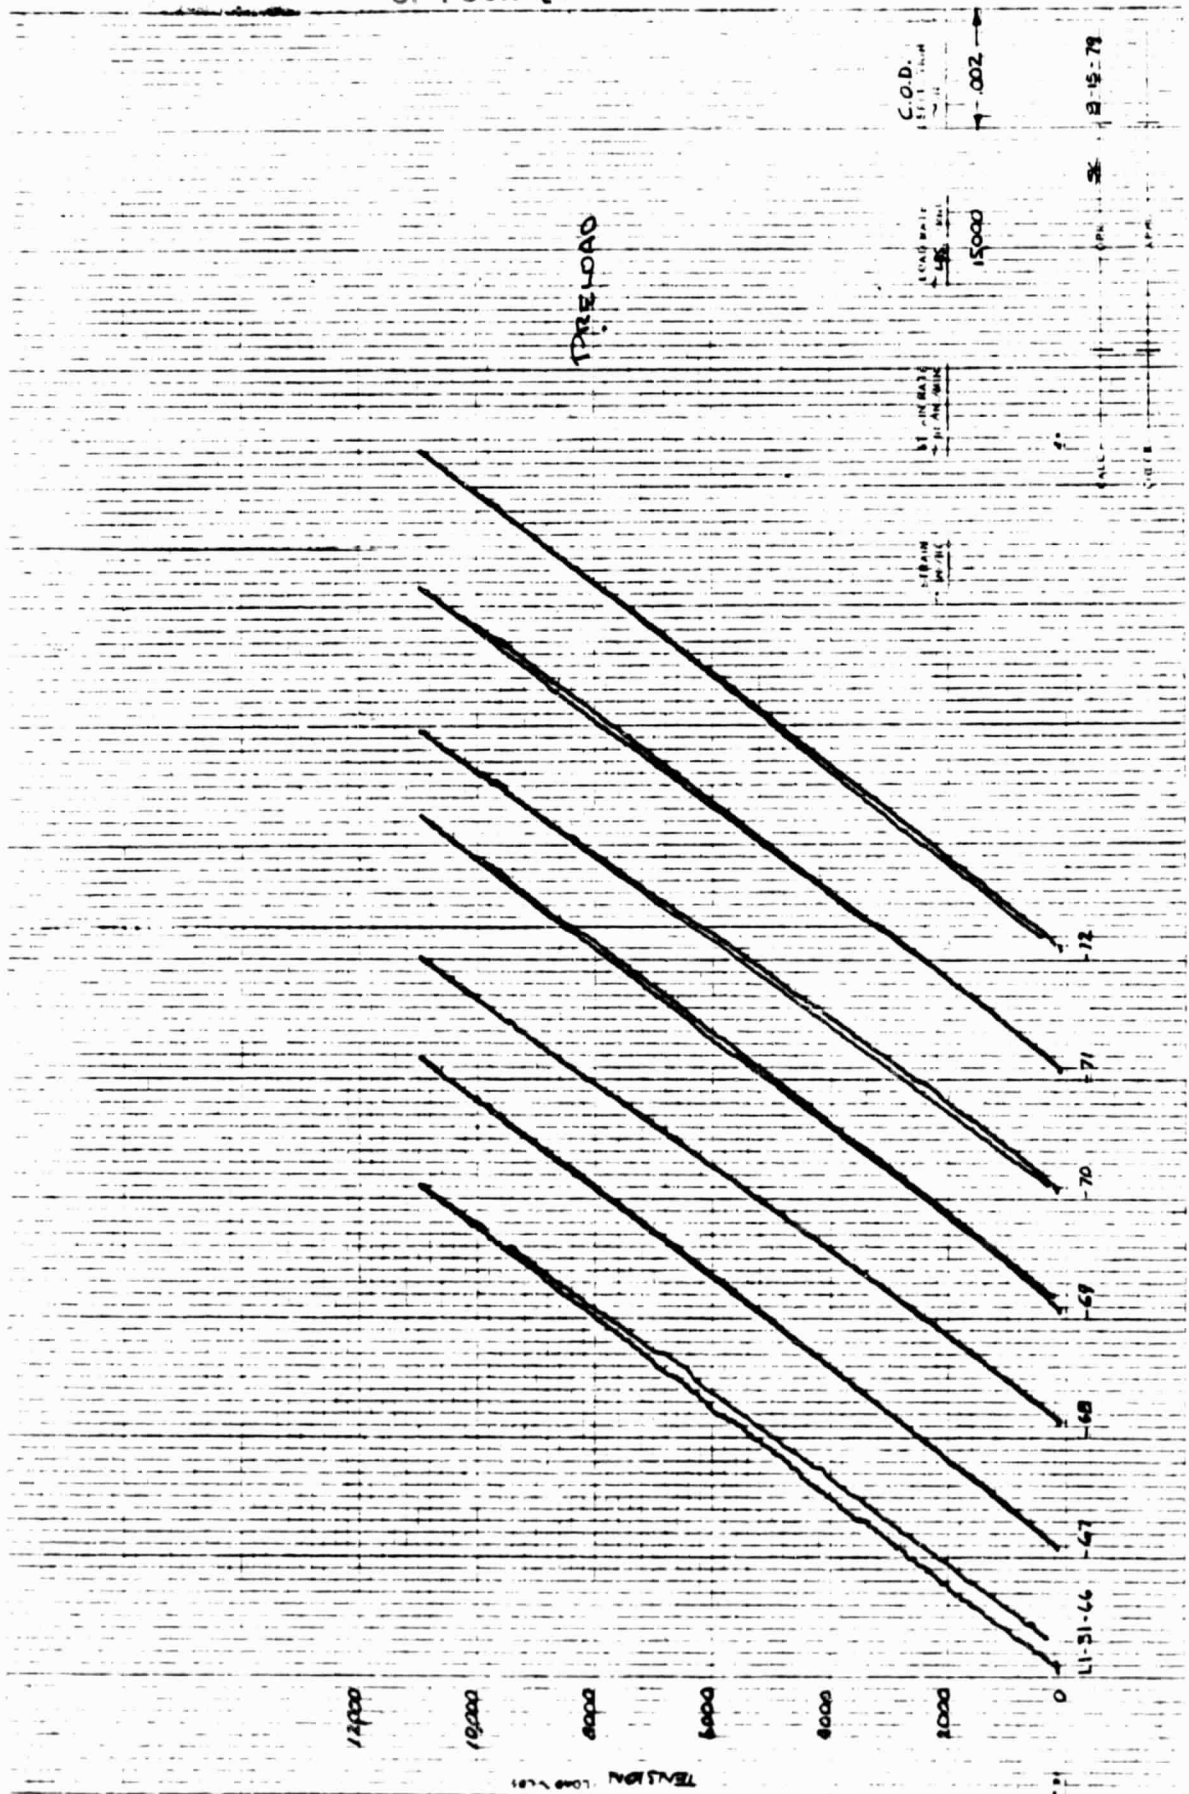

C.2.D.  
E F I C I N Y M

三

100

1000

53274940

17-30



100

10

1998

1000



—

100

10

—

—

—

—

—

—

1

100

+

3

註

5

—

1

100

—

10

5

1000

—

2

1999

1

•

12008


**Flow**

**0000**

1974 0709 - MOISNA



ULTRASONIC C-SCAN DATA

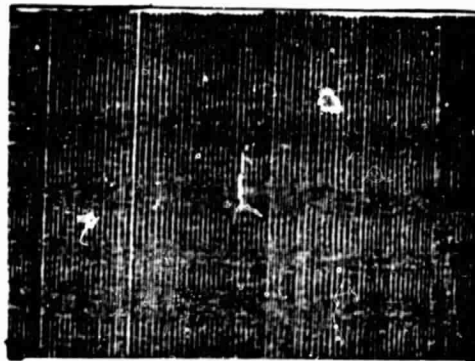

BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-25

DEFECT 5/8 FP SLIT


TEST TYPE CYCCLIC

NO PRELOAD



AFTER PRELOAD

MAXIMUM LOAD

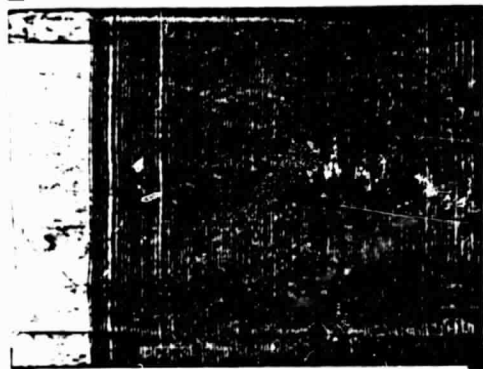

AFTER MOISTURE CONDITIONING



10 CYCLES

CYCLIC LOAD 46700 (10500)

R RATIO 0.05

TEST TEMPERATURE Room




LI-31-25



10<sup>3</sup> CYCLES

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

ULTRASONIC C-SCAN DATA

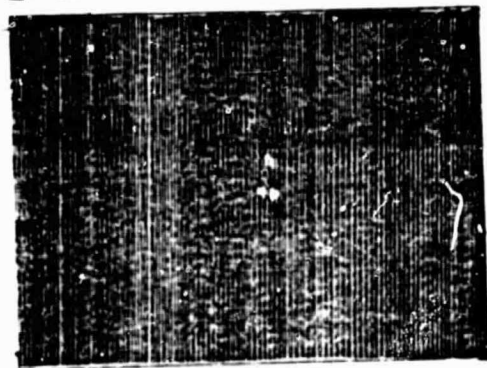

NO PRELOAD

BEFORE TEST



AFTER PRELOAD


MAXIMUM LOAD

LAMINATE LI-

SPECIMEN NO. LI-31-26

DEFECT 2/8 40 51T

TEST TYPE CYC

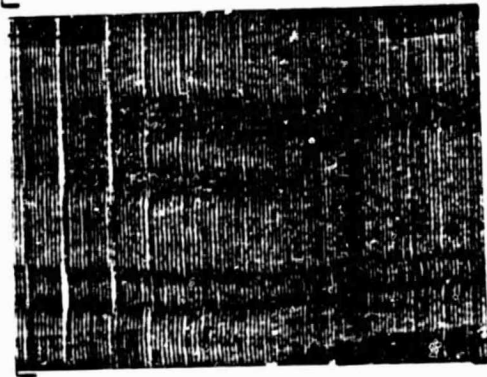

AFTER MOISTURE CONDITIONING



100 CYCLES


CYCLIC LOAD 40/150 (10000)

R RATIO 0.95

TEST TEMPERATURE 25°C



10 CYCLES

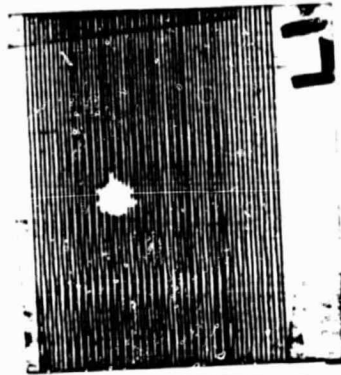

ULTRASONIC C-SCAN DATA



NO PRE LOAD



BEFORE TEST



AFTER PRELOAD


MAXIMUM LOAD

LAMINATE LI


SPECIMEN NO. LI-31-27

DEFECT 5/8 FP SLIT

TEST TYPE CYCCLIC

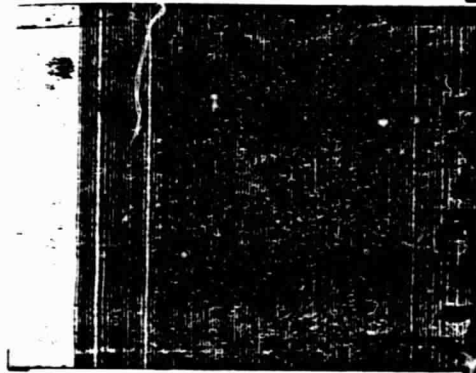

AFTER MOISTURE CONDITIONING

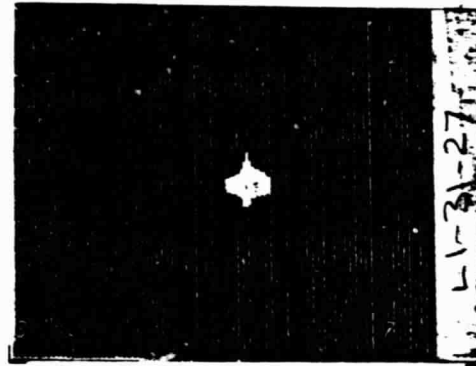

100 CYCLES

CYCLIC LOAD 46,100 (10,000)

R RATIO 0.05

TEST TEMPERATURE Room




10<sup>1</sup> CYCLES




ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

ULTRASONIC C-SCAN DATA

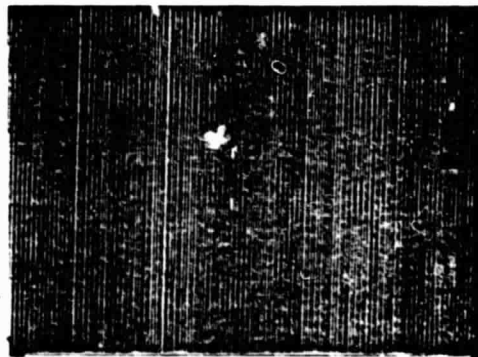

BEFORE TEST

NO PRELOAD

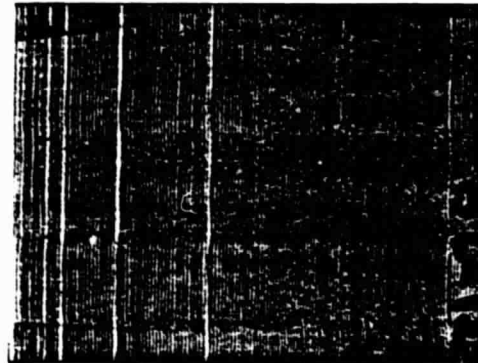


AFTER PRELOAD



AFTER MOISTURE CONDITIONING



10 CYCLES

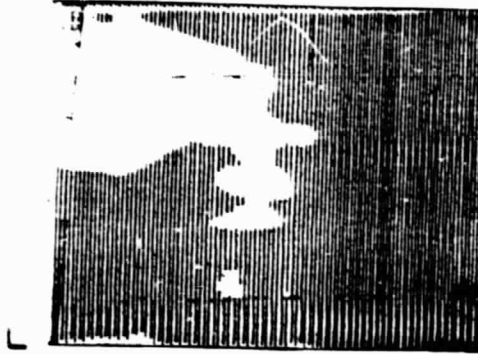

10<sup>3</sup> CYCLES



ORIGINAL PAGE IS  
OF POOR QUALITY

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.5

TEST TEMPERATURE 422 K (300 °C)

LAMINATE L1


SPECIMEN NO. L1-31-28

DEFECT 5/8 PP 6.11

TEST TYPE CYCLIC

MAXIMUM LOAD -

ULTRASONIC C-SCAN DATA

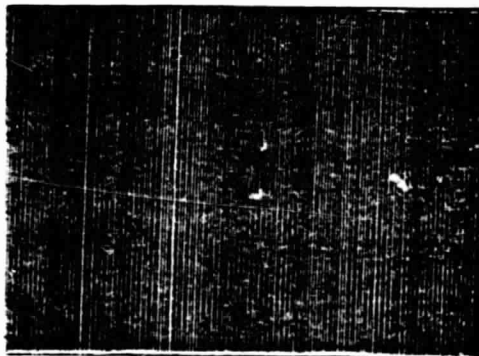

295

NO PRELOAD




BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD

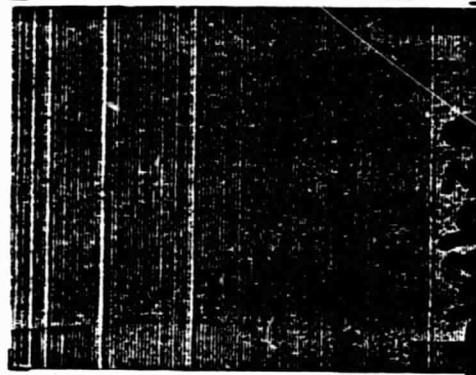


AFTER MOISTURE CONDITIONING



LI-31-29



100 CYCLES

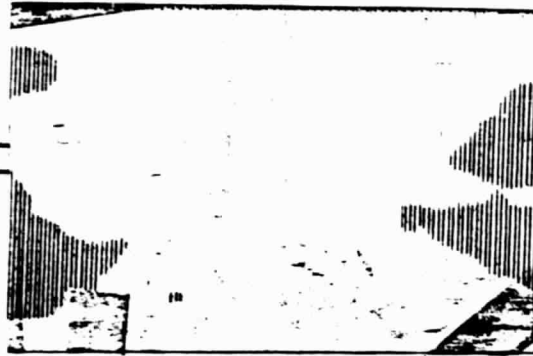

10<sup>6</sup> CYCLES

LAMINATE LI

SPECIMEN NO. LI-31-29

DEFECT S/S FIP SMT

TEST TYPE CYCLIC


R RATIO 0.05

CYCLIC LOAD 46.1 kN (10.5 kip)


TEST TEMPERATURE 122 K (300 °C)

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

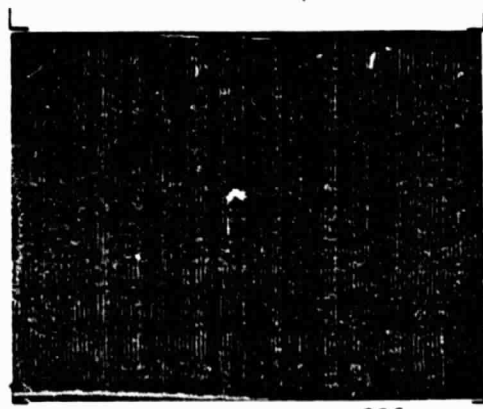

NO PRELOAD

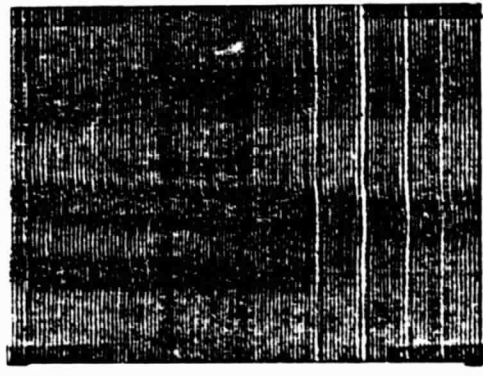

BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD

LAMINATE L1

SPECIMEN NO. L1-31-30

DEFECT S/S PP SUT

TEST TYPE CYCUL

AFTER MOISTURE CONDITIONING



100 CYCLES




CYCLES

CYCLIC LOAD 44.1 kN (10.2 kip)

R RATIO 0.05

TEST TEMPERATURE 42.4 (300°F)



ULTRASONIC C-SCAN DATA

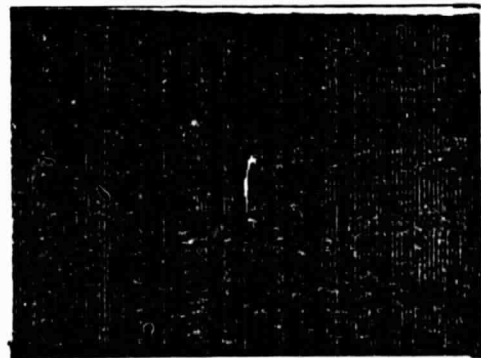

NO PRELOAD

BEFORE TEST

LAMINATE LI  
SPECIMEN NO. LI-31-31  
DEFECT 2/8 FP SLIT  
TEST TYPE CYCLOC

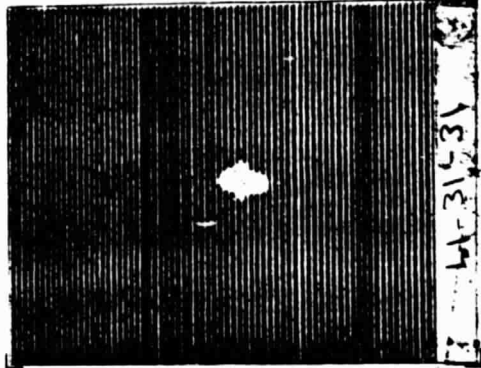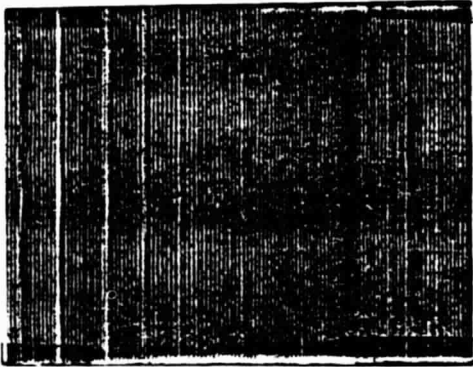

AFTER MOISTURE CONDITIONING


10 CYCLES

CYCLIC LOAD 40 kN (9 kip)  
R RATIO -1.0  
TEST TEMPERATURE Room



750 CYCLES  
(FAILURE)

ULTRASONIC C-SCAN DATA

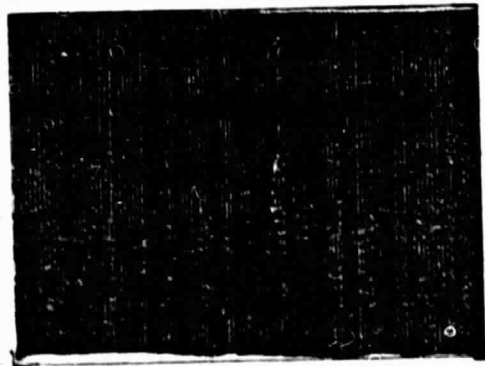

NO PRELOAD

BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD

LAMINATE

L1

SPECIMEN NO.


L1-31-32

DEFECT


5/8 EP SLIT

TEST TYPE

CYCLES

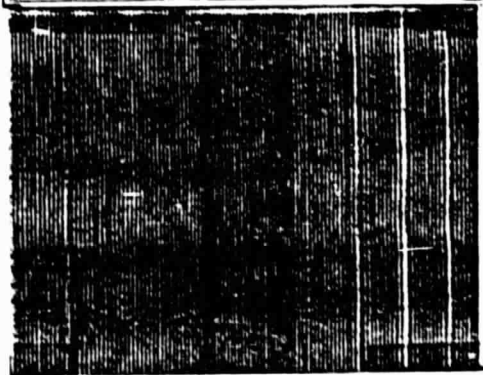

AFTER MOISTURE CONDITIONING

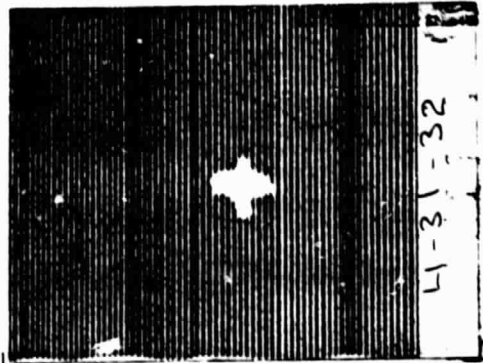

100 CYCLES

CYCLIC LOAD 40 kN (9.0 kip)

R RATIO

-1.0

TEST TEMPERATURE

900H



100 CYCLES  
(FAILURE)




L1-31-32

ORIGINAL PAGE IS  
OF POOR QUALITY



ULTRASONIC C-SCAN DATA

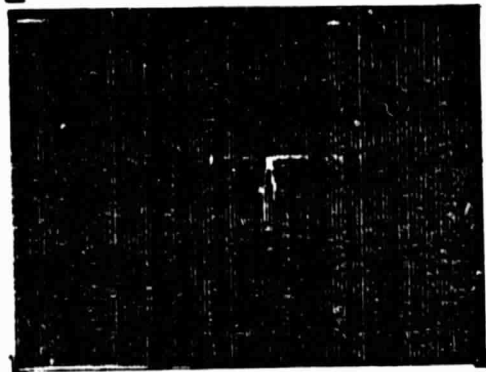

NO PRELOAD





AFTER PRELOAD

MAXIMUM LOAD

BEFORE TEST

LAMINATE LI  
SPECIMEN NO. LI-31-33  
DEFECT 5/8 FP SLIT  
TEST TYPE CYCLES

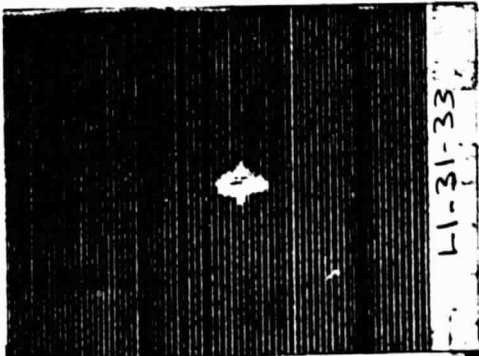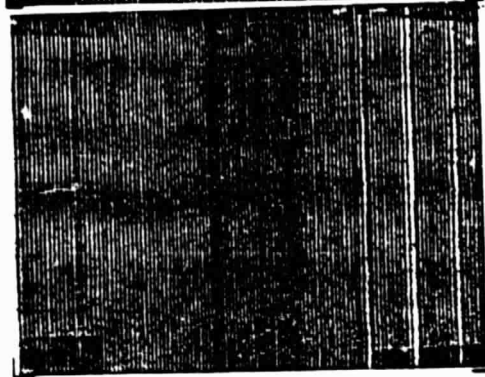


AFTER MOISTURE CONDITIONING

CYCLIC LOAD 37.8 kN (8.5 kip)

R RATIO -1.0

TEST TEMPERATURE Room

2,800 CYCLES  
(FAILURES)

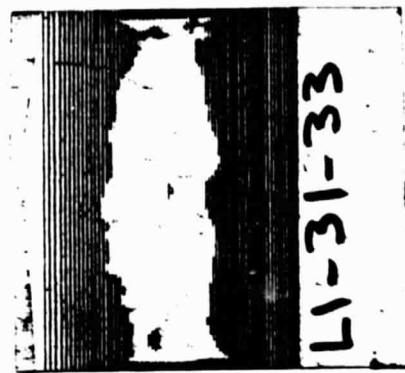


LI-31-33

ULTRASONIC C-SCAN DATA




BEFORE TEST

NO PRELOAD

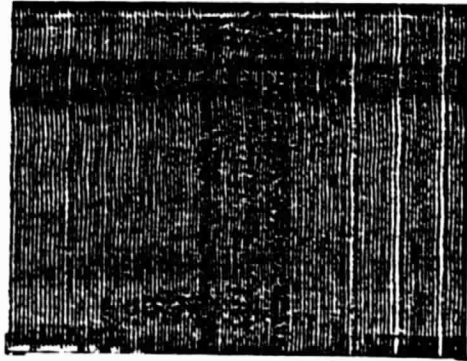

AFTER MOISTURE CONDITIONING

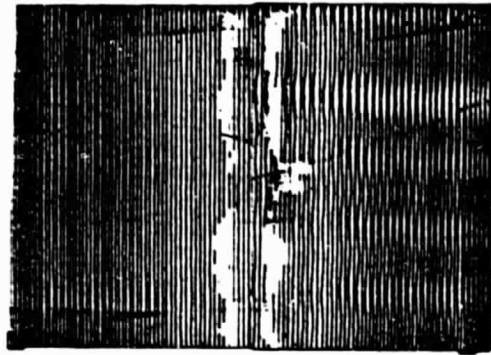

2 CYCLES  
(FAILURE)

CYCLES

CYCLIC LOAD 26.7 kN (6.0 kip)

R RATIO -1.0

TEST TEMPERATURE 422 K (300 °F)

LAMINATE L1

SPECIMEN NO. L1-31-34

DEFECT 5/8 FP SLIT

TEST TYPE CYCLIC

AFTER PRELOAD

MAXIMUM LOAD



ULTRASONIC C-SCAN DATA



BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-35


DEFECT 5/8 IN SLIT

TEST TYPE CYC

NO PRELOAD



NOT CONDITIONED

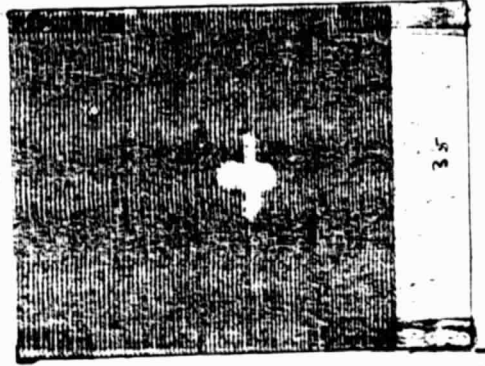


AFTER PRELOAD



MAXIMUM LOAD

10 CYCLES

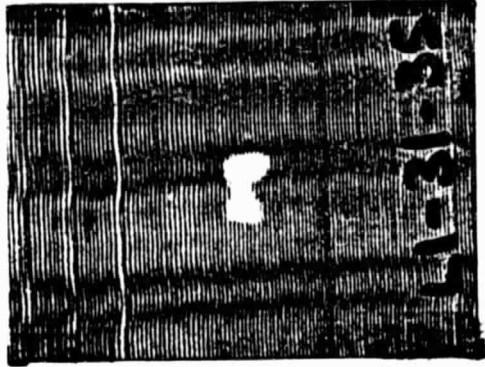

10 CYCLES




CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE ROOM

ULTRASONIC C-SCAN DATA

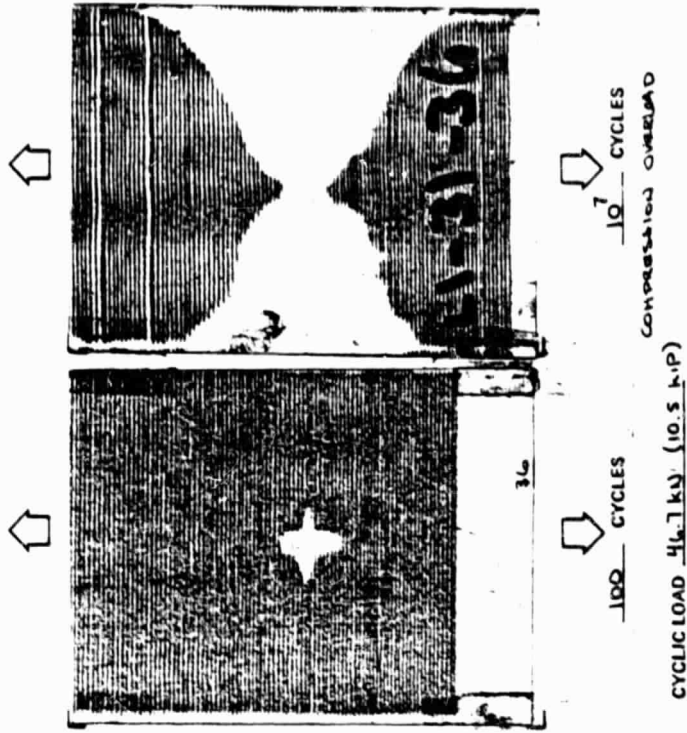

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

MAXIMUM LOAD

CYCLIC LOAD 46.7 kN (10.5 kIP)

R RATIO 0.05

TEST TEMPERATURE ROOM

LAMINATE LI


SPECIMEN NO. LI-31-36

DEFECT 5/8 PD SLIT

TEST TYPE CYCLIC

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

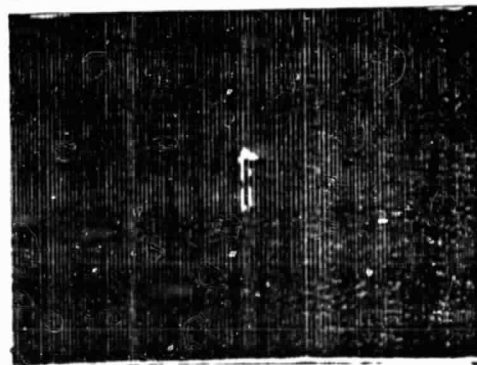


BEFORE TEST




NO PRELOAD

NOT CONDITIONED

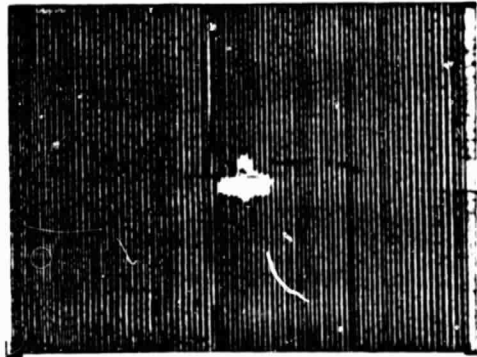

10 CYCLES

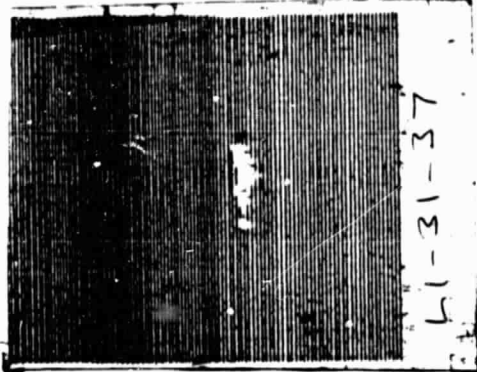

10<sup>3</sup> CYCLES

AFTER MOISTURE CONDITIONING



AFTER PRELOAD

MAXIMUM LOAD

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 422 K (300 °F)

ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE LI  
SPECIMEN NO. LI-31-37  
DEFECT 5/8 FP SLIT  
TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA



BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-B

DEFECT 5/8 PD SLIT

TEST TYPE CYCLES


NO PRELOAD

NOT CONDITIONED




AFTER PRELOAD

MAXIMUM LOAD

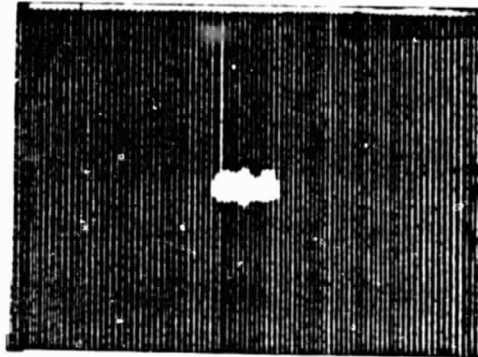

100 CYCLES

AFTER MOISTURE CONDITIONING

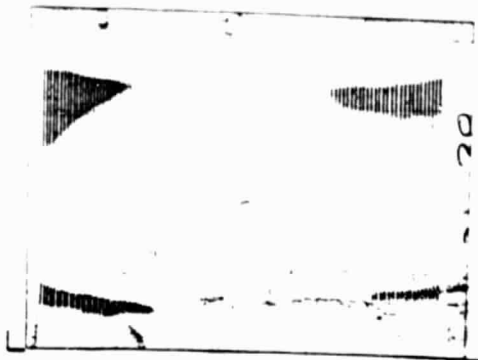

10 CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 422 K (300 °F)

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA



BEFORE TEST

NO PRELOAD

NOT CONDITIONED



AFTER PRELOAD

AFTER MOISTURE CONDITIONING

150 CYCLES

CYCLES

MAXIMUM LOAD

CYCLIC LOAD 46.1 kN (10.3 kip)

R RATIO 0.05

TEST TEMPERATURE 422 K (300 F)

LAMINATE LI

SPECIMEN NO. LI-31-39

DEFECT 5/8 IN SLIT

TEST TYPE CYCLIC


ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA



NO PRELOAD

NOT CONDITIONED

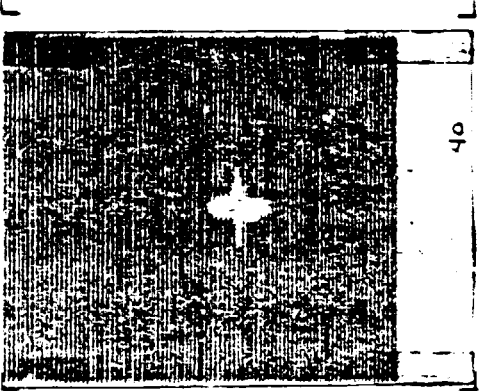

40



BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

10 CYCLES

CYCLES

MAXIMUM LOAD

CYCLIC LOAD 40.0 kN (9.0 kip)

R RATIO

-1.0

TEST TEMPERATURE

ROOM

LAMINATE

E1

SPECIMEN NO.

E1-31-40

DEFECT

5/8 HP SLIT

TEST TYPE

CYCLES



ULTRASONIC C-SCAN DATA



BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-41

DEFECT 2/8 EP SALT

TEST TYPE CSS-15

NO PRELOAD




AFTER PRELOAD

MAXIMUM LOAD

NOT CONDUCTED

AFTER MOISTURE CONDITIONING

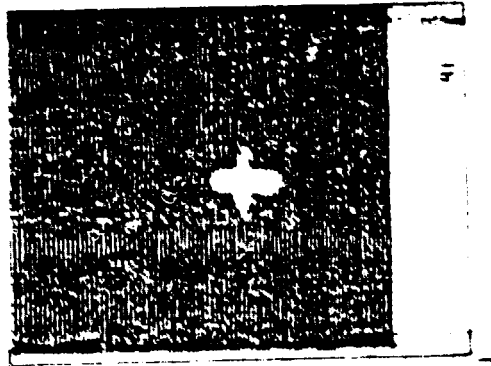

100 CYCLES

CYCLIC LOAD 37.8 kN (8.5 kip)

R RATIO -1.0

TEST TEMPERATURE ROOM



CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA



BEFORE TEST

NO PRELOAD

NOT CONDITIONED





AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING



10 CYCLES

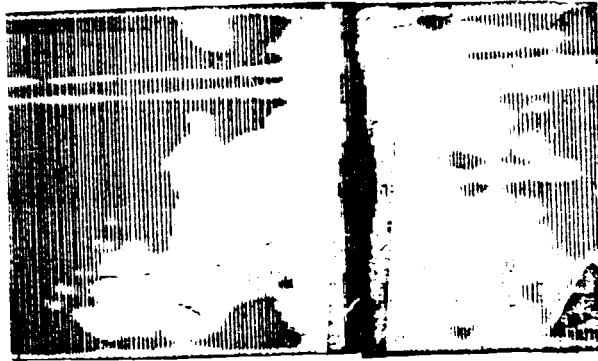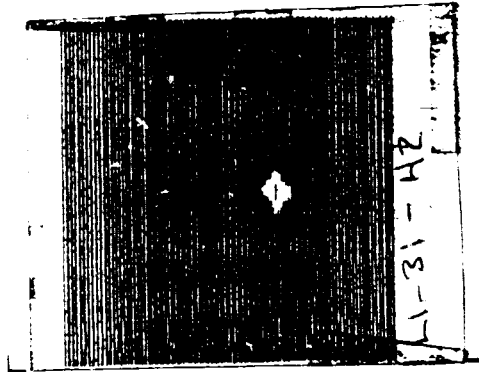

25 CYCLES

ORIGINAL COPY IS  
OF POOR QUALITY

CYCLIC LOAD 46.9 kN (10.5 kip)

R RATIO -1.0

TEST TEMPERATURE 472 K (300 °F)


LAMINATE 11

SPECIMEN NO. 11-31-42

DEFECT 5/8 EP SLIT

TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

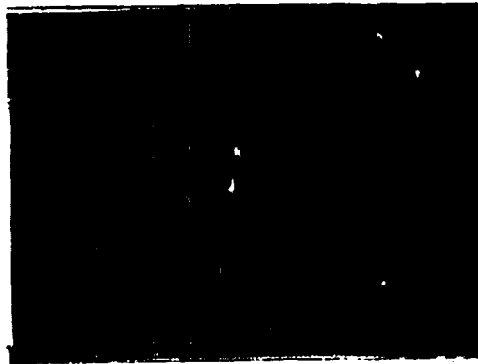

BEFORE TEST

LAMINATE 15



SPECIMEN NO. 11-31-N3

DEFECT 5/8" x 1/4" x 1/4"

TEST TYPE CYCLIC

NO PRELOAD

NOT CONDITIONED

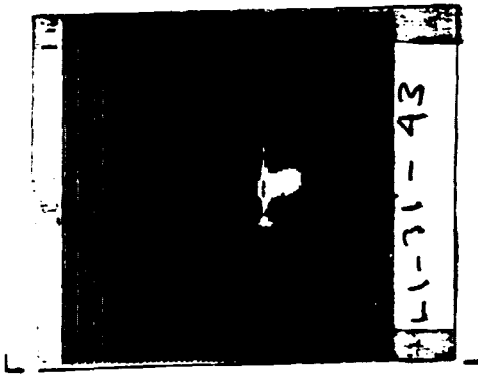

AFTER PRELOAD

AFTER MOISTURE CONDITIONING



MAXIMUM LOAD —

100 CYCLES

CYCLIC LOAD 40.0 kN (9.0 kip)


R RATIO -1.0

TEST TEMPERATURE 43.3 k (100 °F)

1750 CYCLES  
(FAILURE)




ULTRASONIC C-SCAN DATA

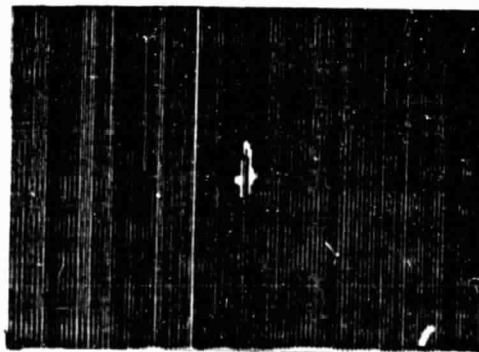

NO DEFECT

NOT CONDITIONED

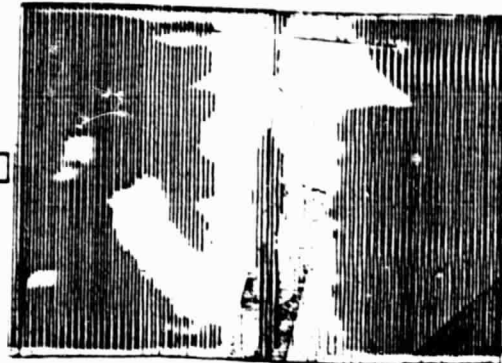

BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD



100 CYCLES



1550 CYCLES  
(FAILING)

LAMINATE L1

SPECIMEN NO. L1-31-44

DEFECT 2/8 FP SALT

TEST TYPE CYCLIC


CYCLIC LOAD 31.8 kN (8.5 kip)

R RATIO -1.0

TEST TEMPERATURE 422 K (300 °F)

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

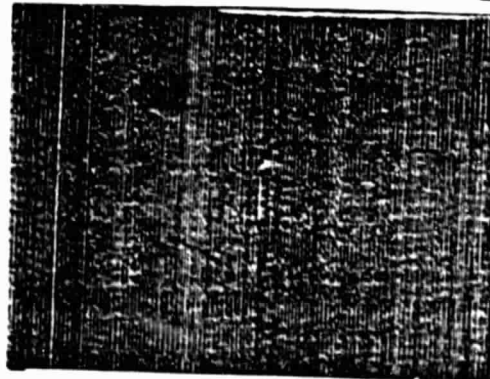

NO PRELOAD

BEFORE TEST


MAXIMUM LOAD

LAMINATE LI

SPECIMEN NO. LI-31-45

DEFECT 5/8 EP SLIT

TEST TYPE CYCLIC

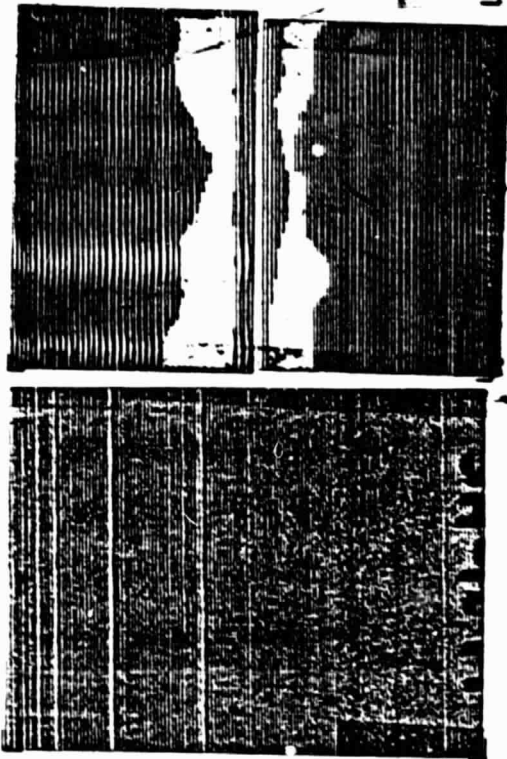

AFTER MOISTURE CONDITIONING

1 CYCLES

1 CYCLES


ORIGINAL PAGE IS  
OF POOR QUALITY

OVERLOAD 28.9 kN (6.5 kip)

R RATIO -1.0

TEST TEMPERATURE 421 K (300 °F)

ULTRASONIC C-SCAN DATA

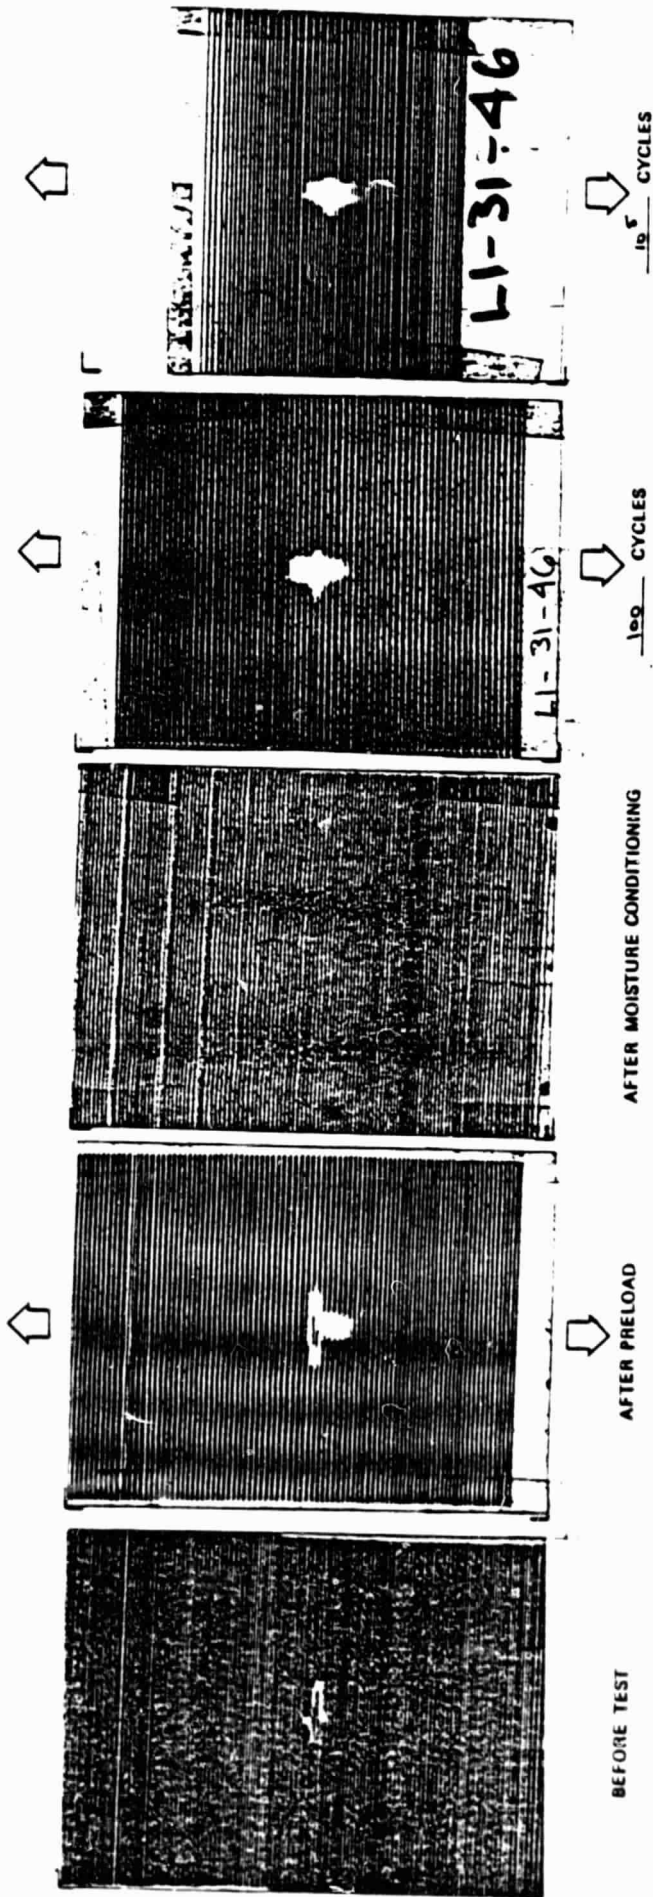

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE Room

MAXIMUM LOAD 48.9 kN (11.0 kip)

LAMINATE L1

SPECIMEN NO. L1-31-46

DEFECT 5/8 in slit


TEST TYPE Cyclic

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA




BEFORE TEST

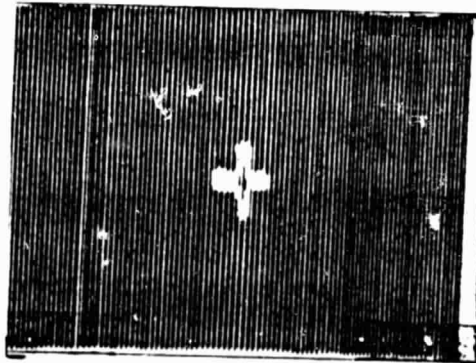

AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (11.0 kip)

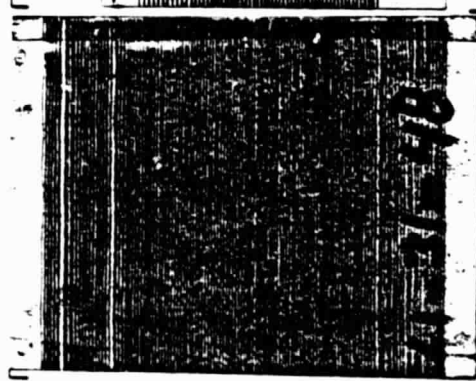

AFTER MOISTURE CONDITIONING




10<sup>3</sup> CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 412 K (100 F)

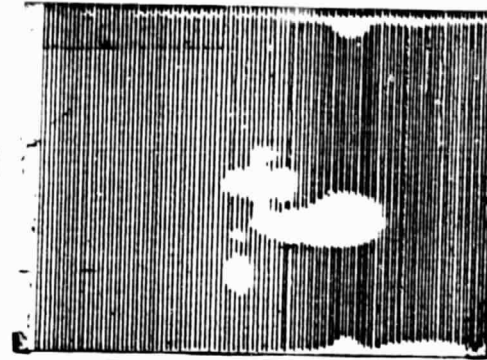


10<sup>3</sup> CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY


LAMINATE L1  
SPECIMEN NO. L1-31-48  
DEFECT 5/8 PD SLT  
TEST TYPE CYCLIC

ORIGINAL PAGE IS  
OF POOR QUALITY


ULTRASONIC C-SCAN DATA

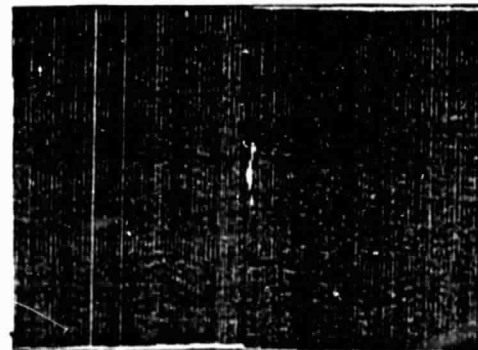

BEFORE TEST

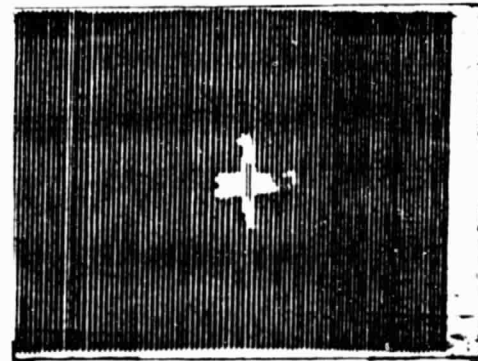

AFTER PRELOAD

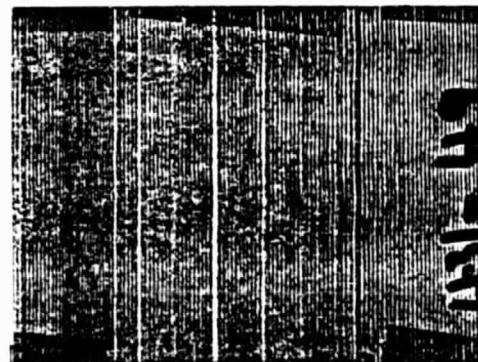

AFTER MOISTURE CONDITIONING



100 CYCLES



10<sup>6</sup> CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 41.1°C (106°F)

MAXIMUM LOAD 48.9 kN (11.0 kip)

LAMINATE L1


SPECIMEN NO. 11-31-49

DEFECT S/S FP SLIT


TEST TYPE CYCLES



ULTRASONIC C-SCAN DATA

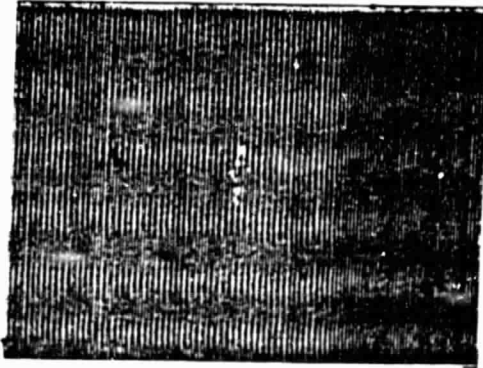


BEFORE TEST

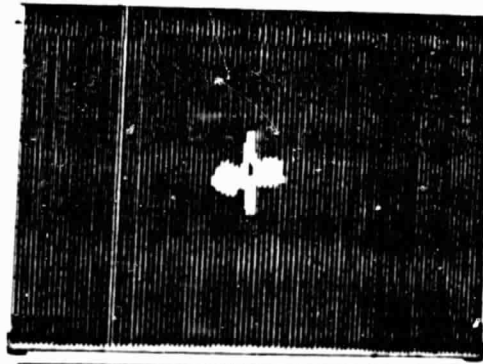


AFTER PRELOAD

MAXIMUM LOAD 489 KN (110 KIP)

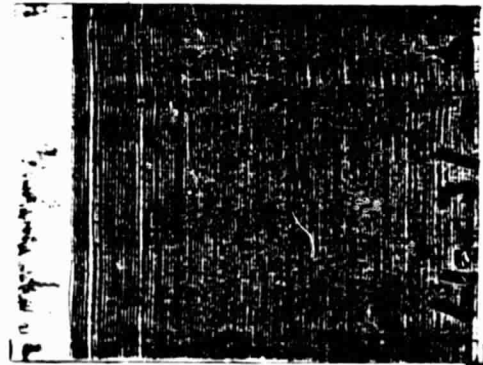

AFTER MOISTURE CONDITIONING

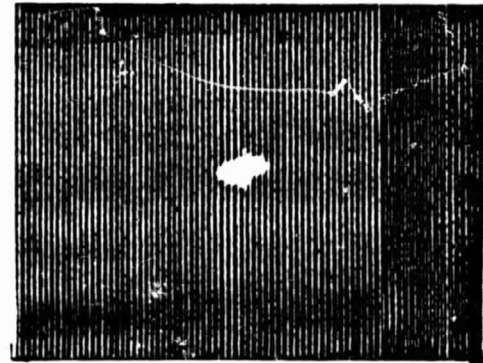


100 CYCLES

CYCLIC LOAD 400 KN (90 KIP)

R RATIO -1.0

TEST TEMPERATURE ROOM

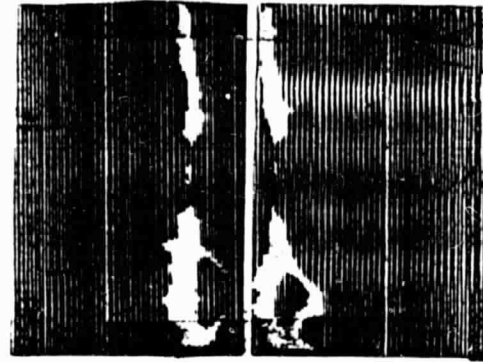


150 CYCLES


(FAILURES)

ORIGINAL PAGE IS  
OF POOR QUALITY


ULTRASONIC C-SCAN DATA

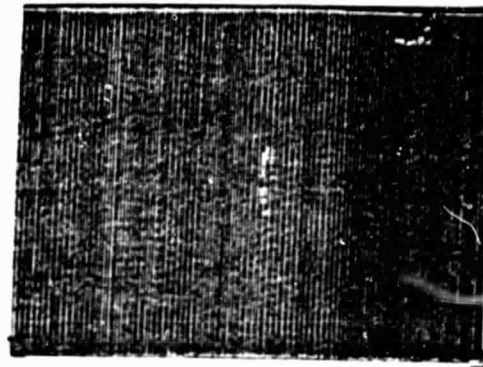


BEFORE TEST

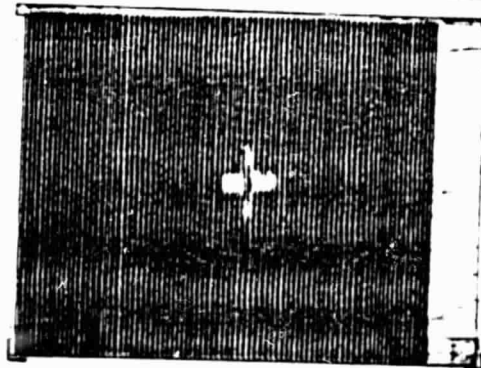


AFTER PRELOAD

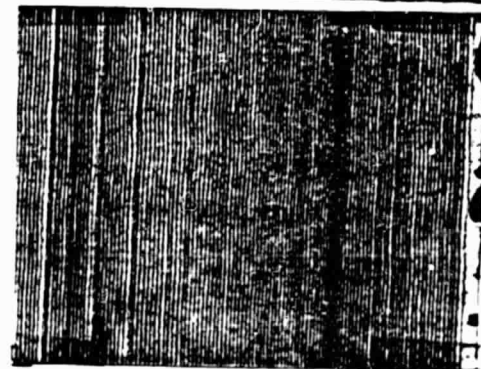

AFTER MOISTURE CONDITIONING

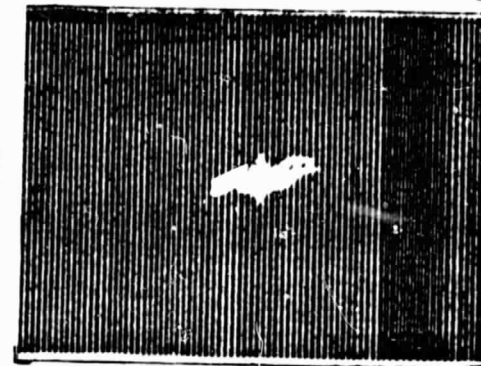

100 CYCLES

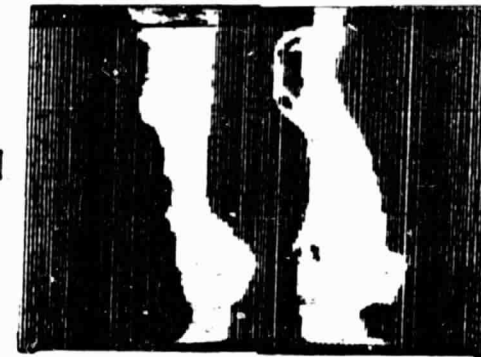

1100 CYCLES



MAXIMUM LOAD 48.8 kN (11.0 kip)

CYCLIC LOAD 40.0 kN (9.0 kip)

LAMINATE L1

SPECIMEN NO. L1-31-51

DEFECT 5/8 EP SLIT


TEST TYPE CYCLIC

R RATIO -1.0


TEST TEMPERATURE ROOM

ORIGINAL PAGE  
OF FOUR

ULTRASONIC C-SCAN DATA

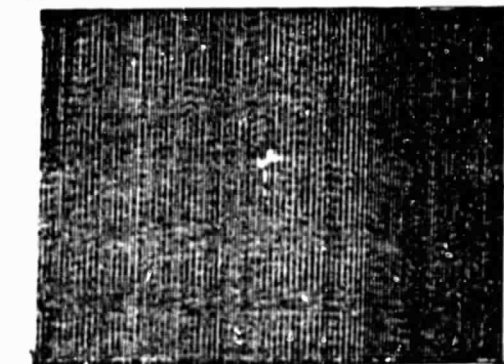


BEFORE TEST

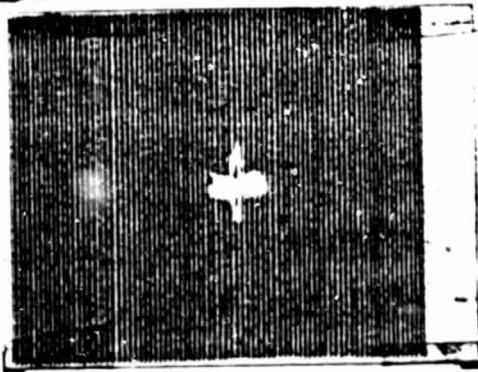


AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (110 kNIP)

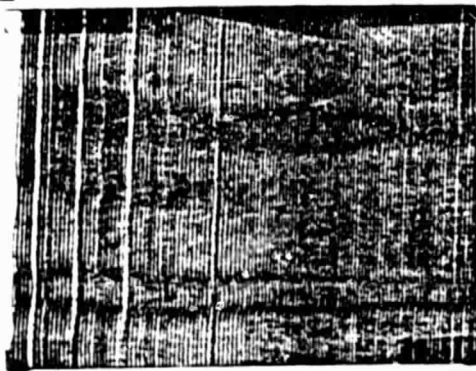

AFTER MOISTURE CONDITIONING

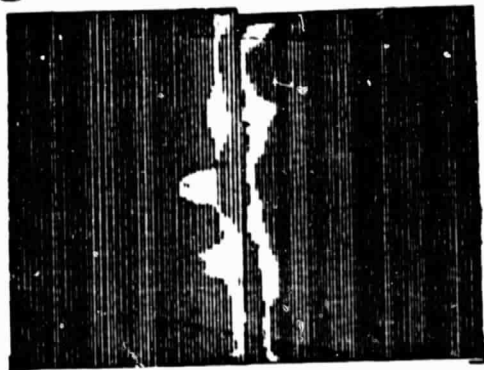

3 CYCLES

CYCLIC LOAD +33.9 kN (7.6 kip)  
-24.8 kN (5.5 kNIP)

R RATIO -0.02


TEST TEMPERATURE 422 K (300 °F)

3 CYCLES


ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE L1  
SPECIMEN NO. L1-31-52  
DEFECT 5/8 FP SLT  
TEST TYPE CYCLIC


ULTRASONIC C-SCAN DATA

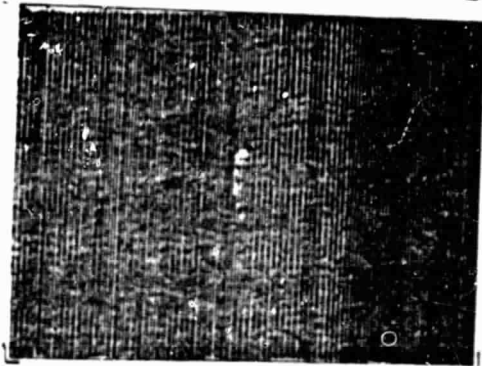

BEFORE TEST

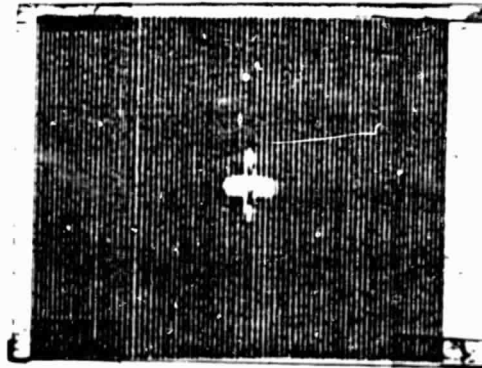


AFTER PRELOAD

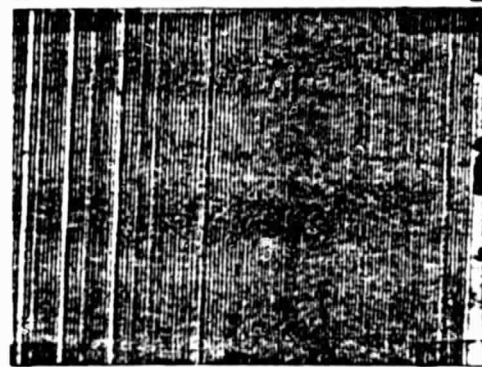

AFTER MOISTURE CONDITIONING



100 CYCLES

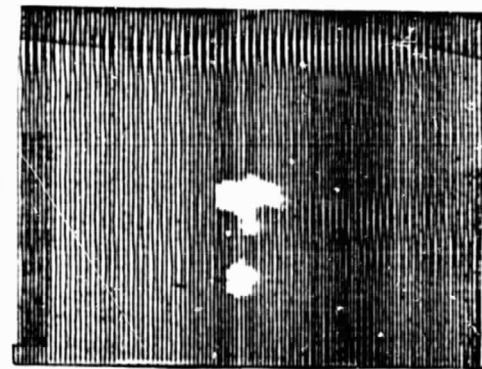

10<sup>6</sup> CYCLES

LAMINATE L1  
 SPECIMEN NO. L1-31-53  
 DEFECT 5/8 FP SLIT  
 TEST TYPE CYCLIC

MAXIMUM LOAD 48.9 kN (11.0 kip)


CYCLIC LOAD 13.3 kN (3.0 kip)

R RATIO -1.0


TEST TEMPERATURE 422 K (300 °F)

ORIGINAL PAGE IS  
 OF POOR QUALITY

ULTRASONIC C-SCAN DATA

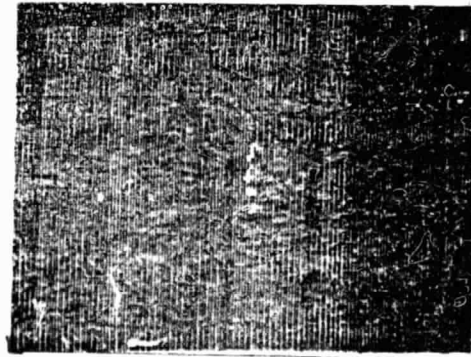


BEFORE TEST

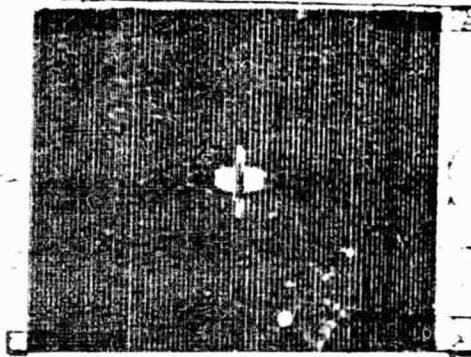

AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (11.0 kip)

NOT CONDITIONED

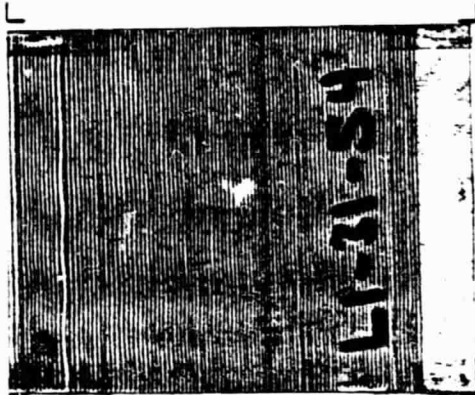

100 CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO .05


TEST TEMPERATURE Room

100 CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE LI  
SPECIMEN NO. LI-31-54  
DEFECT 5/8 PP SLIT  
TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

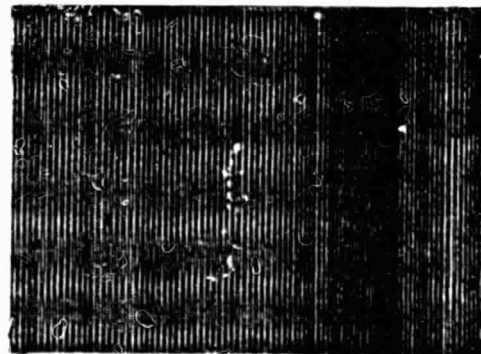

BEFORE TEST




AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (11.0 kip)

NOT COMPROMISED



AFTER MOISTURE CONDITIONING

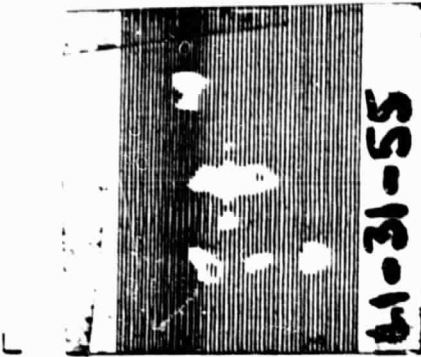

10<sup>3</sup> CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 422 K (300 °F)

LAMINATE L1


SPECIMEN NO. L1-31-55

DEFECT 5/8 PP 3LT

TEST TYPE CYCLIC

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

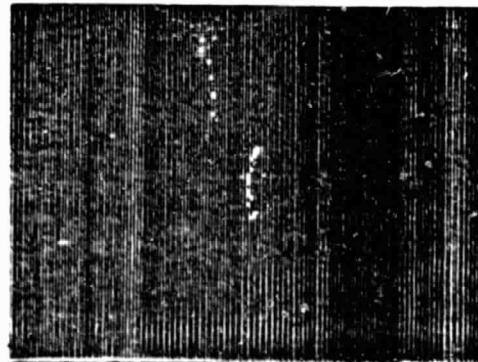

BEFORE TEST



AFTER PRELOAD  
FAILURE

MAXIMUM LOAD 45.3 kN (10.2 kip)

LAMINATE LI

SPECIMEN NO. LI-31-56

DEFECT 5/8 FP SLT

TEST TYPE CYCLIC (FAILURE DUE TO PRELOAD)

NOT CONDITIONED

AFTER MOISTURE CONDITIONING

CYCLIC LOAD \_\_\_\_\_

R RATIO \_\_\_\_\_


TEST TEMPERATURE \_\_\_\_\_

\_\_\_\_\_ CYCLES


\_\_\_\_\_ CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

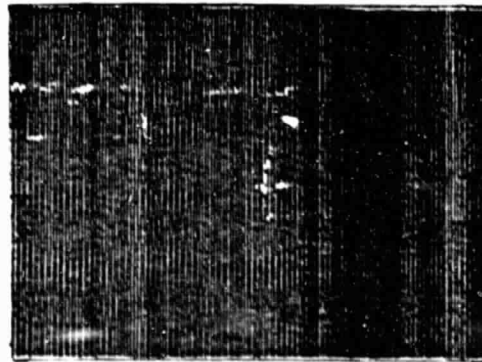


BEFORE TEST

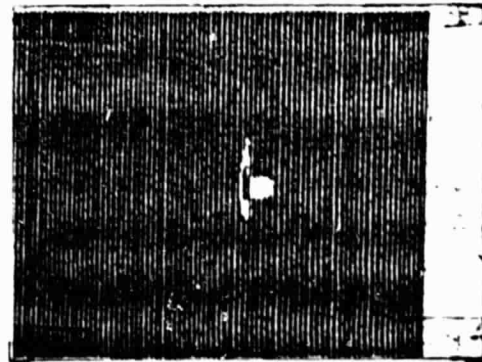

AFTER PRELOAD

NOT CONDITIONED

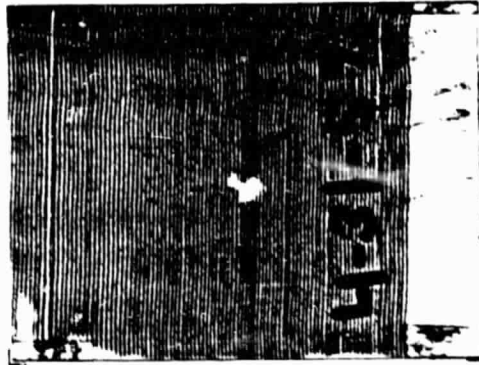

100 CYCLES



CYCLES

CYCLIC LOAD 37.8 kN (8.5 kip)

R RATIO -1.0

TEST TEMPERATURE ROOM

MAXIMUM LOAD 49.1 kN (11.0 kip)

LAMINATE L1

SPECIMEN NO. 11-31-57



DEFECT S/S FP SLT

TEST TYPE CYCLIC

ORIGINAL PAGE IS  
OF POOR QUALITY



ULTRASONIC C-SCAN DATA

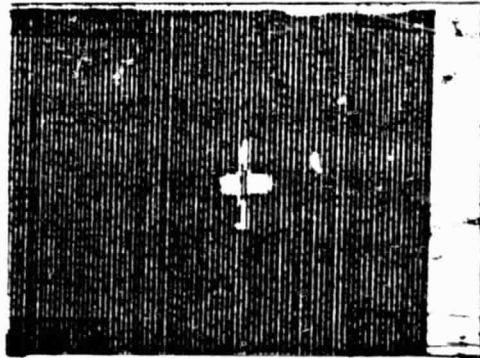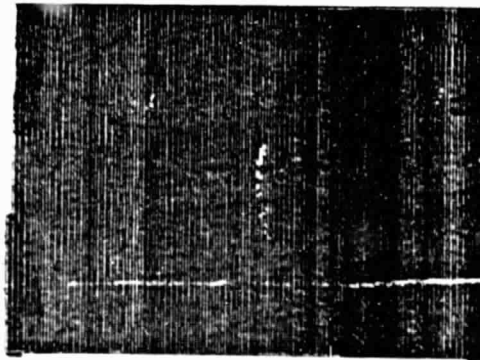

NOT CONDITIONED

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

CYCLES

3 CYCLES TO FAILURE

CYCLIC LOAD 40.0 kN (9.0 kip)

R RATIO -1.0

TEST TEMPERATURE 422 K (790 °F)

LAMINATE LI

SPECIMEN NO. LI-31-5B


DEFECT 5/8 WP SLIT

TEST TYPE CYCLIC

MAXIMUM LOAD 48.9 kN (11.0 kip)

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

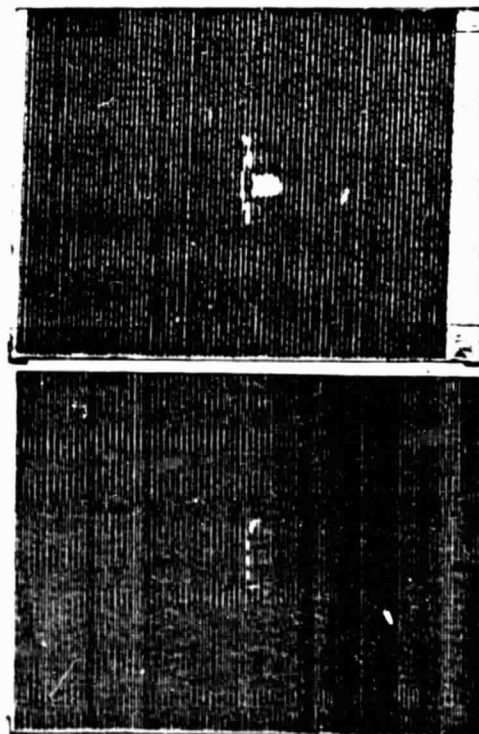


BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (11.0 kN.P)

NOT CONTINUED



CYCLES TO FAILURE

CYCLIC LOAD 39.1 kN (8.8 kN.P)

R RATIO -1.0

TEST TEMPERATURE 422 K (300 °F)


LAMINATE L1

SPECIMEN NO. L1-31-59

DEFECT S/B PD BLT

TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

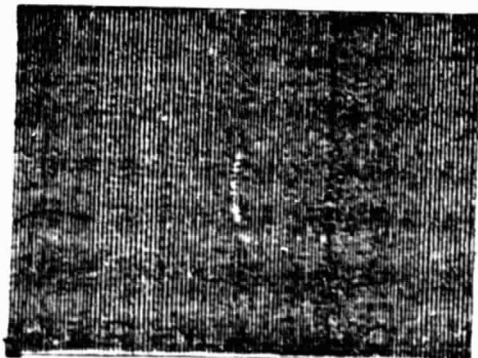

BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-60


DEFECT 5/8 PP SLT

TEST TYPE CYC


NO PRELOAD

AFTER PRELOAD

MAXIMUM LOAD

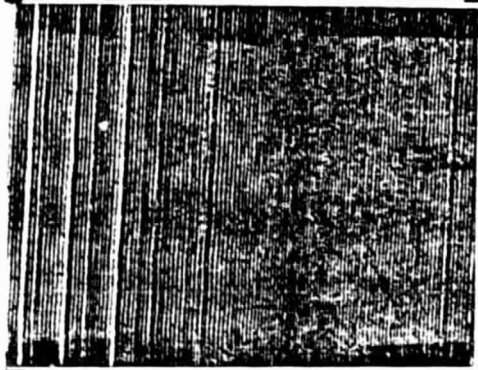

AFTER MOISTURE CONDITIONING

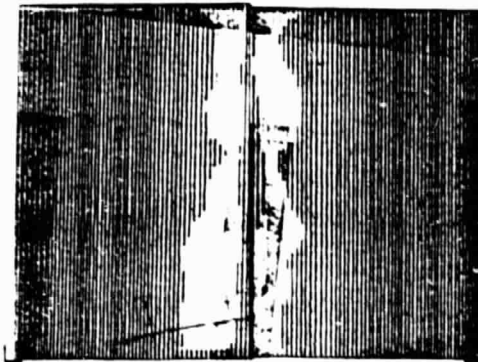

CYCLES



CYCLES

CYCLIC LOAD 21.84 kg (49.1)  
21.84 kg (49.1)

R RATIO

TEST TEMPERATURE 422 K (300 °F)

ULTRASONIC C-SCAN DATA

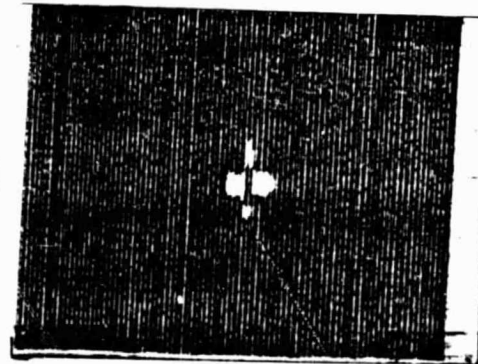
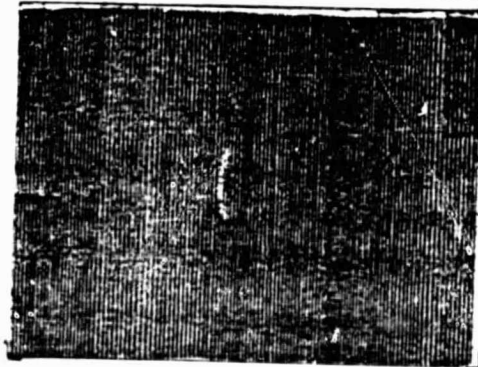


BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD 48.5 kN (11.0 kip)

AFTER MOISTURE CONDITIONING

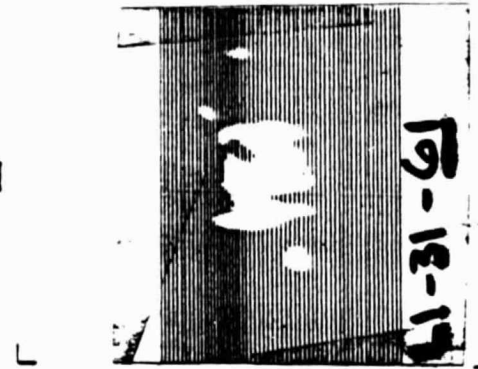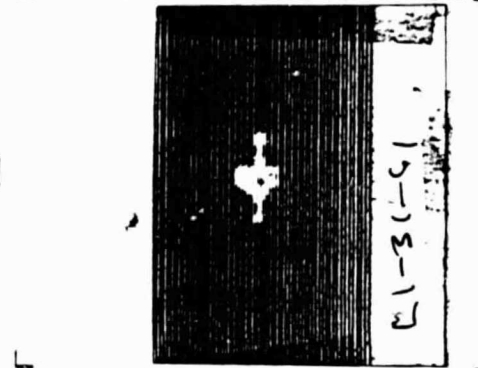

100 CYCLES

10 CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.95

TEST TEMPERATURE 472 K (300 °F)

ORIGINAL PAGE IS  
OF POOR QUALITY


LAMINATE L1

SPECIMEN NO. L1-31-61

DEFECT 5/8 PP DEFECT

TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

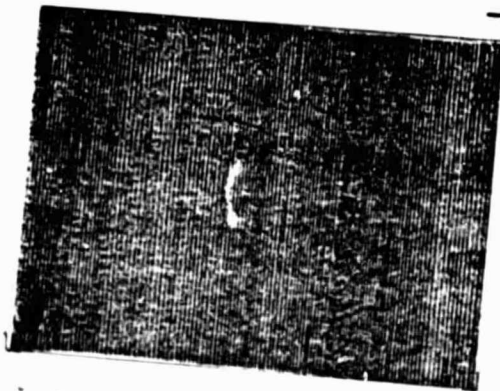

NO PRELOAD

NOT CONDITIONED

NOT CYCLED

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING

\_\_\_\_ CYCLES

\_\_\_\_ CYCLES

LAMINATE LI

SPECIMEN NO. LI-31-62

DEFECT 5/8 PP SLIT

TEST TYPE DRY RT TENSION


CYCLIC LOAD

R RATIO

TEST TEMPERATURE

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

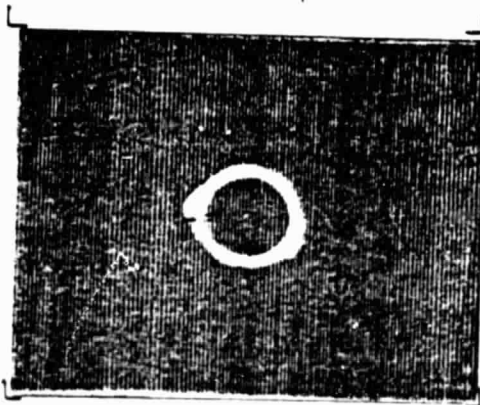

NO PRELOAD

NOT CONDITIONED

NOT CYCLED

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

CYCLES

CYCLES

MAXIMUM LOAD

CYCLIC LOAD

LAMINATE L1

SPECIMEN NO. L1-31-63


DEFECT 5/8 FP HOLE

TEST TYPE SINUS RT TENSION

R RATIO

TEST TEMPERATURE

ULTRASONIC C-SCAN DATA

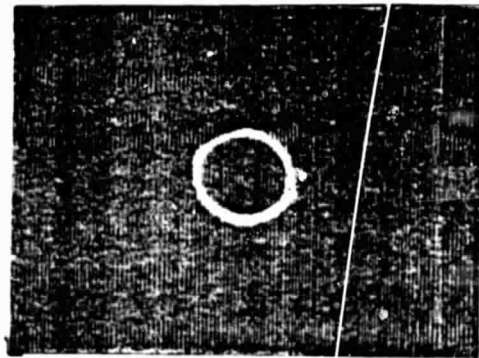

NO PRELOAD



BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD

LAMINATE LI


SPECIMEN NO. LI-31-64

DEFECT D/B FP HOLE

TEST TYPE CYCLIC



AFTER MOISTURE CONDITIONING

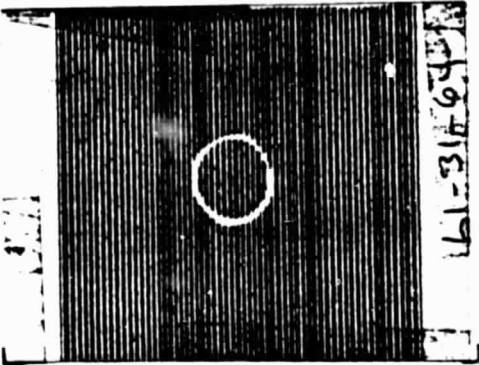

10 CYCLES



10<sup>3</sup> CYCLES


CYCLIC LOAD 46.7 k (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE ROOM

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

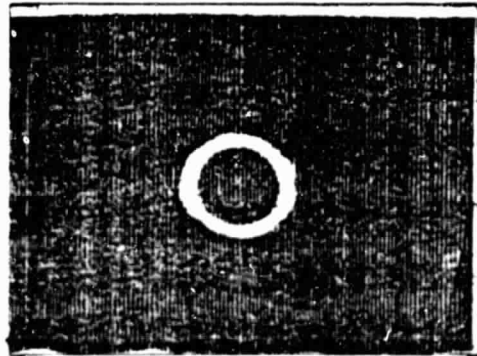

BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-65

DEFECT 5/8 IN HOLE

TEST TYPE CYCLIC

NO PRELOAD



AFTER PRELOAD


MAXIMUM LOAD           



AFTER MOISTURE CONDITIONING



10<sup>2</sup> CYCLES

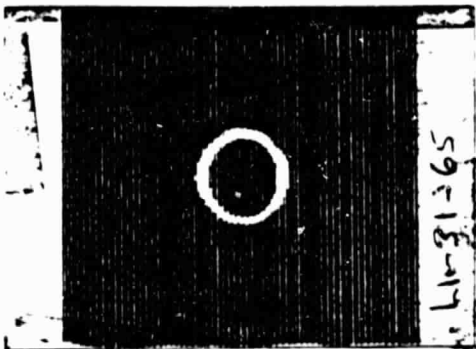


CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.45

TEST TEMPERATURE ROOM

10<sup>6</sup> CYCLES

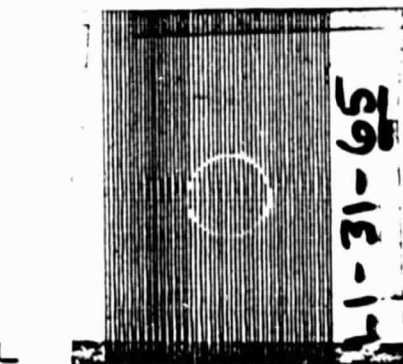


ORIGINAL PAGE IS  
OF POOR QUALITY



ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

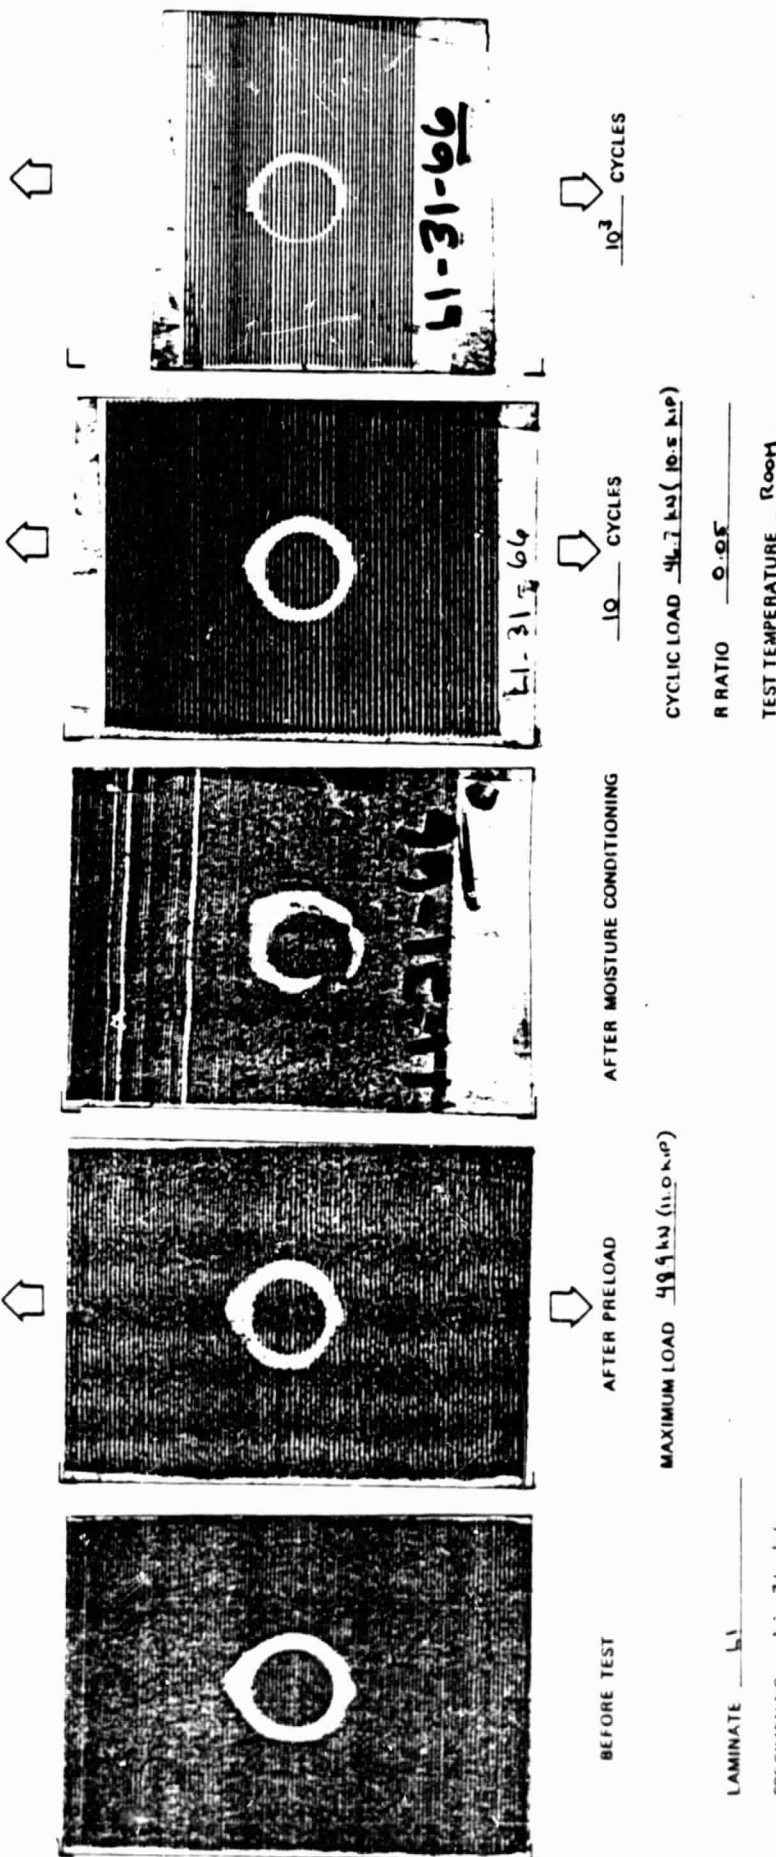


LAMINATE L1

SPECIMEN NO. L1-31-66

DEFECT 5/8" FF HOLE

TEST TYPE CYCCLIC

ULTRASONIC C-SCAN DATA

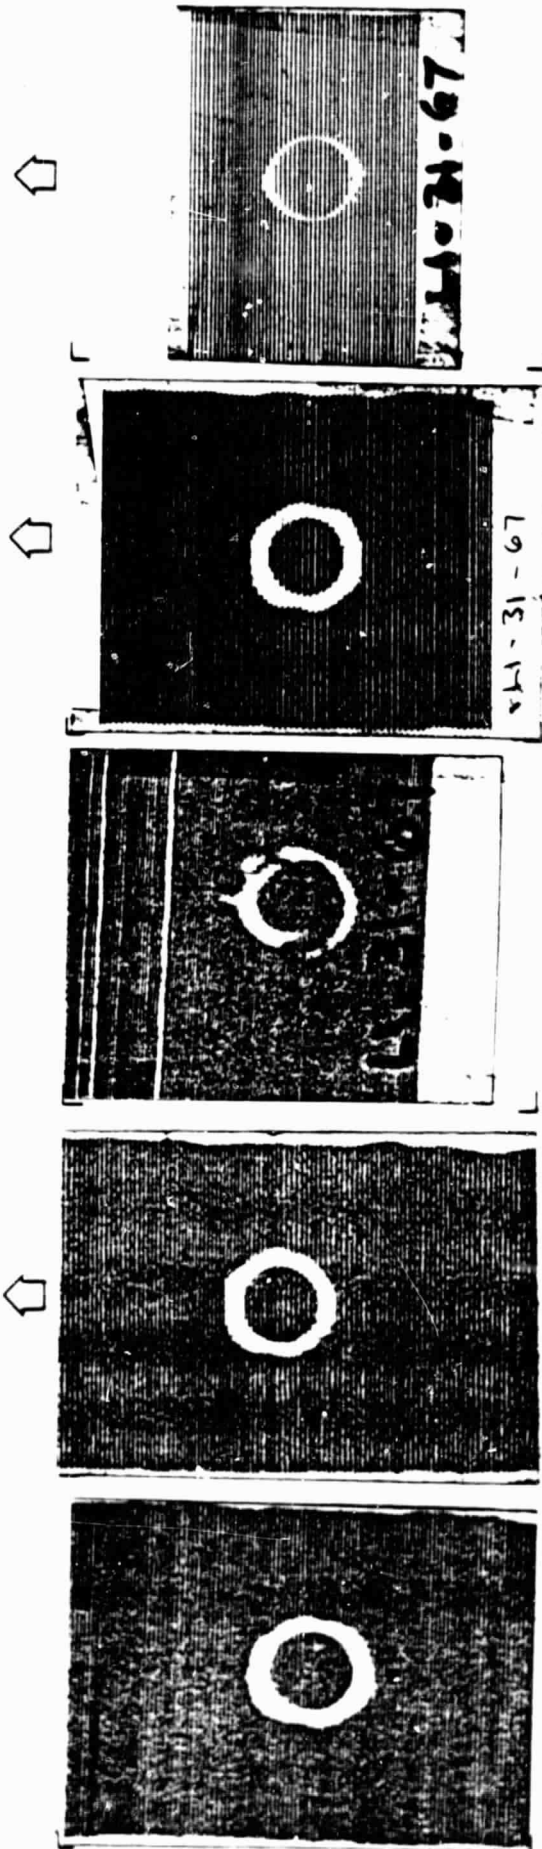

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

100 CYCLES

10<sup>6</sup> CYCLES

MAXIMUM LOAD 48.9 kN (11.0 kip)

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.95

TEST TEMPERATURE ROOM

LAMINATE L1


SPECIMEN NO. L1-31-67

DEFECT 5/8 IN HOLE

TEST TYPE CYCLIC

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

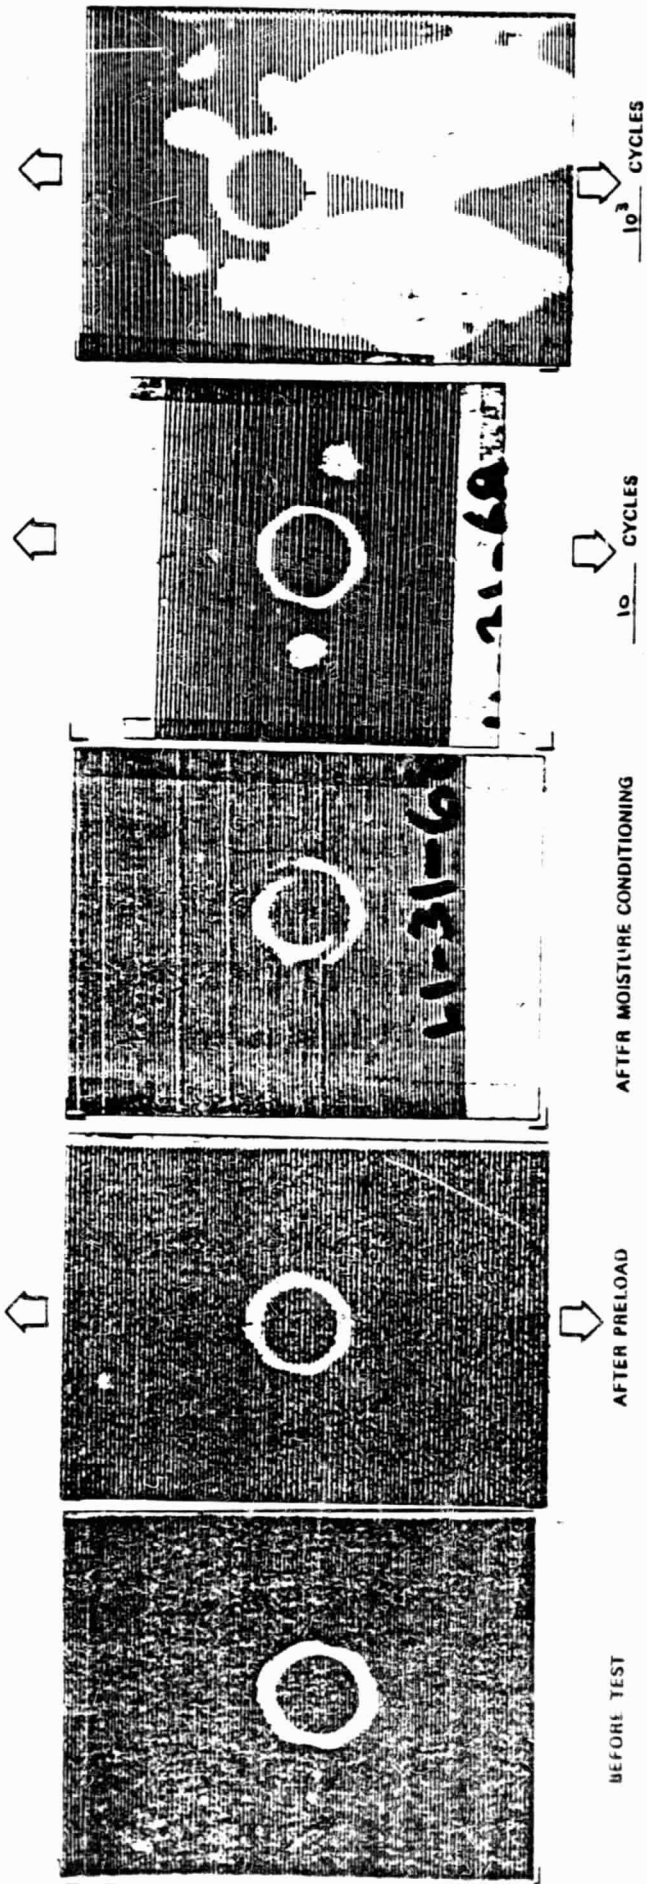

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

10 CYCLES

10<sup>3</sup> CYCLES

MAXIMUM LOAD 48.9 kN (11,000 lbf)

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 432 K (300 °F)

LAMINATE L1

SPECIMEN NO. L1-31-68


DEFECT 5/8" SP HOLE

TEST TYPE CYCCLC


ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY


ULTRASOUND C-SCAN DATA

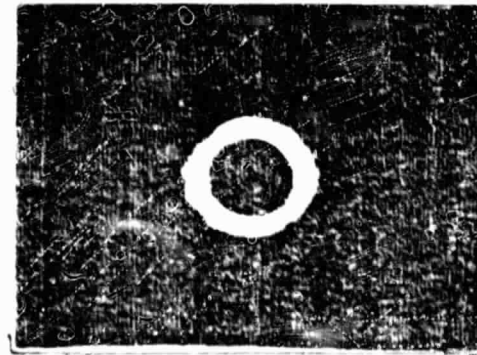


BEFORE TEST

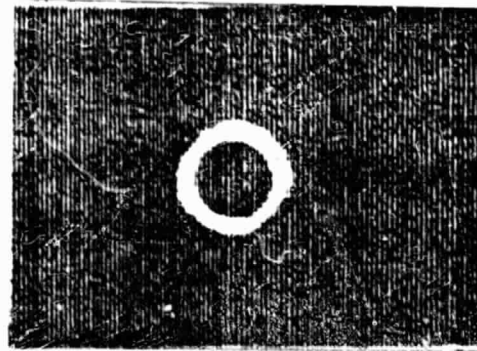


AFTER PRELOAD

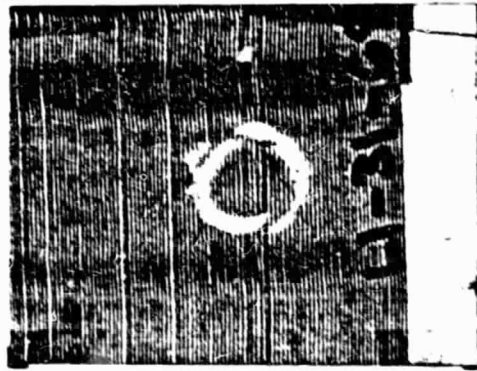

AFTER MOISTURE CONDITIONING

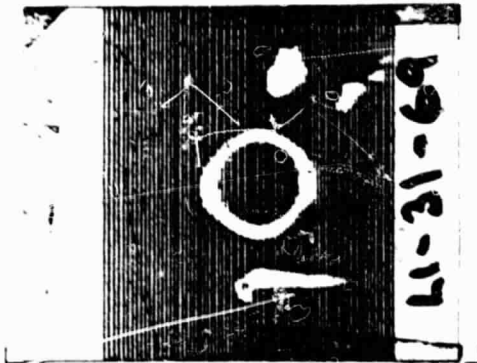

10 CYCLES

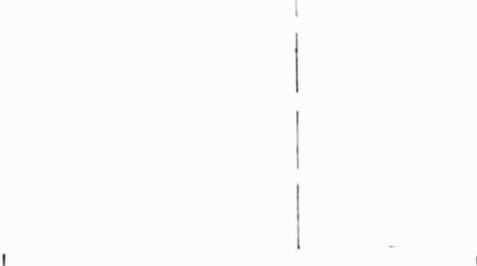

CYCLES

LAMINATE LI

SPECIMEN NO. LI-31-69

DEFECT 5/8 PP HOLE

TEST TYPE CYCLES

MAXIMUM LOAD 48.9 kN (11,000 lb)


CYCLIC LOAD 48.9 kN (10.8 kip)

R RATIO 0.05


TEST TEMPERATURE 422 K (300 °F)

ORIGINAL PAGE IS  
OF POOR QUALITY


ULTRASONIC C-SCAN DATA

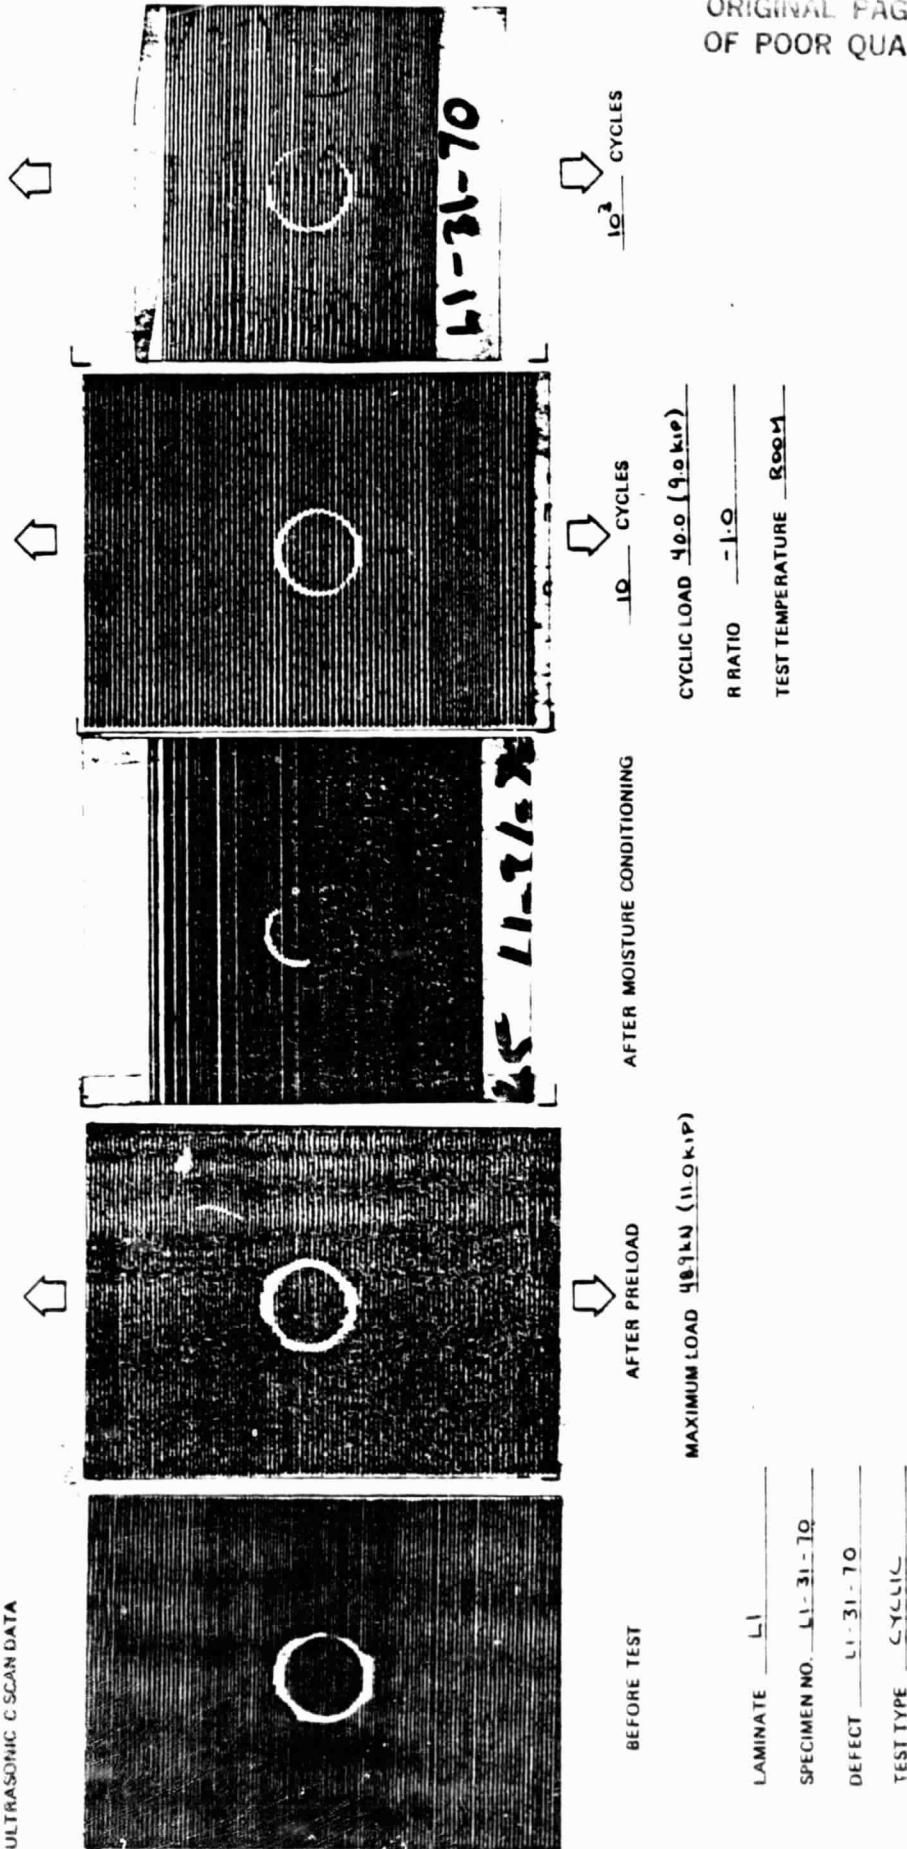

ULTRASONIC C-SCAN DATA

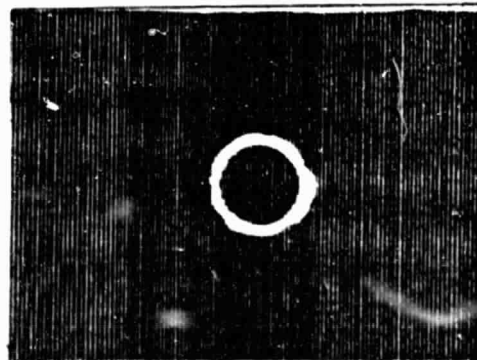


BEFORE TEST

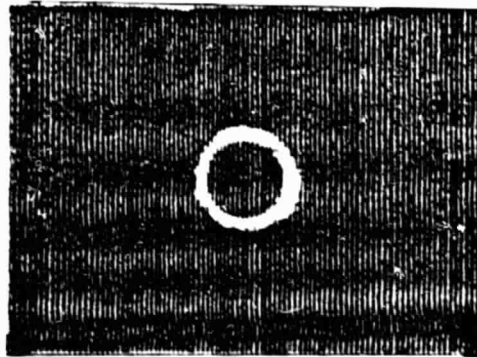


AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (11,041 lb)

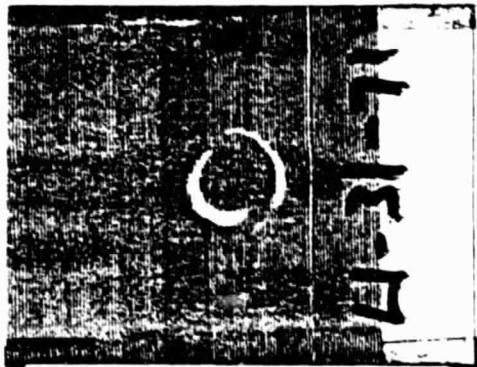

AFTER MOISTURE CONDITIONING

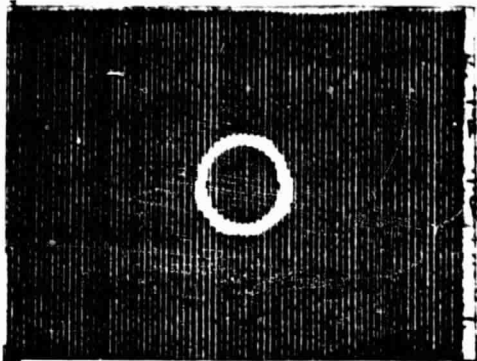


100 CYCLES

CYCLIC LOAD 40.0 kN (9,004 lb)

R RATIO -1.0

TEST TEMPERATURE ROOM

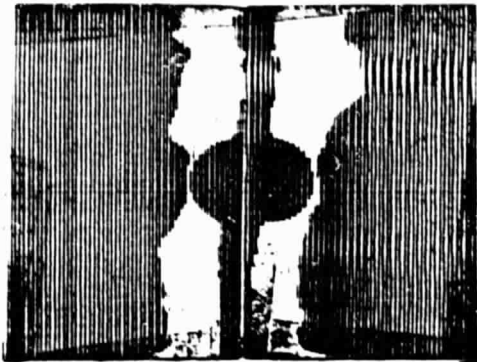


1250 CYCLES  
(FAILURE)

ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE L1  
SPECIMEN NO. L1-31-71  
DEFECT 5/8 IN HOLE  
TEST TYPE CYCLIC



ULTRASONIC C-SCAN DATA

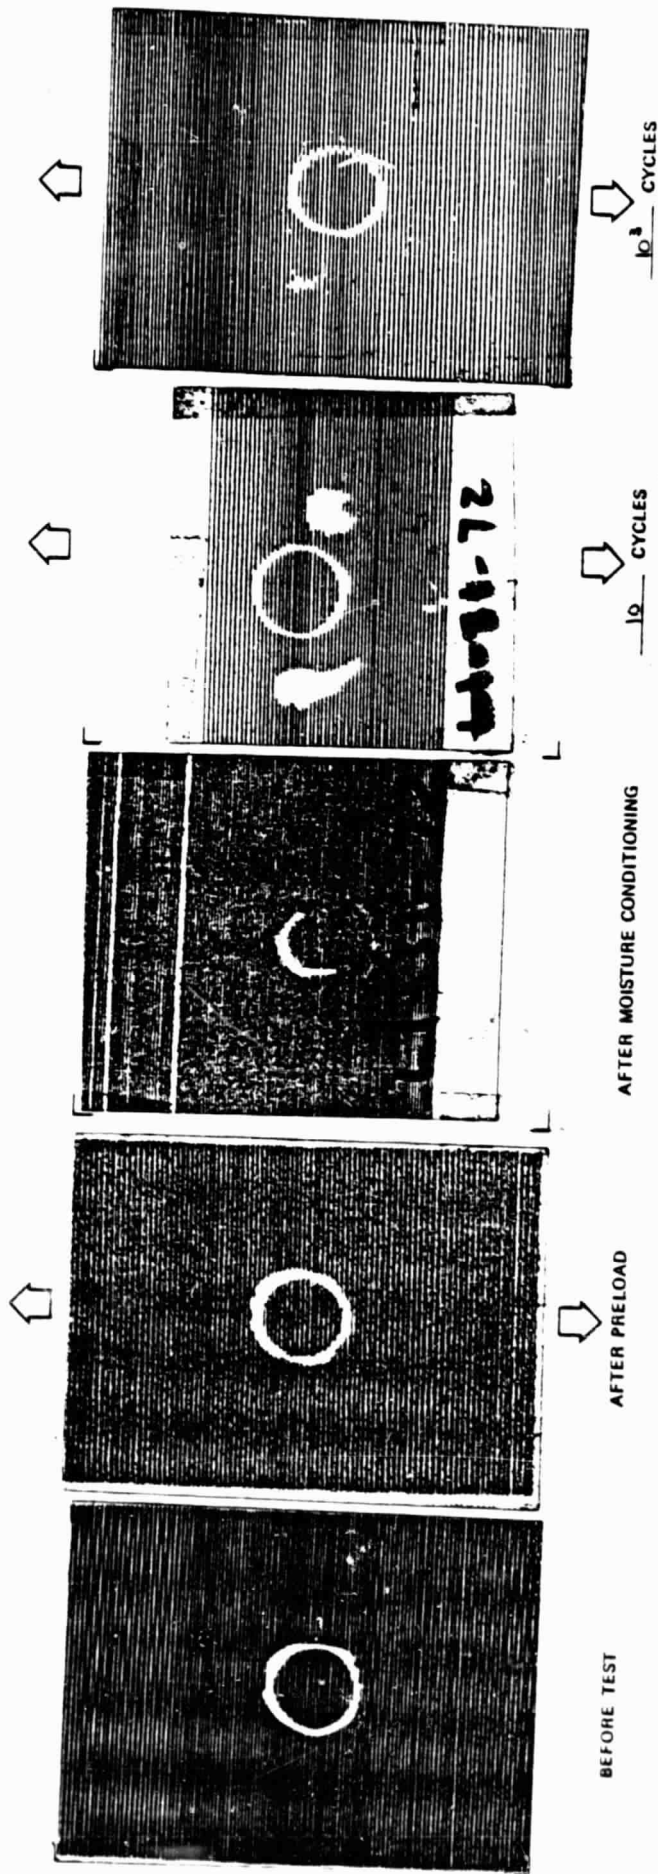

ORIGINAL PAGE IS  
OF POOR QUALITY

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

10 CYCLES

10<sup>3</sup> CYCLES

MAXIMUM LOAD 48.9 kN (11.0 kip)

CYCLIC LOAD 13.3 kN (3.0 kip)

R RATIO -1.0

TEST TEMPERATURE 422 K (300°F)






LAMINATE LI

SPECIMEN NO. LI-31-72

DEFECT 5/8 FP HOLE

TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

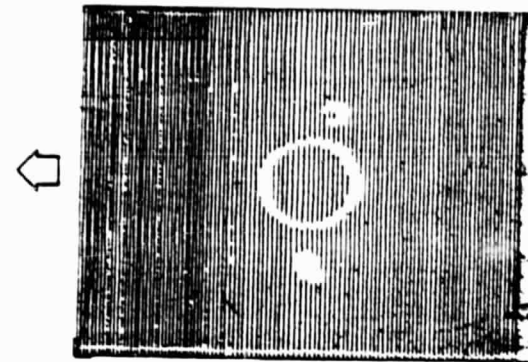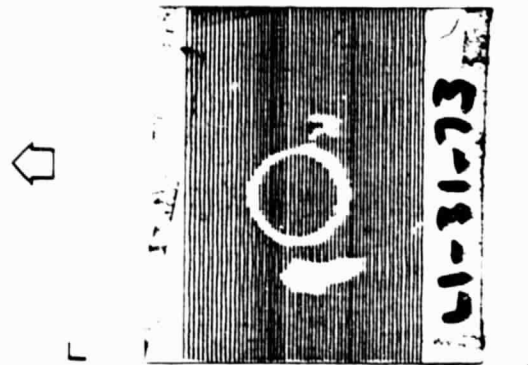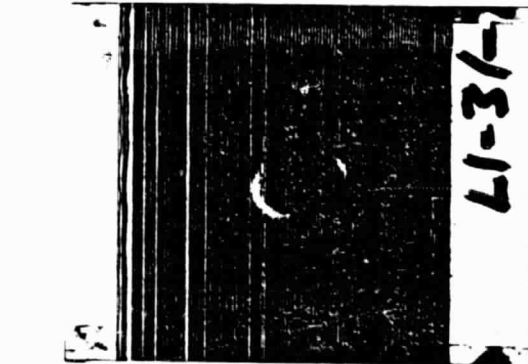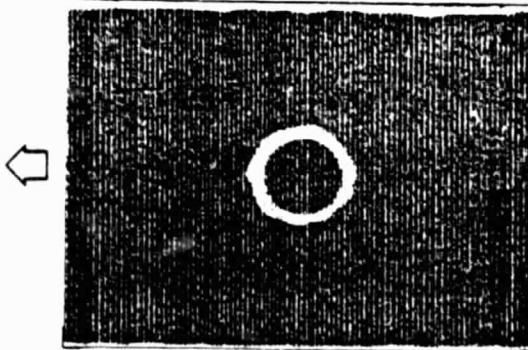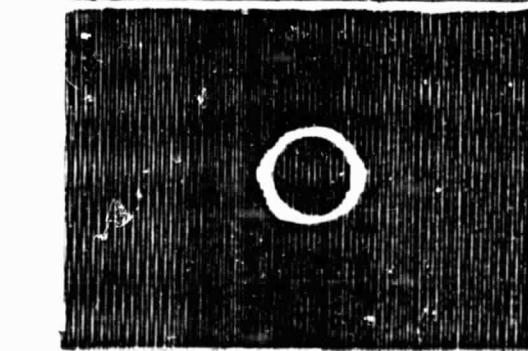

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

100 CYCLES

10<sup>6</sup> CYCLES

MAXIMUM LOAD 40.9 kN (11.0 kip)

CYCLIC LOAD 17.3 kN (3.9 kip)

LAMINATE L1

SPECIMEN NO. L1-31-73

DEFECT 5/8 PP HOLE

TEST TYPE CYCLIC


R RATIO -1.0

TEST TEMPERATURE 422 K (300 °F)


ORIGINAL PAGE IS  
OF POOR QUALITY



ULTRASONIC C-SCAN DATA

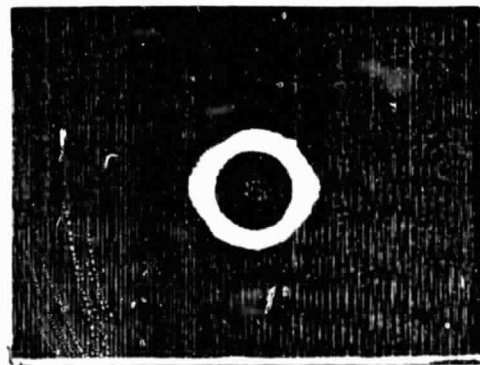

BEFORE TEST

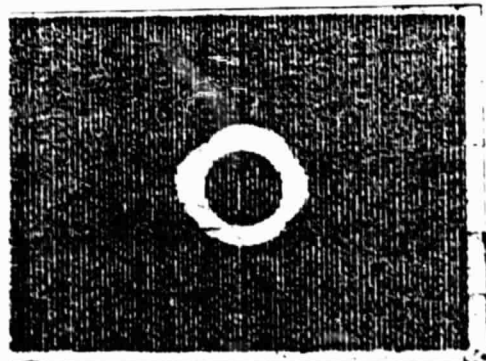

AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (11.0 kip)

NOT COMPLETED



100 CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO .05

TEST TEMPERATURE ROOM

CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY


LAMINATE L1

SPECIMEN NO. L1-31-74


DEFECT 5/8 PP HOLE

TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

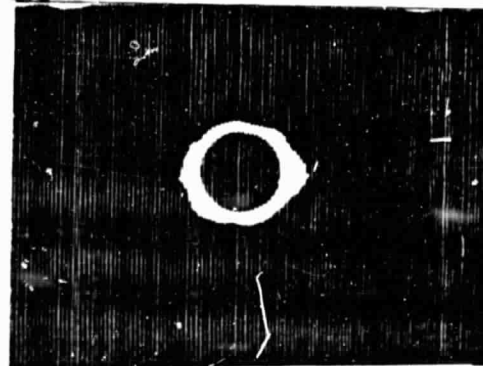

BEFORE TEST

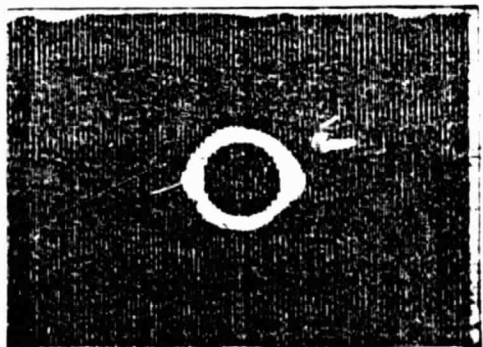

AFTER PRELOAD

MAXIMUM LOAD 48.9 kN (11.0 k.l.p.)

NOT CONDITIONED



10 CYCLES




10<sup>2</sup> CYCLES

LAMINATE L1  
SPECIMEN NO. L1-31-75  
DEFECT S/S FP HOLE  
TEST TYPE CYCCLC


CYCLIC LOAD 46.7 kN (10.5 k.l.p.)  
R RATIO 0.05  
TEST TEMPERATURE 422 K (300 °F)

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

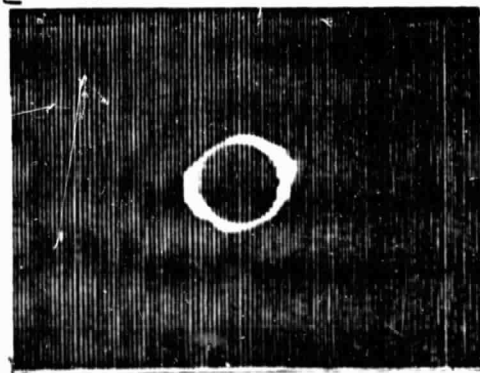

BEFORE TEST

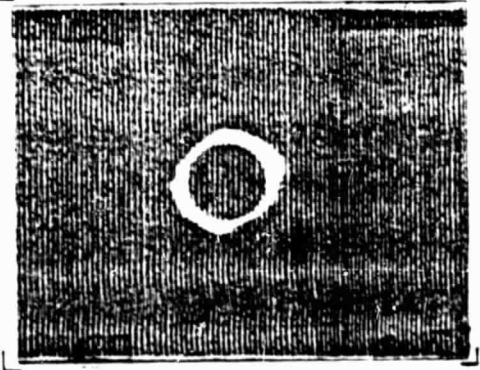

AFTER PRELOAD



MAXIMUM LOAD 48.9 kN (11000 lbf)

NOT CONDITIONED



100 CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 423 K (300 °F)




10<sup>6</sup> CYCLES



ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE L1  
SPECIMEN NO. L1-31-76  
DEFECT 5/8 FP HOLE  
TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

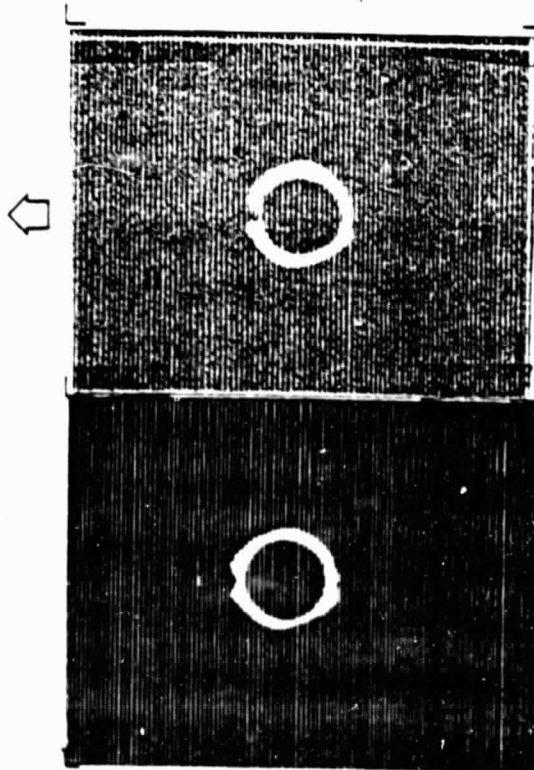

BEFORE TEST

MAXIMUM LOAD 48.9 kN (11.0 kip)

LAMINATE L1

SPECIMEN NO. L1-31-77

DEFECT 5/8 PP HOL

TEST TYPE CYCCLC

NOT CONDITIONED



AFTER PRELOAD

AFTER MOISTURE CONDITIONING

100 CYCLES

CYCLES


CYCCLC LOAD 37.8 kN (8.5 kip)

R RATIO -1.0


TEST TEMPERATURE ROOM

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

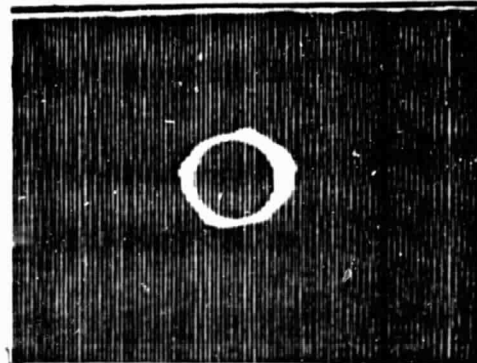

BEFORE TEST

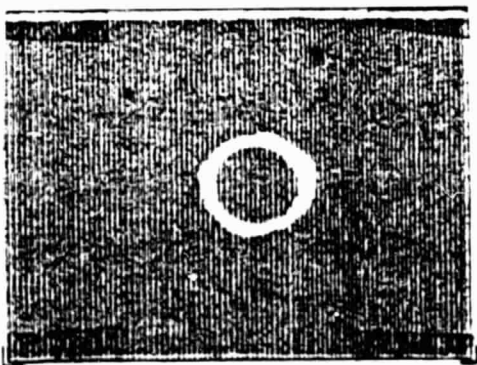

AFTER PRELOAD



NOT CONDITIONED



AFTER MOISTURE CONDITIONING



LAMINATE L1  
SPECIMEN NO. L1-31-78  
DEFECT 5/8 FP HOLE  
TEST TYPE CYCLES

MAXIMUM LOAD 4891N (110kip)

10 CYCLES


CYCLIC LOAD 4001N (90kip)

R RATIO -1.0


TEST TEMPERATURE 422K (300°F)

197 CYCLES  
(FAILURE)

ULTRASONIC C-SCAN DATA

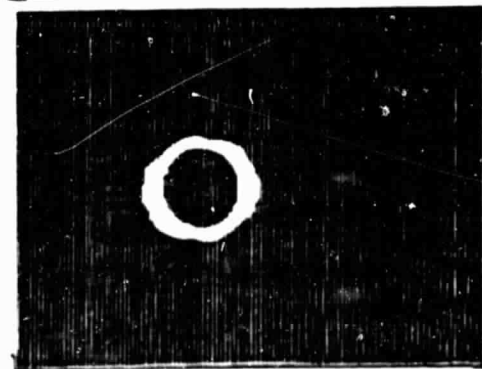


BEFORE TEST

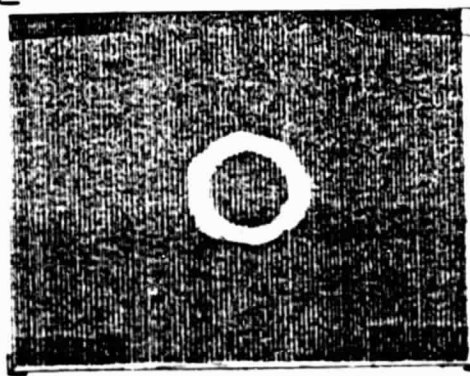

AFTER PRELOAD



NOT CONDITIONED

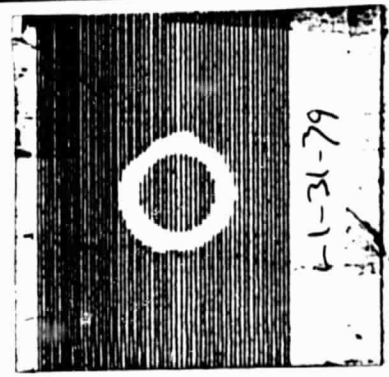

CYCLES



CYCLIC LOAD 40.9 kN (9.0 kip)

R RATIO -1.0

TEST TEMPERATURE 422 K (300 °F)

MAXIMUM LOAD 40.9 kN (9.0 kip)

LAMINATE LI

SPECIMEN NO. LI-31-79


DEFECT 5/8 PD HOLES

TEST TYPE CYCLIC

25 CYCLES  
(FAILURES)


ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

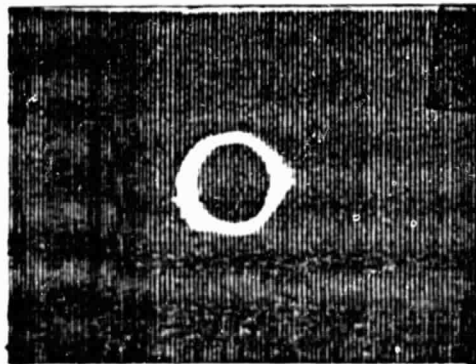

NO PRELOAD


NOT CONDITIONED

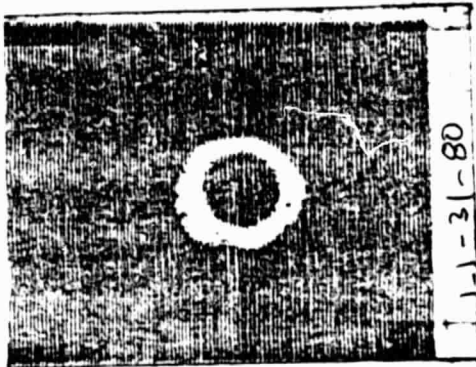

10 CYCLES



10 CYCLES

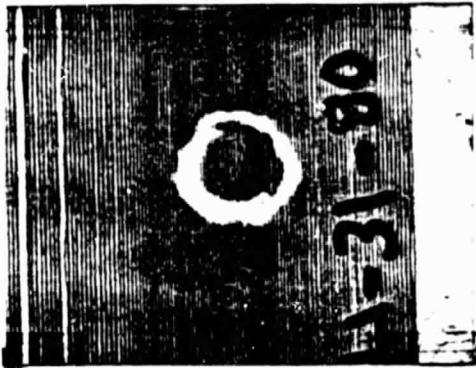

BEFORE TEST

AFTER PRELOAD

AFTER MOISTURE CONDITIONING

MAXIMUM LOAD

CYCLIC LOAD 45.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE ROOM

LAMINATE L1

SPECIMEN NO. L1-31-80


DEFECT 5/8 PD HOLE

TEST TYPE CYCLIC

ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

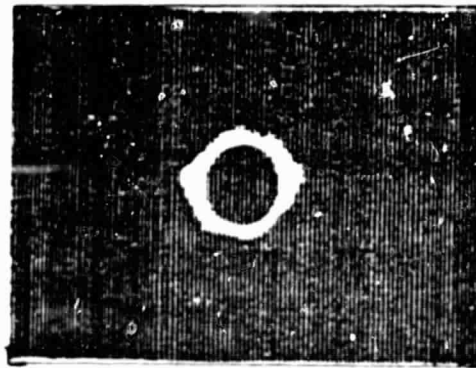

BEFORE TEST

LAMINATE LI  
SPECIMEN NO. LI-31-81  
DEFECT 5/8" FP HOLE  
TEST TYPE CYCLIC


NO PRELOAD

NOT CONDITIONED



AFTER PRELOAD

MAXIMUM LOAD

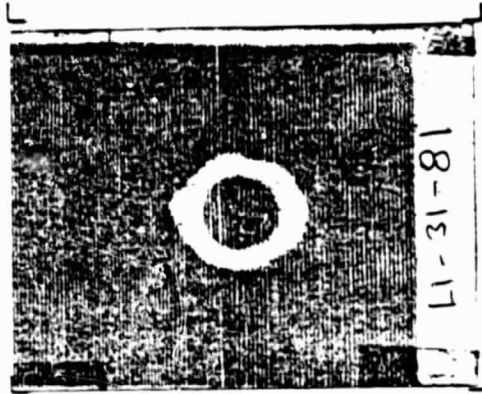

100 CYCLES

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE ROOM




CYCLES





ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

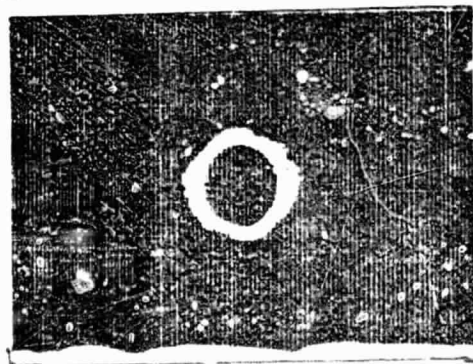


BEFORE TEST

LAMINATE L1  
SPECIMEN NO. L1-31-B2  
DEFECT S/B FP HOLE  
TEST TYPE CYCLIC

NO PRELOAD




NOT CONDITIONED

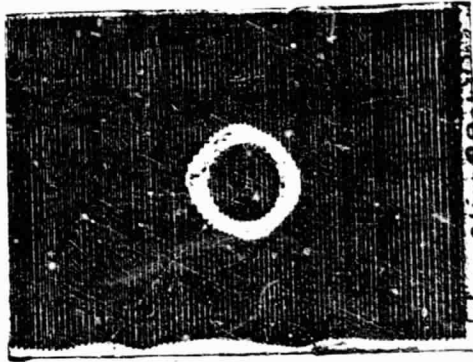

10 CYCLES

AFTER MOISTURE CONDITIONING

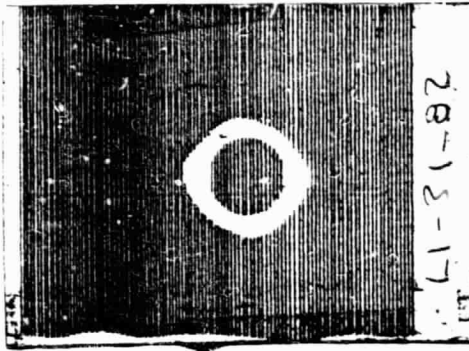

10<sup>3</sup> CYCLES


CYCLIC LOAD 41.1 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 422.2 (200°F)

MAXIMUM LOAD

ULTRASONIC C-SCAN DATA

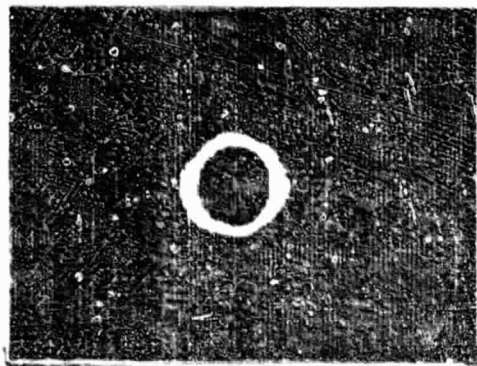

BEFORE TEST

LOAD RATE 1.1  
SPECIMEN NO. 51-21-22  
DEFECT 5/8 IN HOLE  
TEST TYPE CYCLES

NO PRELOAD




AFTER PRELOAD

MAXIMUM LOAD -

NOT SPATIALIZED



AFTER MOISTURE CONDITIONING

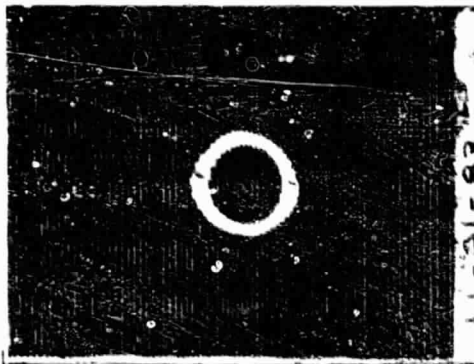

10% CYCLES


CYCLIC LOAD 10.7 kN (10.8 MP)

RATIO 0.05

TEST TEMPERATURE 422 K (262 F)




10% CYCLES

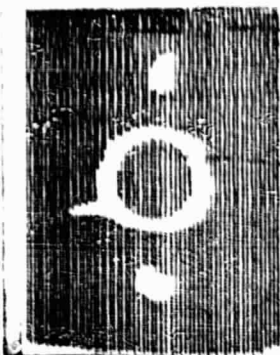

41-31-83

ORIGINAL PAGE IS  
OF POOR QUALITY


ULTRASONIC C-SCAN DATA

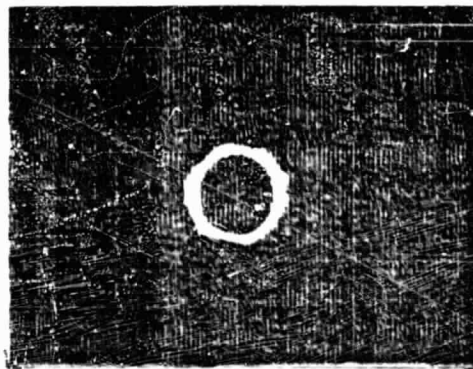

BEFORE TEST

NO PRELOAD

NOT CONDITIONED

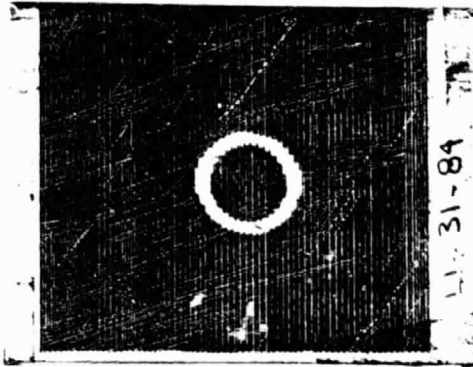

AFTER PRELOAD

AFTER MOISTURE CONDITIONING



100 CYCLES

10<sup>7</sup> CYCLES

41-31-84

41-31-84

CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE 422 K (300 °F)

MAXIMUM LOAD

LAMINATE 41

SPECIMEN NO. 41-31-84


DEFECT 8/8 EP MO-2

TEST TYPE Cyclic


ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

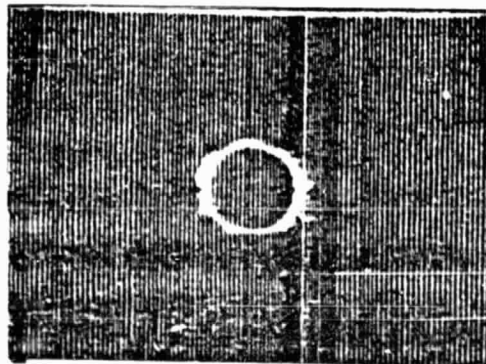

NOT CONDITIONED

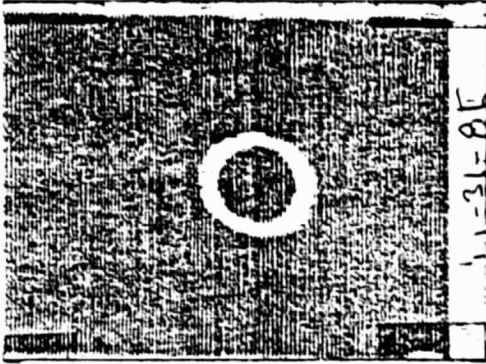

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD


LAMINATE LI  
SPECIMEN NO. LI-31-85  
DEFECT 5/8 PP HOLE  
TEST TYPE CYCLIC

CYCLIC LOAD 40.0 KN (9.0 kip)

R RATIO -1.0

TEST TEMPERATURE ROOM

ULTRASONIC C-SCAN DATA

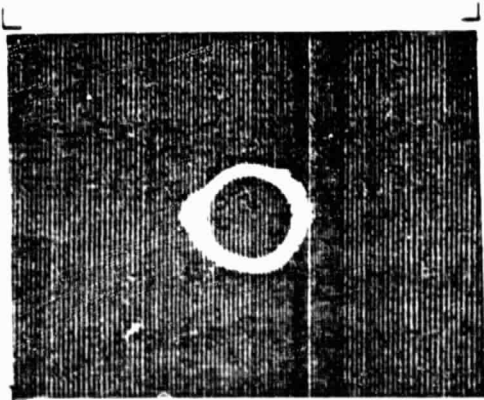


BEFORE TEST

LAMINATE L1  
SPECIMEN NO. L1-31-86  
DEFECT 5/8 FP HOLE  
TEST TYPE CYCLIC

NO PRELOAD



NOT CONDITIONED

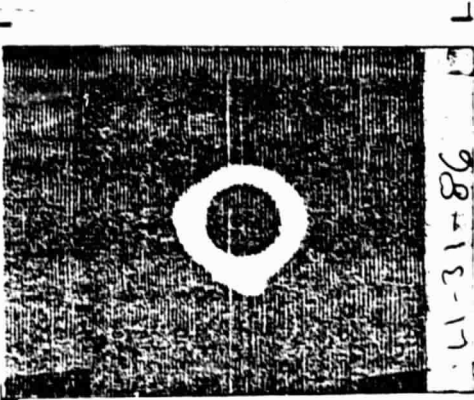

100 CYCLES

↑ CYCLES

AFTER MOISTURE CONDITIONING



AFTER PRELOAD

MAXIMUM LOAD


CYCLIC LOAD 37.8 kN (8.5 kip)

R RATIO -1.0

TEST TEMPERATURE ROOM

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

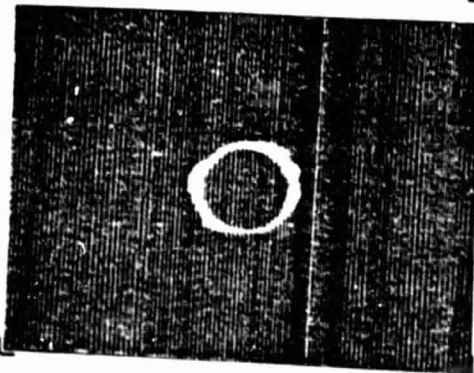

BEFORE TEST

LAMINATE L1  
 SPECIMEN NO. L1-31-87  
 DEFECT 5/8 IN HOLE  
 TEST TYPE CYCLIC

NO PRELOAD

AFTER PRELOAD

MAXIMUM LOAD —

NOT CONDITIONED

AFTER MOISTURE CONDITIONING



10 CYCLES

CYCLIC LOAD 400 LB (40 kP)

R RATIO -1.0


TEST TEMPERATURE 422 K (300 F)

117 CYCLES

(FAILURES)

ORIGINAL PAGE IS  
 OF POOR QUALITY

ULTRASONIC C-SCAN DATA

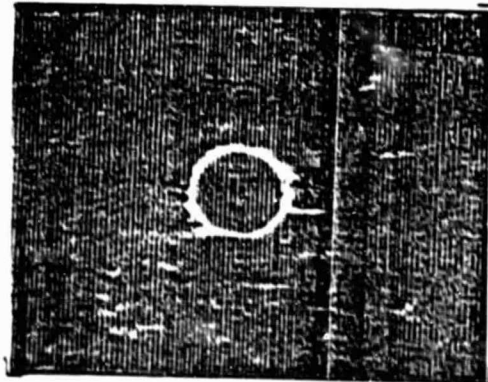

BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-88

DEFECT 5/8 FP HOLE

TEST TYPE CYCLIC

NO PRELOAD



NOT CONDENSED


AFTER PRELOAD



AFTER MOISTURE CONDITIONING



100 CYCLES

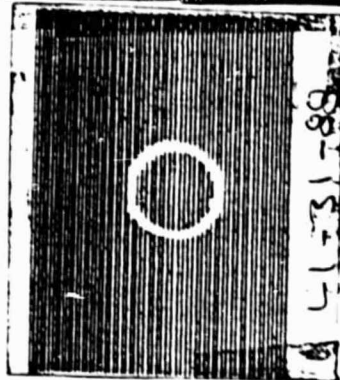


CYCLIC LOAD 40.0 kN (9.0 kip)

R RATIO -1.0

TEST TEMPERATURE 422K (190°F)

1700 CYCLES


(FAILURE)

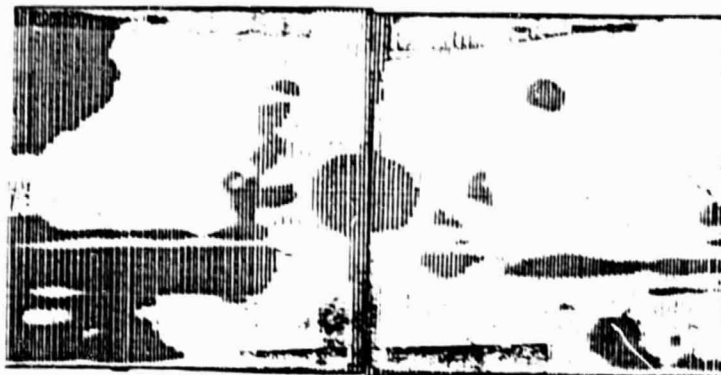

ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

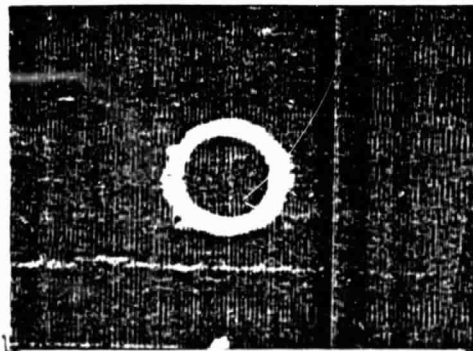

NO PRELOAD NOT CONDITIONED

BEFORE TEST

AFTER PRELOAD

MAXIMUM LOAD

AFTER MOISTURE CONDITIONING

\_\_\_\_ CYCLES  
21 TO FAIL

\_\_\_\_ CYCLES

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

LAMINATE LI


SPECIMEN NO. LI-31-89

DEFECT 5/8 FP HOLE

TEST TYPE CYCLIC



ULTRASONIC C-SCAN DATA

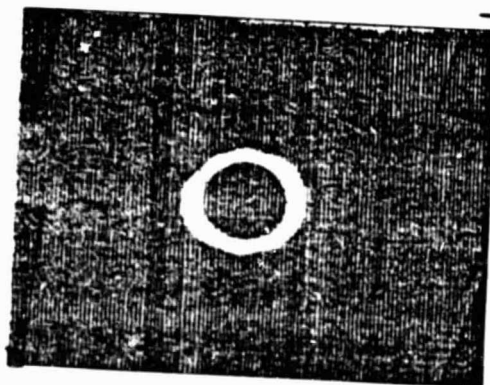

BEFORE TEST

NO PRELOAD



AFTER PRELOAD


MAXIMUM LOAD

LAMINATE


SPECIMEN NO. L1-31-90

DEFECT 5/8 FP HOLE

TEST TYPE CYCLIC

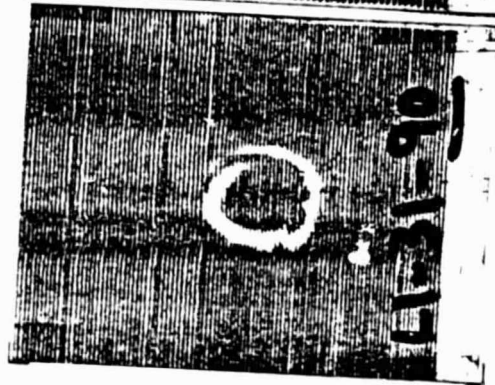

AFTER MOISTURE CONDITIONING

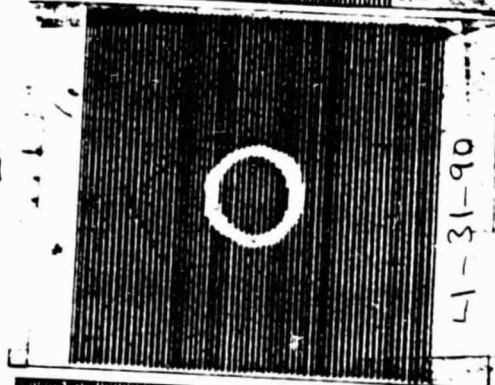

100 CYCLES



10<sup>7</sup> CYCLES


CYCLIC LOAD 46.7 kN (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE ROOM

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

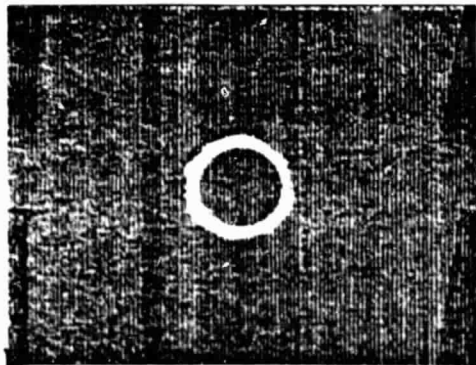

BEFORE TEST

NO PRELOAD



AFTER PRELOAD


MAXIMUM LOAD




AFTER MOISTURE CONDITIONING



10 CYCLES

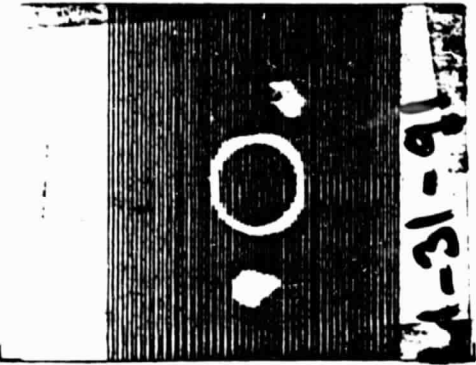

10<sup>3</sup> CYCLES

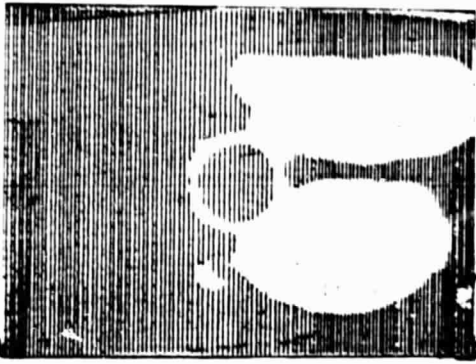

ORIGINAL PAGE IS  
OF POOR QUALITY

CYCLIC LOAD  $46.7 \text{ kN}$  ( $10.5 \text{ kip}$ )

R RATIO  $0.05$

TEST TEMPERATURE  $422 \text{ K}$  ( $300 \text{ F}$ )


LAMINATE  $61$

SPECIMEN NO.  $11-31-91$

DEFECT  $5/8 \text{ PD HOLE}$

TEST TYPE  $\text{CYCLIC}$

ULTRASONIC C-SCAN DATA

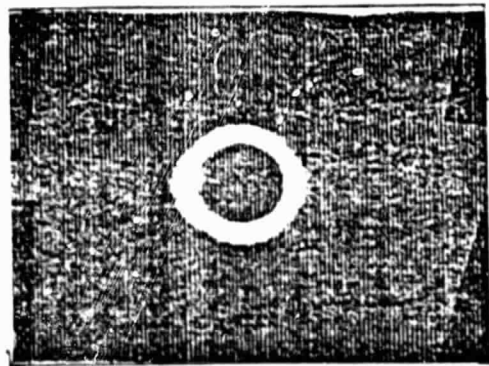

NO PRELOAD

BEFORE TEST

LAMINATE L1


SPECIMEN NO. L1-31-92

DEFECT 5/8 PP HOLE

TEST TYPE CYCLIC

MAXIMUM LOAD


AFTER PRELOAD

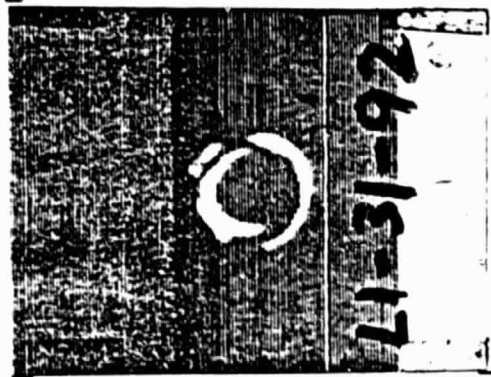

AFTER MOISTURE CONDITIONING



100 CYCLES

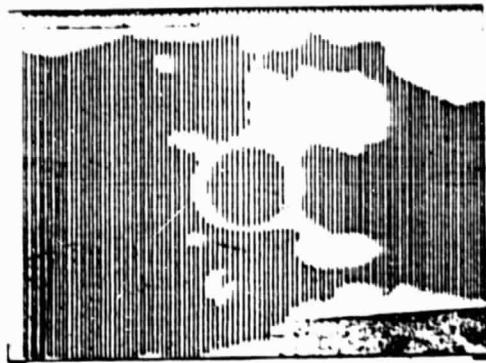

10 CYCLES


CYCLIC LOAD 54.1 kN (10.5 kip)

R RATIO 0.25

TEST TEMPERATURE 42 ± 1300 °F

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

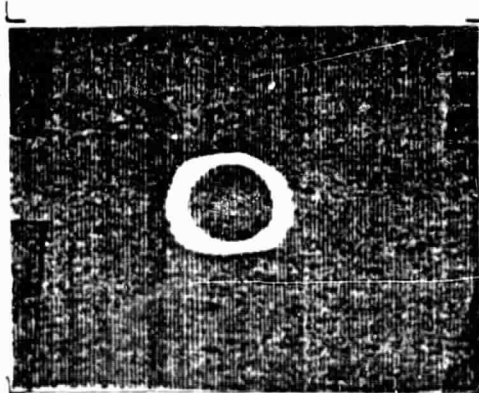


NO PRELOAD

BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD

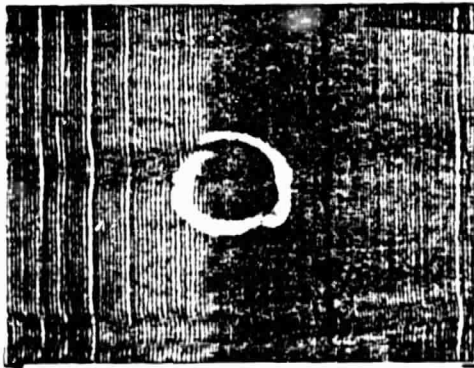


AFTER MOISTURE CONDITIONING



100 CYCLES



100 CYCLES

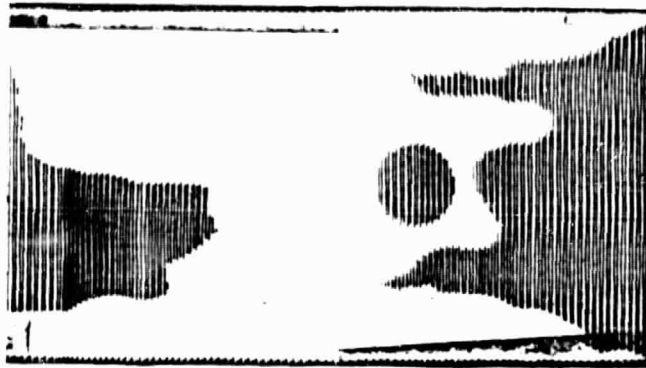

ORIGINAL PAGE IS  
OF POOR QUALITY

CYCLIC LOAD  $44.7 \text{ kN}$  (10.5 kip)

R RATIO 0.05

TEST TEMPERATURE  $432 \text{ K}$  (320 °F)


LAMINATE L1

SPECIMEN NO. 41-31-93

DEFECT S/B FP HOLE


TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

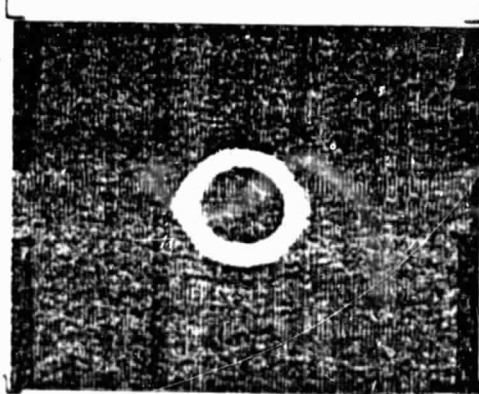


BEFORE TEST

NO PRELOAD

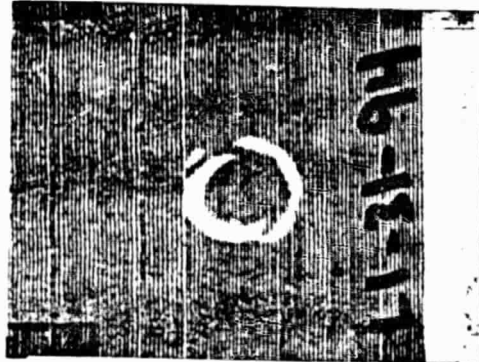


AFTER PRELOAD

MAXIMUM LOAD

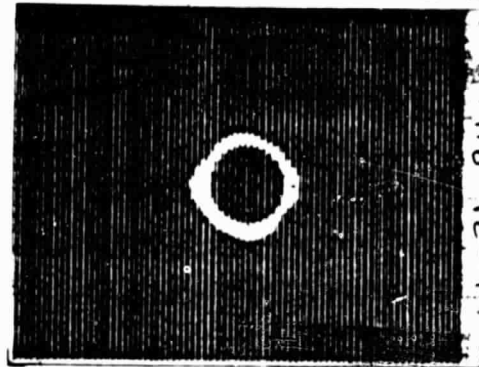

10<sup>3</sup> CYCLES

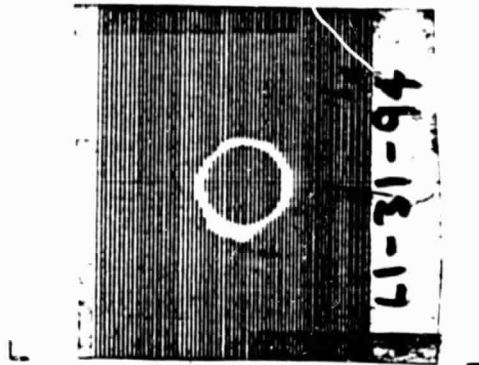

10<sup>3</sup> CYCLES



CYCLIC LOAD 40.0 kN (9.0 kip)

R RATIO -1.0

TEST TEMPERATURE ROOM

LAMINATE L1


SPECIMEN NO. L1-31-94

DEFECT S/B FP HOLES

TEST TYPE CYCLIC

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

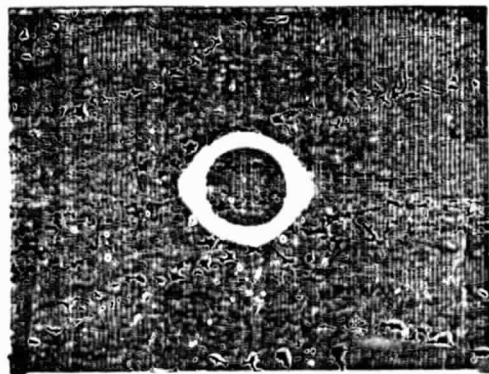

NO PRELOAD




BEFORE TEST




AFTER PRELOAD

MAXIMUM LOAD

LAMINATE LI  
 SPECIMEN NO. LI-31-95  
 DEFECT 5/8 EP HOLE  
 TEST TYPE CYCLIC

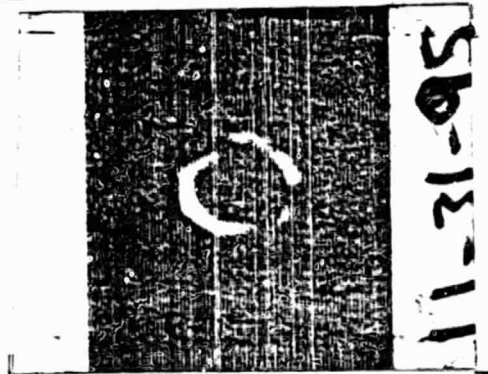

AFTER MOISTURE CONDITIONING

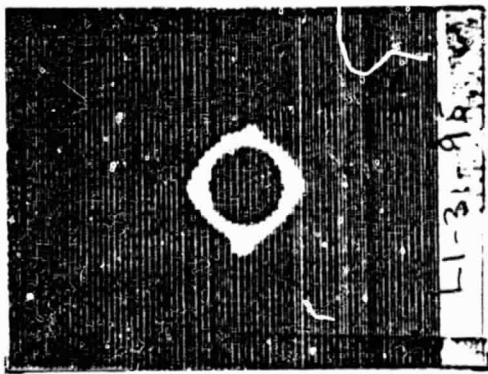

100 CYCLES




450 CYCLES  
(FAILURE)

CYCLIC LOAD 40.0 kN (9.0 k.p)  
 R RATIO -1.0  
 TEST TEMPERATURE Room

ORIGINAL PAGE IS  
OF POOR QUALITY



ULTRASONIC C-SCAN DATA

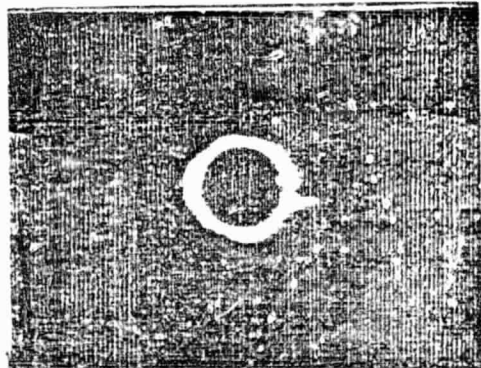


BEFORE TEST

NO PRELOAD




AFTER PRELOAD

MAXIMUM LOAD

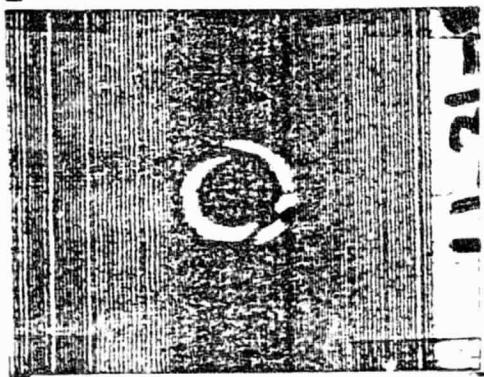

AFTER MOISTURE CONDITIONING

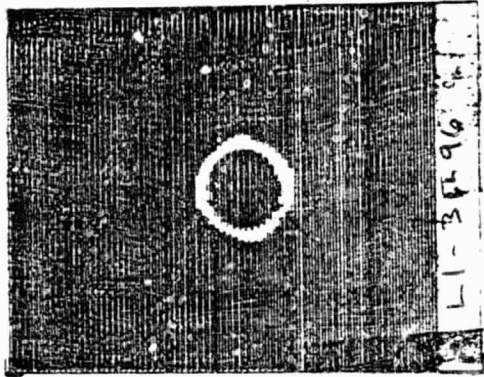


100 CYCLES

CYCLIC LOAD 37.8 kN (8.5 k.l.p)

R RATIO -1.0


TEST TEMPERATURE ROOM

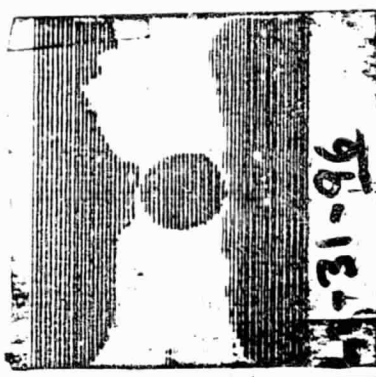

1330 CYCLES  
(FAILURES)


ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

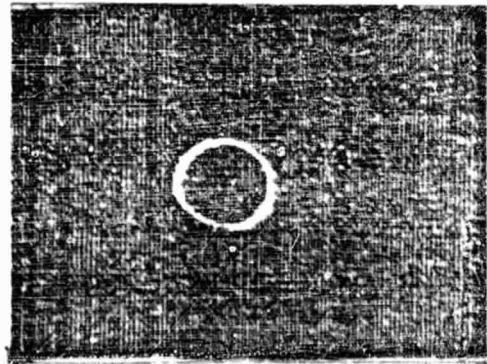

BEFORE TEST


NO PRELOAD

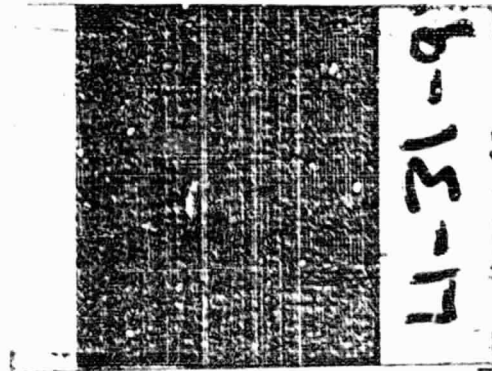

AFTER MOISTURE CONDITIONING



10<sup>7</sup> CYCLES

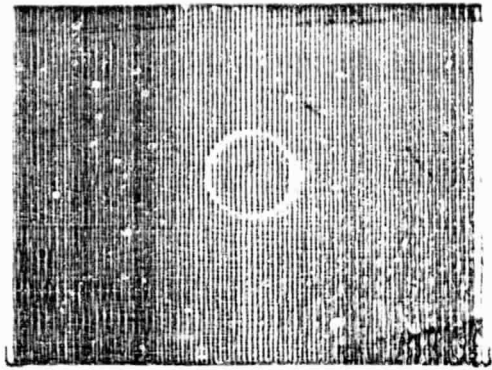

10<sup>8</sup> CYCLES



ORIGINAL PAGE IS  
OF POOR QUALITY

CYCLIC LOAD 13.3 kN (3.0 kip)

R RATIO -1.0

TEST TEMPERATURE 122 F (300 °C)

LAMINATE 41

SPECIMEN NO. 41-31-97

DEFECT 2/B P/P HOLE

TEST TYPE CYCLIC


AFTER PRELOAD

MAXIMUM LOAD





ULTRASONIC SCAN DATA

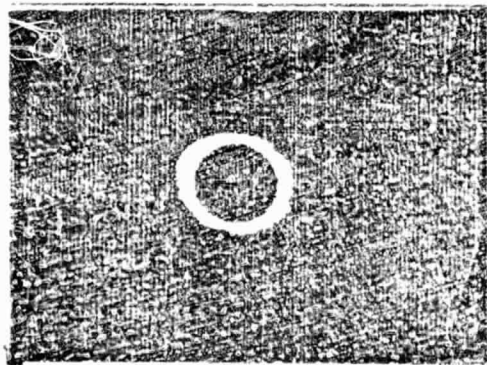

NO PRELOAD




BEFORE TEST



AFTER PRELOAD

MAXIMUM LOAD

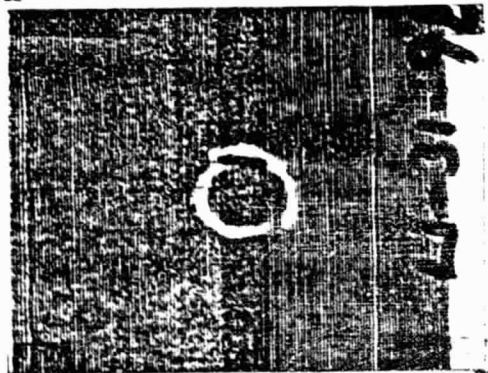

11-31-98

AFTER MOISTURE CONDITIONING



15% CYCLES



11-31-98



15% CYCLES

CYCLIC LOAD 13.3k (3.0kip)


R RATIO -1.0

TEST TEMPERATURE 422K (350°F)

ORIGINAL PAGE IS  
OF POOR QUALITY

LAMINATE 21  
SPECIMEN NO. 11-31-98  
DEFECT 2/8 EP 4012  
TEST TYPE CYCLIC

ULTRASONIC C-SCAN DATA

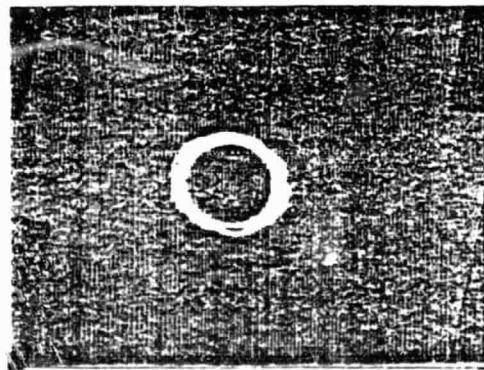

BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-99

DEFECT 5/8" FP HOLE


TEST TYPE CYCLIC

NO PRELOAD



AFTER PRELOAD

MAXIMUM LOAD —

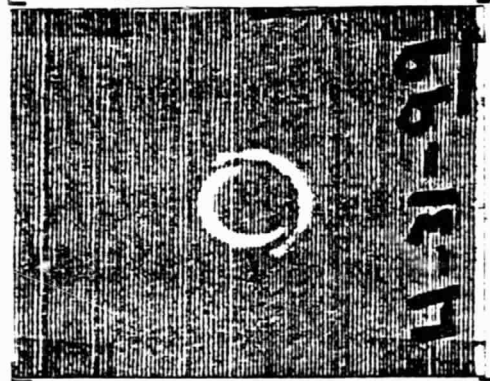

AFTER MOISTURE CONDITIONING



100 CYCLES




CYCLIC LOAD 13.3 kN (3.0 kip)

R RATIO -1.0

TEST TEMPERATURE 422 K (300°F)




10<sup>7</sup> CYCLES

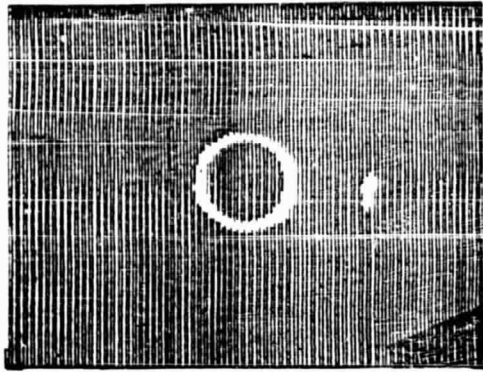

ORIGINAL PAGE IS  
OF POOR QUALITY

ULTRASONIC C-SCAN DATA

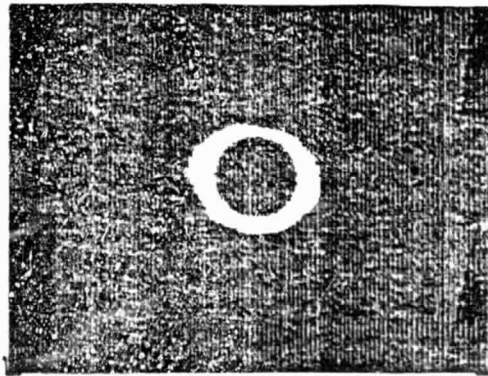

NO PRELOAD


BEFORE TEST

LAMINATE LI

SPECIMEN NO. LI-31-100

DEFECT 5/8" FO HOLE

TEST TYPE COMPRESSION SATIC

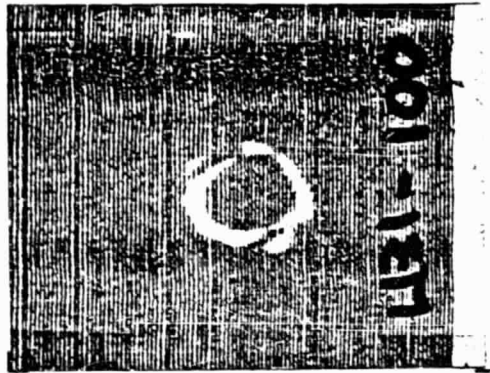

NO CYCLING

AFTER MOISTURE CONDITIONING

MAXIMUM LOAD

CYCLIC LOAD

R RATIO

TEST TEMPERATURE

CYCLES


CYCLES

ORIGINAL PAGE IS  
OF POOR QUALITY

ORIGINAL PAGE IS  
OF POOR QUALITY

SPECIMEN NUMBER	MAX./MIN. LOAD (LBS)	CRACK OPENING DISPLACEMENT GAGE TRACE AMPLITUDE							
		SCALE (IN/IN)	CHART (INCHES)						
			NUMBER OF LOAD CYCLES						
			10	100	1000	10 <sup>4</sup>	10 <sup>5</sup>	10 <sup>6</sup>	10 <sup>7</sup>
L1-31-25	10,500/525	.002	3.07	3.10	3.18	--	--	--	--
-26	10,500/525	.002	2.90	2.96	3.00	2.95	2.97	3.00	--
-27	10,500/525	.002	--	2.93	2.90	3.00	3.00	2.98	3.20
-28	10,500/525	.002	3.15	3.22	3.40	--	--	--	--
-29	10,500/525	.002	3.25	3.61	3.67	4.40	4.60	4.80	--
-30	10,500/525	.002	--	3.46	--	--	--	--	--
-31	9,000/-9,000	.002	4.82	4.90	--	--	--	--	--
-32	9,000/-9,000	.002	5.55	5.42	--	--	--	--	--
-33	8,500/-8,500	.002	--	4.97	--	--	--	--	--
		.004	--	--	2.17	--	--	--	--
-34	6,000/-6,000	.002	--	--	--	--	--	--	--
-35	10,500/525	.002	3.19	3.30	3.30	3.20	3.30	3.27	--
-36	10,500/525	.002	2.86	2.86	3.01	3.02	3.11	2.98	--
-37	10,500/525	.002	2.10	--	2.85	--	--	--	--
-38	10,500/525	.002	3.16	3.16	3.20	3.27	3.03	7.30	--
-39	10,500/525	.002	--	2.80	2.90	3.00	3.00	3.13	--
-40	9,000/-9,000	.002	5.35	5.82	6.30	8.18	--	--	--
-41	8,500/-8,500	.002	--	4.54	5.12	5.34	6.70	--	--
-42	9,000/-9,000	--	--	--	--	--	--	--	--
-43	9,000/-9,000	.002	--	4.80	5.40	--	--	--	--
-44	8,500/-8,500	.002	--	5.20	5.52	--	--	--	--
-45	6,500/-6,500	--	--	--	--	--	--	--	--
-46	10,500/525	.002	2.70	2.72	2.75	2.95	2.93	--	--
-47	10,500/525	.002	2.98	3.05	3.08	3.08	3.08	3.25	--
-48	10,500/525	.002	3.20	3.28	3.37	--	--	--	--
-49	10,500/525	.002	3.96	4.00	4.34	5.50	5.10	7.70	--
-50	9,000/-9,000	.002	5.45	--	--	--	--	--	--
		.004	--	3.00	--	--	--	--	--
-51	9,000/-9,000	.002	5.08	--	--	--	--	--	--
		.004	--	2.43	3.65	--	--	--	--
-52	5,000/-5,000	--	--	--	--	--	--	--	--
-53	3,000/-3,000	.002	1.70	1.35	1.32	1.50	1.50	1.52	--
-54	10,500/525	.002	--	3.00	2.95	2.95	2.98	2.99	3.00
-55	10,500/525	.002	3.17	3.04	3.06	--	--	--	--
-56	--	--	--	--	--	--	--	--	--
-57	8,500/-8,500	.002	--	5.50	5.52	6.78	--	--	--
-58	9,000/-9,000	--	--	--	--	--	--	--	--
-59	9,000/-9,000	--	--	--	--	--	--	--	--
-60	8,500/-8,500	--	--	--	--	--	--	--	--
-61	10,500/525	.002	2.69	2.62	2.68	2.70	2.73	2.75	--
-64	10,500/525	.002	3.62	3.85	--	--	--	--	--
-65	10,500/525	.002	3.66	3.66	3.66	3.72	3.72	3.80	--
-66	10,500/525	.002	3.65	3.70	3.72	--	--	--	--
-67	10,500/525	.002	3.75	3.80	3.80	3.85	3.87	3.96	--
-68	10,500/525	.004	1.90	--	--	--	--	--	--
		.002	--	4.15	4.40	--	--	--	--
L1-31-69	10,500/525	.004	2.15	--	--	--	--	--	--

368

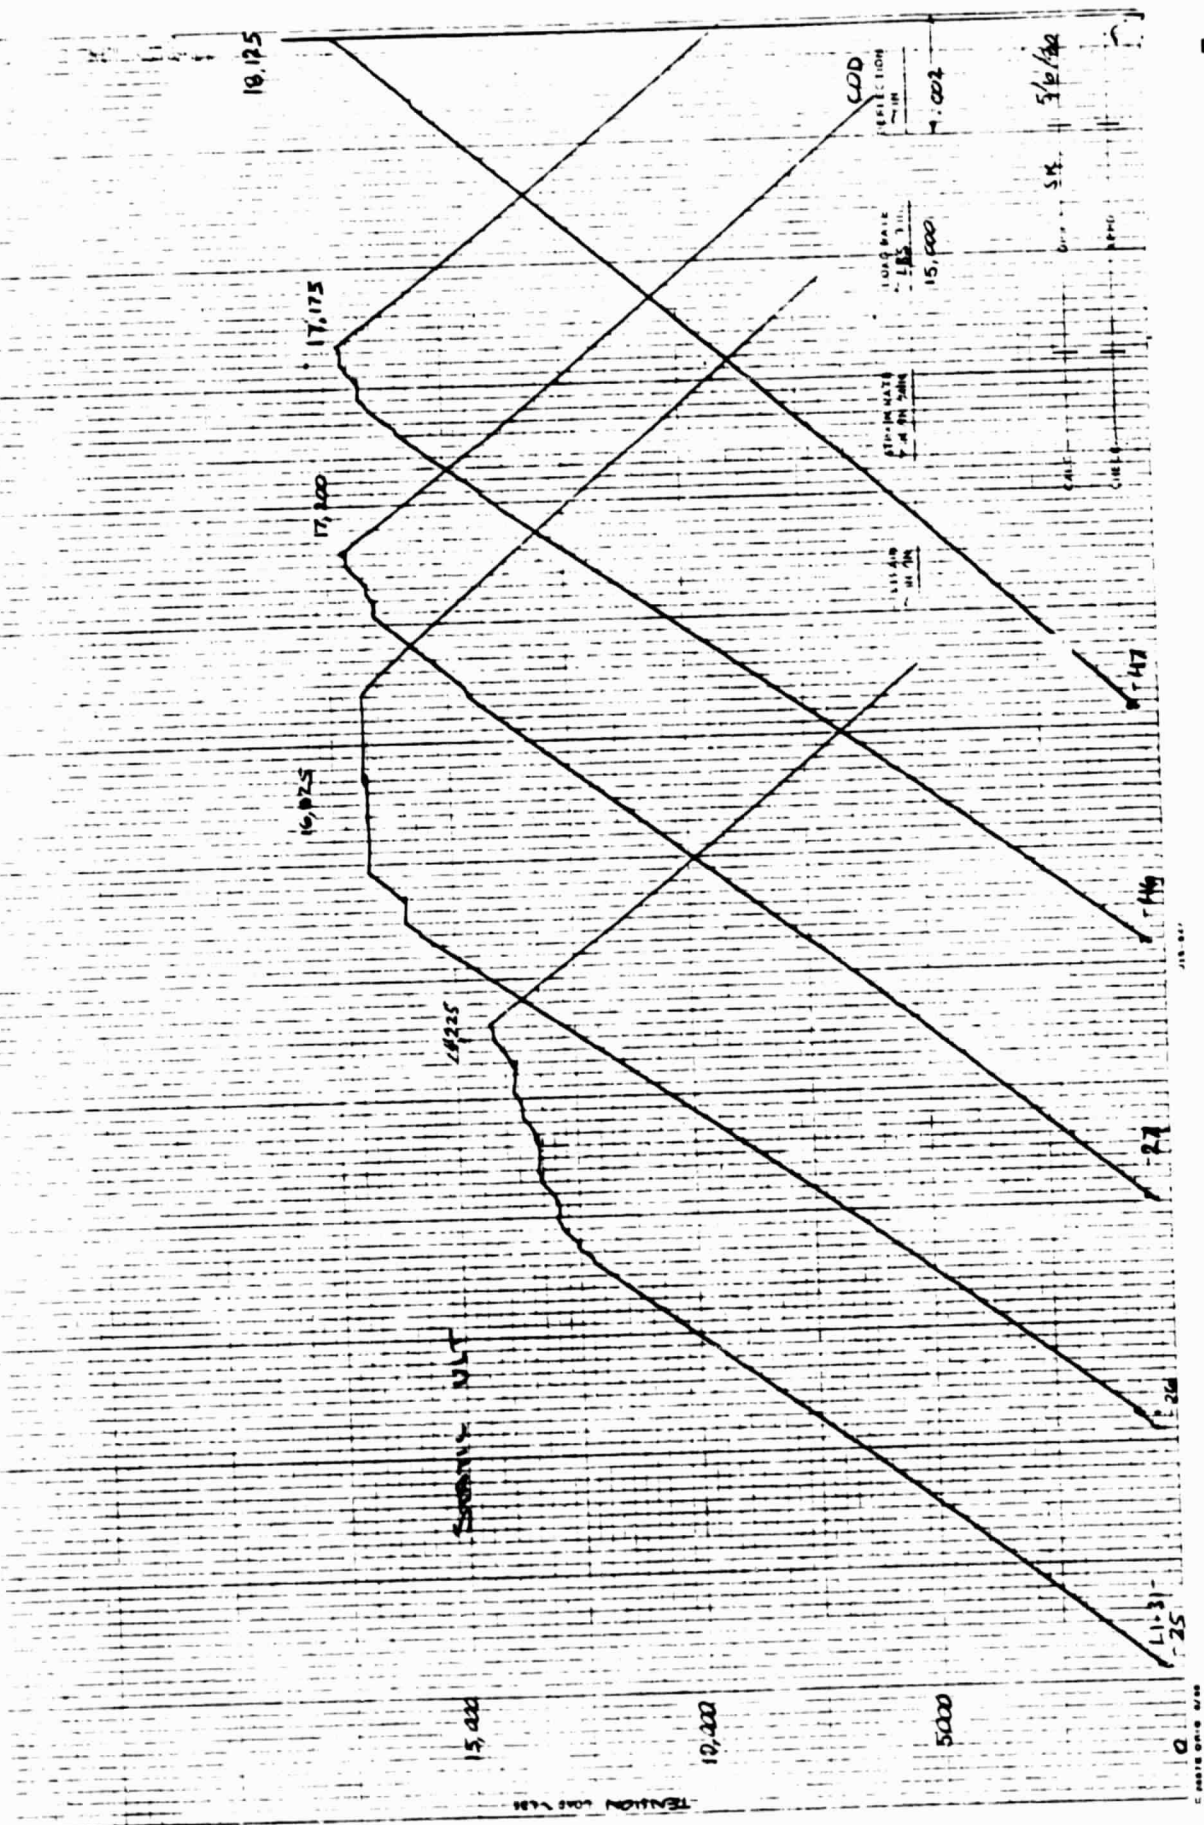



061' B1

602

1990

1-002

10-6894

1500

12-14-30

1. *Introduction*

5. **Stress Management**

10

16-11-18

—

[illegible]

1000

100-501

[illegible]

20,000

16,000

2,000


0000

4000


~~4-31-20~~

107-2049 NONNELL

509

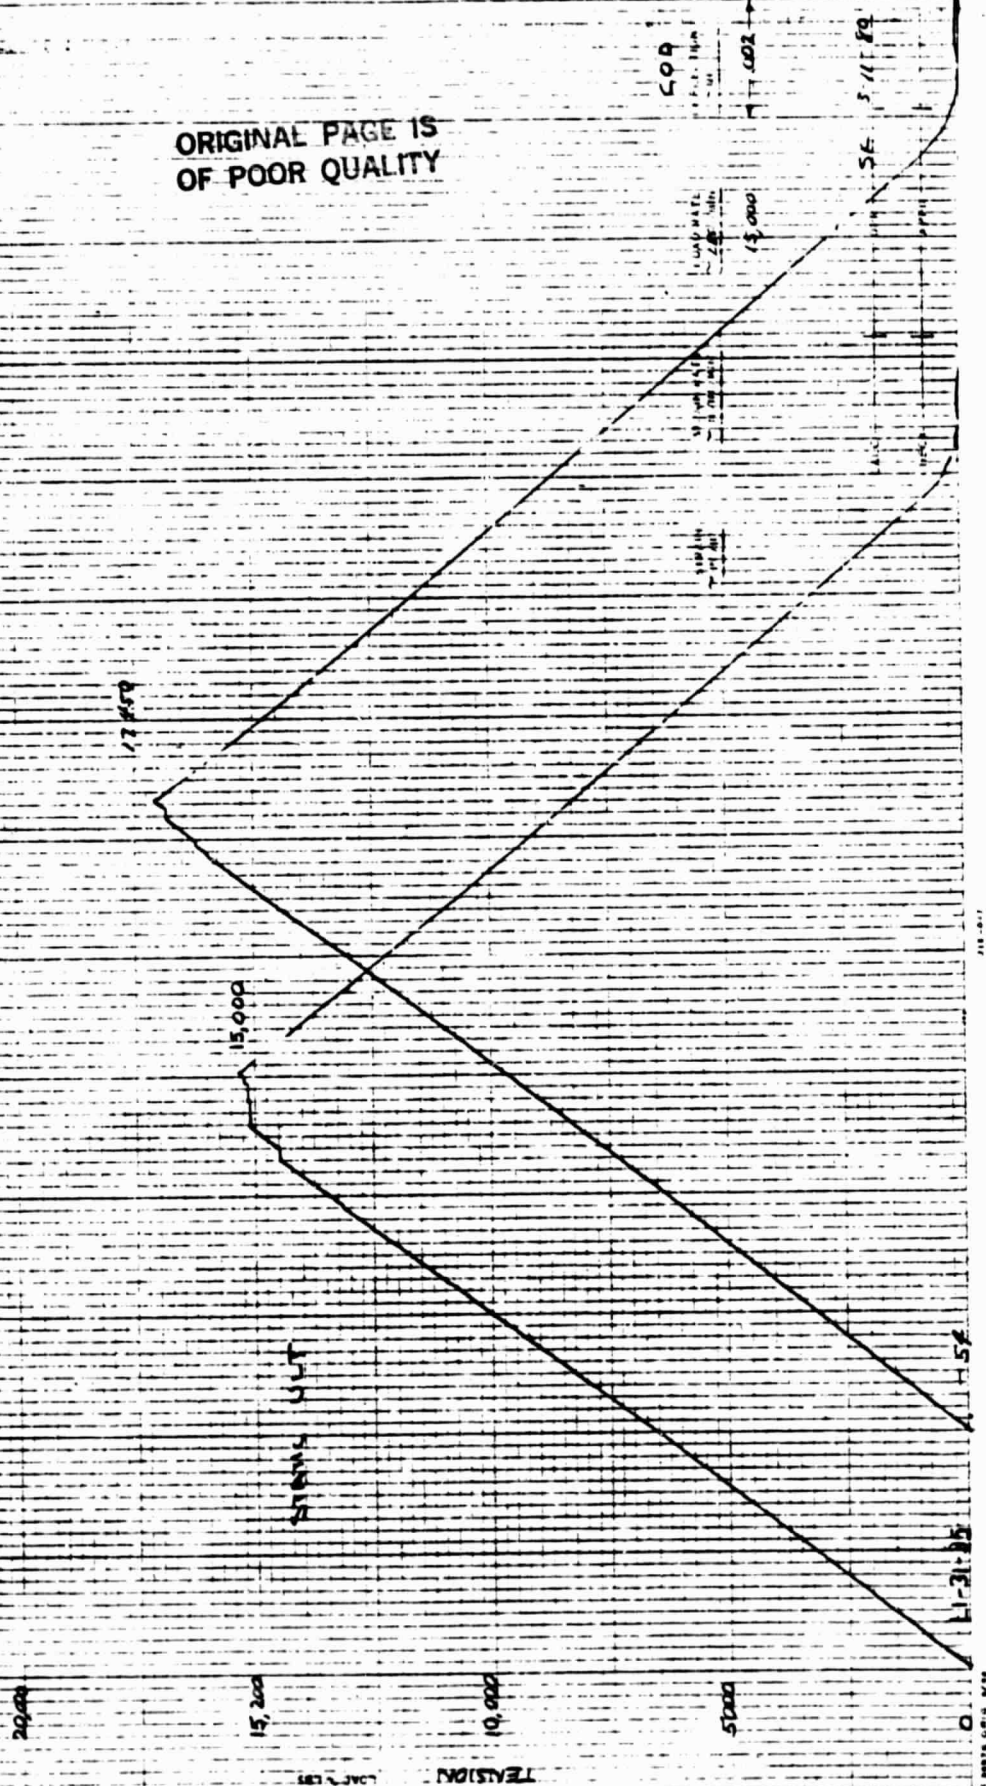


ORIGINAL PAGE IS  
OF POOR QUALITY

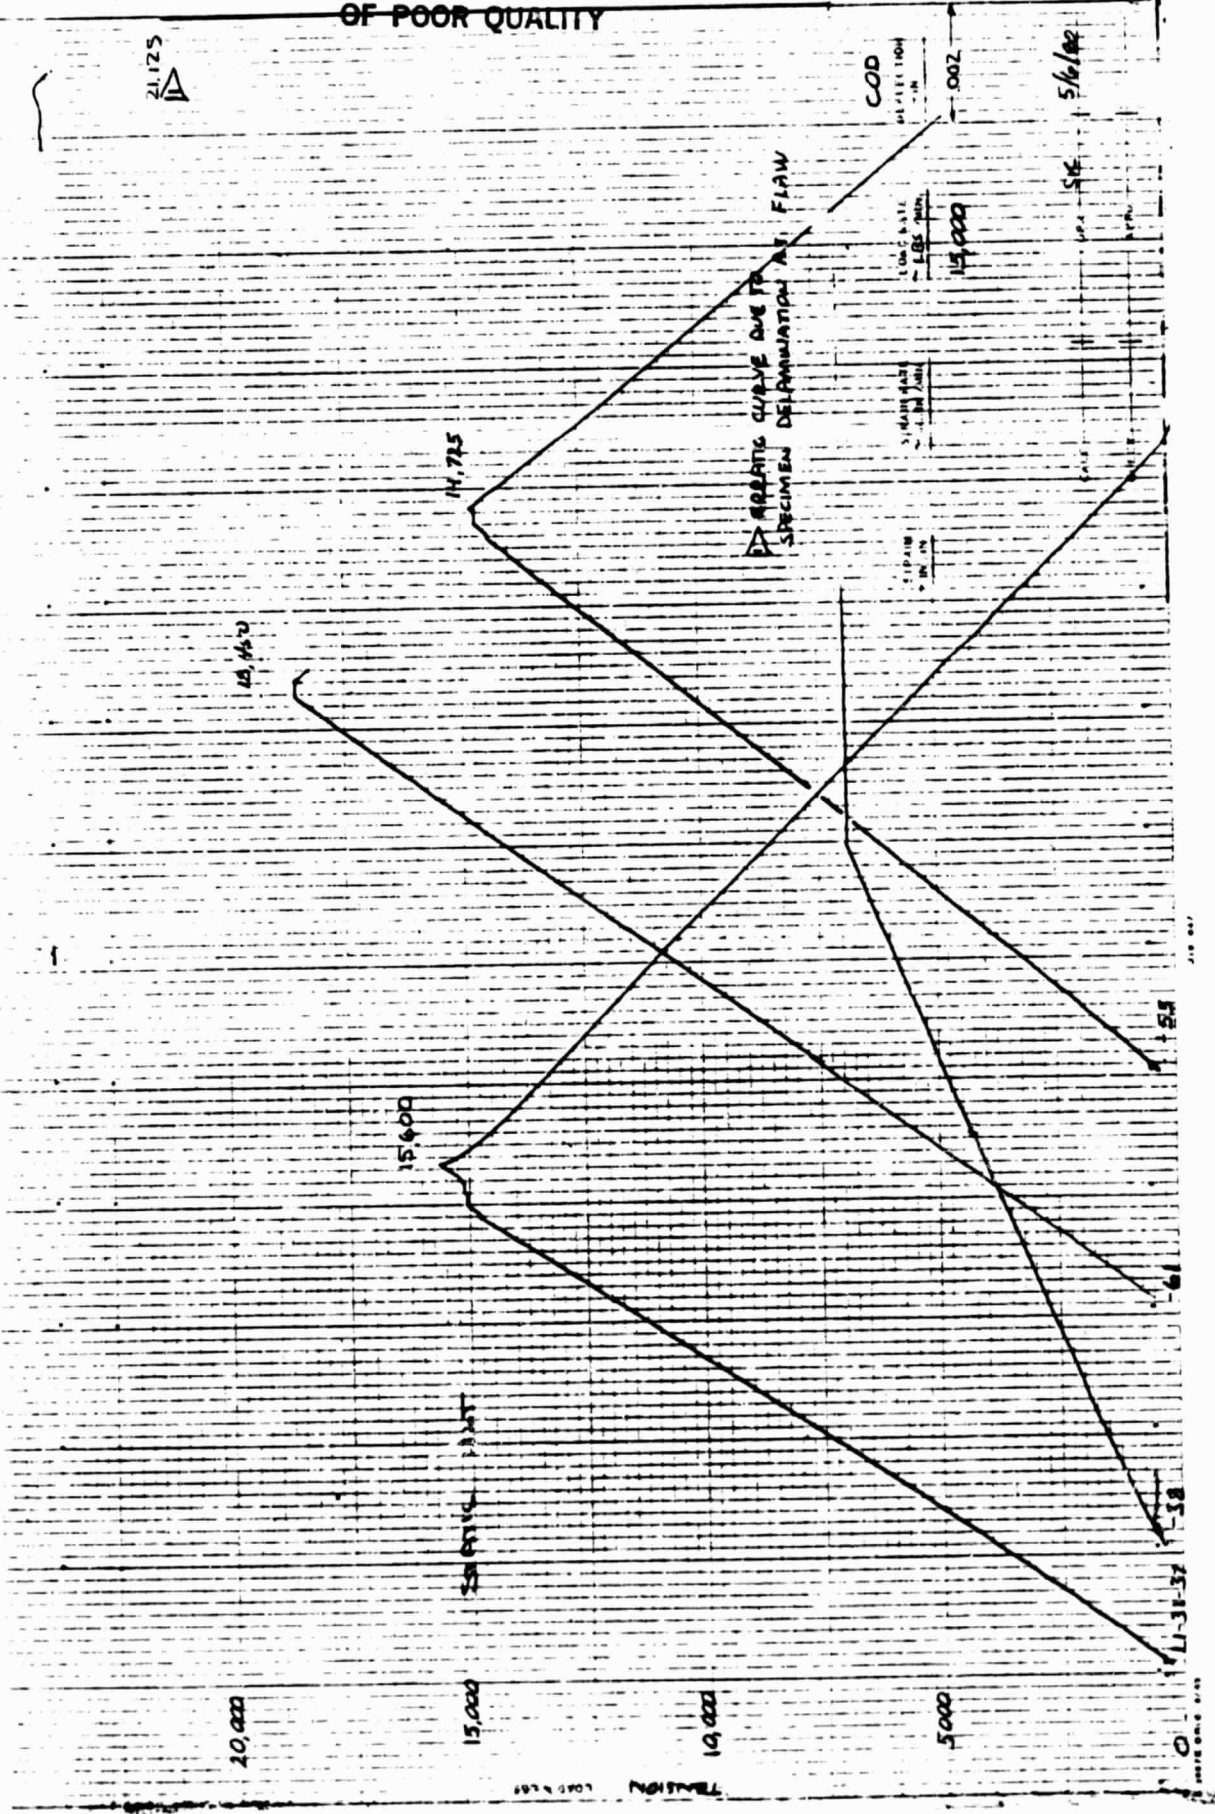





372

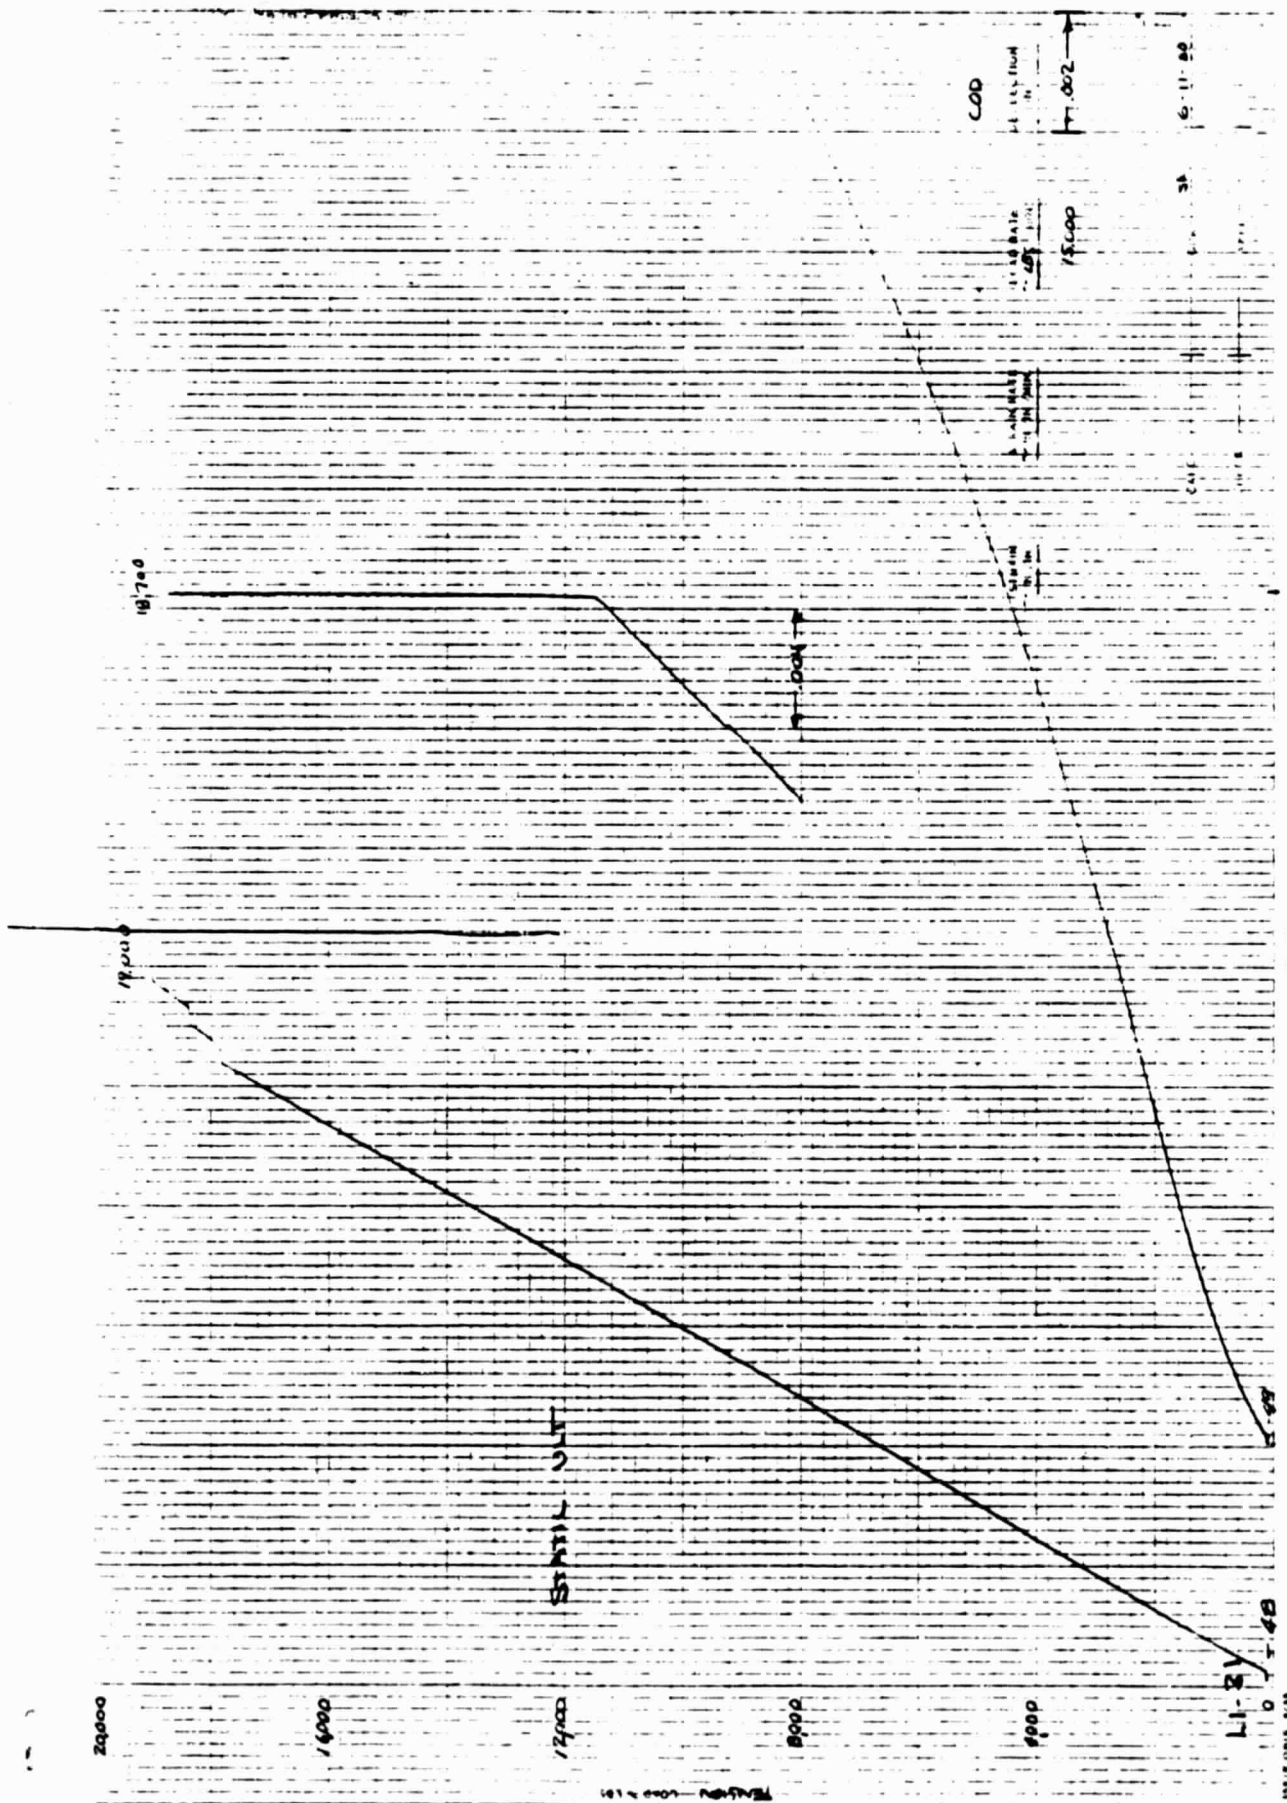


ORIGINAL PAGE IS  
OF POOR QUALITY

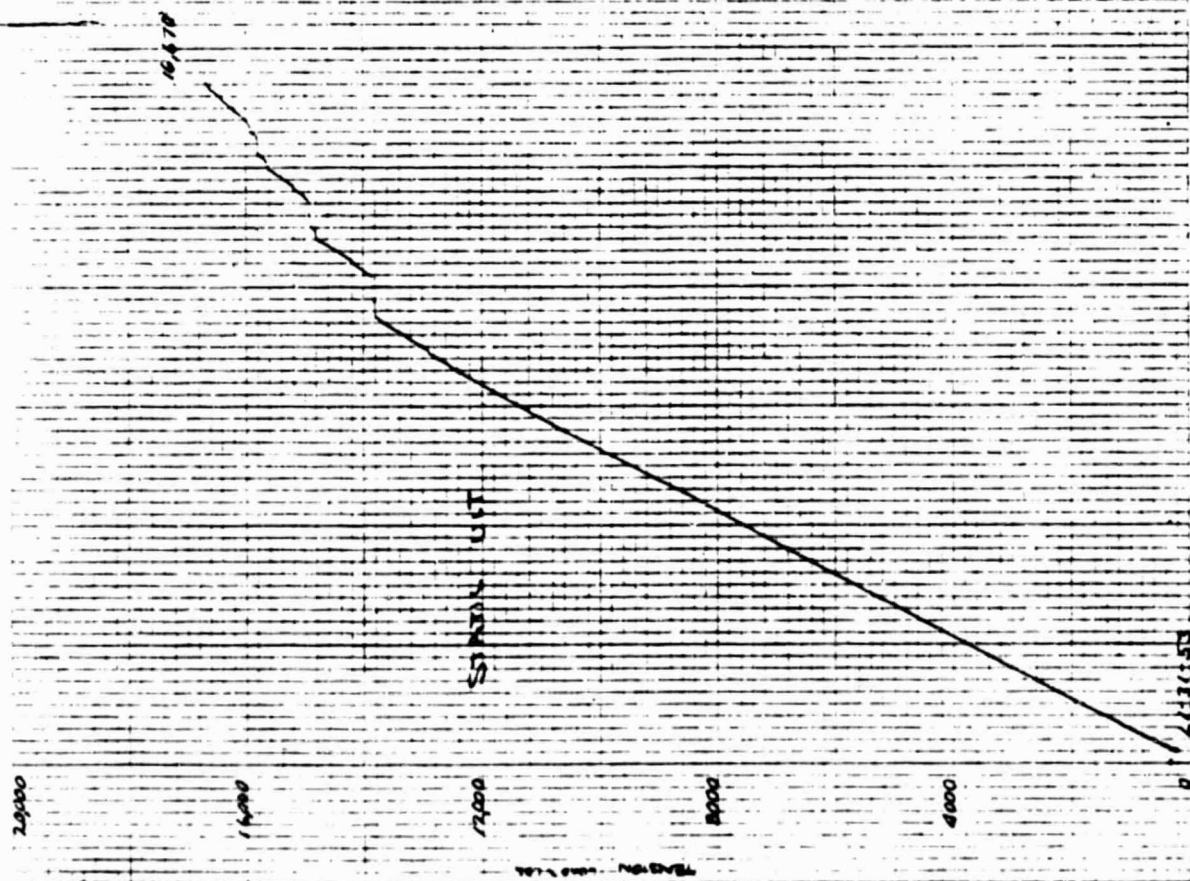

ORIGINAL PAGE IS  
OF POOR QUALITY

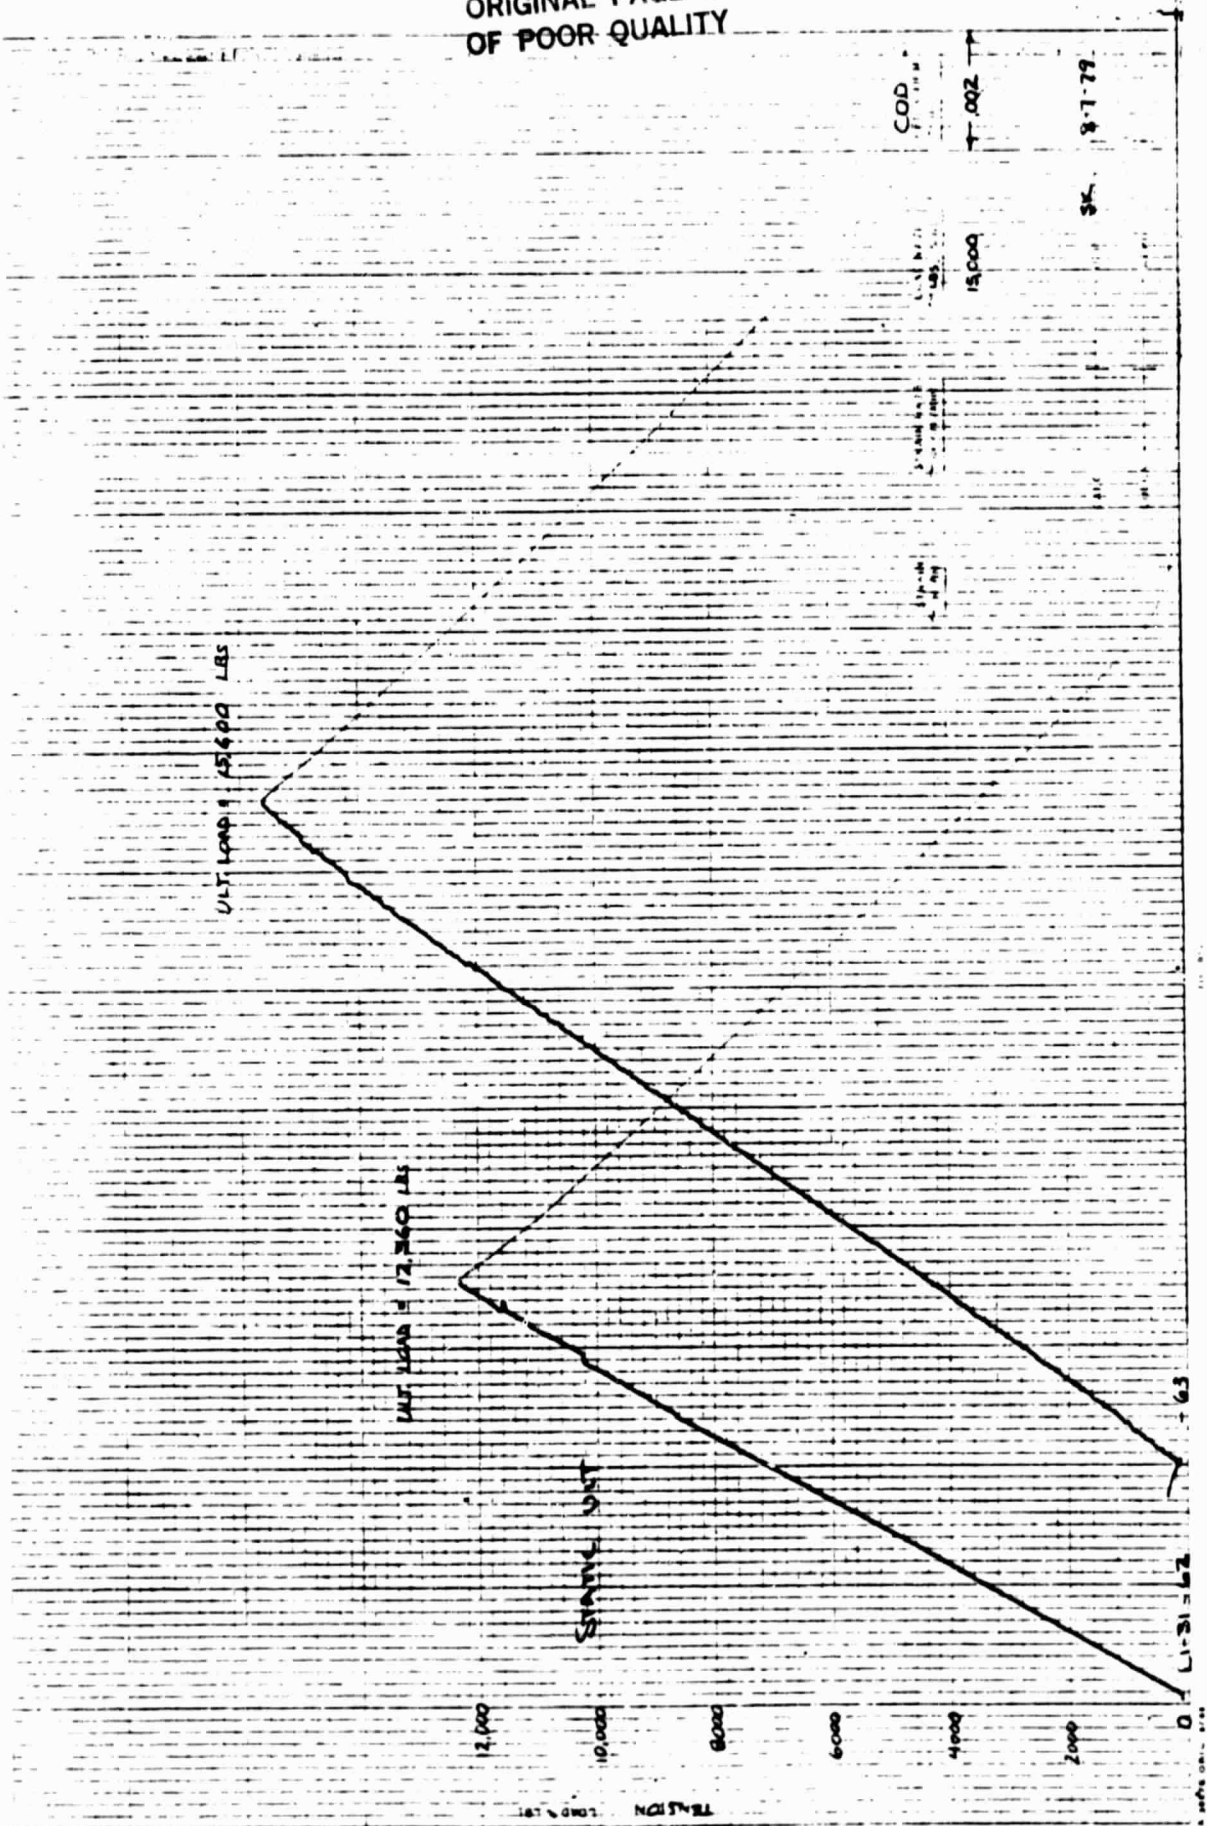

ORIGINAL PAGE IS  
OF POOR QUALITY

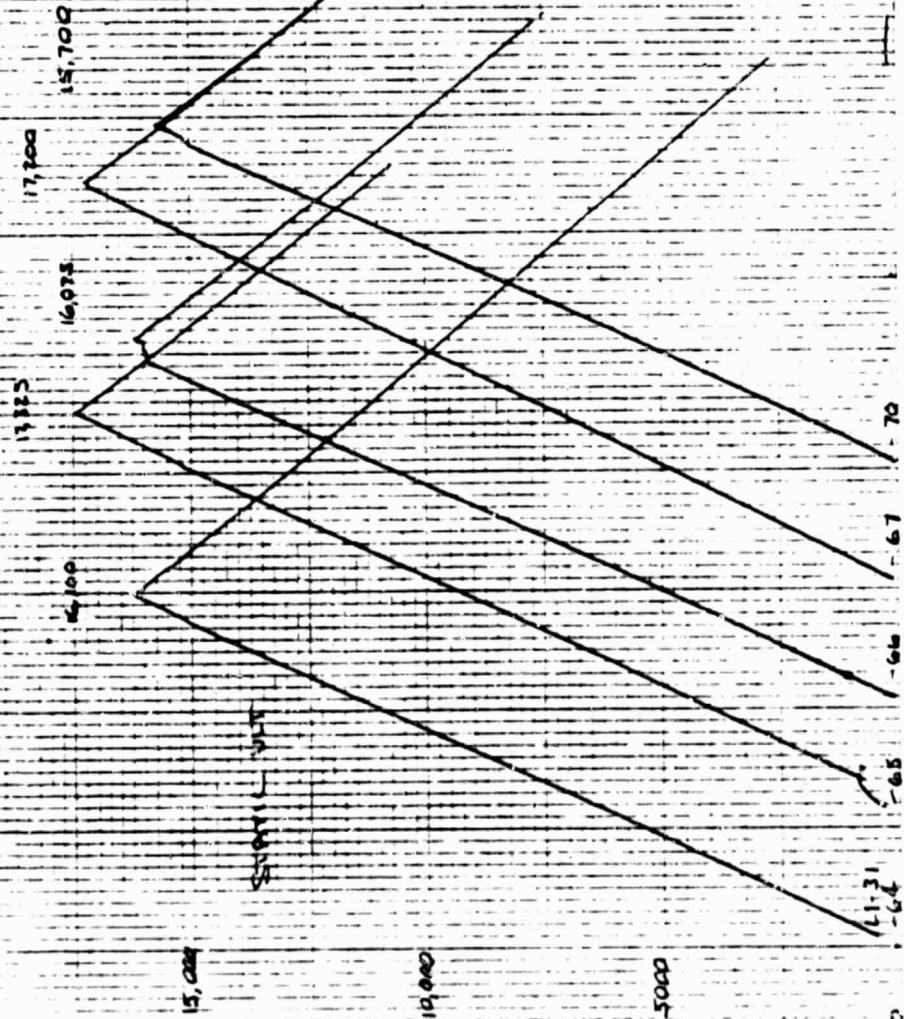

COD


15,000

15,000

15,000



ORIGINAL PAGE IS  
OF POOR QUALITY

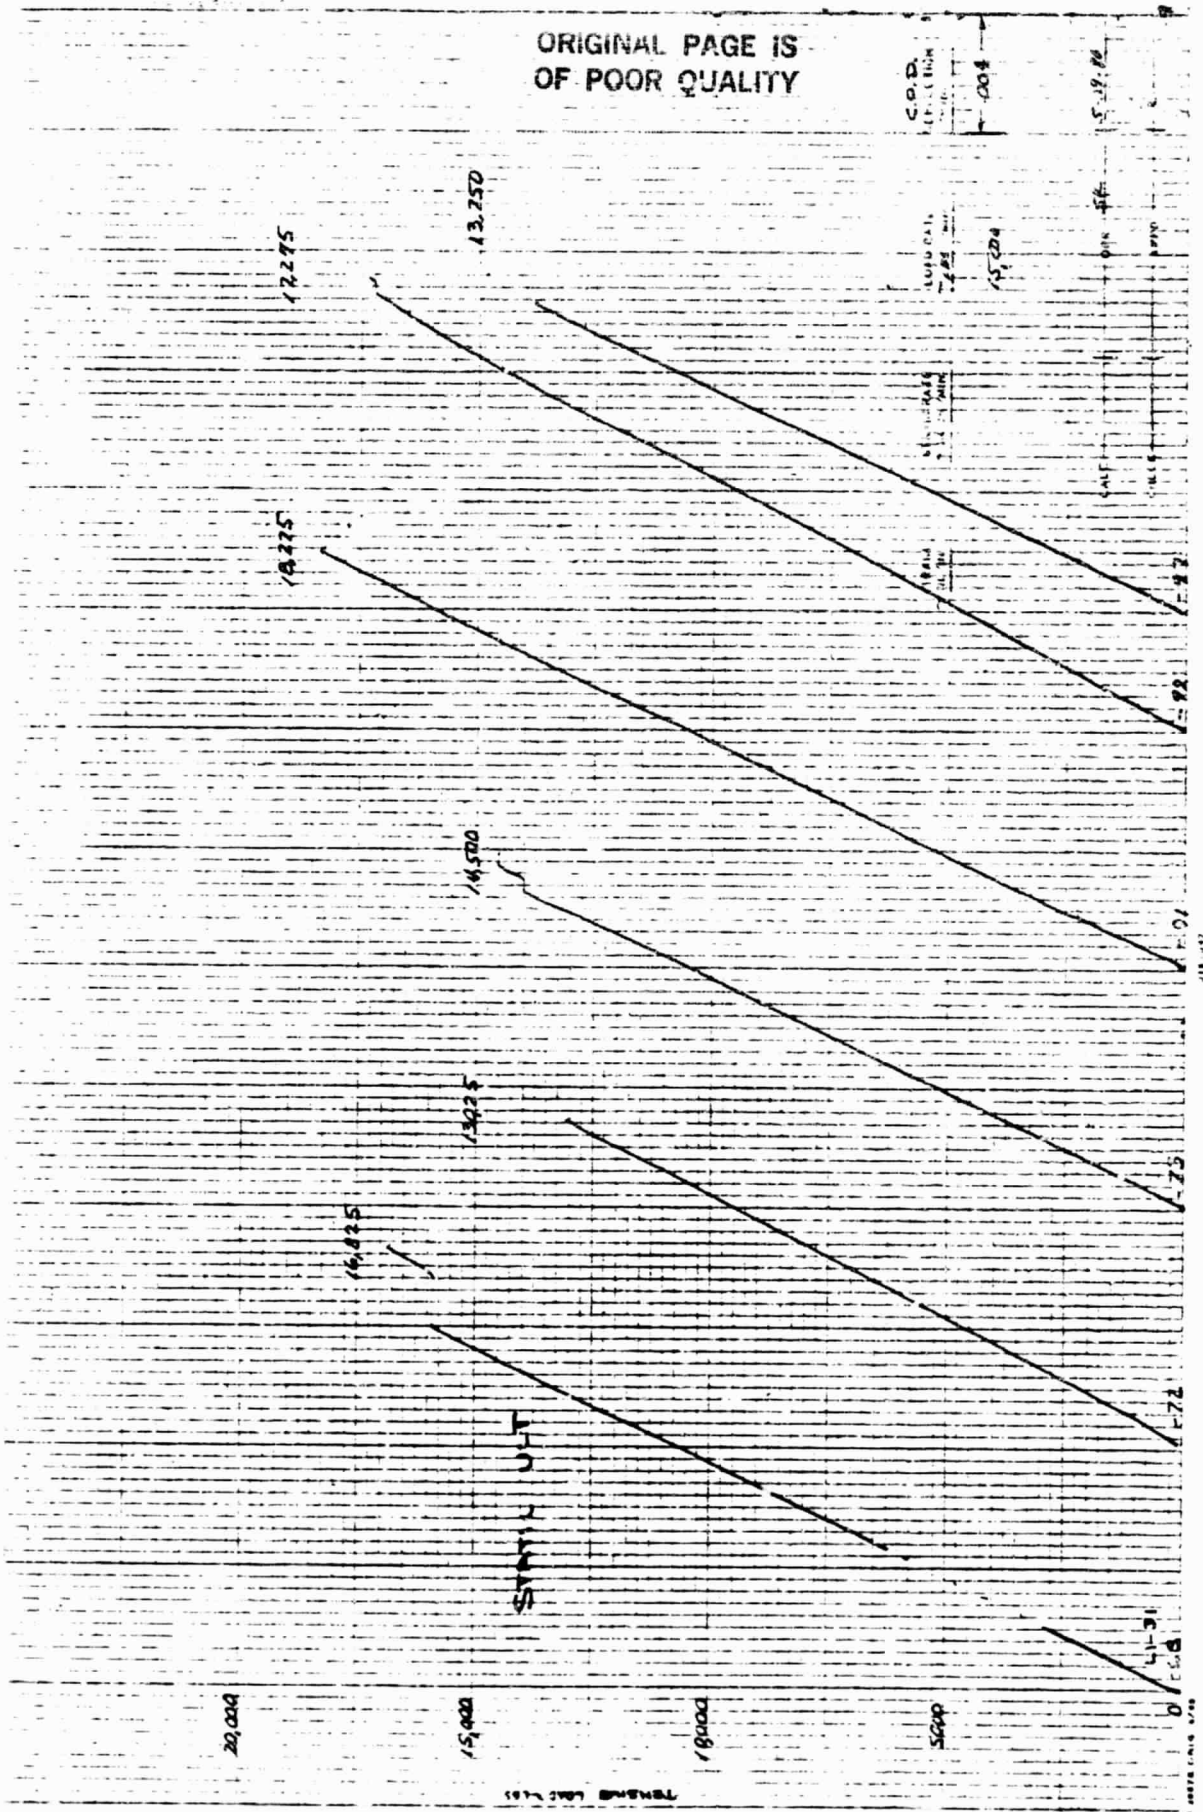

ORIGINAL PAGE IS  
OF POOR QUALITY

COD

1005

3-10-0

1989

SK

20,000

15,000

10,000

5,000

0

STATIC UNIT

18.250

37.525

16.100


18


18

24.75

27.77

ORIGINAL PAGE IS  
OF POOR QUALITY

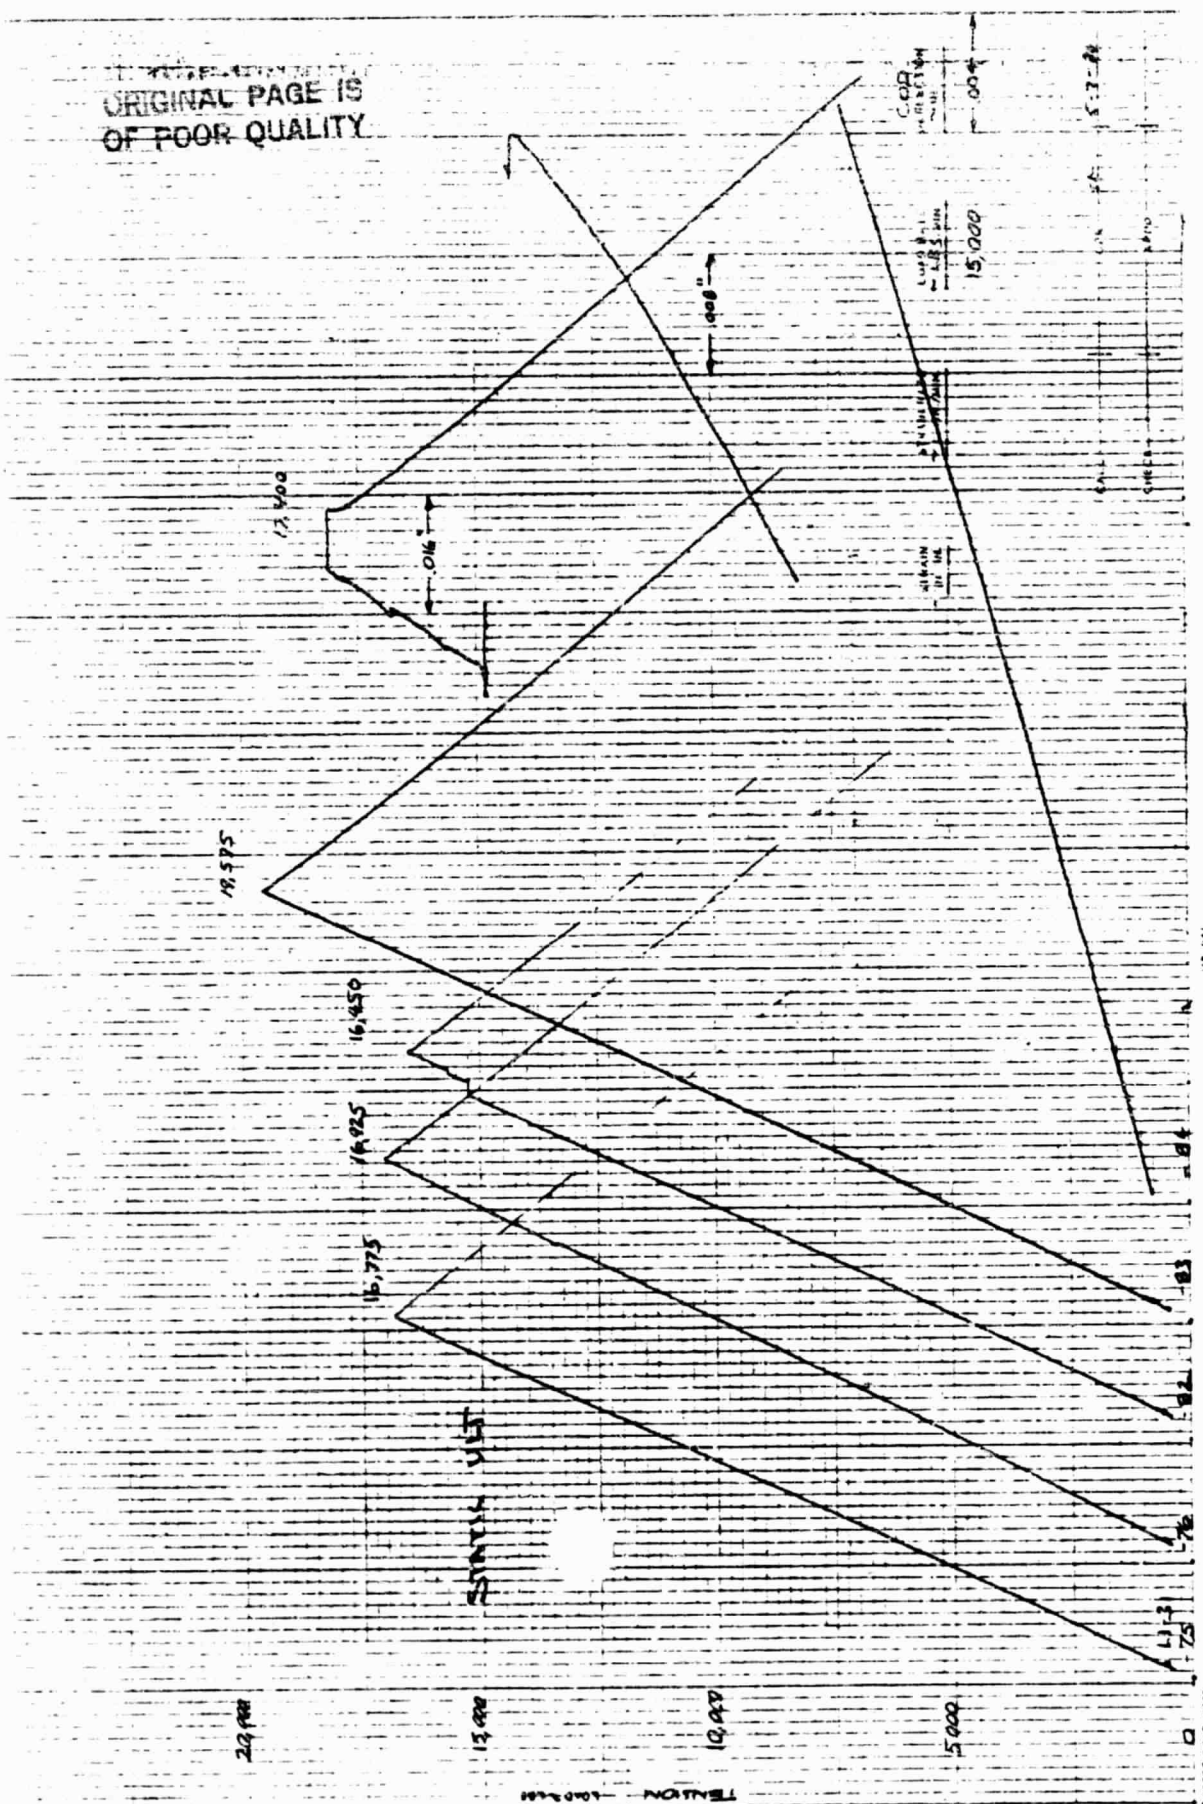

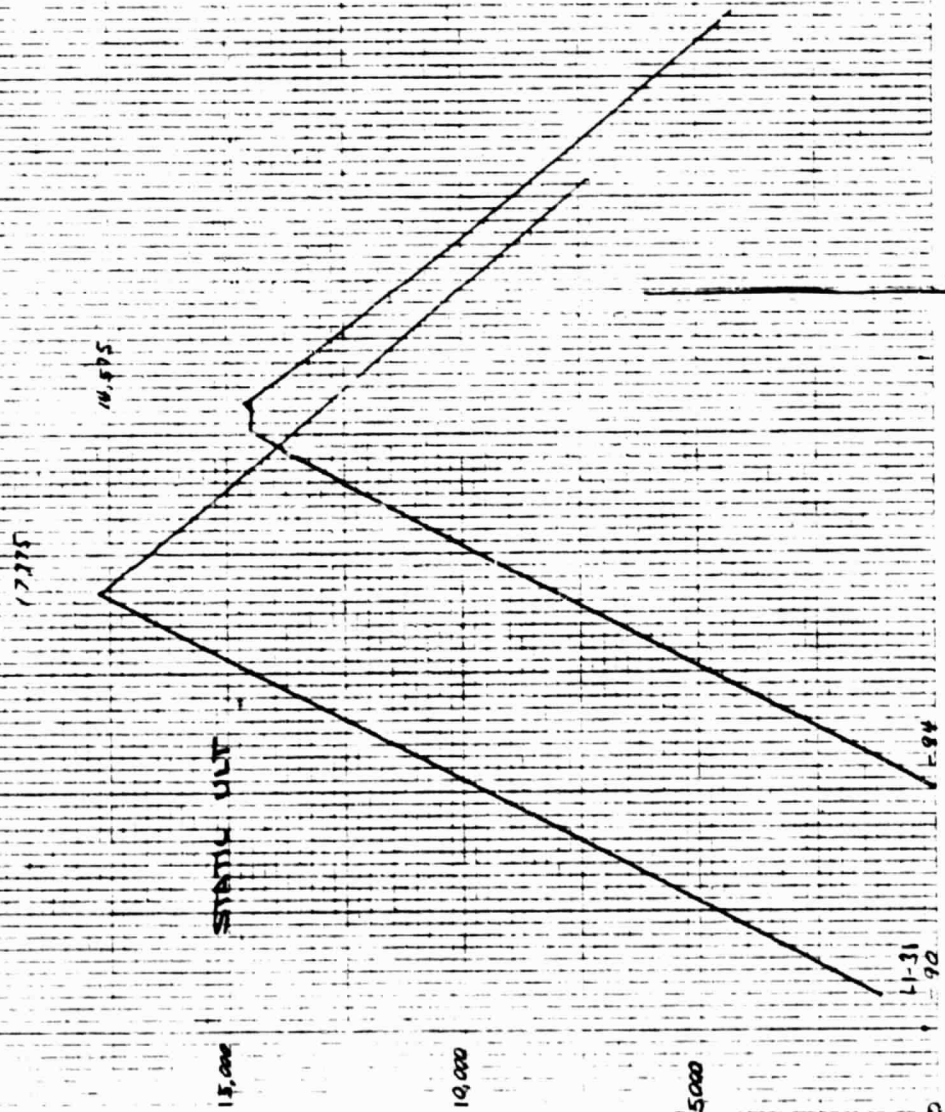[illegible]



ORIGINAL PAGE IS  
OF POOR QUALITY

COB

PERFECT COPY

500

6-11-80

LONG DATA

00051

SK

CLAM MARK

CLAM MARK

SK

SK

20540

STAIN UNIT

1-38-83

1-38-83

24000

16000

12000

8000

4000

ORIGINAL PAGE IS  
OF POOR QUALITY

COD

15000

16-11-88

STATUS UNIT

17200

19000

19000

11-25-91

ORIGINAL PAGE IS  
OF POOR QUALITY

C.O.D.

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

START - 1000

1000

1000

1000

1000

1000

1000

1000

**APPENDIX E**  
**WEIGHT GAIN DATA**

The tabulated weight gain data for each test specimen is included in this appendix as recorded during the course of making the measurements.

PRECEDING PAGE BLANK NOT FILMED

STATIC TEST SPECIMENS  
UNTABBED LAMINATE

Specimen number	Week								
	0	1	2	3	4	5	6	7	8
L1-21-A	18.775	18.910							
L1-21-B	18.534	18.673	18.726						
L1-21-C	18.593	18.733	18.784	18.813	18.827				
L2-21-D	18.784	18.923	18.975	19.003	19.018	19.028	19.029	19.037	19.049
L2-21-A	19.812	19.956							
L2-21-B	19.555	19.700	19.758						
L2-21-C	19.864	20.011	20.069	20.102	20.120				
L2-21-D	19.379	19.526	19.585	19.615	19.632	19.643	19.646	19.653	19.665
L2-22-A	19.603	19.746							
L2-22-B	19.514	19.658	19.714						
L2-22-C	19.901	20.046	20.105	20.136	20.154				
L2-22-D	19.445	19.587	19.643	19.674	19.690	19.702	19.706	19.712	19.726
L2-23-A	20.339	20.494							
L2-23-B	20.345	20.497	20.550						
L2-23-C	20.407	20.561	20.621	20.657	20.677				
L2-23-D	19.951	20.106	20.166	20.199	20.218	20.228	20.234	20.241	20.254
L2-24-A	19.891	20.102							
L2-24-B	19.536	19.753	19.790						
L2-24-C	20.080	20.266	20.315	20.346	20.331				
L2-24-D	19.924	20.115	20.164	20.186	20.205	20.212	20.223	20.231	20.246
L3-21-A	19.667	19.790							
L3-21-B	19.479	19.598	19.664						
L3-21-C	19.778	19.902	19.971	20.014	20.038				
L3-21-D	19.531	19.659	19.727	19.760	19.792	19.804	19.810	19.818	19.831
L3-22-A	20.454	20.600							
L3-22-B	20.240	20.385	20.454						
L3-22-C	19.598	19.738	19.803	19.841	19.861				
L3-22-D	19.772	19.917	19.984	20.024	20.044	20.055	20.061	20.067	20.078

Note: Weight in grams

PRECEDING PAGE BLANK NOT FILMED



# STATIC TEST SPECIMENS

Specimen number	Week								
	0	1	2	3	4	5	6	7	8
L1-21-1	173.847	175.574	176.210		176.670		176.880		176.960
L1-21-2	174.051	175.780	176.430		176.940		177.180		177.310
L1-21-3	174.951	176.661	177.320		177.860		178.050		178.190
L1-21-4	171.736	172.474	173.090		173.580		173.730		173.920
L1-21-5	173.914	175.643	176.200		176.770		176.940		177.020
L1-21-6	173.871	174.573	176.140		176.750		176.990		177.110
L1-21-7	173.074	174.782	175.370		175.960		176.210		176.340
L1-21-8	170.272	171.995	172.520		173.130		173.300		173.370
L1-21-9	174.040	175.750	176.280		176.940		177.060		177.160
L1-21-10	173.811	175.538	176.060		176.700		176.900		177.030
L1-21-11	174.543	176.260	176.790		177.470		177.690		177.860
L1-21-12	170.144	171.875	172.390		173.030		173.160		173.250
L1-21-13	173.340	175.040	175.570		176.250		176.360		176.430
L1-21-14	173.103	174.814	175.350		176.010		176.220		176.330
L1-21-15	173.546	175.264	175.790		176.460		176.640		176.790
L1-21-16	169.010	170.729	171.240		171.900		172.050		172.150
L1-21-17	173.112	174.840	175.370		176.030		176.150		176.290
L1-21-18	173.276	174.016	175.550		176.170		176.330		176.430
L1-21-19	174.185	175.910	176.440		177.090		177.310		177.500
L1-21-21	173.722	175.395	176.040		176.630		176.820		176.960
L1-21-22	171.840	173.490	174.150		174.720		174.920		175.090
L1-21-23	172.035	173.747	174.410		175.000		175.090		175.370
L1-21-24	167.702	169.341	170.020		170.570		170.630		170.870
L1-21-25	171.175	172.801	173.480		174.100		174.090		174.320
L1-21-26	170.290	171.931	172.600		173.170		173.220		173.510
L1-21-27	171.101	172.750	173.410		173.960		174.070		174.360
L1-21-28	166.723	168.359	169.020		169.530		169.720		169.840
L1-21-29	170.807	172.427	173.080		173.610		173.720		173.940

Note: Weight in grams

# STATIC TEST SPECIMENS

Specimen number	Week								
	0	1	2	3	4	5	6	7	8
L1-21-30	170.408	172.130	172.780		173.320		173.460		173.750
L1-21-31	172.104	173.758	174.420		174.950		175.060		175.330
L1-21-32	167.594	169.230	169.920		170.410		170.490		170.740
L1-21-33	170.395	172.052	172.700		173.240		173.330		173.600
L1-21-34	170.334	171.988	172.630		173.170		173.300		173.600
L1-21-35	171.551	173.195	173.860		174.410		174.510		174.800
L1-21-36	166.663	168.338	168.990		169.510		169.610		169.860
L1-21-37	171.380	173.040	173.700		174.220		174.340		174.630
L1-21-38	171.473	173.136	173.810		174.310		174.450		174.730
L1-21-39	173.910	175.597	176.260		176.810		177.000		177.140
L1-21-41	171.163	172.864	173.530		174.000		171.150		174.240
L1-21-42	174.212	174.900	176.580		177.080		177.340		178.490
L1-21-43	174.086	175.770	176.460		176.980		177.190		178.330
L1-21-44	172.606	174.292	174.960		175.450		175.560		175.660
L1-21-45	171.720	173.422	174.080		174.570		174.690		174.810
L1-21-46	174.400	176.084	176.760		177.240		177.540		177.720
L1-21-47	174.293	175.972	176.540		177.180		177.400		177.630
L1-21-48	172.897	174.601	175.170		175.760		175.900		176.000
L1-21-49	173.005	174.702	175.230		175.830		176.010		176.130
L1-21-50	174.522	176.214	176.760		177.430		177.650		177.860
L1-21-51	174.414	176.100	176.660		177.320		177.520		177.700
L1-21-52	171.964	173.666	174.200		174.830		174.950		175.050
L1-21-53	173.264	174.970	175.510		176.170		176.260		176.360
L1-21-54	175.117	176.820	177.370		178.040		178.260		178.420
L1-21-55	174.713	176.410	176.960		177.630		177.820		177.990
L1-21-56	171.992	173.711	174.250		174.900		175.010		175.110
L1-21-57	173.445	174.150	175.700		176.340		176.540		176.690
L1-21-58	174.490	176.224	176.890		177.400		177.540		177.650

Note: Weight in grams

STATIC TEST SPECIMENS

Specimen number	Week								
	0	1	2	3	4	5	6	7	8
L1-21-59	173.679	175.375	176.030		175.560		176.710		176.800
L1-21-61	175.441	177.028	177.690		178.280		178.590		178.790
L1-21-62	174.730	176.322	177.000		177.580		177.850		178.060
L1-21-63	176.150	177.768	178.430		179.650		179.310		179.520
L1-21-64	171.810	173.423	174.060		174.670		174.940		175.140
L1-21-65	175.865	177.479	178.120		178.740		179.010		179.240
L1-21-66	175.344	176.938	177.600		178.190		178.470		178.690
L1-21-67	175.778	177.383	178.040		178.600		178.940		179.110
L2-21-1	171.558	173.353	173.854		174.429		174.682		174.898
L2-21-2	174.237	175.931	176.480		177.105		177.391		177.625
L2-21-3	174.077	175.777	176.326		176.945		177.246		177.503
L2-21-4	175.950	177.730	178.241		178.802		179.050		179.246
L2-21-5	171.236	172.940	173.522		174.079		174.352		174.556
L2-21-6	173.606	175.304	175.854		176.466		176.763		176.940
L2-21-7	173.932	175.640	176.196		176.809		177.109		177.330
L2-21-8	175.592	177.316	177.883		178.460		178.733		178.926
L2-21-9	171.140	172.860	173.419		173.983		174.250		174.436
L2-21-10	173.596	175.286	175.842		176.447		176.735		176.934
L2-21-11	173.945	175.636	176.191		176.799		177.102		177.309
L2-21-12	174.803	176.500	177.060		177.620		177.884		178.058
L2-21-21	169.808	171.523	172.094		172.650		172.898		173.041
L2-21-22	172.092	173.772	174.320		174.910		174.208		174.392
L2-21-23	172.161	173.846	174.398		174.990		175.266		175.437
L2-21-24	173.607	175.290	175.861		176.446		176.707		176.890
L2-21-25	170.197	171.900	172.465		173.030		173.275		173.442
L2-21-26	172.364	174.019	174.611		175.198		175.475		175.662
L2-21-27	173.353	175.028	175.618		176.209		176.495		176.668

Note: Weight in grams



STATIC TEST SPECIMENS

Specimen number	Week								
	0	1	2	3	4	5	6	7	8
L2-21-28	174.323	176.033	176.596		177.166		177.429		177.600
L2-21-29	169.900	171.645	172.202		172.719		172.956		173.119
L2-21-30	172.937	174.606	175.209		175.792		176.061		176.224
L2-21-31	173.056	174.720	175.321		174.920		176.191		176.378
L2-21-32	173.370	175.153	175.630		176.170		175.301		176.545
L2-21-41	173.860	175.623	176.167		176.662		176.818		176.945
L2-21-42	171.730	173.439	174.041		174.580		174.790		174.967
L2-21-43	171.856	173.544	174.135		174.675		174.884		175.010
L2-21-44	169.760	171.470	172.045		172.541		172.693		172.794
L2-21-45	173.506	175.281	175.825		176.273		176.413		176.489
L2-21-46	171.467	173.162	173.749		174.292		174.513		174.670
L2-21-47	172.090	173.785	174.365		174.904		175.110		175.273
L2-21-48	169.990	171.776	172.298		172.740		172.910		172.978
L2-21-49	173.435	175.190	175.727		176.251		176.412		176.538
L2-21-50	170.704	172.411	172.994		173.530		173.762		173.984
L2-21-51	170.434	172.144	172.725		173.262		173.467		173.644
L2-21-52	169.510	171.251	171.788		172.262		172.382		172.508
L2-21-61	175.871	177.671	178.223		178.730		178.874		179.030
L2-21-62	173.536	175.283	175.877		176.443		176.658		176.845
L2-21-63	173.695	175.430	176.025		176.587		176.791		176.969
L2-21-64	173.150	174.963	175.504		176.007		176.144		176.269
L2-22-1	172.917	174.538	175.096		175.725		176.014		176.268
L2-22-2	173.630	175.227	175.806		176.452		176.748		177.010
L2-22-3	174.840	176.425	177.008		177.659		177.966		178.238
L2-22-4	169.060	170.691	171.244		171.864		172.148		172.396
L2-23-1	174.300	175.989	176.552		177.205		177.508		177.751

Note: Weight in grams

STATIC TEST SPECIMENS

Specimen number	Week								
	0	1	2	3	4	5	6	7	8
L2-23-2	175.480	177.117	177.714		178.375		178.687		178.960
L2-23-3	174.650	176.325	176.924		177.588		177.898		178.187
L2-23-4	169.060	176.034	176.610		177.260		177.565		177.747
L2-24-1	173.125	175.334	175.794		176.291		176.474		176.756
L2-24-2	173.589	175.540	176.164		176.640		176.856		177.100
L2-24-3	175.576				178.665		178.890		179.122
L2-24-4	170.206	172.320	172.812		173.306		173.511		173.750
L3-21-1	176.234	177.804	178.454		179.142		179.450		179.677
L3-21-2	175.989	177.513	178.177		178.890		179.225		179.484
L3-21-3	175.653	177.192	177.858		178.563		178.908		179.166
L3-21-4	170.752	172.385	173.002		173.661		173.978		174.221
L3-21-5	176.117	177.700	178.332		179.032		179.369		179.735
L3-21-6	176.528	178.056	178.720		179.422		179.760		180.030
L3-21-7	174.898	176.424	177.091		177.778		178.118		178.373
L3-21-8	170.460	172.090	172.715		173.360		173.682		173.921
L3-21-9	176.426	178.003	178.647		179.340		179.676		179.427
L3-21-10	176.818	178.348	179.006		179.709		180.042		180.286
L3-21-11	174.563	176.090	176.737		177.427		177.353		177.984
L3-21-12	173.247	173.790	174.426		175.068		175.386		175.628
L3-21-21	169.552	171.144	171.780		172.410		172.710		172.949
L3-21-22	175.720	177.227	177.877		178.570		178.911		179.169
L3-21-23	177.082	178.605	179.227		179.983		180.330		180.596
L3-21-24	175.468	177.012	177.643		178.335		178.671		178.922
L3-21-25	170.044	171.636	172.260		172.896		173.210		173.462
L3-21-26	176.266	177.776	178.418		179.115		179.470		179.725
L3-21-27	175.755	177.258	177.895		178.596		178.950		179.207

Note: Weight in grams

STATIC TEST SPECIMENS



Specimen number	Week								
	0	1	2	3	4	5	6	7	8
L3-21-28	174.915	176.470	177.085		177.774		178.130		178.355
L3-21-29	169.396	170.996	171.634		172.243		172.570		172.812
L3-21-30	177.720	179.216	179.878		180.597		180.961		181.243
L3-21-31	175.926	177.416	178.063		178.767		179.103		179.360
L3-21-32	175.524	177.066	177.699		178.569		178.685		178.894
L3-21-41	175.598	177.148	177.792		178.474		178.801		179.042
L3-21-42	175.687	177.203	177.853		178.560		178.895		179.160
L3-21-43	175.166	176.695	177.342		178.047		178.378		178.642
L3-21-44	170.514	172.121	172.752		173.412		173.707		173.951
L3-21-45	175.096	176.650	177.267		177.976		178.303		178.525
L3-21-46	175.939	177.452	178.103		178.815		179.159		179.416
L3-21-47	173.562	175.074	175.718		176.410		176.730		176.984
L3-21-48	169.655	171.232	171.966		172.534		172.841		173.070
L3-21-49	174.324	175.880	176.522		177.215		177.539		177.779
L3-21-50	175.518	177.032	177.693		178.395		178.729		178.978
L3-21-51	173.218	174.729	175.380		176.056		176.329		176.618
L3-21-52	171.631	173.168	173.800		174.433		174.760		176.989
L3-21-61	169.868	171.475	172.121		172.734		173.034		173.250
L3-21-62	175.812	177.333	177.988		178.685		179.019		179.276
L3-21-63	175.635	177.148	177.810		178.506		178.846		179.097
L3-21-64	175.660	177.208	177.857		178.515		178.819		179.043
L3-22-1	176.420	178.010	178.656		179.400		179.575		179.779
L3-22-2	173.730	175.325	175.982		176.700		176.919		177.128
L3-22-3	176.400	177.996	178.663		179.390		179.609		179.812
L3-22-4	172.144	173.769	174.420		175.140		175.319		175.537
L3-22-5	176.093	177.724	178.367		179.080		179.315		179.512
L3-22-6	174.692	176.303	176.948		177.680		177.890		178.092

Note: Weight in grams

[illegible]

392

CYCLIC TEST SPECIMENS  
UNTABBED LAMINATE

SPECIMEN NUMBER	INITIAL WEIGHT (g)	1 WEEK WEIGHT (g)	2 WEEK WEIGHT (g)	3 WEEK WEIGHT (g)	4 WEEK WEIGHT (g)	6 WEEK WEIGHT (g)	8 WEEK WEIGHT (g)	POST-TEST WEIGHT  (g)	$\Delta t$  (IN)
L3-1	16.3018	16.4100	--	--	--	--	--	--	.0009
-2	16.4907	16.6020	--	--	--	--	--	--	.0010
-3	17.0016	17.1191	17.1725	--	--	--	--	--	.0010
-4	17.5768	17.9990	18.0527	18.0813	18.1031	18.1331	--	--	.0015
L3-5	17.4347	17.5539	17.6078	17.6379	17.6597	17.6885	17.7024	--	.0010
L3-1	16.3478	16.4490	--	--	--	--	--	--	.0006
-2	17.4071	17.5201	--	--	--	--	--	--	.0002
-3	16.6088	16.7170	16.7752	--	--	--	--	--	.0010
-4	17.7412	17.8561	17.9179	17.9532	17.9774		18.0018	--	.0012
L3-5	17.3719	17.4840	17.5456	17.5769	17.5984	17.6246	17.6366	--	.0010

ORIGINAL PAGE IS  
OF POOR QUALITY

CYCLIC TEST SPECIMENS

SPECIMEN NUMBER	INITIAL WEIGHT (g)	1 WEEK WEIGHT (g)	2 WEEK WEIGHT (g)	3 WEEK WEIGHT (g)	4 WEEK WEIGHT (g)	6 WEEK WEIGHT (g)	8 WEEK WEIGHT (g)	POST-TEST WEIGHT (g)	$\Delta t$ (IN)
L1-31-25	173.9663	175.3480	176.0412	176.4707	176.8324	177.2609	177.5203	--	.002
-26	177.1086	178.5035	179.2368	179.6499	180.0209	180.4889	180.7839	--	.002
-27	174.2561	175.6922	176.3800	176.8109	177.1666	177.6339	177.9021	--	.002
-28	174.5697	176.0275	176.7257	177.1446	177.4990	177.9597	178.2452	179.1433	.002
-29	172.8259	174.2592	174.9309	175.3636	175.7104	176.1870	176.4573	177.2737	.002
-30	171.5496	173.3513	174.0765	174.5104	174.8759	175.3402	175.5927	--	.003
-31	176.3698	177.7885	178.4801	178.9156	179.2746	179.7473	180.0364	--	.002
-32	175.6493	177.0730	177.8005	178.2152	178.5825	179.0383	179.2949	--	.002
-33	176.0354	177.4776	178.1696	178.5953	178.9558	179.3828	179.6853	--	.002
-34	177.6780	178.9027	179.5849	180.0146	180.3807	180.8543	181.1329	--	.003
-45	171.4104	172.8120	173.5165	173.9429	174.2862	174.7493	175.0150	--	.003
-46	176.1933	177.6576	178.3735	178.7823	179.1286	179.5684	179.7603	--	.001
-47	176.6724	178.1500	178.8089	179.2406	179.5858	179.9806	180.2225	--	.002
-48	178.9384	180.4486	181.1853	181.6624	181.9782	182.3744	182.6039	183.3423	.002
-49	173.5899	175.1135	175.8123	176.2223	176.5362	176.9220	177.1609	177.7933	.002
-50	174.2360	176.2497	176.9363	177.3162	177.6453	178.0577	178.2869	--	.001
-51	176.6392	178.1130	178.7763	179.1854	179.5185	179.9173	180.1901	--	.002
-52	174.8657	176.3635	177.0401	177.4659	177.8006	178.2310	178.4657	--	.002
-53	173.9534	175.4082	176.0905	176.4982	176.8372	177.2294	177.4857	176.4448	.003
-60	174.3782	175.7920	176.4836	176.9257	177.2537	177.7359	178.0305	--	.001
-64	178.0692	179.4672	180.1722	180.6148	180.9824	181.4509	181.7278	--	.002
-65	176.4795	177.9055	178.6109	179.0344	179.4371	179.8518	180.1290	--	.001
-66	174.3568	175.8600	176.5307	176.9272	177.2639	177.6802	177.9017	--	.001
-67	173.6507	175.1908	175.8258	176.2282	176.5541	177.0059	177.2076	--	.002
-68	177.2446	178.8111	179.4462	179.8820	180.2154	180.6047	180.8522	181.2025	.002
-69	176.0571	177.5316	178.1688	178.6104	178.9662	179.3550	179.5969	--	.001
-70	176.8531	178.3705	179.0117	179.4432	179.8221	180.2674	180.5149	--	.002
-71	175.9640	177.4100	178.0537	178.4904	178.8093	179.2240	179.4726	--	.002
-72	173.4033	174.9080	175.5725	175.9807	176.3233	176.7108	176.9617	177.3314	.002
-73	174.0064	175.4320	176.1334	176.5428	176.8875	177.3012	177.5445	176.6219	.002
-90	179.5883	180.9537	181.6707	182.1103	182.5005	183.0223	183.3135	--	.002
-91	180.5374	181.8734	182.5769	183.0453	183.4375	183.8925	184.1639	184.7209	.002
-92	173.9853	175.3399	176.0307	176.4868	176.8325	177.3080	177.5642	177.3832	.002
-93	180.5600	181.9410	182.6336	183.1226	183.5159	183.9983	184.2851	--	.002
-94	179.0833	180.4661	181.2043	181.6316	182.0098	182.4721	182.7830	--	.002
-95	176.5762	177.9863	178.6787	179.1128	179.4798	179.9512	180.2322	--	.002
-96	175.4752	176.8998	177.6163	178.0513	178.4159	178.9008	179.1929	--	.002
-97	171.3532	172.7230	173.3901	173.8081	174.1609	174.6187	174.8810	175.3081	.001
-98	176.3297	177.6925	178.3496	178.8158	179.2018	179.6626	179.9459	--	.001
-99	178.1413	179.5495	180.2229	180.6939	181.0650	181.5511	181.8435	179.3209	.002
L1-31-100	174.5703	175.9191	176.5896	177.0201	177.3835	177.8528	178.1331	178.0334	.002

- ① Upon completion of cyclic loading, specimens were wrapped in wet cloth and stored in plastic bags. Specimens were weighed approx. 20-30 days post-test.
- ② Difference in thickness measurements made before and after eight-week soak.
- ③ Post-test weight measured immediately upon removal from test machine.

TABLE III  
MOISTURE CONDITIONING DATA


**APPENDIX F**  
**PHOTOGRAPHS OF FAILED TEST SPECIMENS**

This appendix contains photographs of typical test specimens after completion of the testing. The specimens are identified by specimen number, defect code and testing history.

PRECEDING PAGE BLANK NOT FILMED




L1-21-8  
422K

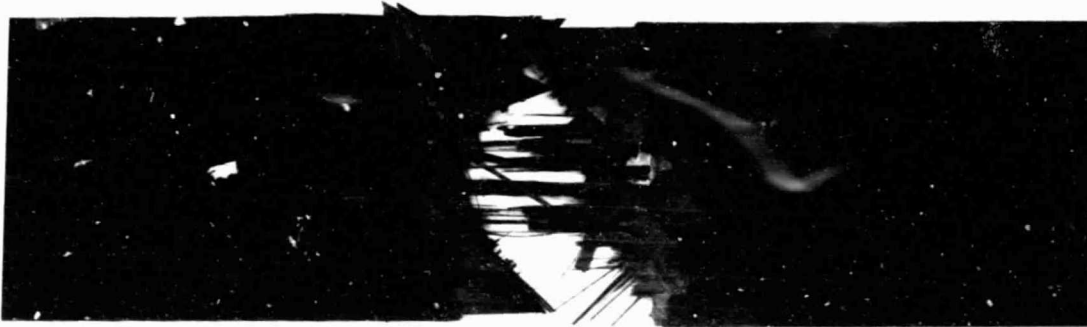

L1-21-7  
422K



L1-21-6  
ROOM

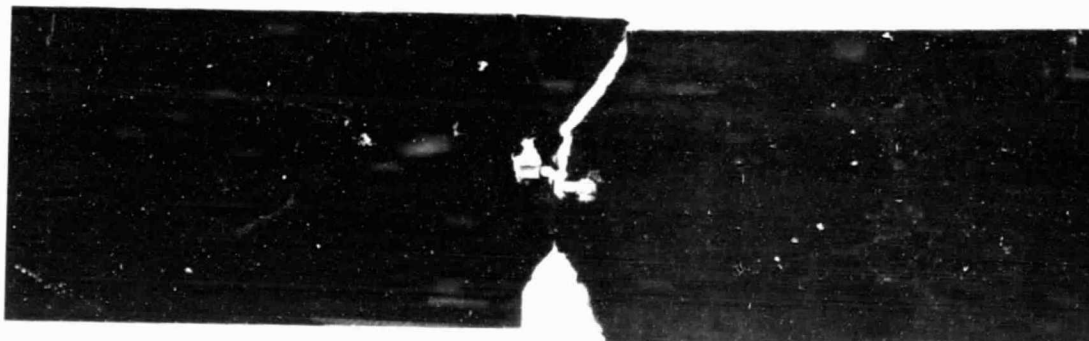

L1-21-5  
ROOM

STATIC TEST SPECIMENS (WET)  
1/8 FP HOLE

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH




ORIGINAL PAGE IS  
OF POOR QUALITY



L1-21-44  
422K



L1-21-43  
422K

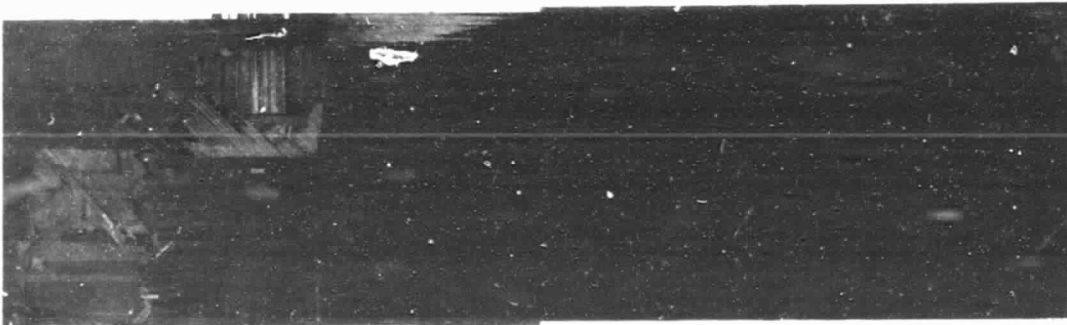

L1-21-42  
ROOM



L1-21-41  
ROOM

STATIC TEST SPECIMENS (WET)  
1/8 HP HOLE


ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH




L2-21-24  
422K



L2-21-23  
422K

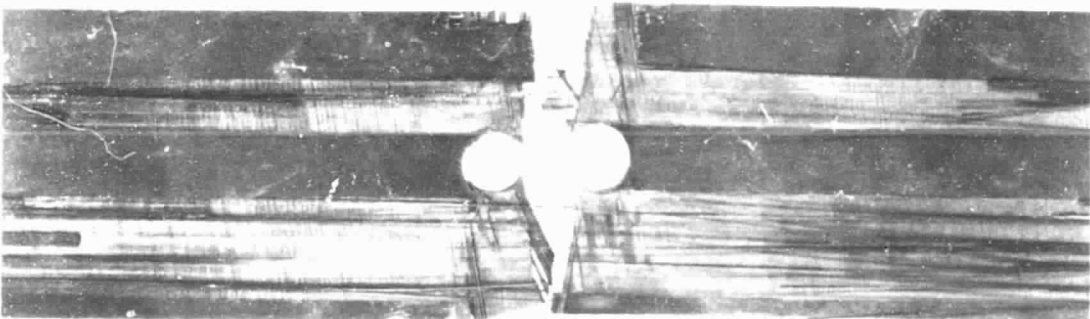


L2-21-22  
ROOM

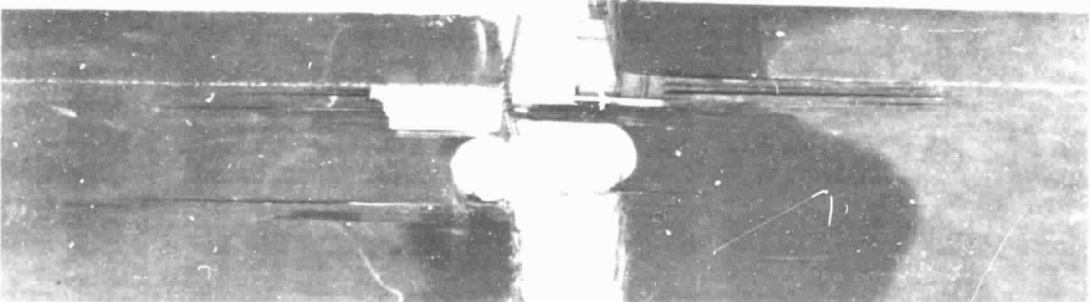


L2-21-21  
ROOM

STATIC TEST SPECIMENS (WET)  
5/8 FP HOLE


ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

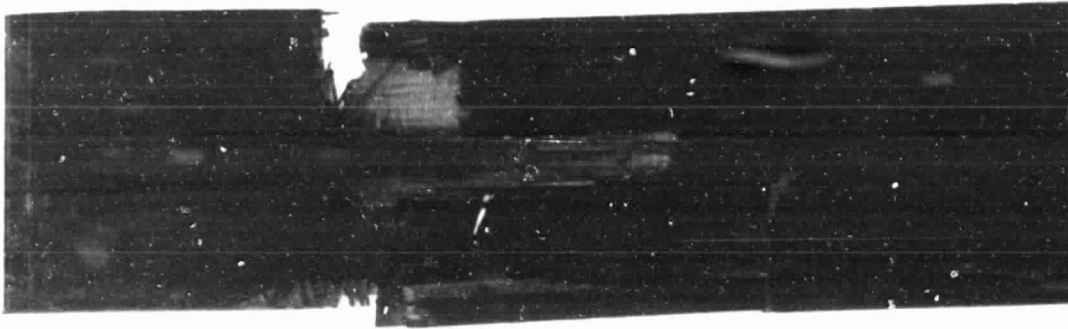


L2-21-8  
422K

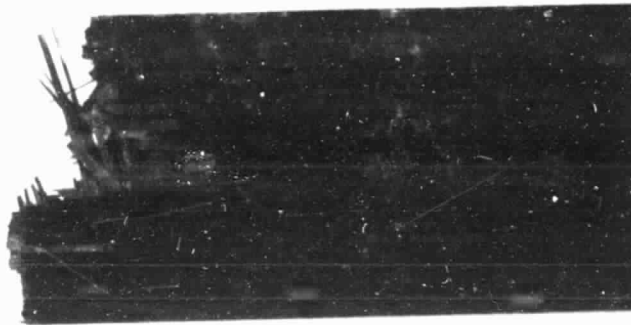

L2-21-7  
422K

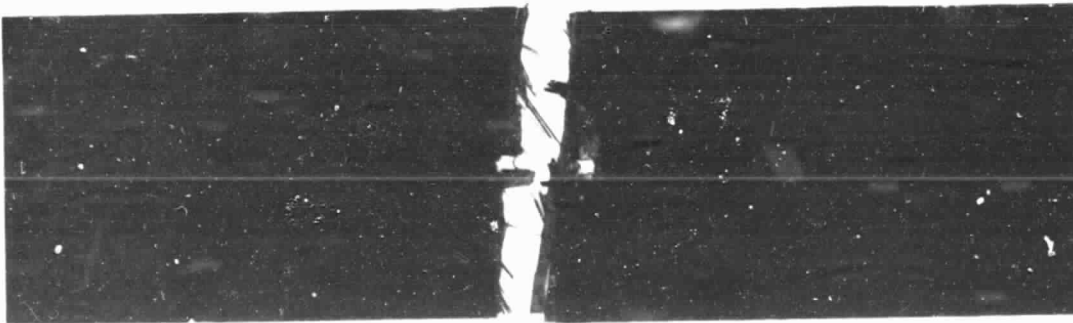


L2-21-6  
ROOM

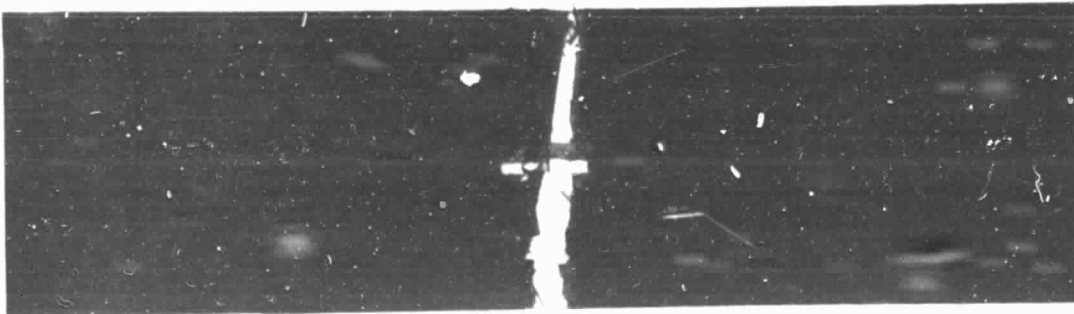


L2-21-5  
ROOM

STATIC TEST SPECIMENS (WET)  
1/8 FP HOLE

ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

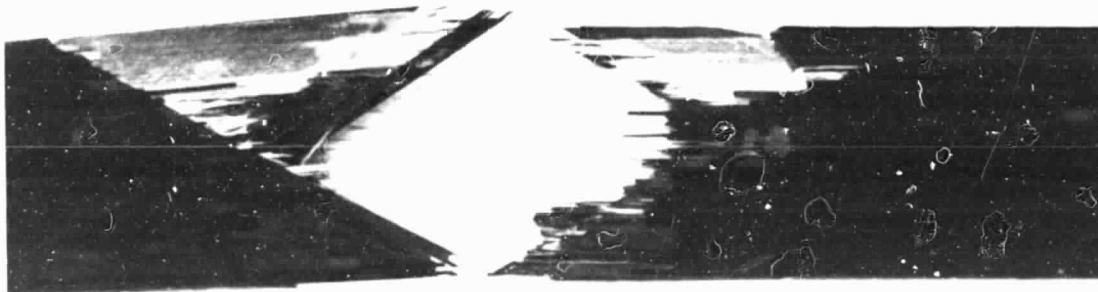

L3-21-24  
422K

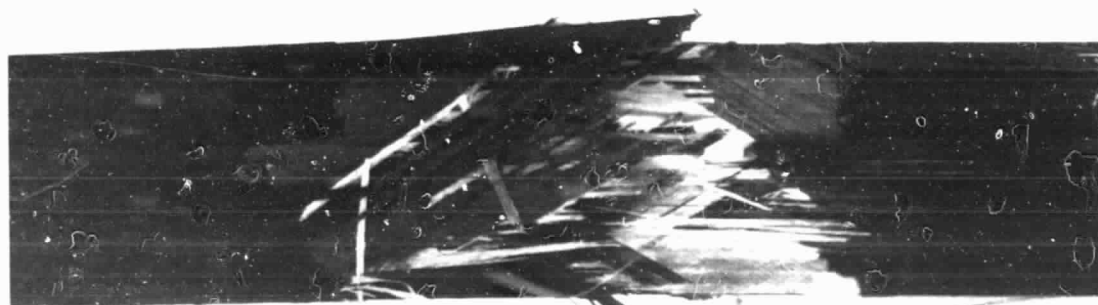

L3-21-23  
422K




L3-21-22  
ROOM



L3-21-21  
ROOM

STATIC TEST SPECIMENS (WET)  
1/8 HP SLIT


ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

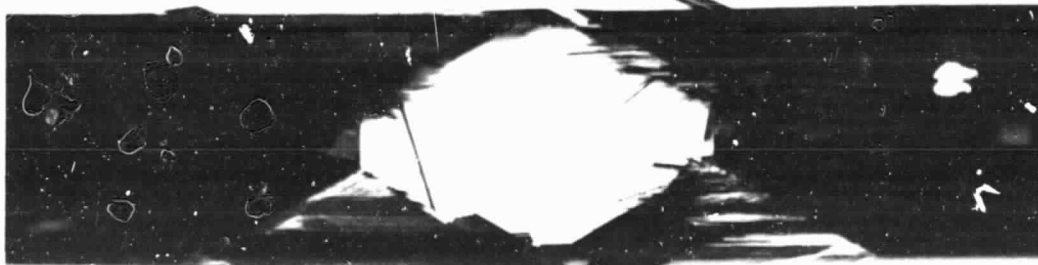


L3-21-12  
422K



L3-21-11  
422K

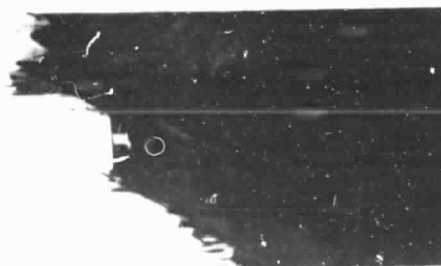

L3-21-10  
ROOM

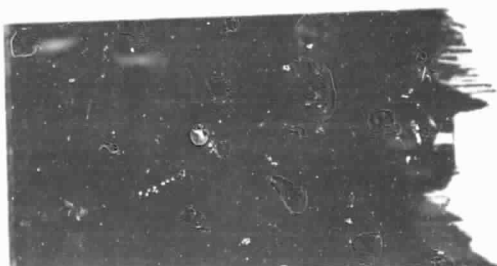

L3-21-9  
ROOM

STATIC TEST SPECIMENS (WET)  
5/8 FP SLIT


ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH



L3-22-24  
422K



L3-22-23  
422K

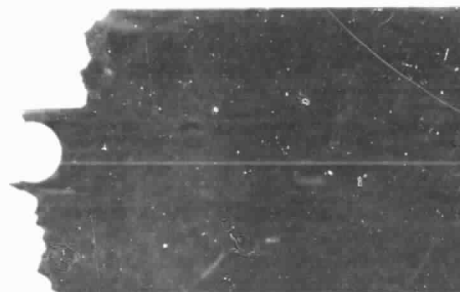


L3-22-22  
ROOM




L3-22-21  
ROOM

STATIC TEST SPECIMENS (WET)  
5/8 FP HOLE


ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

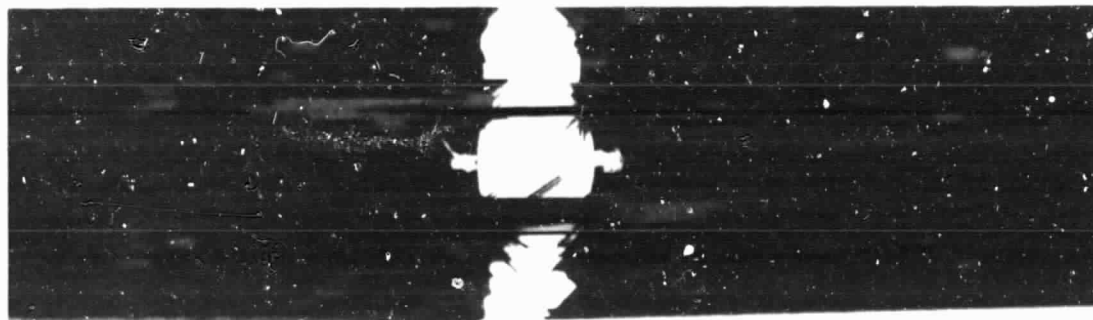


L1-31-41  
R = -1.00

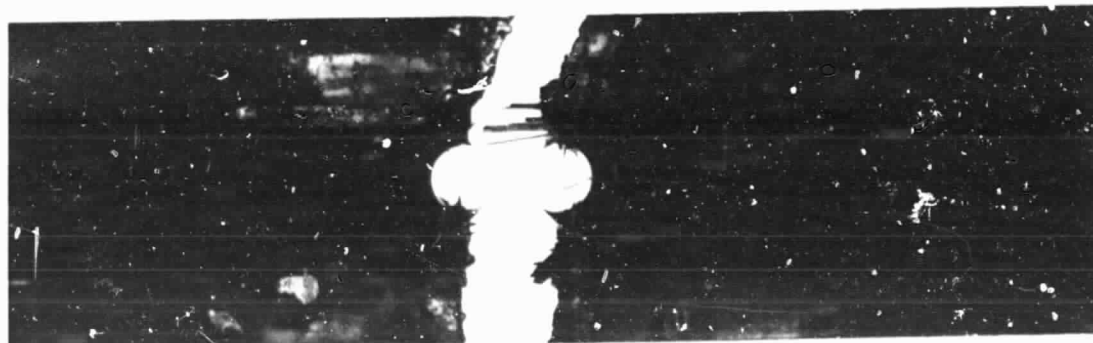

L1-31-77  
R = -1.00

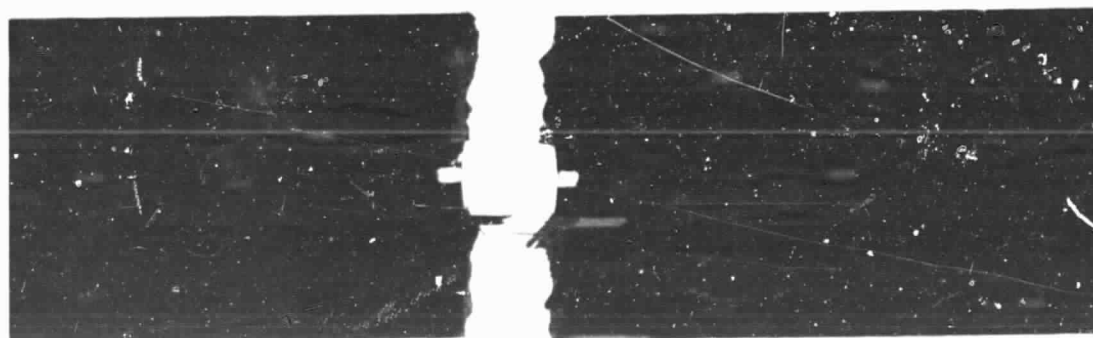

L1-31-35  
R = 0.05

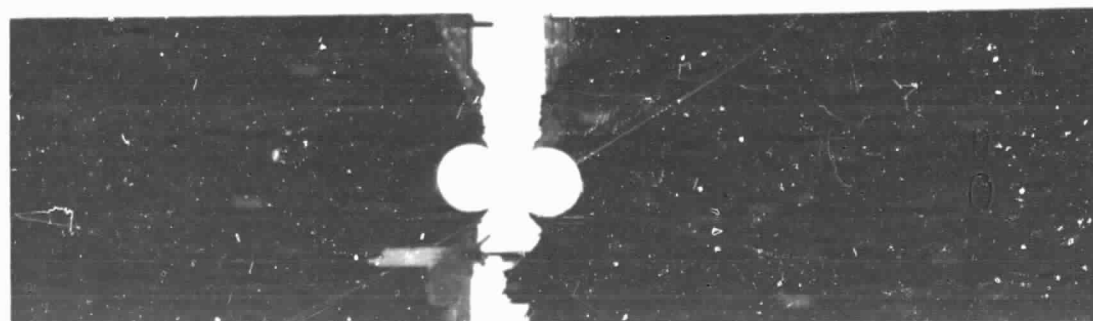


L1-31-80  
R = 0.05


C/CLIC TEST SPECIMENS (DRY)  
ROOM TEMPERATURE




ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

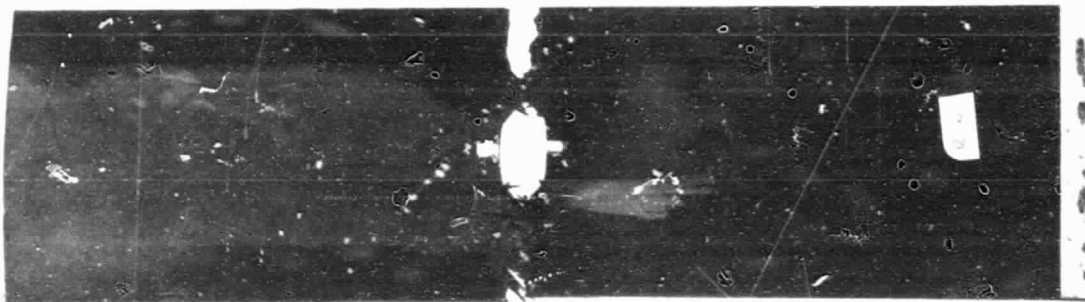


L1-31-25  
R = 0.05

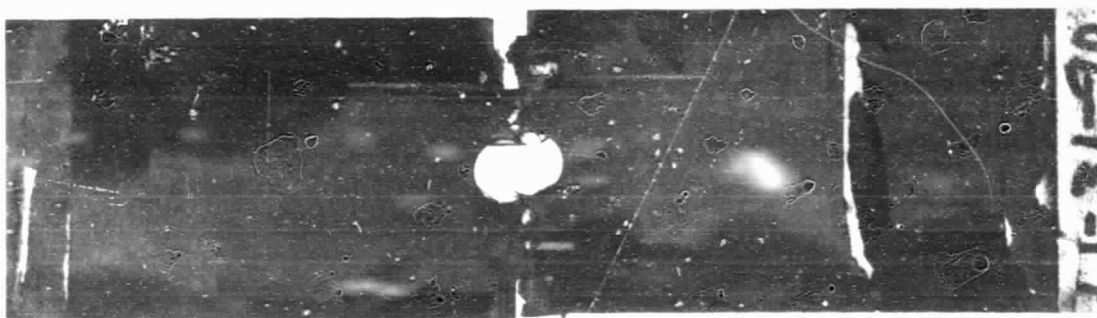

L1-31-90  
R = 0.05

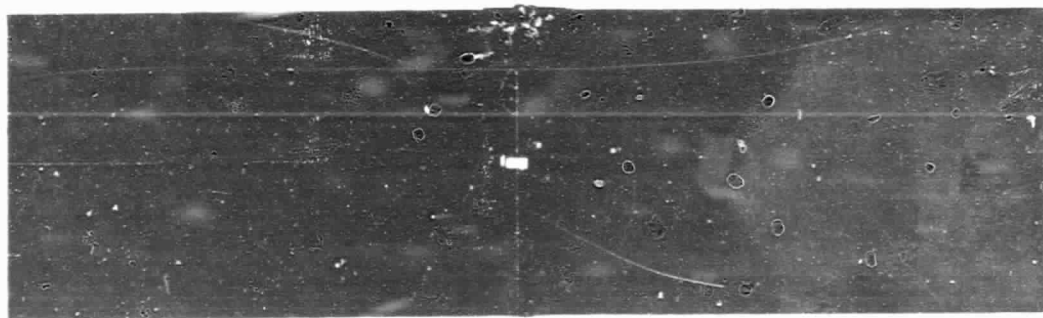

L1-31-31  
R = -1.00

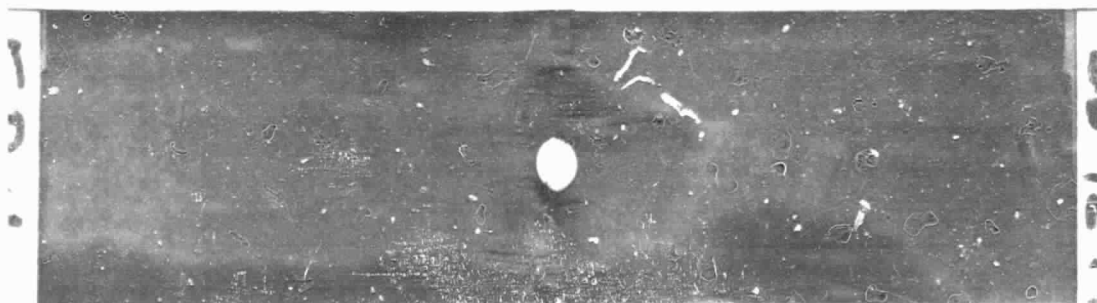


L1-31-95  
R = -1.00


CYCLIC TEST SPECIMENS (WET)  
ROOM TEMPERATURE




ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

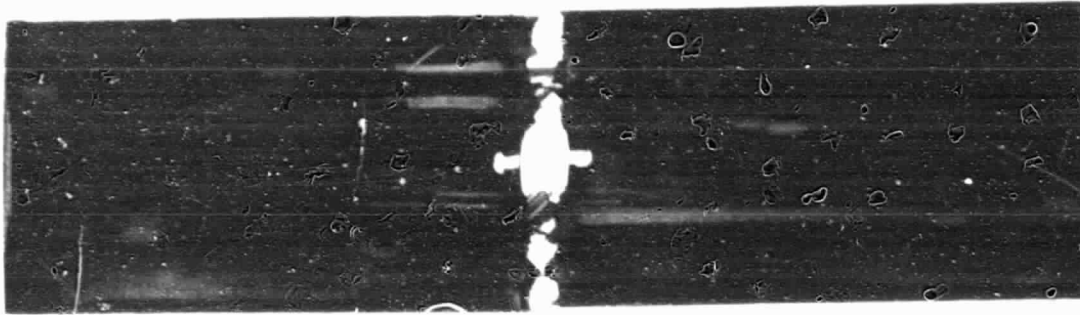


L1-31-59  
R = -1.00

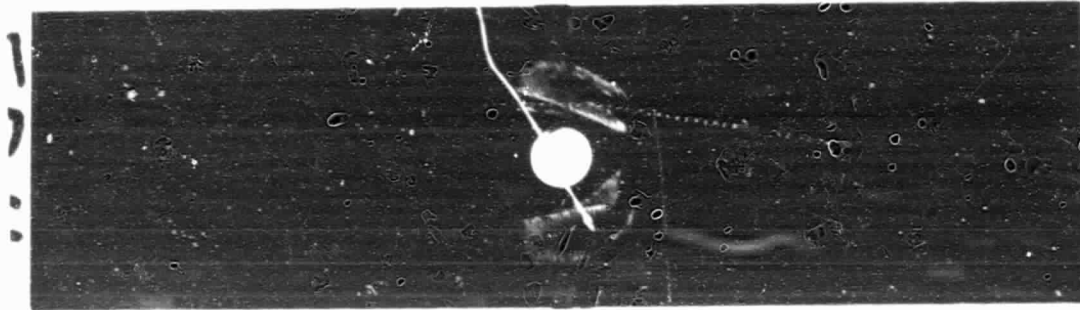

L1-31-89  
R = -1.00

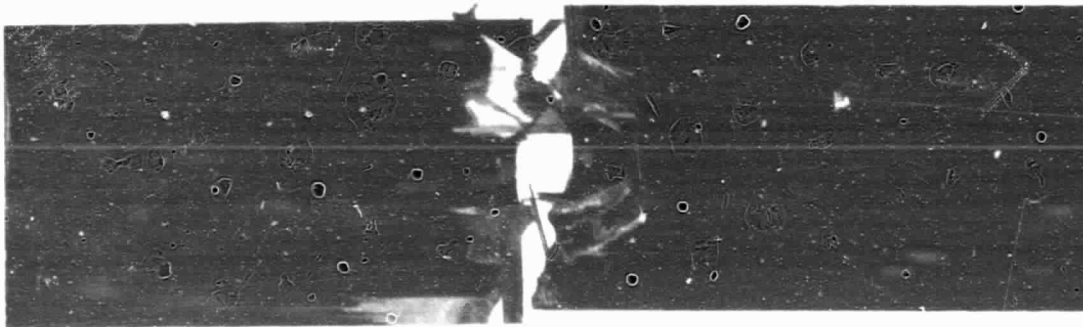


L1-31-61  
R = 0.05

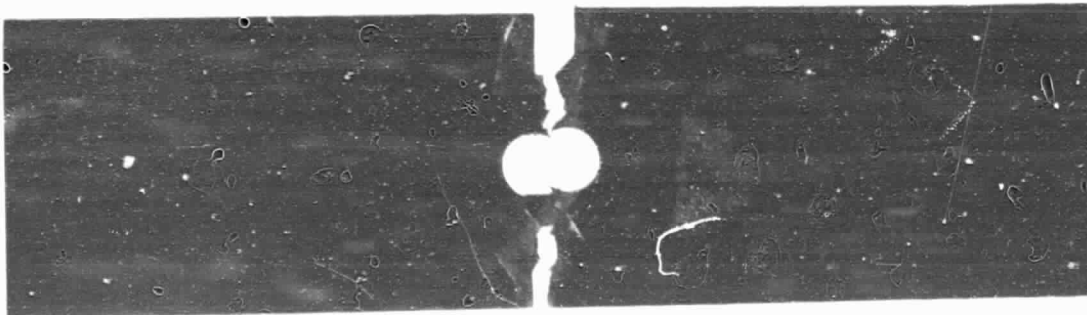


L1-31-82  
R = 0.05

CYCLIC TEST SPECIMENS (DRY)  
422K (300°F)


ORIGINAL PAGE  
BLACK AND WHITE PHOTOGRAPH

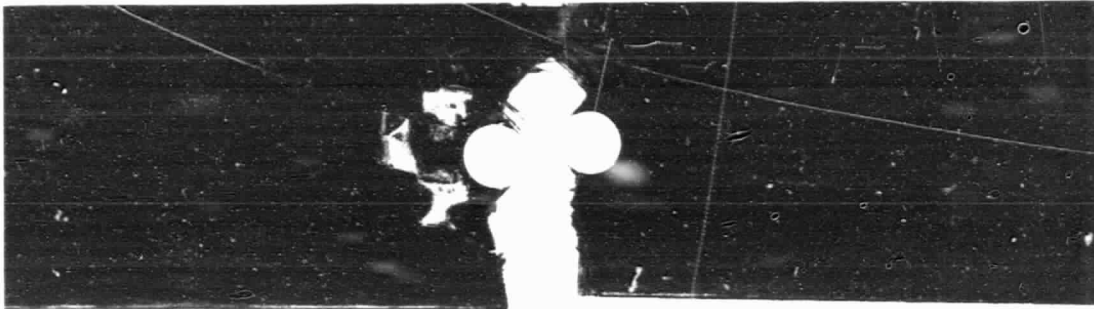


L1-31-73  
R = -1.00

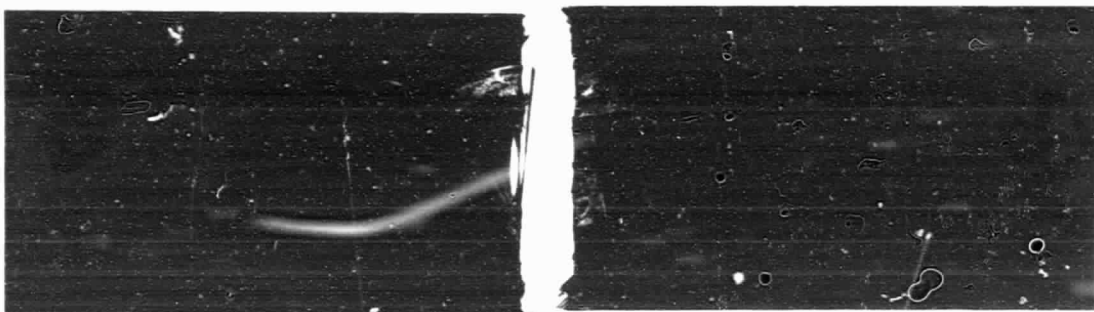

L1-31-34  
R = -1.00

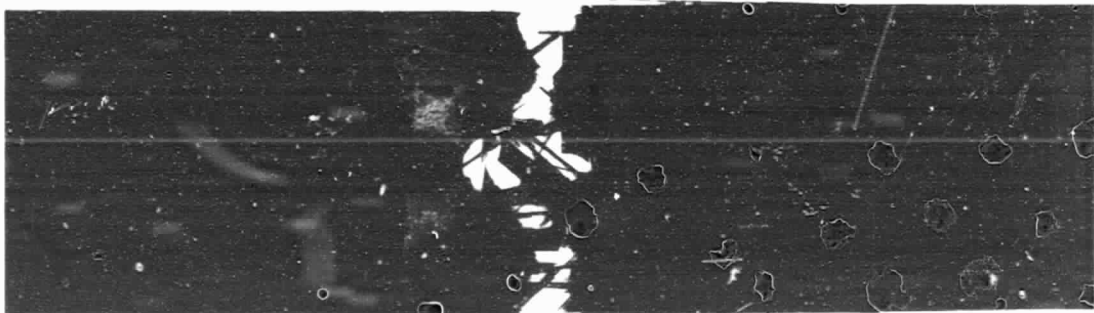

L1-31-93  
R = 0.05

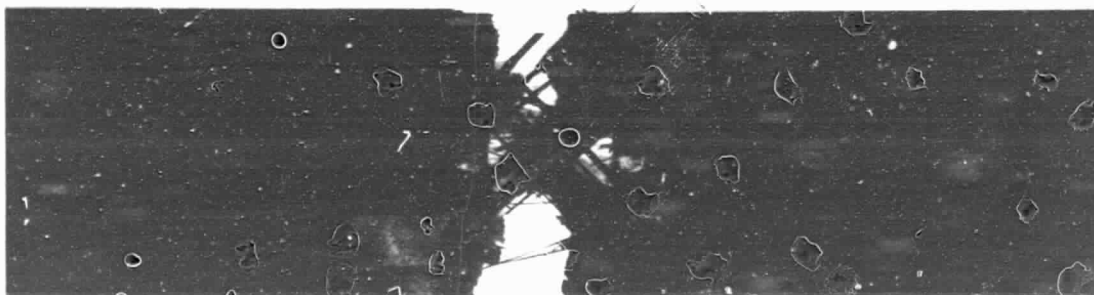

L1-31-49  
R = 0.05

CYCLIC TEST SPECIMENS (WET)  
422K (300°F)